

**SONY.**

# Car Stereo Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** XR-210A/6150

**No.** 109

**Subject:** Error In Schematic Diagram


**Date:** September 19, 1988

**Symptom:**  
(\*\*)

The emitter of Q513 (DTA114ES) should not be connected to ground.

**Solution:**

The proper connection is to the anode of D526 and S902.  
Please correct your service manuals.

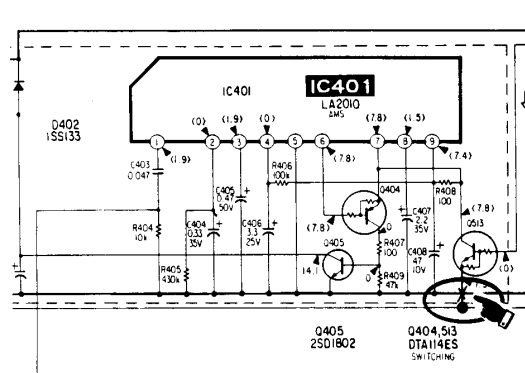

Tuner/Tape Deck

CSA-14

Reference: FPR 000389

PRINTED IN U.S.A.  
CSA-14888-2