

**SONY**

Car Stereo  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** EX-R400, XR-300

**No. 167**

**Subject:** Flashing Display

**Date:** March 22, 1990


**Symptom:**  
(13)

Segment of display is flashing constantly.

**Solution:** Remove solder bridge on Pins 10 and 11 of CNS701.

Serial Number:

ES-R400:	10,001 - 32,500
XR-300:	10,001 - 11,000 13,701 - 14,700

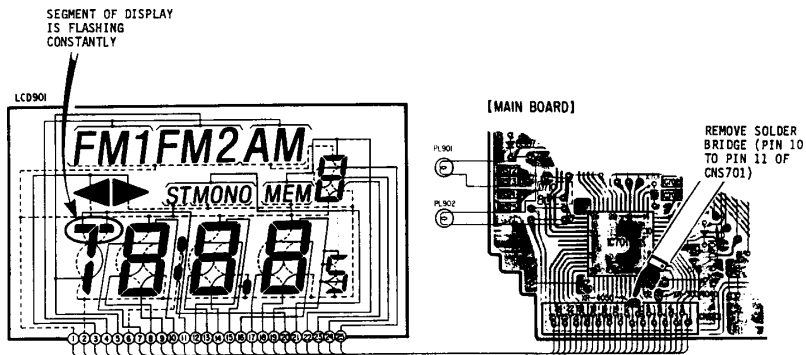

Reference: FAX TX90017

PRINTED IN U.S.A.  
CSA-14390-1

CSA-14 Tuner / Tape Deck