

SONY

Car Stereo Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-7050

No.171

Subject: Handle Breaks From Hinge


Date: July 31, 1990

Symptom:
(**)

An alternative to replacing the Hinge Assembly when the handle breaks away from the bracket, is to repair it using pop rivets.

Solution: Obtain two pop rivets of size 1/8" diameter and 1/8" drive range. Using a pop rivet tool, insert the pop rivet through the handle and then into the bracket, as shown.

Verify that the handle swings freely.

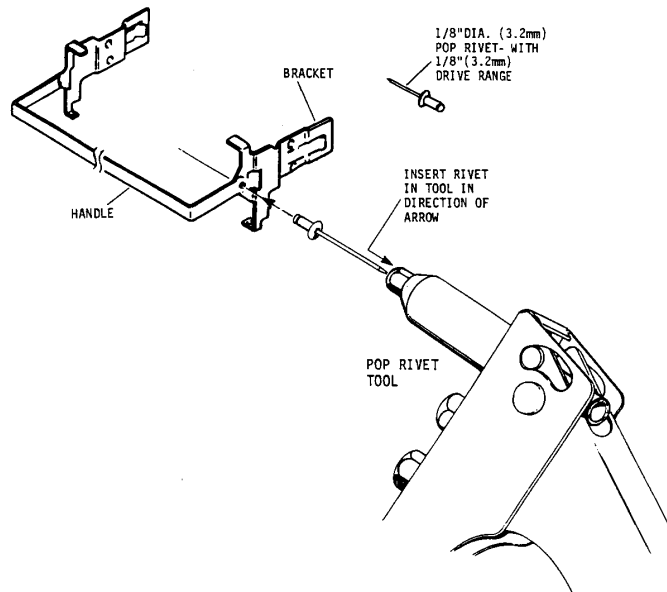

Reference: FPR L0828

PRINTED IN U.S.A.
CSA-14790-3

CSA-14 Tuner / Tape Deck