

SONY

Car Stereo Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-7560/7580

No. 210

Subject: Service Manual Correction


Date: September 9, 1991

Symptom:
(**)

According to the schematic diagram in the Service Manual, the collector of Q418 is connected to the collectors of Q416. This is incorrect.

Solution:

The collector of Q418 is directly linked with the BATT line, pin 15 of connector CNJ1.

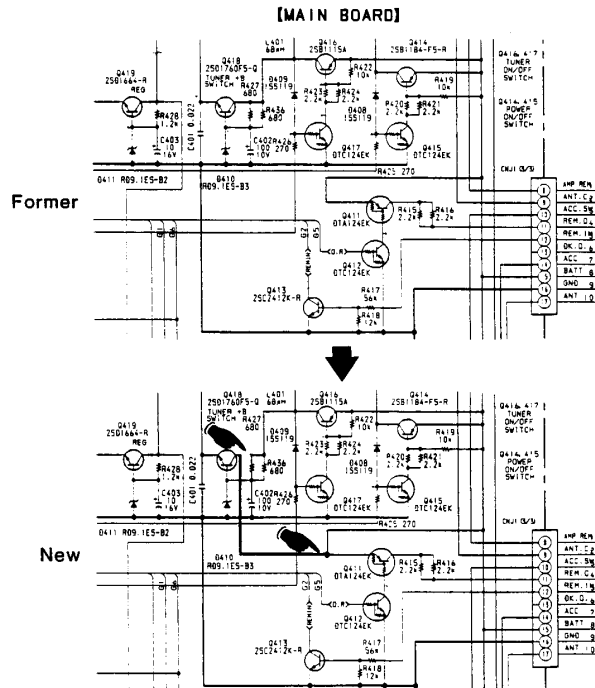

Reference: FPR M2060

PRINTED IN U.S.A.
CSA-14891-1

CSA-14 Compact Disc