

**SONY**

## Car Stereo Service Bulletin

Sony Service Company · Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-R77/R79/5040/5080/7520/7540/  
7560/7580

**No. 218**

**Subject:** Service Manual Error; turntable height adjustment.


**Date:** October 31, 1991

**Symptom:**  
(\*\*) The specification for turntable clearance is incorrectly shown as 0.95 cm in the Service Manuals.

**Solution:** The correct clearance is 0.95mm. Please make this correction in your Service Manuals.

### Turntable Height Adjustment

Loosen the fixing screws and adjust the height to the specification illustrated.

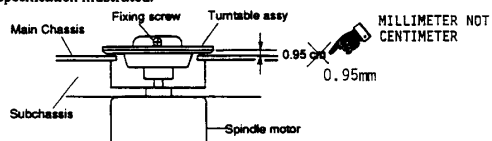

CSA-14 CD Player