

**SONY**

Car Stereo  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-5180

**No.248**

**Subject:** Ticking Noise During Quiet Passages Or  
Between Tracks On Disc

**Date:** August 14, 1992


**Symptom:**  
(54)

A ticking noise may be heard from the speakers while listening to quiet passages on the disc, or when between tracks.

**Solution:**

Add a shield plate to the Main Board as shown below. Secure the shield with tape:

DESCRIPTION	PART NUMBER
SHIELD PLATE	T-9985-491-1

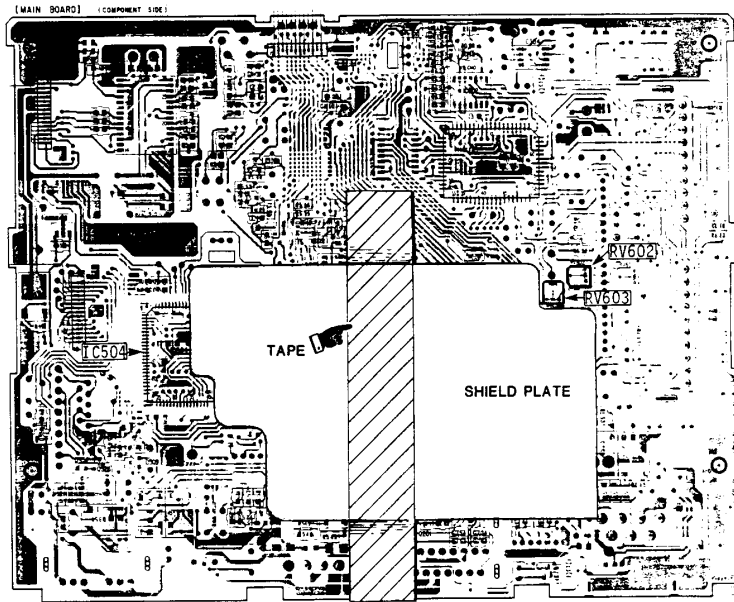

Reference: FPR N1525

PRINTED IN U.S.A.  
CSA-14892-3

CSA-14 CD Player