

SONY

Car Stereo
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: RM-X2

No. 255

Subject: Part Number Change: PC Boards

Date: August 31, 1992

Symptom:
(**)


There is a difference between the B and C connector wiring on the first version Main PC Board and revisions 2 and 3 of the Main PC Board.

This makes it necessary to rewire the B and C connectors when changing the Main PC Board.

Solution:

If it is necessary to replace any of the PC Boards, replace them simultaneously with the part numbers shown below:

REFERENCE	DESCRIPTION	PART NUMBER	
		FORMER	NEW
907	MOUNTED PCB, A	A-3279-729-A	A-3279-739-A
908	PC BOARD, C	1-625-385-11	1-626-958-11
909	PC BOARD, B	1-625-386-11	1-626-957-11

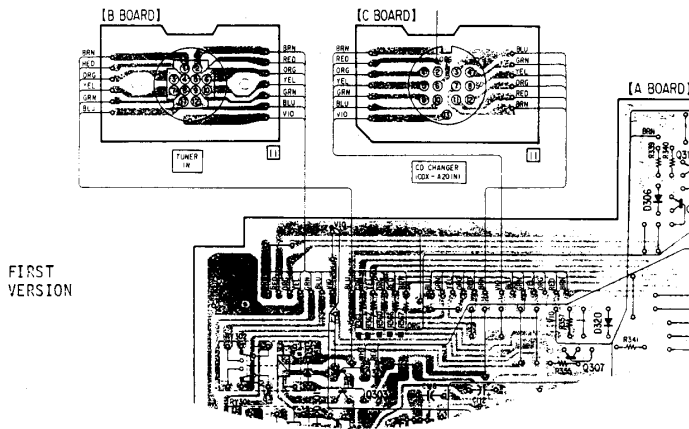

(Continued)

Reference: FPR M0887

PRINTED IN U.S.A.
CSA-14892-11

Miscellaneous
CSA-14