

SONY

Car Stereo Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: XR-5250

No. 263

Subject: Procedure For Changing Tuning Intervals
to U.S. Standards

Date: October 30, 1992


Symptom:
(21)

The FM tuning interval on this model is set at 50KHz. The AM tuning interval is switch-selectable between 9KHz and 10KHz steps.

Solution:

Follow the procedure below to change the tuning intervals to U.S. standards (200KHz steps for FM; 10KHz steps for AM).

1. Remove D-704
2. Remove D-705

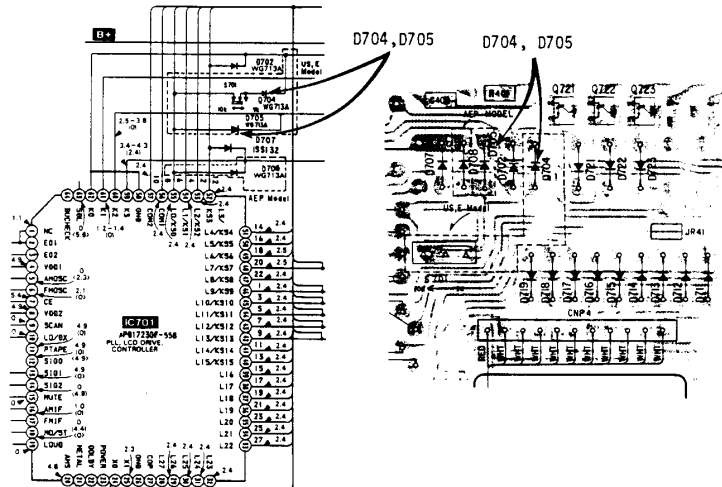

CSA-14 Tuner/Tape Deck