

SONY.

Car Stereo Service Bulletin

CSA-14

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-5180/U8000

No. 313

Subject: Service Information Addition: Small Circuit Board
On CD Mechanism. **Date:** March 18, 1994

Symptom:

(**)

Early production units included a small circuit board mounted to the CD mechanism chassis. The purpose of this board is to prevent 3" discs from being prematurely ejected after loading. The board was not documented in the service manual.

Solution: Refer to the information below when servicing the CD mechanism.



REF	DESCRIPTION	PART NUMBER
A	TRANSISTOR, 2SA1175-HFE	8-729-119-76
B	RESISTOR, 82 K, 5%	1-216-095-00
C	CAPACITOR, 2.2 UF	1-164-337-11

Applicable serial numbers

CDX-5180: up to 112200

CDX-U8000 up to 103300

Additional Small Board

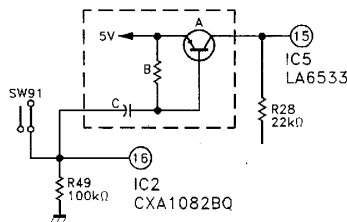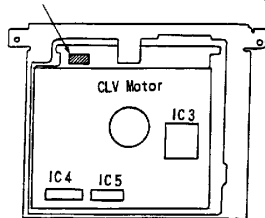

Reference: Technical News ME-93039
Autoflagged - NO



PRINTED IN USA
CSA-14394-1