

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-21/110/501

No. 19

Subject: Intermittent No Eject

Date: May 9, 1988

Symptom:
(65)


Intermittent No Eject

Solution: Replace the driving belt with the following new one.
Please note the applicable U.S. serial numbers.

Ref No.	Description	Part Number	
		Former	New
108	Driving Belt	4-917-548-01	4-917-548-02

U.S. Serial Numbers:

CDP-21.....up to No. 805,501
CDP-110.....up to No. 808,001
CDP-501.....up to No. 806,001

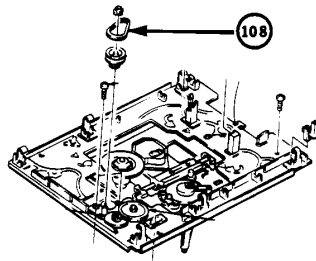

Reference:

PRINTED IN U.S.A.
CSA-13488-9

Compact Disc
CSA-13