

**SONY**

Hi-Fi Products  
**Service Bulletin**

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** MHC-1500, FH-B7CD, FH-B5CD

**No.137**

**Subject:** CD No Operation


**Date:** October 25, 1990

**Symptom:**  
(12)

If the CD is non-operational, it is caused by the flexible board with the terminal (between the BD Board and the Main Board) being disconnected.

**Solution:** Replace the flexible board with the new one which has been reinforced.

Ref. No.	Description	Part Number	
		Former	New
911	Flexible Board With Terminal	1-535-832-11	1-535-832-12

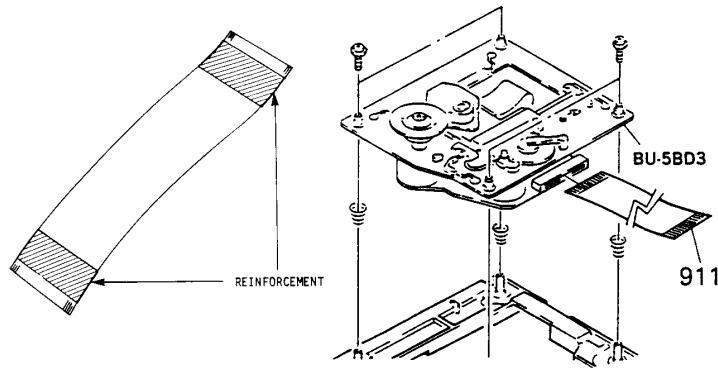

Reference: AU90033

PRINTED IN U.S.A.  
CSA-131090-4

CSA-13 Component System