

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company · Technical Services
A Division of Sony Corporation of America
Sony Drive · Park Ridge, New Jersey 07656

Model: DTC-75ES/700

No.160

Subject: No Loading, No Eject

Date: January 7, 1991

Symptom:
(65)

Cassette cannot be loaded or ejected. Slider Cam breaks when cassette is forcibly loaded.


Solution: If this symptom occurs, replace Slider Cam with improved Slider Assembly.

Description	Part Number
Slider Assembly	X-3362-656-1

Applicable Serial Numbers:

DTC-75ES (U) up to 805,100

DTC-700 (U) up to 805,500

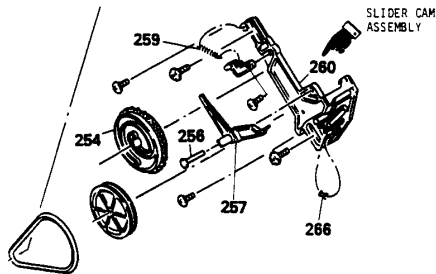

Reference: AU90042

PRINTED IN U.S.A.
CSA-131290-9

CSA-13 DAT