

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: DTC-700/75ES

No. 183


Subject: Creasing Tape In Review Mode

Date: March 29, 1991

Symptom:
(**)

When in Reverse AMS or Review Mode, the DAT tape is creased due to poor back tension. The felt brake pad glued to the Lever Assembly (Ref. No. 658) loosens or falls off.

Solution: If this symptom occurs, reattach the felt brake pad.

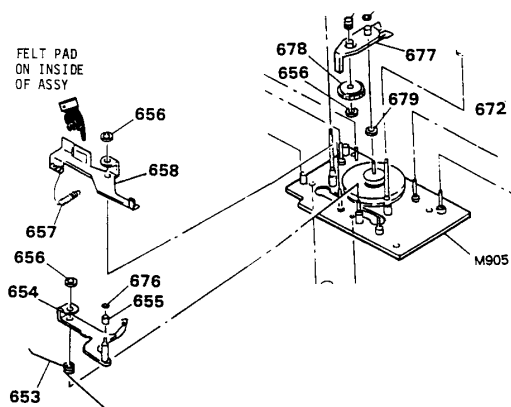

CSA-13 DAT

Reference: FPR M0604

PRINTED IN U.S.A.
CSA-13391-7