

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company Technical Services
A Division of Sony Corporation of America
Sony Drive Park Ridge, New Jersey, 07656

Model: TA-DL100

No. 191


Subject: Incorrect Labeling of IC203/IC204 **Date:** May 8, 1991

Symptom:
(**)

The service manual (schematic diagram, physical diagram, and parts listing) has IC203 of the Decoder board listed as the clock oscillator (SN74HCU04) and IC204 as the wave shaper (SN74H00N).

Solution: Change the schematic, physical diagrams, and the parts list to show IC203 as the wave shaper and IC204 as the Clock Oscillator.

[DECODER BOARD]

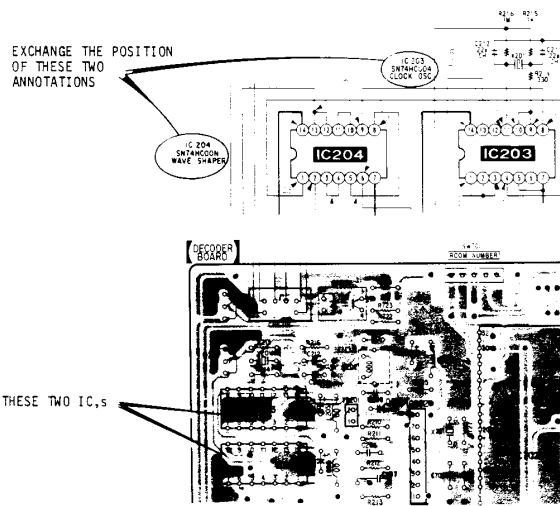

Reference: FPR #1052

PRINTED IN U.S.A.
CSA-13491-3

CSA-13 Amplifier