

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: FH-616R, HST-616

No. 202

Subject: Service Manual Correction

Date: August 19, 1991


Symptom: (**)
On page 7 of the Service Manual, the test point for tape speed adjustment is incorrect. On page 17, Transistor Q912 is drawn incorrectly.

Solution: The following corrections should be made:

Tape Speed Adjustment **DECK A** **DECK B**

Procedure:

Mode: playback

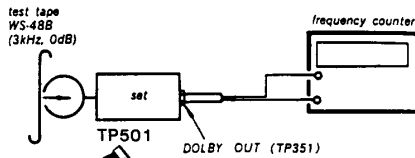

Connect TP501 to ground with jumper wire and continue to press HIGH SPEED DUBBING switch: High speed playback. After the high speed adjustment, remove jumper wire of TP501.

TP501

