

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
300 V. Park Ridge, New Jersey 07656

Model: TC-WR570

No. 241

Subject: Part Number Correction: Q702

Date: January 27, 1992


Symptom
(**):

The Service Manual parts list indicates that the part number for Q702 is 8-729-111-55, but when ordered, a different transistor package type is received. The parts list also indicates that the transistor type is a 2SD1312-K, but the unit has a type 2SD2061 installed.

Solution:

The correct part number for replacement of Q702 is shown in the chart below:

REFERENCE	DESCRIPTION		PART NUMBER	
	INCORRECT	CORRECT	INCORRECT	CORRECT
Q702	2SD1312-K	2SD2012	8-729-111-55	8-729-209-15

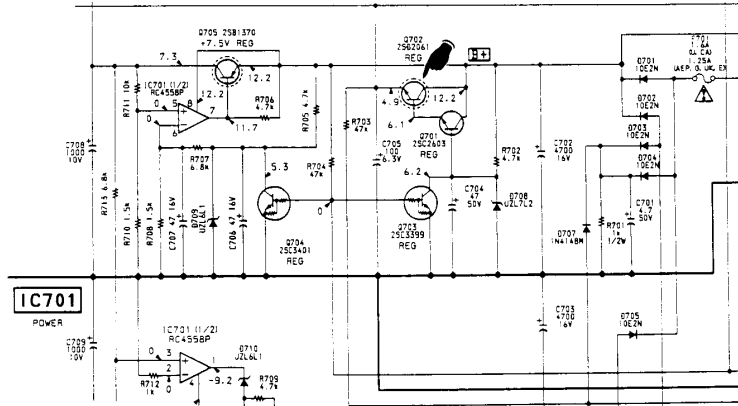

Reference: FPR-M3014

PRINTED IN U.S.A.
CSA-13192-9

CSA-13 Tape Deck