

SONY

Hi-Fi Products Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: TA-DM1000ES

No. 251

Subject: CD 1 SIRCS Output Will Not Control CD Player


Date: March 13, 1992

Symptom:
(25)

The CD 1 SIRCS output will not control the CD Player. There is no code being output from the SIRCS jack. There is also no code coming out of the infrared emitter jack.

Solution:

Hit the CLEAR button on the TA-DM1000ES. If the other manufacturer's commands have previously been learned, these will be erased. They will have to be reprogrammed.

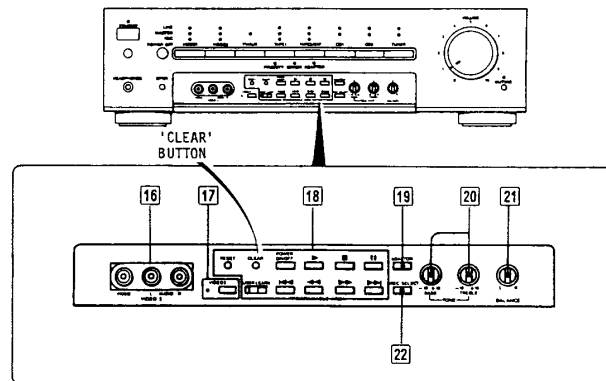

CSA-13 Pre-Amp./Signal Processor