

**SONY.**

Hi-Fi Products  
**Service Bulletin**

**CSA-13**

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** D-802K

**No. 345**

**Subject:** No Lighting Of Pilot Lamp Or LEDs - C-901  
Inserted Backwards


**Date:** June 7, 1993

**Symptom:**  
(13)

No lighting of pilot lamp or LEDs

**Solution:** Inspect C-901 for proper polarity. If C-901 is inserted backwards, then replace C-901 (observing proper polarity).

REF	DESCRIPTION	PART NUMBER
C-901	TANTAL. CHIP 2.2UF	1-135-179-21

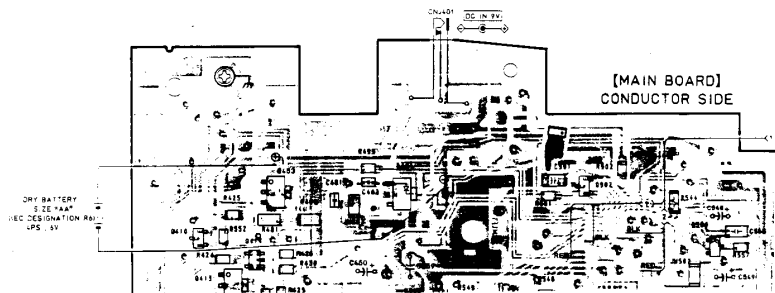

Reference: FPR-O0692  
Autoflagged - NO



PRINTED IN USA  
CSA-13593-5