

**SONY.**

Hi-Fi Products  
**Service Bulletin**

**CSA-13**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDP-C69ES/C79ES/C89ES/C225/  
C322M/C325/C425/C525/C725

**No. 354**

**Subject:** Preventing Damage When Installing Flex Cable

**Date:** September 24, 1993

**Symptom:**


(\*\*)

The flex cable may be damaged if it is not carefully inserted into the connectors.

**Solution:**

Do not allow the ends of the flex cable to be bent when installing the cable.

REF	DESCRIPTION	PART NUMBER
101 (CDP-C225/C325/C425)	JUMPER, FILM	1-694-003-11
64 (CDP-C322M)	JUMPER, FILM	1-694-003-11
104 (CDP-C525/C69ES)	JUMPER, FILM	1-694-003-11
171 (CDP-C725)	JUMPER, FILM	1-694-003-11
170 (CDP-C79ES/89ES)	JUMPER, FILM	1-694-003-11

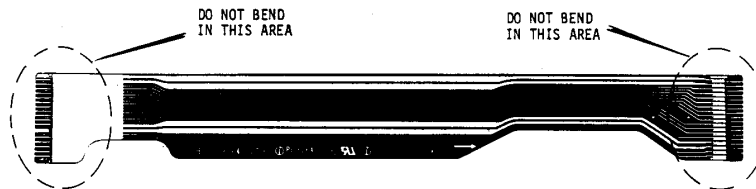

Reference: FPR-O2261  
Autoflagged - YES



PRINTED IN USA  
CSA-13993-1