

SONY

Hi-Fi Products

CSA-13

Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: D-321

No. 368

Subject: During Battery power, When Battery's Voltage
Drops To A Low Level, Noise Is Heard

Date: January 30, 1994


Symptom:
(57)

During battery power, when battery's voltage drops to a low level, noise is heard

Solution: replace IC801 to the part listed below.

REF	DESCRIPTION	PART NUMBER
IC801	IC CXP83916-610Q	8-752-851-84

Applicable Serial Nos. 204000 and lower

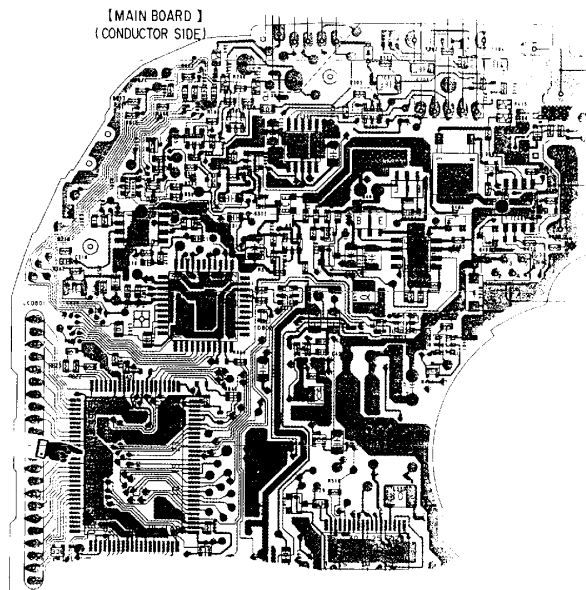

Reference: Tokyo Fax D-93010
Autoflagged - NO



PRINTED IN USA
CSA-13194-2