

SONY

Hi-Fi Products

CSA-13

Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: D-121/125

No. 372

Subject: CD Not Locking - Reconnect CN501

Date: February 18, 1994


Symptom:
(12)

Unit would not read disc, indicating "No Disc" on display.

Solution: Reconnect connector CN501 onto Main Board.

REF	DESCRIPTION	PART NUMBER
CN501	CONNECTOR, FPC (ZIF) 18P	1-566-534-11

Applicable serial numbers: 432240 and lower

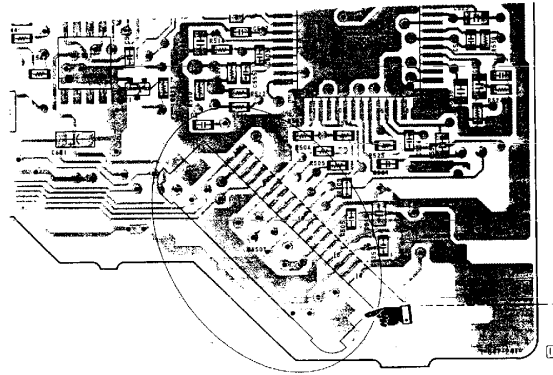

Reference: FPR-03680
Autoflagged - NO



PRINTED IN USA
CSA-13294-4