

# SONY® Service Bulletin

NO: HIFI2-00-001


**SUBJECT:** REPLACEMENT OVERWRITE HEAD

**DATE:** APRIL 2000

**MODEL (S):** MDS-302

**SYMPTOM:** The replacement overwrite head contacts the mechanism frame.

**SOLUTION:** Remove the two protruding tips of the overwrite head P/N 150030421 before it is installed (see diagram).

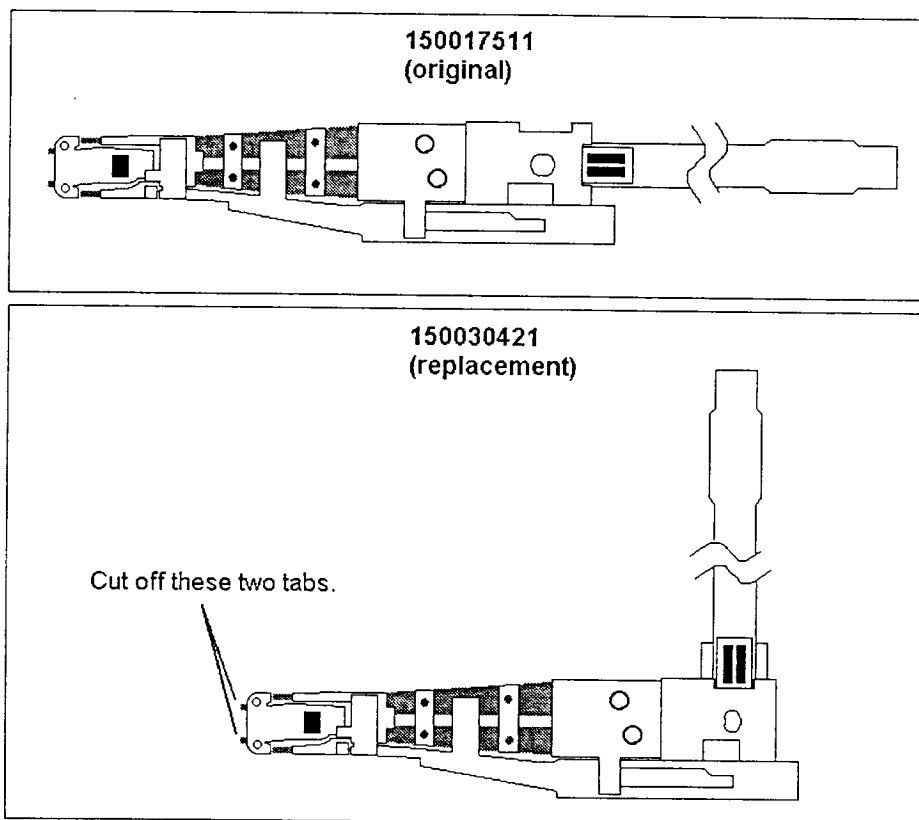

SONAM 621

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6  
NATIONAL LAB - CONSUMER SERVICE