

SONY®

Service Bulletin

NO:HIFI2-98-003

SUBJECT: NO BATTERY CHARGING


DATE: SEP 1998

MODEL (S): MZ-R30

Symptom : Customer complaint may state rechargeable battery is not recharging.

Solution : Replace System Control IC801 with an improved type.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC801	CXP819P60MR-4 CXP81960M-638R	8-752-865-00 8-752-881-89	CXP81960M-654R VER 1.7	8-752-885-06

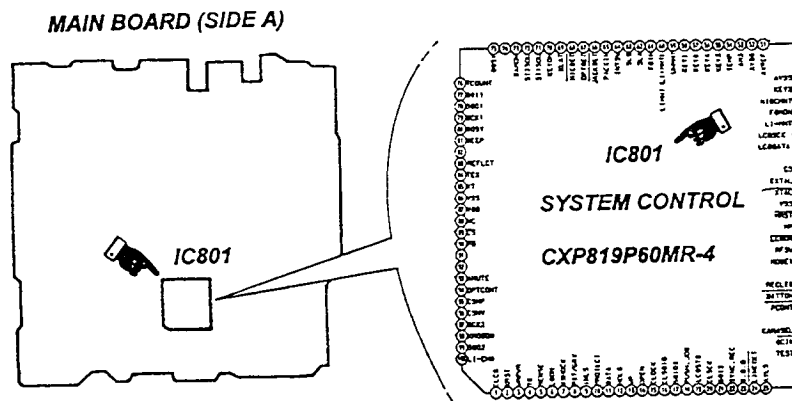

SONAM471
GA98014

Sony of Canada Ltd.

115 Gordon Baker Road, Willowdale, Ontario M2H-3R6
NATIONAL LAB - CONSUMER SERVICE