

User Manual



CSA8000B Communications Signal Analyzer TDS8000B Digital Sampling Oscilloscope

071-1099-02

This document applies to firmware version 1.5
and above.

www.tektronix.com

Copyright © Tektronix, Inc. All rights reserved. Licensed software products are owned by Tektronix or its suppliers and are protected by United States copyright laws and international treaty provisions.

Use, duplication, or disclosure by the Government is subject to restrictions as set forth in subparagraph (c)(1)(ii) of the Rights in Technical Data and Computer Software clause at DFARS 252.227-7013, or subparagraphs (c)(1) and (2) of the Commercial Computer Software - Restricted Rights clause at FAR 52.227-19, as applicable.

Tektronix products are covered by U.S. and foreign patents, issued and pending. Information in this publication supercedes that in all previously published material. Specifications and price change privileges reserved.

Tektronix, Inc., P.O. Box 500, Beaverton, OR 97077

TEKTRONIX and TEK are registered trademarks of Tektronix, Inc.

FrameScan is a registered trademark of Tektronix, Inc.

WARRANTY

Tektronix warrants that the products that it manufactures and sells will be free from defects in materials and workmanship for a period of one (1) year from the date of shipment. If this product proves defective during its warranty period, Tektronix, at its option, will either repair the defective product without charge for parts and labor, or provide a replacement in exchange for the defective product.

This warranty applies only to products returned to the designated Tektronix depot or the Tektronix authorized representative from which the product was originally purchased. For products returned to other locations, Customer will be assessed an applicable service charge. The preceding limitation shall not apply within the European Economic Area, where products may be returned for warranty service to the nearest designated service depot regardless of the place of purchase.

In order to obtain service under this warranty, Customer must provide the applicable office of Tektronix or its authorized representative with notice of the defect before the expiration of the warranty period and make suitable arrangements for the performance of service. Customer shall be responsible for packaging and shipping the defective product to the service center designated by Tektronix or its representative, with shipping charges prepaid. Tektronix or its representative shall pay for the return of the product to Customer. Customer shall be responsible for paying any associated taxes or duties.

This warranty shall not apply to any defect, failure or damage caused by improper use or improper or inadequate maintenance and care. Tektronix shall not be obligated to furnish service under this warranty:

- a) to repair damage resulting from attempts by personnel other than Tektronix representatives to install, repair or service the product;
- b) to repair damage resulting from improper use or connection to incompatible equipment;
- c) to repair any damage or malfunction caused by the use of non-Tektronix supplies or consumables;
- d) to repair a product that has been modified or integrated with other products when the effect of such modification or integration increases the time or difficulty of servicing the product; or
- e) to repair damage or malfunction resulting from failure to perform user maintenance and cleaning at the frequency and as prescribed in the user manual (if applicable).

THE ABOVE WARRANTIES ARE GIVEN BY TEKTRONIX WITH RESPECT TO THIS PRODUCT IN LIEU OF ANY OTHER WARRANTIES, EXPRESS OR IMPLIED. TEKTRONIX AND ITS VENDORS DISCLAIM ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. TEKTRONIX' RESPONSIBILITY TO REPAIR OR REPLACE DEFECTIVE PRODUCTS IS THE SOLE AND EXCLUSIVE REMEDY PROVIDED TO THE CUSTOMER FOR BREACH OF THIS WARRANTY. TEKTRONIX AND ITS VENDORS WILL NOT BE LIABLE FOR ANY INDIRECT, SPECIAL, INCIDENTAL, OR CONSEQUENTIAL DAMAGES IRRESPECTIVE OF WHETHER TEKTRONIX OR THE VENDOR HAS ADVANCE NOTICE OF THE POSSIBILITY OF SUCH DAMAGES.

Table of Contents

General Safety Summary	ix
Preface	xi
About This Manual	xi
Related Manuals and Online Documents	xii
Conventions	xii
Contacting Tektronix	xiii

Getting Started

Product Description	1-1
Models	1-1
Key Features	1-1
Product Software	1-3
Firmware Upgrade	1-4
Sampling Modules Supported	1-4
Check the Package Contents	1-7
Installation	1-9
Check the Environmental Requirements	1-9
Install the Sampling Modules	1-10
Connect the Peripherals	1-13
Power On the Instrument	1-14
Powering Off the Instrument	1-16
Brightness and Contrast Adjustment (Gamma)	1-16
Create an Emergency Startup Disk	1-17
Back Up User Files	1-17
Software Installation	1-18
Description	1-18
Software Release Notes	1-18
Operating System Reinstallation	1-19
System Diagnostics	1-20
Incoming Inspection	1-21
Assemble Equipment	1-21
Perform the Diagnostics	1-22
Perform the Compensation	1-24
Perform the Functional Tests	1-25
Perform the Hardware and Operating System Tests	1-42
Accessories and Options	1-45
Accessories	1-45
Standard	1-45
Optional	1-46
Options	1-47

Operating Basics

Operational Maps	2-1
Documentation Map	2-2
System Overview Maps	2-4
Functional Model Map	2-4
Process Overview Map	2-6
User Interface Map - Complete Control and Display	2-7
Front Panel Map - Quick Access to Most Often Used Features	2-8
Display Map - Single Graticule View	2-9
Display Map - Multiple Views	2-10
Front Panel I/O Map	2-11
Rear Panel I/O Map	2-12

Reference

Overview	3-1
Acquiring Waveforms	3-3
Signal Connection and Scaling	3-4
Why Use?	3-4
What's Special?	3-5
What's Excluded?	3-5
Keys to Using	3-5
To Set Up the Signal Input	3-8
To AutoSet the Instrument	3-11
To Reset the Instrument	3-13
Signal Conditioning Background	3-13
Setting Acquisition Controls	3-21
Why Use?	3-21
What's Special?	3-21
What's Excluded?	3-22
Keys to Using	3-22
To Set Acquisition Modes	3-24
To Start and Stop Acquisition	3-26
Acquisition Control Background	3-27
Acquisition Hardware	3-27
Sampling Process	3-27
Sampling Modes	3-28
Waveform Record	3-28
Acquisition Cycle	3-29
FrameScan Acquisitions	3-30
Why Use?	3-30
What's Special?	3-30
What's Excluded?	3-31
Keys to Using	3-31
To Acquire in FrameScan Mode	3-33
To Catch a Bit Error	3-36

Triggering	3-39
Edge Triggering	3-39
Why Use?	3-39
What's Special?	3-39
Keys to Using	3-40
To Trigger	3-48
To Use Gated Trigger	3-50
Displaying Waveforms	3-53
Using the Waveform Display	3-53
Why Use?	3-55
What's Special?	3-55
What's Excluded?	3-55
Keys to Using	3-56
To Display Waveforms in the Main Time Base View	3-62
To Display Waveforms in a Mag View	3-64
Customizing the Display	3-66
Why Use?	3-66
What's Special?	3-66
Keys to Using	3-66
To Set Display Styles	3-68
To Customize the Graticule and Waveforms	3-69
Measuring Waveforms	3-73
Taking Automatic Measurements	3-74
Why Use?	3-74
What's Measured?	3-74
What's Special?	3-74
What's Excluded?	3-76
Keys to Using	3-76
To Take Automatic Measurements	3-80
To Localize a Measurement	3-83
Taking Cursor Measurements	3-85
Why Use?	3-85
What's Measured?	3-85
What Sources Can I Measure?	3-86
Keys to Using Cursors	3-86
To Take a Cursor Measurement	3-89
To Set the Cursor Sources	3-90
Optimizing Measurement Accuracy	3-92
Why Use?	3-92
Compensation	3-92
To Compensate the Instrument and Modules	3-92
To Perform Dark-Level and User Wavelength Gain Compensations	3-98
Creating Math Waveforms	3-101
Defining Math Waveforms	3-101
Why Use?	3-102
What's Special?	3-102
What's Excluded?	3-102
Keys to Using	3-103
To Define a Math Waveform	3-105

Operations on Math Waveforms	3-107
Why Use?	3-107
What's Excluded?	3-107
Keys to Using	3-108
To Use Math Waveforms	3-109
Data Input and Output	3-113
Saving and Recalling Setups	3-113
Why Use?	3-113
What's Special?	3-114
What's Excluded?	3-114
Keys to Using	3-114
To Save Your Setup	3-115
To Recall Your Setup	3-118
Saving and Recalling Waveforms	3-120
Why Use?	3-120
What's Special?	3-120
What's Excluded?	3-120
To Save Your Waveform	3-121
To Recall Your Waveform	3-124
To Clear References	3-127
Exporting Waveforms and Histograms	3-128
Why Use?	3-128
Keys to Using	3-128
To Export Your Waveform	3-128
To Export Your Histogram	3-129
To Use an Exported Waveform (or Histogram)	3-129
Printing Waveforms	3-132
Remote Communication	3-139
Using Masks, Histograms, and Waveform Databases	3-141
Mask Testing Waveforms	3-141
Why Use?	3-141
What's Special?	3-141
What's Excluded?	3-142
Keys to Using	3-142
To Mask Test a Waveform	3-145
To Edit a Mask	3-149
Counting Masks	3-151
To Create a New Mask	3-152
Taking Histograms	3-154
Why Use?	3-154
What's Special?	3-154
What's Excluded?	3-155
Keys to Using Histograms	3-155
To Take a Histogram	3-156
Histogram Statistics	3-158
Using Waveform Databases	3-159
Why Use?	3-159
What's Special?	3-159
What's Excluded?	3-159
Keys to Using	3-160
To Set Up a Waveform Database	3-162
To Customize the Database Display	3-164

Accessing Online Help	3-167
What's Available?	3-167
Why Use?	3-167
Keys to Using	3-167
How to Use Online Help	3-168
Cleaning the Instrument	3-175
Exterior Cleaning	3-175
Flat Panel Display Cleaning	3-176
Optical Connector Cleaning	3-176

Appendices

Appendix A: Specifications	A-1
Certifications	A-11
Appendix B: Automatic Measurements Reference	B-1
Pulse Measurements - Amplitude	B-2
Pulse Measurements - Timing	B-8
Pulse Measurement - Area	B-14
Return-to-Zero (RZ) Measurements - Amplitude	B-15
Return-to-Zero (RZ) Measurements - Timing	B-29
Return-to-Zero (RZ) Measurements - Area	B-36
Non-Return-to-Zero (NRZ) Measurements - Amplitude	B-37
Non-Return-to-Zero (NRZ) Measurements - Timing	B-50
Non-Return-to-Zero (NRZ) Measurements - Area	B-55
Measurement Reference Parameters and Methods	B-56
All Sources	B-56
Pulse Sources	B-57
RZ Sources	B-60
NRZ Sources	B-62
Tracking Methods	B-68
Mid-reference Level	B-69
To Optimize the Vertical Resolution	B-69
Use a Waveform Database	B-70
Appendix C: Insert Sampling Module User Manuals Here	C-1

Glossary

Index

List of Figures

Figure 1-1: Compartments for sampling modules	1-11
Figure 1-2: Maximum inputs in three configurations	1-12
Figure 1-3: Locations of peripheral connectors on rear panel	1-13
Figure 1-4: Line fuse and power cord connector locations, rear panel	1-14
Figure 1-5: On/Standby switch location	1-15
Figure 1-6: Compensation dialog box	1-24
Figure 1-7: Hookup for electrical functional tests	1-27
Figure 1-8: Channel button location	1-27
Figure 1-9: Channel button location	1-30
Figure 1-10: Optical channel verification	1-31
Figure 1-11: Hookup for the time base tests	1-32
Figure 1-12: Channel button location	1-33
Figure 1-13: Main time base verification	1-34
Figure 1-14: Mag time base verification	1-35
Figure 1-15: Channel button location	1-36
Figure 1-16: Hookup for the gated trigger tests	1-37
Figure 1-17: Signal triggered	1-38
Figure 1-18: Signal not triggered (signal frozen)	1-39
Figure 1-19: Signal not triggered (no signal)	1-40
Figure 1-20: Signal triggered	1-41
Figure 3-1: Acquisition and display controls	3-4
Figure 3-2: Setting vertical scale and position of input channels ...	3-15
Figure 3-3: Varying offset positions vertical acquisition window on waveform amplitude	3-17
Figure 3-4: Horizontal acquisition window definition	3-18
Figure 3-5: Common trigger, record length, and acquisition rate for all channels	3-20
Figure 3-6: Aliasing	3-23
Figure 3-7: Channel configuration	3-27
Figure 3-8: Digital acquisition — sampling and digitizing	3-28
Figure 3-9: The waveform record and its defining parameters	3-29
Figure 3-10: How FrameScan acquisition works (scanning on a 127-bit PRBS shown)	3-32
Figure 3-11: Slope and level define the trigger event	3-41

Figure 3-12: Triggered versus untriggered displays	3-41
Figure 3-13: Trigger inputs	3-42
Figure 3-14: Holdoff adjustment can prevent false triggers	3-46
Figure 3-15: Trigger to End Of Record Time (EORT)	3-47
Figure 3-16: Display elements	3-54
Figure 3-17: Horizontal position includes time to Horizontal Reference	3-59
Figure 3-18: Graticule, cursor and automatic measurements	3-73
Figure 3-19: Measurement annotations on a waveform	3-75
Figure 3-20: High/Low tracking methods	3-78
Figure 3-21: Reference-level calculation methods	3-79
Figure 3-22: Horizontal cursors measure amplitudes	3-86
Figure 3-23: Components determining Time cursor readout values	3-88
Figure 3-24: Functional transformation of an acquired waveform .	3-101
Figure 3-25: Export dialog box	3-129
Figure 3-26: Creating a user mask	3-144
Figure 3-27: Adding a new vertex	3-144
Figure 3-28: Vertical histogram view and statistics on data	3-154
Figure 3-29: Normal vector view of a waveform	3-163
Figure 3-30: Waveform database view of a waveform	3-163
Figure B-1: Reference-level calculation methods	B-56
Figure B-2: Pulse-reference levels	B-57
Figure B-3: Pulse crossings and mid-reference level	B-58
Figure B-4: AOP pulse crossings and mid-reference level	B-59
Figure B-5: Overshoot levels	B-59
Figure B-6: RZ measurement reference levels	B-60
Figure B-7: RZ crossings	B-61
Figure B-8: RZ eye-aperture parameters	B-62
Figure B-9: NRZ measurement reference levels	B-63
Figure B-10: NRZ crossings	B-64
Figure B-11: NRZ eye-aperture parameters	B-65
Figure B-12: NRZ overshoot levels	B-66
Figure B-13: NRZ Crossings (OMA)	B-67

List of Tables

Table 1-1: Additional accessory connection information	1-14
Table 1-2: Line fuses	1-14
Table 1-3: Standard accessories	1-45
Table 1-4: Optional accessories	1-46
Table 3-1: Application-based triggering	3-43
Table 3-2: Defining and displaying waveforms	3-56
Table 3-3: Operations performed based on the selected waveform	3-57
Table 3-4: Equivalent mouse and touchscreen operations	3-61
Table 3-5: Customizable display attributes	3-66
Table 3-6: Cursor functions (types)	3-85
Table 3-7: Cursor units	3-88
Table 3-8: Math expressions and the math waveforms produced ..	3-103
Table 3-9: Standard masks	3-142
Table 3-10: Histogram statistics	3-158
Table A-1: System - Signal acquisition	A-1
Table A-2: System - Timebase	A-2
Table A-3: System - Trigger	A-3
Table A-4: System - Environmental	A-6
Table A-5: Power consumption and cooling	A-7
Table A-6: Display	A-7
Table A-7: Ports	A-8
Table A-8: Data storage	A-9
Table A-9: Mechanical	A-10
Table A-10: Certifications and compliances	A-11
Table B-1: Pulse Measurements — Amplitude	B-2
Table B-2: Pulse Measurements - Timing	B-8
Table B-3: Pulse Measurements - Area	B-14
Table B-4: RZ Measurements - Amplitude	B-15
Table B-5: RZ Measurements - Timing	B-29
Table B-6: RZ Measurements -Area	B-36
Table B-7: NRZ Measurements - Amplitude	B-37
Table B-8: NRZ Measurements - Timing	B-50
Table B-9: NRZ Measurements - Area	B-55

General Safety Summary

Review the following safety precautions to avoid injury and prevent damage to this product or any products connected to it. To avoid potential hazards, use this product only as specified.

Only qualified personnel should perform service procedures.

While using this product, you may need to access other parts of the system. Read the *General Safety Summary* in other system manuals for warnings and cautions related to operating the system.

To Avoid Fire or Personal Injury

Use Proper Power Cord. Use only the power cord specified for this product and certified for the country of use.

Connect and Disconnect Properly. Do not connect or disconnect probes or test leads while they are connected to a voltage source.

Ground the Product. This product is grounded through the grounding conductor of the power cord. To avoid electric shock, the grounding conductor must be connected to earth ground. Before making connections to the input or output terminals of the product, ensure that the product is properly grounded.

Observe All Terminal Ratings. To avoid fire or shock hazard, observe all ratings and markings on the product. Consult the product manual for further ratings information before making connections to the product.

Do not apply a potential to any terminal, including the common terminal, that exceeds the maximum rating of that terminal.

Do Not Operate Without Covers. Do not operate this product with covers or panels removed.

Use Proper Fuse. Use only the fuse type and rating specified for this product.

Avoid Exposed Circuitry. Do not touch exposed connections and components when power is present.

Wear Eye Protection. Wear eye protection if exposure to high-intensity rays or laser radiation exists.

Do Not Operate With Suspected Failures. If you suspect there is damage to this product, have it inspected by qualified service personnel.

Do Not Operate in Wet/Damp Conditions.

Do Not Operate in an Explosive Atmosphere.

Keep Product Surfaces Clean and Dry.

Provide Proper Ventilation. Refer to the manual's installation instructions for details on installing the product so it has proper ventilation.

Symbols and Terms

Terms in this Manual. These terms may appear in this manual:



WARNING. *Warning statements identify conditions or practices that could result in injury or loss of life.*



CAUTION. *Caution statements identify conditions or practices that could result in damage to this product or other property.*

Terms on the Product. These terms may appear on the product:

DANGER indicates an injury hazard immediately accessible as you read the marking.

WARNING indicates an injury hazard not immediately accessible as you read the marking.

CAUTION indicates a hazard to property including the product.

Symbols on the Product. The following symbols may appear on the product:



CAUTION
Refer to Manual



WARNING
High Voltage



Protective Ground
(Earth) Terminal



Mains Disconnected
OFF (Power)



Mains Connected
ON (Power)



Standby

Preface

This is the user manual for the CSA8000B Communications Signal Analyzer and TDS8000B Digital Sampling Oscilloscope. It covers the following information:

- Describes the capabilities of the instrument: how to install it and reinstall its software
- Explains how to operate the instrument: how to control acquisition of, processing of, and input/output of information
- Lists the specifications and accessories of the instrument

About This Manual

This manual is composed of the following chapters:

- *Getting Started* shows you how to configure and install your instrument and provides an incoming inspection procedure.
- *Operating Basics* uses maps to describe the various interfaces for controlling the instrument, including the front panel and the software user interface. These maps provide overviews of the product and its functions from several viewpoints.
- *Reference* comprises an encyclopedia of topics (see *Overview* on page 3-1) that describe the instrument interface and features, and that give background and basic information on how to use them. (The online help onboard the instrument application describes the interface, features, and their usage in more detail; detailed descriptions of all programming commands are found in the online *CSA8000 & TDS8000 Programmer Guide* manual.)
- *Appendices* provides additional information including the specifications and automatic measurement definitions.

Related Manuals and Online Documents

This manual is part of a document set of standard-accessory manuals and online documentation; this manual mainly focuses on installation and background needed to use the product features. See the following list for other documents supporting instrument operation and service. (Manual part numbers are listed in Table 1-3 on page 1-45.)

Manual name	Description
<i>CSA8000 & TDS8000 Online Help</i>	An online help system, integrated with the User Interface application that ships with this product.
<i>CSA8000B & TDS8000B References</i>	A quick reference to major features of the instrument and how they operate.
<i>Electrical Sampling Modules User Manual¹</i>	The user manual for the electrical sampling modules. Included as a standard accessory if you ordered electrical sampling modules with this instrument. Shipped in the sampling module package, not the main instrument package.
<i>80C00 Series Optical Sampling Modules User Manual¹</i>	The user manual for the optical sampling modules. Included as a standard accessory if you ordered optical sampling modules with this instrument. Shipped in the sampling module package, not the main instrument package.
<i>80A01 Trigger Prescale Limiting Preamplifier Module User Manual¹</i>	The user manual for the 80A01 Trigger Prescale Limiting Preamplifier Module. Included as a standard accessory if you ordered this module with this instrument. Shipped in the module package, not the main instrument package.
<i>CSA8000 & TDS8000 Programmer Guide</i>	Part of the online help system this guide comprises an alphabetical listing of the programming commands and other information related to controlling the instrument over the GPIB. This is an online document.
<i>CSA8000 & TDS8000 Service Manual</i>	Describes how to service the instrument to the module level. This optional manual must be ordered separately.

¹ You can insert the module user manuals in Appendix C (in this manual) to keep the user manuals together.

For more information on how the product documentation relates to the instrument operating interfaces and features, see *Documentation Map* on page 2-2.

Conventions

This manual uses the terms *vertical acquisition window* and *horizontal acquisition window* throughout this section and elsewhere. These terms refer to the vertical and horizontal range of the acquisition window, which defines the segment of the input signal that the acquisition system acquires.

The terms do not refer to any operating system windows that you might display on screen.

Contacting Tektronix

Phone	1-800-833-9200*
Address	Tektronix, Inc. Department or name (if known) 14200 SW Karl Braun Drive P.O. Box 500 Beaverton, OR 97077 USA
Web site	www.tektronix.com
Sales support	1-800-833-9200, select option 1*
Service support	1-800-833-9200, select option 2*
Technical support	Email: techsupport@tektronix.com 1-800-833-9200, select option 3* 6:00 a.m. - 5:00 p.m. Pacific time

* **This phone number is toll free in North America. After office hours, please leave a voice mail message. Outside North America, contact a Tektronix sales office or distributor; see the Tektronix web site for a list of offices.**

Product Description

This chapter describes your instrument, which is either the CSA8000B Communications Signal Analyzer or the TDS8000B Digital Sampling Oscilloscope, and its options. Following this description are four sections:

- *Check the Package Contents*, on page 1-7, shows you how to verify that you have received all of the parts of your instrument.
- *Installation*, on page 1-9, shows you how to configure and install the instrument, as well as how to reinstall the system software included with the product.
- *Incoming Inspection*, on page 1-21, provides a procedure for verifying basic operation and functionality.
- *Accessories and Options*, on page 1-45, lists the instrument options available and the standard and optional accessories for this product.

Models

This manual supports two very similar instruments:

- The CSA8000B Communications Signal Analyzer.
- The TDS8000B Digital Sampling Oscilloscope.

Differences between the two instruments will be called out when necessary; otherwise, the material applies to both instruments. The word “instrument” refers to either product.

Key Features

The instrument is a high-speed, precision sampling system that finds use in validation and conformance testing and impedance verification for:

- high-performance semiconductor/computer applications, such as semiconductor testing, TDR characterization of circuit boards, IC packages and cables, and high-speed serial digital data communications.
- high-performance communications applications, such as design evaluation and manufacturing test of datacom and telecom components, transceiver subassemblies, and transmission systems.

The instrument includes a user interface that runs on the Microsoft Windows 98 operating system as a windowed application. You operate the instrument using

front-panel controls with the mouse and keyboard or with the touch screen. Key features include:

- industry-leading waveform acquisition and measurement rate, with Sample, Envelope, and Average acquisition modes.
- support for up to six sampling modules (two large and four small modules) for a maximum configuration of ten inputs. (Up to eight inputs can be active at a time. See *Maximum Configuration* on page 1-11).
- supports integrated optical signal pick-off and clock recovery enabling accurate triggering on optical communication-signals.
- support for optical modules with several integrated, selectable reference receivers, which eliminates the need for a multitude of add-on reference receivers.
- full programmability, with an extensive GPIB-command set and a message-based interface.
- true differential TDR, with fast step (35 psec reflected risetime) when used with a TDR-capable sampling module.
- industry-leading trigger bandwidth (12+ GHz) when using the built-in-prescaler.
- support of both telecom (SONET and SDH) and datacom (Fibre Channel, Infiniband, and Gigabit Ethernet) optical communication standards.
- powerful built-in measurement capability, including histograms, mask testing, and automatic measurements.
- automatic measurements operate on Pulses, RZ eye patterns, and NRZ eye patterns.
- DC to 65 GHz optical bandwidth; DC to 65 GHz electrical bandwidth, with up to 12.5 GHz triggering.

NOTE. *Bandwidth is determined by the specific modules that are installed.*

- FrameScan acquisition for isolating data-dependent failures during conformance/performance testing and for examining very low-level repetitive signals.
- support for optical conformance testing of SONET/SDH signals (including the various forward error correction rates for these telecom rates) from 155 Mbps to 43 Gb/s, 1 and 10 Gb/s FibreChannel signals, 10.52 Gb/s FibreChannel signals, and 1, 2, and 10 Gigabit FibreChannel signals as well as 2.5 Gb/s Infiniband signals.

NOTE. Support for conformance testing rates is determined by the specific modules that are installed.

- high precision time base with two modes of operation, locked and short-term jitter-optimized
- negligible long-term jitter degradation (<0.1 ppm), which substantially improves the ability to view signals that are delayed far from the trigger point without distortion.
- improved short-term and long-term trigger jitter.
- a gated trigger option (Option GT) that lets you disable or enable (gate) triggering based on a TTL signal you connect to the instrument rear panel.
- the GT feature also allows you to use recirculating buffers as part of your test setup to simulate the effects of very long optical links that are typical of undersea cables and other long terrestrial links.
- analysis and connectivity tools enable the instrument to be controlled from a variety of local and remote environments and to share data with other commercially available analysis programs.
- pre-defined, built-in masks in addition to the user-defined masks.
- a large 10-inch color display that supports color grading of waveform data to show sample density.
- an intuitive UI (User Interface), with built-in online help displayable on screen.

Product Software

The instrument includes the following software:

- Windows 98 comes preinstalled on the instrument. Windows 98 is the operating system on which the user-interface application of this instrument runs. The OS Rebuild CD (063-3491-XX) includes the software needed to rebuild the instrument operating system if that becomes necessary.
- The User Interface (UI) Application (product software) comes preinstalled on the instrument. This UI application complements the hardware controls of the front panel, allowing complete set up of all instrument features. The Product Software CD (063-3492-XX) includes the UI Application for use if reinstalling the product software becomes necessary. See *Software Installation* on page 1-18.

New versions of the software may become available at our web site. See *Contacting Tektronix* on page xiii in *Preface*.

Firmware Upgrade

Tektronix may offer firmware upgrade kits for the instrument. Contact your Tektronix service representative for more information (see *Contacting Tektronix* on page xiii).

Sampling Modules Supported

This product can use the following optical and electrical sampling modules listed below. These modules, which plug into the instrument, are more fully described in their respective user manuals. These manuals were shipped with those sampling modules that were ordered with this product.

The sampling modules listed here were available at the time this manual was published; see your Tektronix product catalog for current offerings.

Optical Sampling Modules.

- 80C01 - 622/2488/9953 Mb/s, 12.5/20 GHz optical module.
Clock Recovery (622/2488 Mb/s) added with option CR.
- 80C02 - 9.953 Gb/s, 20/30 GHz optical module.
Clock Recovery (9.953 Gb/s) added with option CR.
- 80C03 - 1.063/1.250/2.488/2.500 Gb/s amplified optical module.
Clock Recovery for all rates added with option CR.

This module has been superseded by the 80C07B.

- 80C04 - 9.953/10.3125 Gb/s, 20/30 GHz optical module.
Clock Recovery (9.953 Gb/s) added with option CR1.
Clock Recovery (9.953 Gb/s and 10.66 Gb/s) added with option CR2.

This module has been superseded by the 80C11.

- 80C05 - 9.953 Gb/s, 20/30/40 GHz optical module for 10/40 Gb/s NRZ.
- 80C06 - 55 GHz optical module for 40 Gb/s RZ and NRZ telecom.
- 80C07 - 155/622/2488 Mb/s amplified optical module.
Clock Recovery for all rates added with option CR1.

This module has been superseded by the 80C07B.

- 80C07B - 155/622/1063/1250/2125/2488/2500 Mb/s amplified optical module. (The module is limited to five receivers configured at the time of order.)
Clock Recovery for all rates (plus 2666 Mb/s) added with option CR1.

- 80C08 - 9.953/10.31 Gb/s Multi-rate amplified optical module. Clock Recovery (9.953 and 10.3125 Gb/s) added with option CR1.

This module has been superseded by the 80C08C.

- 80C08B - 9.953/10.31/10.52 Gb/s Multi-rate amplified optical module. Clock Recovery (9.953 and 10.3125 Gb/s) added with option CR1. FibreChannel Clock Recovery (10.3125 and 10.51875 Gb/s) added with option CR2.

This module has been superseded by the 80C08C.

- 80C08C - 9.953/10.31/10.52/11.10 Gb/s Multi-rate amplified optical module. Clock Recovery (9.953 and 10.3125 Gb/s) added with option CR1. Clock Recovery (10.3125 and 10.51875 Gb/s) added with option CR2. Continuous-rate clock recovery added with CR4.

- 80C09 - 9.953/10.71 Gb/s Multi-rate optical module. Clock Recovery (9.953 and 10.709 Gb/s) added with option CR1.

This module has been superseded by the 80C11.

- 80C10 - 65 GHz optical module for 40 Gb/s RZ and NRZ telecom.
- 80C11 - 9.953/10.31/10.52/10.66/10.71//11.10 Gb/s Multi-rate amplified optical module. Clock Recovery (9.953 Gb/s) added with option CR1. Clock Recovery (9.953 and 10.66 Gb/s) added with option CR2. Clock Recovery (9.953 and 10.71 Gb/s) added with option CR3. Continuous-rate clock recovery added with CR4.

Electrical Sampling Modules.

- 80E01 - A single-channel, 50 GHz sampling module
- 80E02 - A dual-channel, 12.5 GHz, 50 Ω , sampling module with low noise
- 80E03 - A dual-channel, 20 GHz sampling module. This model provides the same features as 80E04, but without the TDR step generators.
- 80E04 - A dual-channel, 20 GHz TDR sampling module. The TDR step generator provides 35 ps reflected step risetime. Voltage polarity can be reversed on either step to provide true differential TDR.
- 80E06 - A single-channel, 70+ GHz sampling module. This model provides very high performance bandwidth for general-purpose characterization of high speed devices and circuits.

Other Modules.

- 80A01 Trigger Prescale Limiting Preamplifier Module - A single-channel module providing 8-14 GHz AC coupled 50 Ω limiting preamplification. It increases the sensitivity of the prescale trigger input of the 8000 Series instruments to $\leq 200 \text{ mV}_{\text{pk-pk}}$.

Check the Package Contents

Verify that you have received all of the parts of your instrument. You should verify that you have:

- the main instrument.
- all the standard accessories for the main instrument.

NOTE. Standard accessories are listed in Table 1-3 on page 1-45.

- the correct power cords for your geographical area.
- the OS Rebuild CDs (063-3491-XX) and Product Software CD (063-3492-XX) that include an installation copy of the software installed on the instrument and all files needed to rebuild your instrument operating system if necessary. Store the CDs in a safe location where you can easily retrieve them for maintenance purposes.

NOTE. *Keep the certificate of authenticity that accompanies the product-software CD.*

- the 8000 Series Demo Applications Software CD (063-3617-XX) that includes an installation copy of the software. This CD, which is a separate CD from the Oscilloscope software, includes the TDR Impedance Measuring application, which implements the TDR calibration procedures specified by the IPC-TM-650 test methodology, and the Fast NRZ application, which allows you to improve throughput for when eye-pattern mask testing.

NOTE. *New versions of the product and/or demo application software may become available at our web sit. See Contacting Tektronix on page xiii.*

- the correct electrical and optical sampling modules (shipped separately if ordered). (The sampling modules available for order for use with this instrument are listed on page 1-4.)

NOTE. *Any electrical and optical sampling modules ordered are shipped separately. The sampling modules available for order for use with this instrument are listed on page 1-4. (Also, any optional accessories ordered are shipped separately. See Optional on page 1-46 for a list of optional accessories.)*

Check the Package Contents

Remember to fill out and send in the customer registration card. The registration card is packaged in an envelope in the shipping package.

Installation

NOTE. Before beginning installation for the first time, be sure to see *Check the Package Contents*, on page 1-7. Then return to this installation section.

This section covers installation of the instrument, addressing the following topics:

- *Check the Environment Requirements* on page 1-9
- *Install the Sampling Modules* on page 1-10
- *Connect the Peripherals* on page 1-13
- *Power On the Instrument* on page 1-14
- *Powering Off the Instrument* on page 1-16
- *Brightness and Contrast Adjustment (Gamma)* on page 1-16
- *Create an Emergency Startup Disk* on page 1-17
- *Back Up User Files* on page 1-17

The basic operating software is already installed on the hard disk. If reinstallation of software becomes needed, see the following topic:

- *Software Installation* on page 1-18



CAUTION. Be sure to create your emergency startup disk as described on page 1-17. You will need that disk if you ever need to reinstall Windows 98 from the instrument hard drive.

Check the Environmental Requirements

Read this section before attempting any installation procedures. This section describes site considerations, power requirements, and ground connections for your instrument.

Site Considerations

The instrument is designed to operate on a bench or on a cart in the normal position (on the bottom feet). For proper cooling, at least two inches (5.1 cm) of clearance is recommended on the rear and sides of the instrument.

You can also operate the instrument while it rests upright on its rear feet. If you operate the instrument while it is resting on the rear feet, make sure that you properly route any cables coming out of the rear of the instrument to avoid damaging them.



CAUTION. *Keep the bottom of the instrument clear of obstructions to ensure proper cooling.*

Operating Requirements

Specifications in Appendix A list the operating requirements for the instrument. Power source and temperature, humidity, and altitude are listed.

Rackmount Requirements

If this instrument is rackmounted, see the *TDS8000 & CSA8000 Rackmount Instructions* for additional site considerations or operating requirements. This document ships with the Option 1R (rackmount kit).

Install the Sampling Modules



CAUTION. *Do not install or remove any sampling modules while the instrument is powered on.*

Always power the instrument down before attempting to remove or insert any sampling module.



CAUTION. *Sampling modules are inherently vulnerable to static damage. Always observe static-safe procedures and cautions as outlined in your sampling module user manual.*

Check Your Sampling Module Manual(s)

The sampling modules that you order with your instrument ship with the appropriate sampling-module user manuals. Read these manuals for instructions on how to install your sampling modules, and then install them as outlined. (Sampling modules do not ship preinstalled.)

NOTE. After first installing a sampling module(s) or after moving a sampling module from one compartment to another, you should run compensation from the Utilities menu to ensure the instrument meets its specifications. You must run a compensation (accessed from the Utilities menu) whenever the extender configuration is changed from that present at the last compensation. In short, if you install or remove an 80E00 extender, run a compensation. If you exchange a extender for one of a different length, run a compensation. For instructions on running a compensation, see *Optimizing Measurement Accuracy on page 3-92*.

Figure 1-1 shows compartments for both large and small sampling modules, along with the plug-in connector for the ESD wrist strap that you must use while installing or removing these modules.

Please place your sampling-module user manuals in Appendix C of this manual to keep them handy.

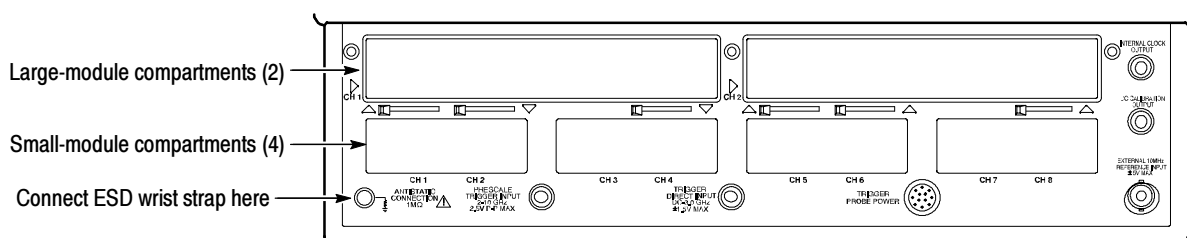


Figure 1-1: Compartments for sampling modules

Maximum Configuration

You can install up to two large sampling modules and four small modules for a total of 10 inputs. Of these 10 inputs, only eight inputs can be active at one time (see Figure 1-2, top two configurations). Also, note that installing a single large module in either compartment disables the first small-module compartment (see note). This configuration (see Figure 1-2, bottom configuration) limits the input count to seven—one from the large, six from the small compartments.

NOTE. Power is still provided to this small slot, which does allow an 80A01 to be functional in this slot even when a large module is installed.

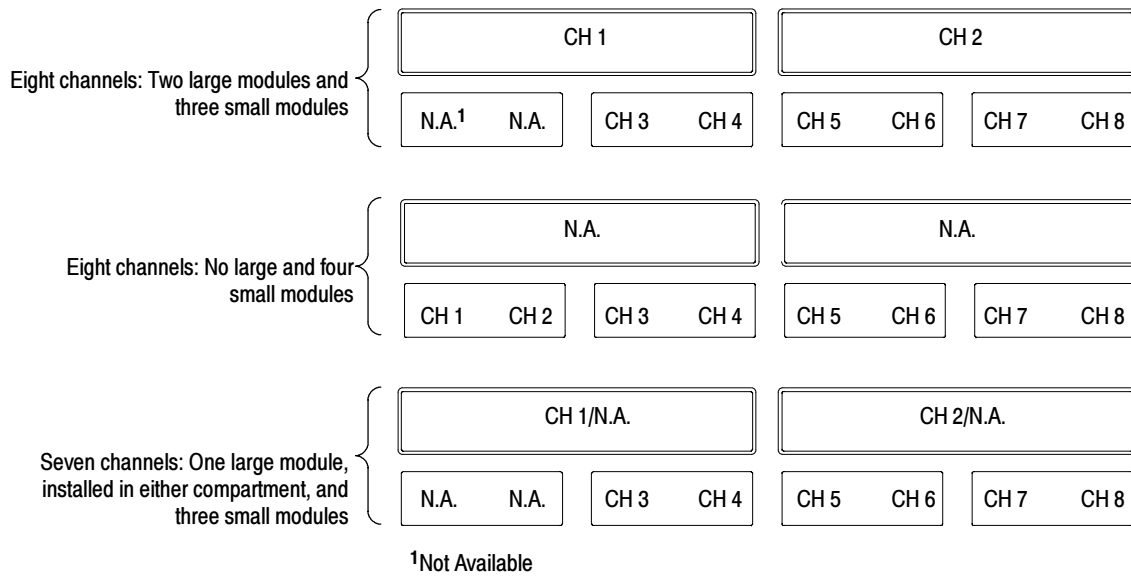


Figure 1- 2: Maximum inputs in three configurations

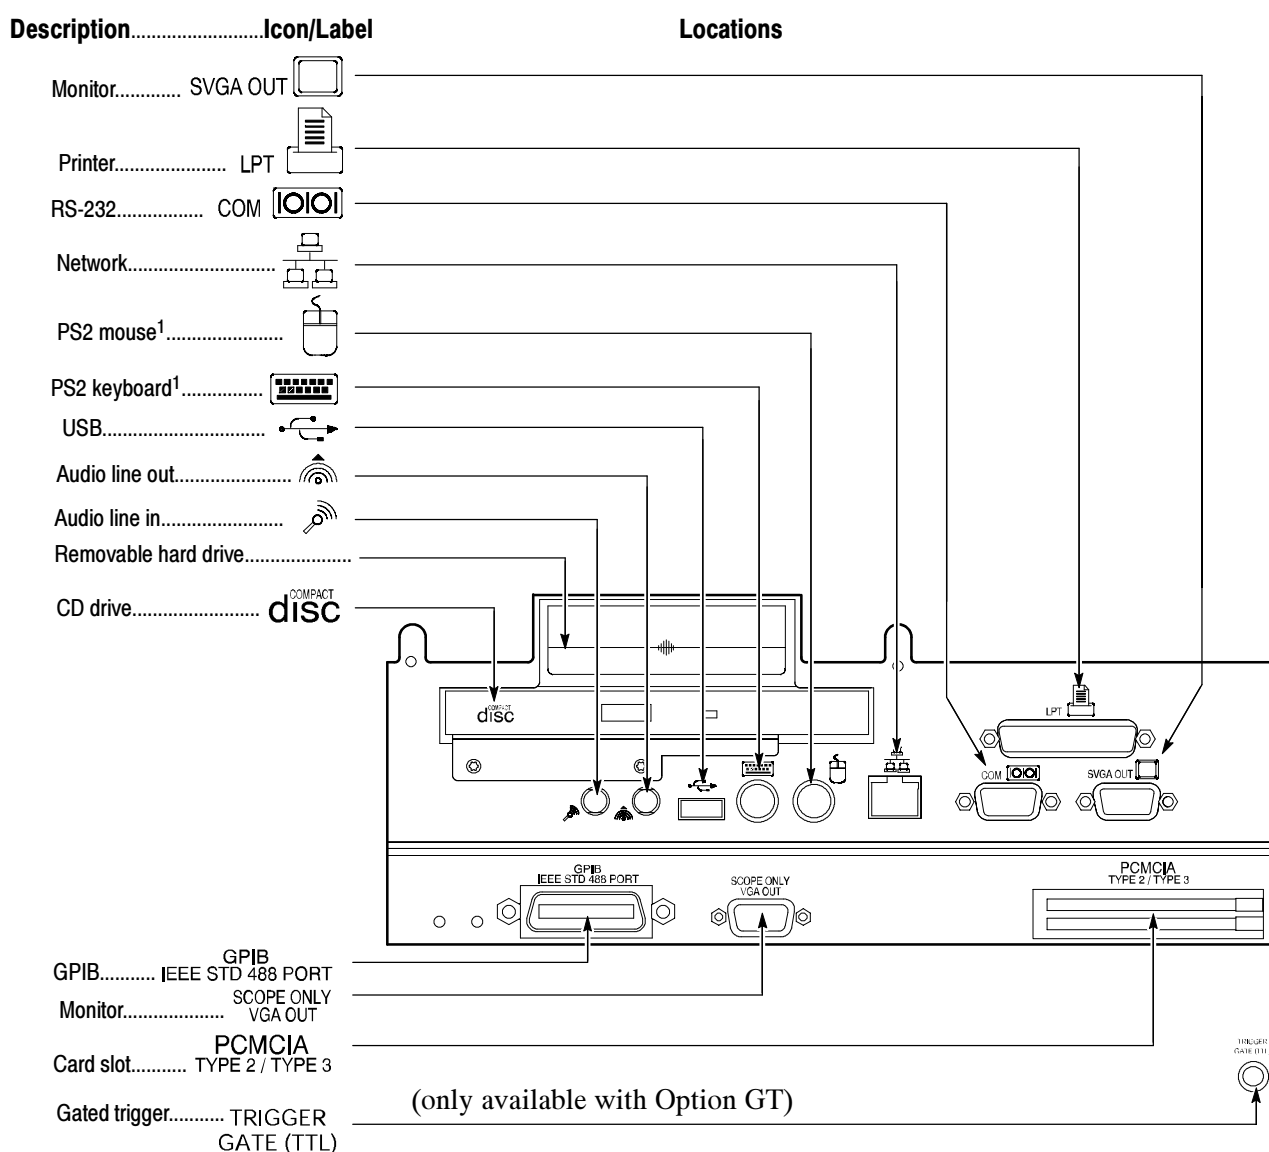
Install probes, cables, and other connection accessories to your sampling modules as appropriate for your application and sampling module. Again, consult your sampling-module and connection-accessory manuals. Continue with the next section after installing the sampling modules.

Connect the Peripherals

The peripheral connections are mostly the same as those you would make on a personal computer. The connection points are shown in Figure 1-3. See Table 1-1 on page 1-14 for additional connection information.



WARNING. Before installing peripheral accessories to connectors (mouse, keyboard, etc.), power down the instrument. See Powering Off the Instrument on page 1-16.



¹Product ships with a USB keyboard, that plugs into the USB port, and a USB mouse that plugs into the back of the keyboard

Figure 1-3: Locations of peripheral connectors on rear panel

Table 1-1: Additional accessory connection information

Item	Description
Monitor	If you use a non-standard monitor, you may need to change the the Windows-98 display settings to achieve the proper resolution for your monitor.
Printer	Connect the printer to the EPP (enhanced parallel port) connector directly. If your printer has a DB-25 connector, use the adapter cable that came with your printer to connect to the EPP connector. For information on printer usage, see <i>Printing Waveforms</i> on page 3-126.
Other	Refer to the Application release notes on your System Rebuild CD for possible additional accessory installation information not covered in this manual.

Power On the Instrument

Follow these steps to power on the instrument for the first time.

1. Check that the line fuses are correct for your application. Both fuses must be the same rating and type. Fuse types require a unique cap and fuseholder. See Table 1-2 and Figure 1-4.

Table 1-2: Line fuses

Fuse type	Rating	Fuse part number	Cap & fuseholder part number
0.25 x 1.250 inch	8 A, fast blow, 250 V	159-0046-00	200-2264-00
5 x 20 mm	6.3 A, fast blow, 250 V	159-0381-00	200-2265-00

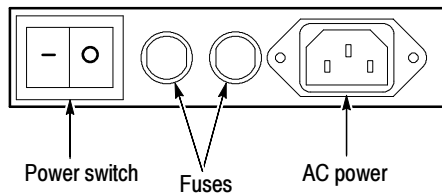


Figure 1-4: Line fuse and power cord connector locations, rear panel



CAUTION. Connect the keyboard, mouse, and other accessories before applying power to the product. Connecting the accessories after powering on the instrument can damage the accessories. Two exceptions are the USB keyboard and mouse that ships with the instrument. Both can be plugged or unplugged without first turning power off.

2. Connect the keyboard and mouse, observing the caution above. Note that the instrument ships with a USB keyboard, which plugs into the USB port (see Figure 1-3 on page 1-13 for location) and a USB mouse, which plugs into the back of the USB keyboard.

NOTE. Connection of the keyboard and mouse is optional. You can operate most features without them, using the front-panel controls and the touchscreen.

3. Connect the power cord.
4. If you have an external monitor, connect the power cord and power on the monitor.
5. Turn the Power switch on at the rear panel. (See Figure 1-4 on page 1-14 for switch location.)
6. Push the On/Standby switch to power on the instrument (see Figure 1-5 for the switch location).

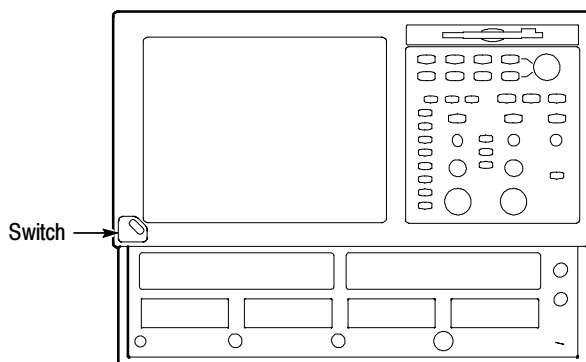


Figure 1-5: On/Standby switch location

7. Wait for the boot routine and low-level self test to complete.
8. Follow any instructions on the screen.

The internal setup software will automatically configure your instrument and install all required devices, depending on the installed accessories.

Powering Off the Instrument

The instrument has a built-in soft power-down function that safely powers down the instrument when you push the On/Standby button. You do not need to close the UI application or Windows 98 before using the On/Standby button.

To completely remove power to the instrument, first soft power-down the instrument using the On/Standby button, and then set the power switch on the rear panel to off.

Brightness and Contrast Adjustment (Gamma)

Although this instrument is set for optimal Gamma display before shipping, you can adjust it to suit your preferences. If you wish to do so, use the following procedure:

1. Click the minimize icon (the minus “-” character) in the upper-right corner to minimize the instrument application and expose the Windows tool bar at the bottom of the screen.
2. From the Windows Start menu, select Settings > Control Panel.
3. In the Control Panel, double click the Display icon to open the Display Properties dialog box.
4. Select the Settings tab at the top of the dialog box.
5. Click the Advanced button, and then select the Chips tab.
6. Click the Gamma button, and then use the Gamma control to adjust the brightness and contrast settings of the LCD display.
7. After you are satisfied with the display settings, right-click the Gamma control and then select Exit.
8. Click OK to close the Chips and Tech 69000 PCI Properties dialog box, and then click OK to close the Display Properties dialog box.
9. Click File-Close or click the control box to close the Control Panel.
10. Click the TDS/CSA8000 button on the Windows tool bar to restore the instrument application to the screen.

Create an Emergency Startup Disk

Now that you have completed the basic installation process, you should create an emergency startup disk that you can use to restart your instrument in case of a major hardware or software failure. You should create this disk, and then store it in a safe place.



CAUTION. *Create this disk and store it in a safe place. It may allow you to recover your Windows 98 installation without rebuilding the entire instrument hard disk.*

The emergency startup disk contains basic files to restart your instrument. It also contains files to check and format the hard disk.

Follow these steps to create the emergency startup disk:

1. Push the **RUN/STOP** front-panel button to stop acquisition.
2. Minimize the application to the Windows Task bar by clicking the minimize (-) button in the upper-right corner of the user interface screen.
3. Click the Windows-98 Start button, point to Settings, and click Control Panel.
4. In the Control Panel window, double-click Add/Remove Programs.
5. Click the tab for the Startup Disk page.
6. Insert a floppy disk into the disk drive and follow the on-screen instructions to create the startup disk.
7. You can restore the UI application to the screen by clicking its button in the Windows Task bar.

Back Up User Files

You should back up your user files on a regular basis. Use the Windows-98 Back Up tool to back up files stored on the hard disk. The Back Up tool is located in the System Tools folder in the Accessories folder.

1. Minimize the UI application by clicking the minimize (-) button in the upper-right corner on screen.
2. Click Start in the Task bar to pop up the Start menu.
3. Select Programs > Accessories > System Tools > Backup in the Start menu.

4. Use the backup tool that displays to select your back-up media and to select the files and folders that you want to back up. Use the Windows 98 online help for information on using the Backup tool. You can back up to the floppy drive or to a networked storage device over the ethernet port (rear panel).
5. You can restore the UI application to the screen by clicking its button in the Windows Task bar.

Software Installation

This section describes how to install the software found on the CSA8000 & TDS8000 OS Rebuild (063-3491-XX) and Product Software (063-3492-XX) CDs that accompany this product. The instrument ships with the product software installed, *so only perform these procedures if reinstallation becomes necessary.*

Description

There are two sets of CDs that ship with this instrument:

- OS Rebuild CD (063-3491-XX). This 2-disk set contains the operating system for the instrument. This CD set, which can be used to rebuild the instrument hard drive, includes the Window 98 operating system installation.

If you need to reinstall Windows 98, you may be able to do so without rebuilding the instrument hard drive. See *Operating System Reinstallation* on page 1-19 for more information.

- Product Software CD (063-3492-XX). The product software, or UI application, complements the hardware controls of the front panel, allowing complete set up of all instrument features. The Product Software CD includes software allowing you to reinstall the product software without having to rebuild the entire operating system.

Software Release Notes

Read the software release notes README.TXT ASCII file if present on the Product Software CD before performing any installation procedures. This file contains additional installation and operation information that supercedes other product documentation.

To view the README.TXT file, open the Notepad Windows accessory and open the file on the CD. After installation, you can also read the copy from a directory on the product:

C:\Programs Files\TDSCSA8000\System

A printed version of the Software Release Notes is shipped with the product. The printed version included with your instrument supercedes the online version.

Operating System Reinstallation

Use the following procedure if reinstalling Windows 98 becomes necessary.

NOTE. *Only do the reinstall if Windows 98 is missing or corrupted.*

There are two possibilities for reinstall:

- The instrument can access the hard drive; if so, reinstall Windows using the emergency startup disk and the procedure *Windows 98 Reinstall Only* on page 1-19.
- The instrument cannot access the hard drive or you do not have an emergency startup disk available. In either case, you must rebuild your hard drive using the procedure *System Hard Drive Rebuild* on page 1-20. Any files or programs you have installed will be lost.

Windows 98 Reinstall Only. If you can access the instrument hard drive and you have your emergency startup disk, you can reinstall Windows 98 from the hard drive. This procedure is preferred over rebuilding the hard drive, since the rebuild rewrites the entire hard drive.

1. Power off the instrument. Use the On/Standby switch if possible; if not, use the principle power switch found at the back of the instrument.
2. If a keyboard is not connected to the instrument, connect it.
3. Insert your emergency startup disk in the instrument floppy drive.
4. Power on the instrument. Make sure the principle power switch at the back of the instrument is set on. Push the On/Standby switch on the front panel.
5. The instrument should now boot from the emergency startup disk and present you with a selection menu. Use the arrow and enter keys to choose Start the computer without CDROM support.
6. At the `a:\` prompt, type `c:.` Then type `cd windows\options\cabs.`
7. Type `setup.` Follow the instructions on screen.

NOTE. *At the `a:\` prompt, you can type `help` at anytime to read a file that may be helpful in getting the Windows 98 operating system up and running.*

System Hard Drive Rebuild. If you cannot access the instrument hard drive, you must rebuild the instrument hard drive. This process will return the hard disk to the its original condition present when the instrument shipped.

Since data and programs you may have installed are lost with this rebuild, you should do the *Windows 98 Reinstall Only* procedure instead if you can. (See *Windows 98 Reinstall Only* on page 1-19.)

If you must rebuild the system hard drive, use the set of OS Rebuild CDs (063-3491-XX) that shipped with the instrument. Follow the instructions in the booklet found in the CD case.

System Diagnostics

In case of instrument problems, you may wish to run the system diagnostics. If so, see the procedure *Perform the Diagnostics*, on page 1-22.

Window Safe Mode

If the instrument is turned off before the operating system boots, or if you've installed a third-party product with a driver incompatible with instrument start up, Windows 98 will open in Safe mode. The touchscreen will be inoperable; therefore, you must install the standard-accessory mouse and keyboard to operate the instrument.

When you have finished investigating and removed any barrier to Windows start-up, you can reboot. If the instrument no longer boots to Safe mode, you can remove the keyboard and mouse if desired.

Incoming Inspection

This section contains instructions for performing an incoming inspection of this instrument. Performance of an incoming inspection is not required to put the instrument in service.

These instructions verify that the instrument is operating correctly after shipment, but do not check product specifications. An incoming inspection includes the following parts:

- *Perform the Diagnostics* on page 1-22 runs the internal diagnostics.
- *Perform a Compensation* on page 1-24 runs the self compensation routine.
- *Perform the Functional Tests* on page 1-25 uses the DC CALIBRATION OUTPUT and the INTERNAL CLOCK OUTPUT connectors to verify that the instrument is functioning.
- *Perform the Hardware and Operating System Tests* on page 1-42 uses a software program called QAPlus/Win to verify instrument hardware and the Windows 98 operating system is functioning.

NOTE. *The procedures that follow contain instructions based on the menus and controls supported by the version 1.5 release and later of the instrument firmware. The procedures will work for earlier versions of software, but the control and menu names may vary slightly.*

If the instrument fails any test within this section, it may need service. To contact Tektronix for service, see *Contacting Tektronix* on page xiii of *Preface*.

Make sure you have put the instrument into service as detailed in *Installation* starting on page 1-9. Then assemble the following test equipment and proceed with the procedures that follow.

Assemble Equipment

To complete the incoming inspections procedures requires the following test equipment:

- One SMA cable, such as Tektronix part number 174-1427-00.
- One 50 Ω BNC cable, such as Tektronix part number 174-1341-00.
- One SMA 10X attenuator, such as Tektronix part number 015-1003-00.

- One or more (quantity to match number of electrical channels to compensate) 50 Ω terminators, such as Tektronix part number 015-1022-01
- One 50 Ω terminator cap, such as Tektronix part number 011-0049-02
- One 80E00-series electrical sampling modules installed as outlined in its User manual.
- One 80C00-series optical sampling module installed as outlined in its User manual (optional; test only if purchased with/for your instrument).
- Mouse
- Keyboard

Perform the Diagnostics

The instrument *Diagnostics* use internal routines to confirm basic functionality and proper adjustment.

Equipment required	None
Prerequisites	<p>First, all sampling modules to be diagnosed must be installed as outlined in their user manuals.</p> <p>Second, power on the instrument and allow a 20 minute warm-up before doing this procedure.</p>

1. *Set up the instrument:* From the application menu bar, select Utilities, and then select Diagnostics. The Diagnostics dialog box displays. See below.



2. *Select a diagnostics suite:*
 - a. In the dialog box, click the **Subsystem Level** tab.
 - b. Select the all the entries by clicking the first entry **Control Proc** and dragging down to select the rest. All entries should be highlighted as shown above.
 - c. In the **Run** box, leave **Loop** and **Halt on Failure** unchecked.
3. *Verify that the diagnostic suite passes:*
 - a. Click the **Run** button to execute the diagnostics.
 - b. The diagnostics may take several minutes to complete. Verify that **Pass** appears as **Status** in the dialog box when the diagnostics complete.
 - c. If instead an error number appears as **Status**, rerun the diagnostics. If Fail status continues after rerunning diagnostics and you have allowed warm up to occur, the module or main instrument may need service.
4. *Close the diagnostic dialog box.*

End of Procedure

Perform the Compensation

This procedure uses internal routines to verify that the instrument compensates properly.

Equipment required	<p>For sampling modules:</p> <ul style="list-style-type: none"> ■ 50 Ω terminations on all electrical module channels (Tektronix part number 015-1022-xx). ■ Dust covers on all optical module channels. <p>The sampling modules ship from Tektronix with the proper terminations and dust covers installed.</p>
Prerequisites	<p>First, all sampling modules to be compensated must be installed as outlined in their user manuals.</p> <p>Second, power on the instrument and allow a 20 minute warm-up before doing this procedure.</p>

1. Run the compensation routines:

- a. From the application menu bar, select Utilities, and then select Compensation.

In the Compensation dialog box, the main instrument (mainframe) and sampling modules are listed. The temperature change from the last compensation is also listed. See Figure 1-6.

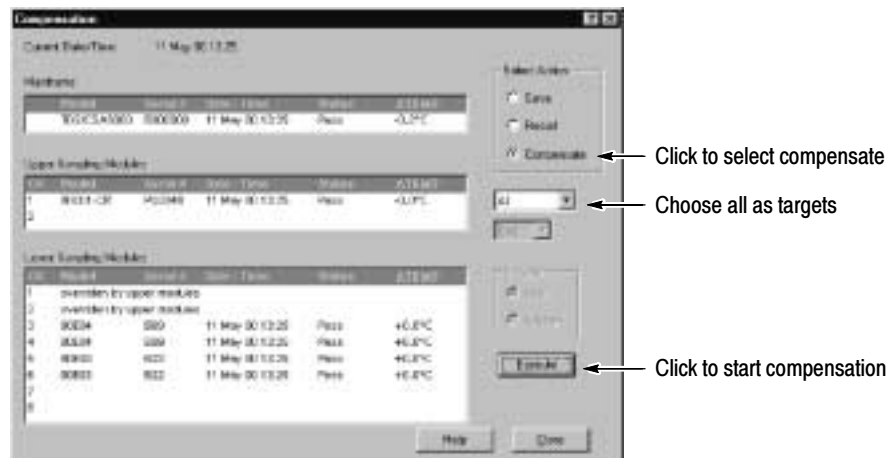


Figure 1-6: Compensation dialog box

- b. Wait until the Status for all items you wish to compensate changes from **Warm Up** to **Pass**, **Fail**, or **Comp Req'd**.
- c. Under Select Action, click the **Compensate** option button.
- d. From the top pulldown list, choose **All** (default selection) to select the main instrument and all its modules as targets to compensate.
- e. Click the **Execute** button to begin the compensation.
- f. Follow the instructions to disconnect inputs and install terminations that will appear on screen; be sure to follow static precautions (see the user manual for your sampling module) when following these instructions.

NOTE. *Failing to install the 50 Ω terminations on electrical inputs can yield erroneous compensation failures or results.*

2. *Verify that the compensation routines pass:*

- a. The compensation may take several minutes to complete. Verify that **Pass** appears as **Status** for the main instrument and for all sampling modules listed in the Compensation dialog box when compensation completes.
- b. If instead **Fail** appears as **Status**, rerun the compensation. If **Fail** status continues after rerunning compensation and you have allowed warm up to occur, the module or main instrument may need service.
- c. If you want to save the compensation constants generated by this compensation, click the **Save** option button under Select Action. Click the **Execute** button to save the compensation.

3. *Close the compensation dialog box.*

End of Procedure

Perform the Functional Tests

These procedures use the DC CALIBRATION OUTPUT and the INTERNAL CLOCK OUTPUT connectors to further verify that the instrument functions properly. An SMA cable and a 10x attenuator are required to do these test procedures.

The purpose of these procedures is to confirm that the instrument functions properly. The equipment required is intentionally kept to a minimum.

STOP. These procedures verify functions; that is, they verify that the instrument features operate. They do not verify that they operate within limits; therefore, do not interpret any quantities cited (such as “about five horizontal divisions”) as limits.

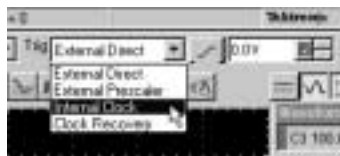
STOP. DO NOT make changes to the front-panel settings that are not called out in the procedures. Each verification procedure will require you to set the instrument to default settings before verifying functions. If you make changes to these settings, other than those called out in the procedure, you may obtain invalid results. In this case, go back to step 1 and repeat the procedure.

Verify Electrical Input Channels

Install the test hookup and preset the instrument controls:

Equipment required	One SMA cable, such as Tektronix part number 174-1427-00.
Prerequisites	At least one electrical (80E00 series) sampling module must be installed as outlined in its user manual.

1. *Initialize the instrument:* Push the front-panel **DEFAULT SETUP** button, and click **Yes** in the confirmation dialog box.
2. *Set the Trigger System:* In the UI application toolbar, select **Internal Clock** from the **Trig** list box as shown below.



3. *Hook up the signal source:* Connect the SMA cable from the DC CALIBRATION output to the channel input that you want to test as shown in Figure 1-7.

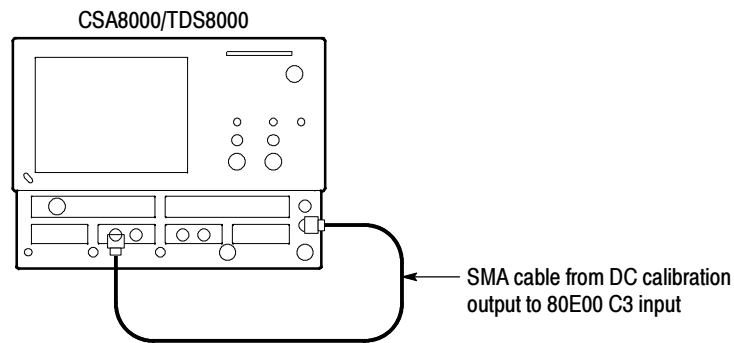


Figure 1-7: Hookup for electrical functional tests

4. Set the DC CALIBRATOR OUTPUT:

- a. Push the Vertical **MENU** front-panel button. This displays the Vert Setup dialog box.

NOTE. When an optical module is installed, the optical setup dialog box displays by default. Click the Basic button to display the basic dialog box.

- b. Enter a level of **200 mV** in the DC CAL box.
 - c. Push the Vertical **MENU** front-panel button again to dismiss the Vert Setup dialog box.
- 5. Select the channel to test:** Push the channel button for the channel you want to test. The button lights and the channel display comes on. See Figure 1-8.

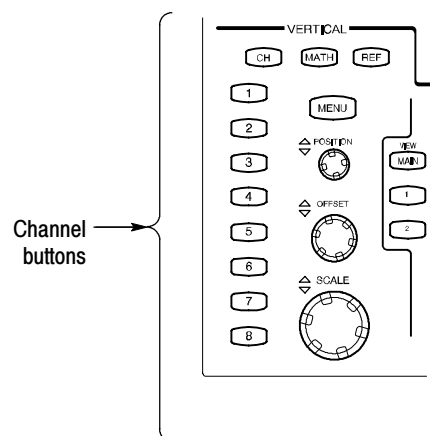


Figure 1-8: Channel button location

6. *Verify that the channel is operational:* Confirm that the following statements are true:
 - The vertical scale readout for the channel under test shows a setting of **100 mV**, and a DC level is at about 2 divisions above center screen.
 - The front-panel vertical **POSITION** knob (for the channel you are testing) moves the DC level up and down the screen when rotated.
Return the DC level to 2 divisions above center screen before continuing.
 - Turning the vertical **SCALE** knob to **50 mV** changes the amplitude of the DC level to about 4 divisions above center screen, and returning the knob to **100 mV** returns the amplitude to about 2 divisions above center screen.
7. *Verify that the channel acquires in all acquisition modes:* Push the front-panel Acquisition **MENU** button to display the Acq setup dialog box. Click each of the three acquisition modes, and confirm that the following statements are true:
 - **Sample** mode displays an actively acquiring waveform on-screen. (Note that there is a small amount of noise present on the DC level).
 - **Average** mode displays an actively acquiring waveform on-screen with the noise reduced.
 - **Envelope** mode displays an actively acquiring waveform on-screen with the upper and lower extremes of the noise displayed.
8. *Close Acquisition setup dialog box:* Push the Acquisition **MENU** button to close the Acq setup dialog box.
9. *Verify the DC accuracy compensation:* Do the following substeps:
 - a. Select Measurement from the Setup menu. In the Meas Setup dialog box that displays:
 - Select as Source the channel under test. For example, select Main C3 for channel 3.
 - Select Meas1.
 - Set the Select Meas menu to Pulse > Amplitude > Mean.
 - b. Push the Vertical **MENU** front-panel button to switch to the Vert Setup dialog box.

- c. Set the Vertical Scale, Vertical Offset, and DC Calibration Output to the levels shown in the first row of the table that follows.
- d. In Measurement readout on screen, verify that the Mean measurement for the channel under test falls within the limits given in the table.
- e. Repeat steps c and d for each row in the table.

Vertical Scale (mV/div)	Vertical Offset (mV)	DC CAL Output (mV)	Limits	
			Minimum (mV)	Maximum (mV)
100	-1000.0	-1000.0	-1009.0	-991.0
100	0.0	-450	-461.0	-439.0
100	0.0	0	-2.0	2.0
100	0.0	450	439.0	461.0
100	1000.0	1000.0	991.0	1009.0

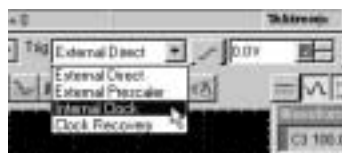
10. *Test all channels:* Repeat steps 3 through 9 until all electrical input channels are verified.
11. *Remove the test hookup:* Disconnect the SMA cable from the channel input and the DC CALIBRATION output.

Verify Optical Input Channels

After verifying the electrical channels and if you have an 80C00 Series Sampling Module installed, you can now verify its optical channels. This verification is done without an input signal.

Equipment required	None.
Prerequisites	At least one optical (80C00 series) sampling module must be installed as outlined in its user manual.

1. *Initialize the instrument:* Push the front-panel **DEFAULT SETUP** button, and click **Yes** in the confirmation dialog box.
2. *Set the Trigger System:* In the UI application toolbar, select **Internal Clock** from the **Trig** list box as shown below.



3. *Select the channel to test:* Push the channel button for the channel you want to test. The button lights amber and the channel displays. See Figure 1-9.

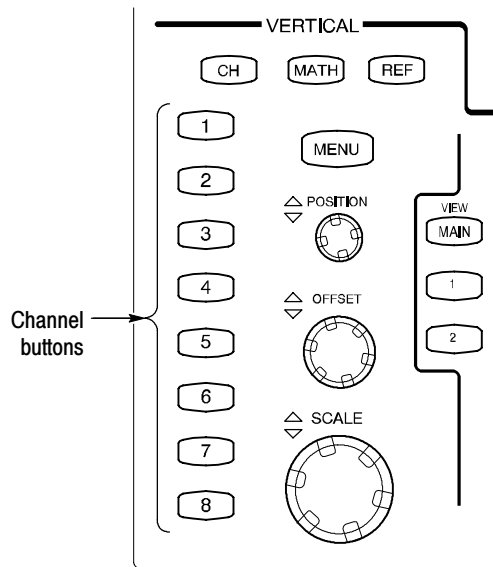


Figure 1-9: Channel button location

4. *Verify that the channel is operational:* Confirm that the following statements are true.
 - A baseline trace displays at about center screen (see Figure 1-10 on page 1-31) and the vertical scale readout for the channel under test shows a setting as follows:
 - 80C01, 80C02, 80C04, 80C09, and 80C11: 1 mW
 - 80C03: 100 μ W
 - 80C05: 3 mW
 - 80C06: 6 mW
 - 80C07, and 80C07B: 100 μ W
 - 80C08, 80C08B, and 80C08C: 200 μ W
 - 80C10: 3 mW
 - Turning the front-panel Vertical **POSITION** knob (for the channel you are testing) moves the signal up and down the screen. *Return the baseline trace to center screen before continuing.*
 - Turning the front-panel Vertical **OFFSET** knob counterclockwise offsets the baseline towards the bottom of the screen; turning the knob clockwise offsets the baseline towards the top of the screen, and returning the knob to **0.000** offset returns the baseline to center screen.

NOTE. If the position knob was set to 0.000, you can confirm this in the Vertical menu (use Basic button in the dialog box).

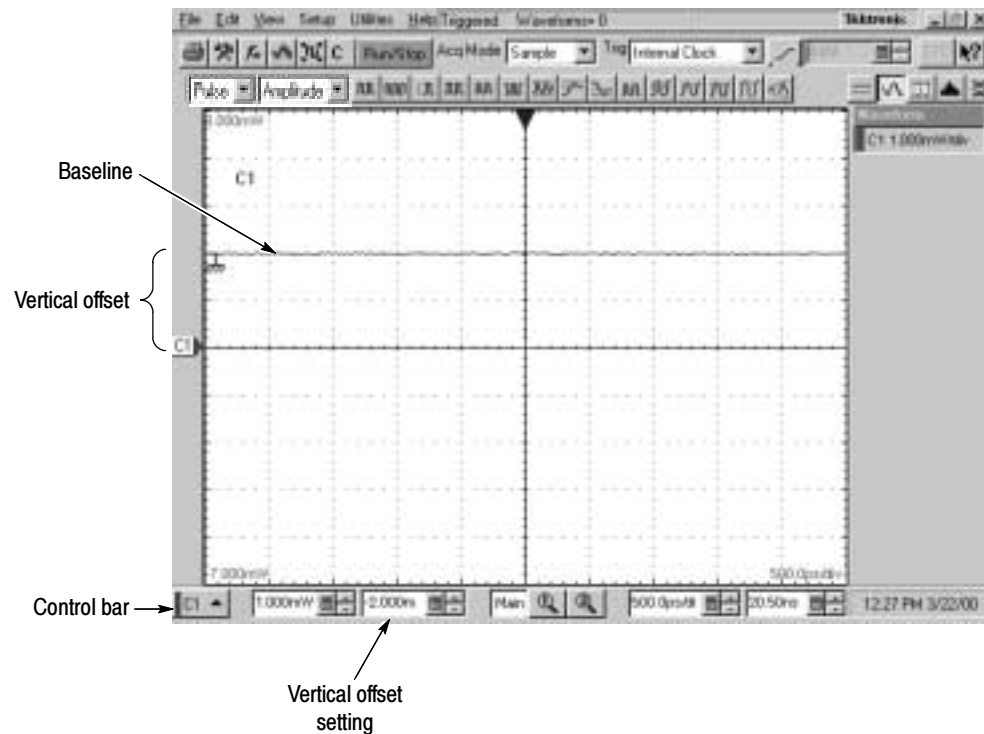


Figure 1-10: Optical channel verification

5. *Verify that the channel acquires in all acquisition modes:* Push the front-panel button Acquisition **MENU** to display the Acq Setup dialog box. Click each of the three acquisition modes and confirm that the following statements are true:
 - **Sample** mode displays an actively acquiring waveform on-screen. (Note that there may be a small amount of noise present on the baseline level).
 - **Average** mode displays an actively acquiring waveform on-screen with any noise present reduced.
 - **Envelope** mode displays an actively acquiring waveform on-screen with the upper and lower extremes of the noise displayed.
6. *Close Acquisition setup dialog box:* Push the Acquisition **MENU** button to close the Acq setup dialog box.

7. *Test all channels:* Repeat steps 3 through 5 until all optical input channels are verified.

Verify the Time Bases Work

After verifying the channels, you can now verify that the time bases function. This verification is done using a front-panel signal.

Equipment required	One SMA cable, such as Tektronix part number 174-1427-00. One 10x SMA attenuator, such as Tektronix 015-1003-00. One electrical (80E00-series) sampling module.
Prerequisites	None

1. *Initialize the instrument:* Push the front-panel **DEFAULT SETUP** button, and click **Yes** in the confirmation dialog box.
2. *Hook up the signal source:* Connect the SMA cable from the Internal Clock output through a 10x attenuator to the 80E00 sampling module input channel 3 as shown in Figure 1-11.

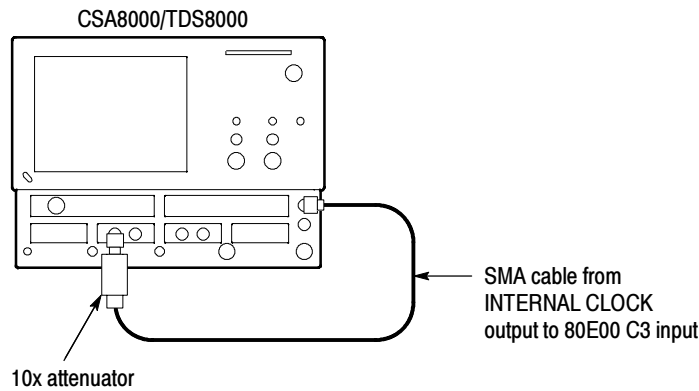


Figure 1- 11: Hookup for the time base tests

3. *Set up the instrument:*
 - a. Push the Trigger **MENU** front-panel button to display the Trig Setup dialog box.
 - b. Click **Internal Clock** under **Trigger Source** in the Trig Setup dialog box. The Internal Clock rate should be set to **200kHz**.
 - c. Push the Trigger **MENU** front-panel button again to dismiss the Trig Setup dialog box.

- d. Push the channel button for the channel you connected to in step 2. See Figure 1-12 on page 1-33. The button lights and the channel display comes on.
- e. Turn the Vertical **SCALE** knob to set the vertical scale to **20 mV/div**. The channel scale readout is displayed in the Control bar at the bottom of the graticule.

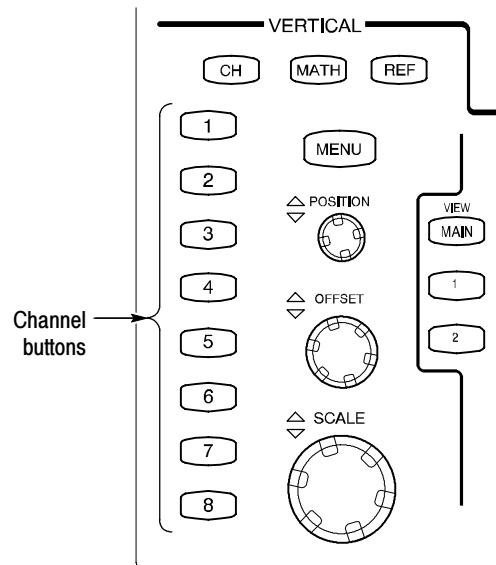


Figure 1-12: Channel button location

4. *Set the time base:* Set the Horizontal **SCALE** to **1 μ s/div**. The horizontal scale readout is displayed in the Control bar at the bottom of the graticule.
 - a. Set the display for **Normal** and **Show Vectors** (enable). See *To Set Display Styles* on page 3-68.
 - b. Rotate vertical **OFFSET** knob counterclockwise so that the base of the square wave is about 2 divisions below the center graticule.

NOTE. *Otherwise, no vertical trace will be seen for rise and fall.*

5. *Verify that the Main time base operates:* Confirm the following statements are true:
 - One period of the internal clock signal (a square wave) is about five horizontal divisions on-screen. See Figure 1-13 on page 1-34.

NOTE. At some temperatures, there may be extraneous data points after the first half cycle when viewing the front-panel Internal Clock output (as is done in this step). This behavior may also occur when viewing multiple cycles in TDR mode. In both cases, this behavior is normal.

- Rotating the Horizontal **SCALE** knob clockwise expands the waveform on-screen (more horizontal divisions per waveform period), counter-clockwise rotation contracts it, and returning the horizontal scale to **1 μ s/div** returns the period to about five divisions. **Leave the time base set to 1 μ s/div.**
- The horizontal **POSITION** knob positions the signal left and right on-screen when rotated.

NOTE. The signal will not move past the minimum position setting.

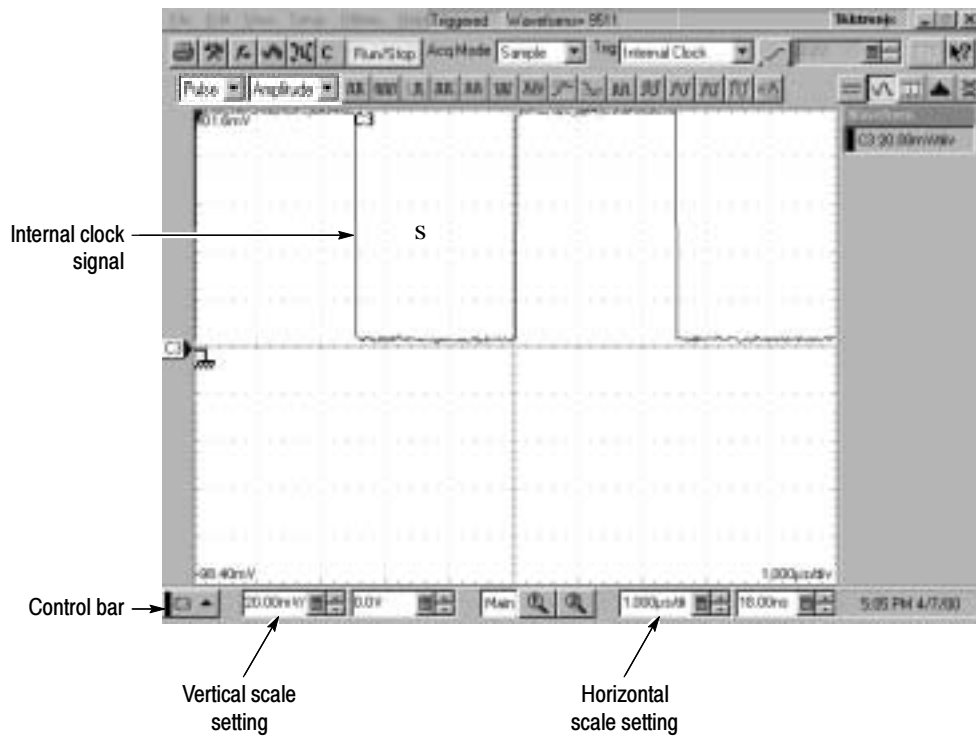


Figure 1- 13: Main time base verification

6. Set up the Mag1 time base:

- a. Push the Horizontal View **MAG1** button on the front panel. The Mag1 time base view will display under the Main time base view.
- b. Set the Horizontal **SCALE** to **1 $\mu\text{s}/\text{div}$** . The horizontal scale readout is displayed in the Control bar at the bottom of the graticule and is now reading out the scale of the Mag1 time base view.

7. Verify that the Mag1 time base operates: Confirm the following statements.

- The brackets on the Main View waveform (*top graticule*) are a full-screen width apart (10 divisions). See Figure 1-14 on page the 1-35.
- One period of the internal clock signal (a square wave) in the Mag view (*bottom graticule*) is about five horizontal divisions on-screen. (Matches the waveform in the top graticule.) See Figure 1-14.
- Rotating the Horizontal **SCALE** knob clockwise to **500 ns/div** expands the waveform *in the bottom graticule* to double the period (about 10-horizontal divisions per waveform period) and returning the Horizontal **SCALE** knob to **1 $\mu\text{s}/\text{div}$** returns the period to about five divisions. Leave the Horizontal Scale set to 1 us/div.

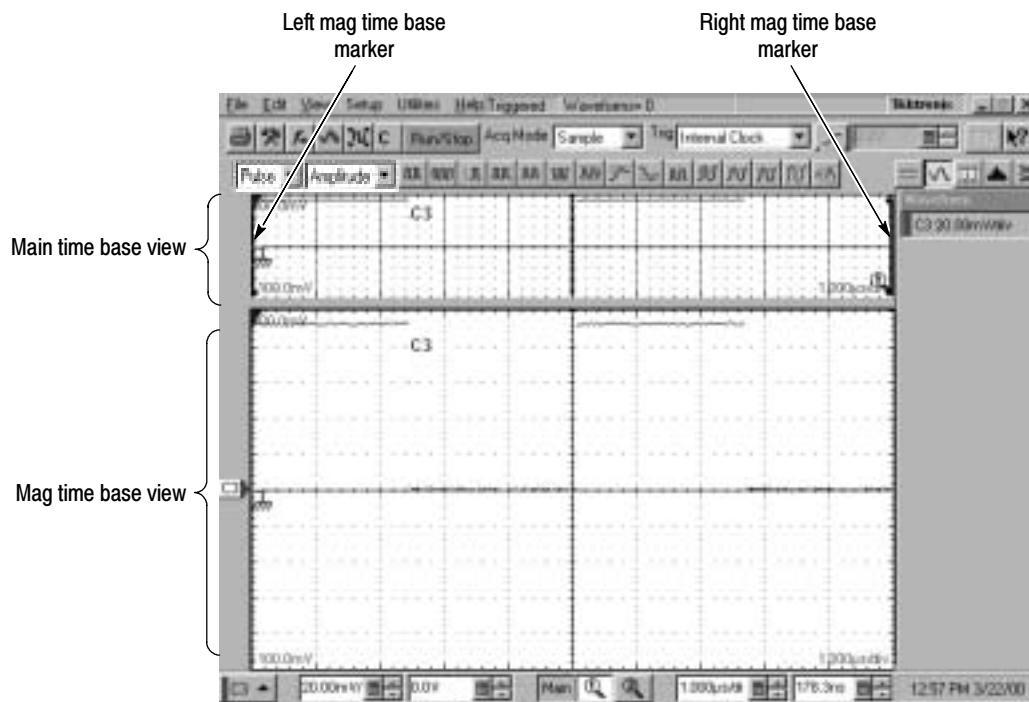


Figure 1-14: Mag time base verification

8. *Verify that the Mag2 time base operates:*

- a. Push the Mag1 button to remove the display of the Mag1 time base.
- b. Perform steps 6 and 7, but use the Mag2 button instead of the Mag1.

Perform Gated Trigger Test

This test verifies that the Gated Trigger (GT Option) is functional. This test is done using a front-panel signal and a rear-panel TTL connection.

Equipment required	One 50 Ω BNC cable, such as Tektronix part number 174-1341-00 One SMA cable, such as Tektronix part number 174-1427-00 One 50 Ω terminator cap, such as Tektronix part number 011-0049-02. One SMA 10X attenuator (20 dB attenuator), SMA connector, such as Tektronix part number 015-1003-00 One electrical (80E00-series) sampling modules.
Prerequisites	This test applies only to instruments that include option GT.

1. *Initialize the instrument:* Push the front-panel **DEFAULT SETUP** button, and click **Yes** in the confirmation dialog box.
2. Push the channel 3 button to select it. The button lights and the channel display comes on. See Figure 1-15.

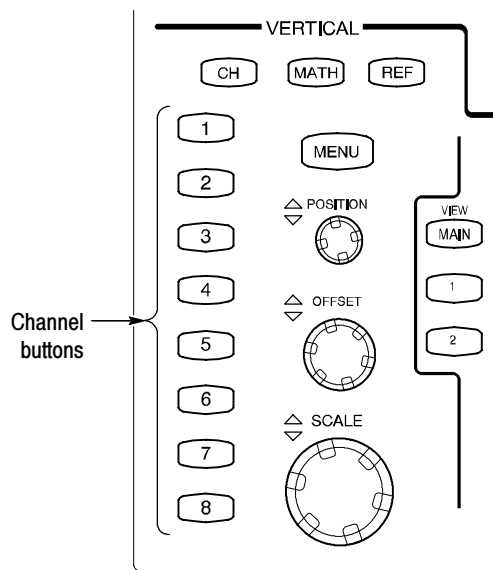


Figure 1- 15: Channel button location

3. *Hook up the signal source:* Connect the SMA cable from the Internal Clock output through a 10x attenuator to 80E00 sampling module input channel 3 as shown in Figure 1-16. Connect BNC cable to External Gate input at rear panel.

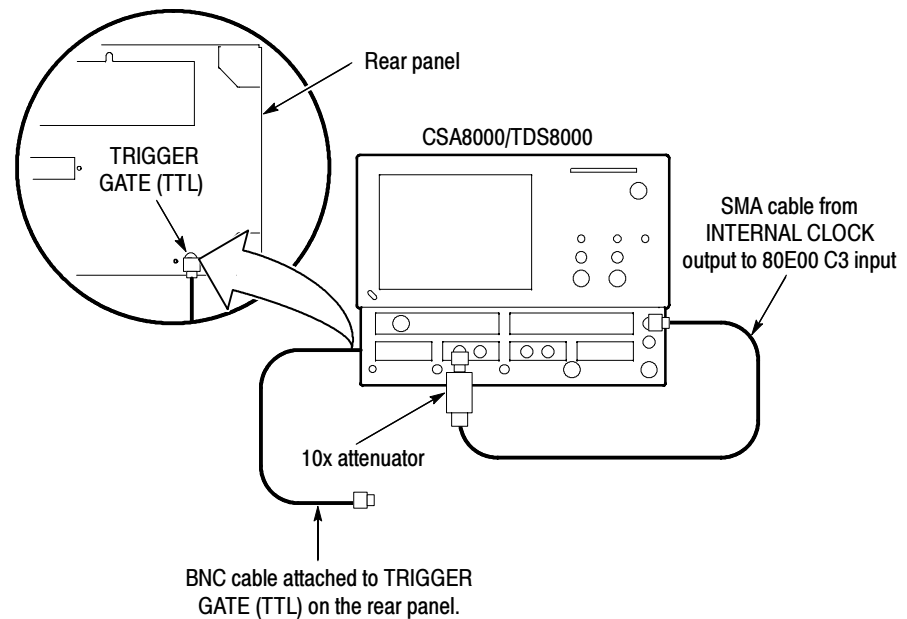


Figure 1-16: Hookup for the gated trigger tests

4. *Set up the instrument:*
 - a. Push the Trigger **MENU** front-panel button to display the Trig Setup dialog box.
 - b. Click **Internal Clock** under **Trigger Source** in the Trig Setup dialog box. The Internal Clock rate should be set to **200kHz**.
 - c. Verify that the Gated Trigger option in Enhanced Triggering section is selected (check box is checked). See *To Use Gated Trigger*, step 4 on page 3-51.
 - d. Turn the Vertical **SCALE** knob to set the vertical scale to **50 mV/div**. The channel scale readout is displayed in the Control bar at the bottom of the graticule.
5. *Set the time base:* Set the Horizontal **SCALE** to **2 μ s/div**. The horizontal scale readout is displayed in the Control bar at the bottom of the graticule.
6. Set the display for **Normal** and **Show Vectors** (enable). See *To Set Display Styles* on page 3-68.

7. Push the Horizontal **MENU** button, the Mode in All Timebases must be set to Lock to Int. 10 MHz.
8. *Verify that Triggering occurs:* Verify signal is triggered with waveform on-screen. See Figure 1-17 on page 1-38.

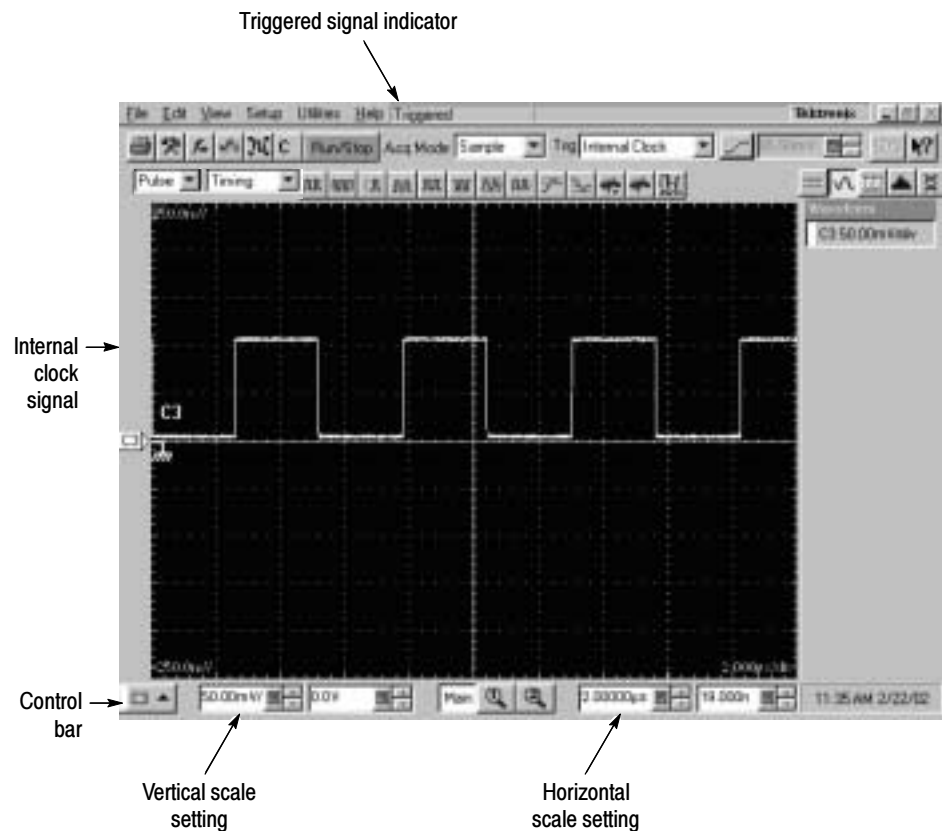


Figure 1-17: Signal triggered

9. *Disable trigger:* Install 50 Ω terminator cap to the end of the cable that is attached to the rear-panel gated trigger BNC. See Figure 1-16 on page 1-37.
10. *Verify that the Gated Trigger functions:* Verify signal is not triggered (gate disabled). Signal freezes on the screen above to indicate triggering has stopped. See Figure 1-18 on page 1-39. Note the Not Trigd indication at the top of the window.
 - a. Push the **CLEAR DATA** button.
 - b. Verify signal is not triggered with no waveform on-screen (see Figure 1-19 on page 1-40). Note the Not Trigd indication at the top of the window.

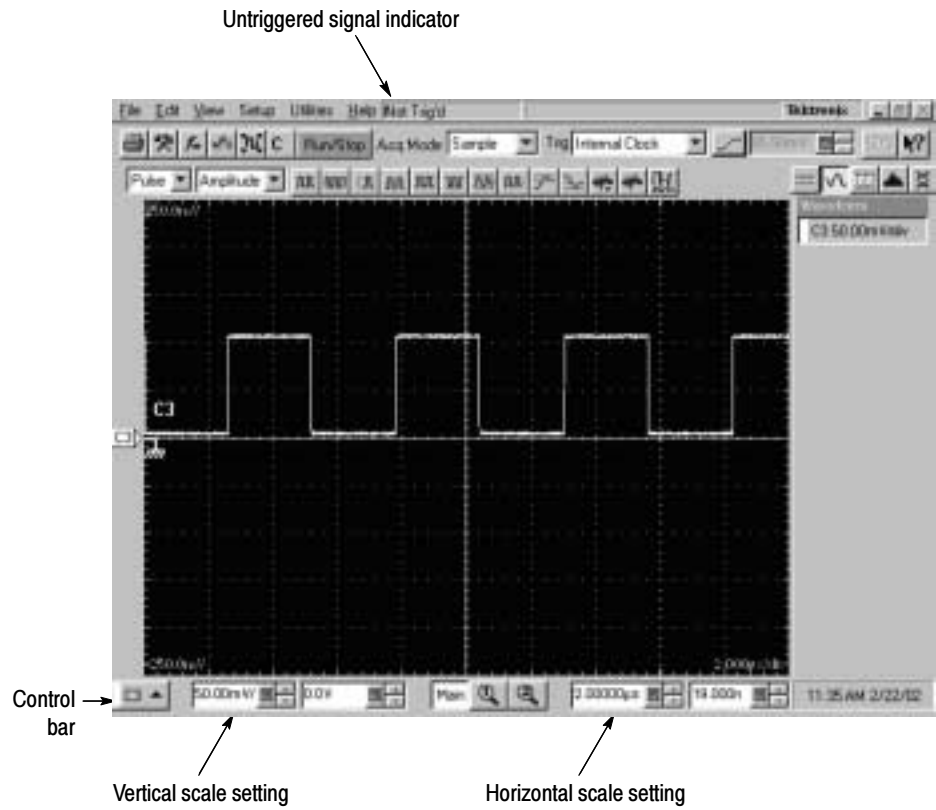


Figure 1-18: Signal not triggered (signal frozen)

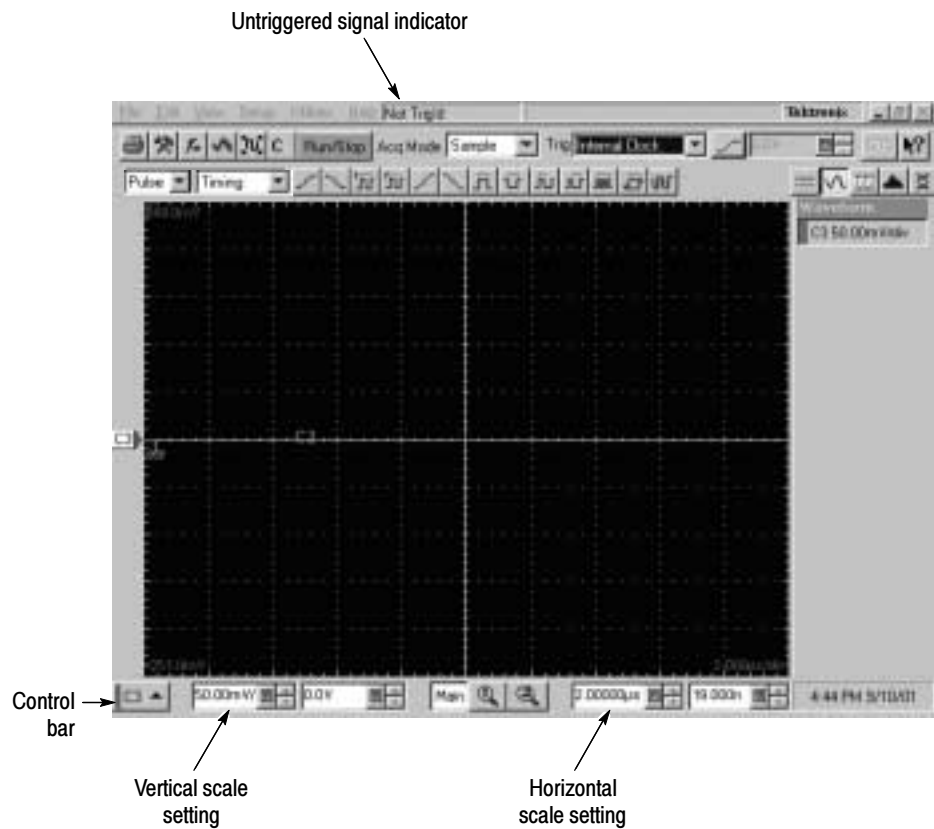


Figure 1-19: Signal not triggered (no signal)

11. *Verify that the Gated Trigger function is enabled:* Disconnect 50 Ω terminator cap from the end of the cable. Verify signal is triggered (gate enabled) with waveform on-screen. See Figure 1-20 on page 1-41.

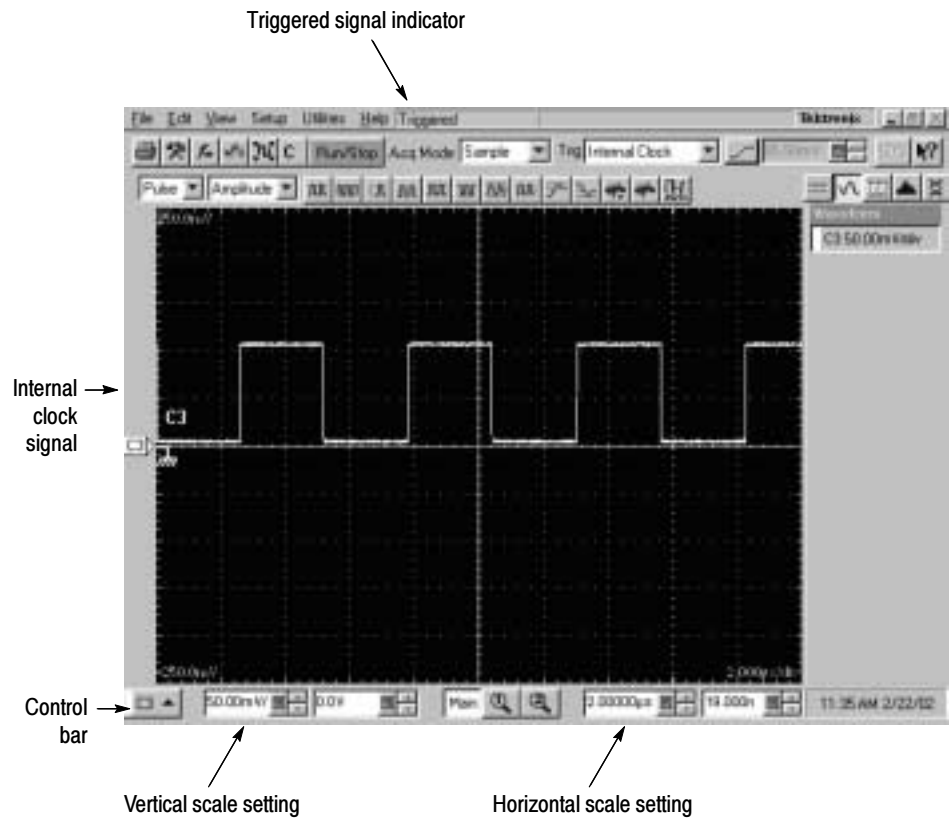


Figure 1-20: Signal triggered

12. Disconnect the test hook up.

End of Functional Test Procedures

Perform the Hardware and Operating System Tests

These procedures verify the instrument hardware functions. A diagnostics program called QAPlus/Win is used to make the verifications. No equipment is required.

QA+Win32

QA+Win32 is a comprehensive software application used to check and verify the operation of the PC hardware in the portable mainframe. This procedure uses QA+Win32 to verify the instrument hardware. To run QA+Win32, you must have either a working keyboard or a working mouse or other pointing device and have Windows 98 running.



CAUTION. Before running the QA+Win32 tests, be aware of the following problems and work-arounds.

- The QA+Win32 discrete memory test fails if the system being tested contains more than 16 megabytes of RAM.

Since your product ships with more than 16 megabytes of RAM, please follow the procedure for *Checking the Hardware and Operating System* on page 1-43.

NOTE. Do not run the memory test from the Memory icon.

- The QA+Win32 hard drive test may report an incorrect number of tracks and cylinders for your hard drive.

This is an internal mapping problem, but has no effect on the results of the test. Bad sectors on your hard drive are still found and marked.

- The QA+Win32 keyboard test does not respond correctly to keys used by Windows 98.

Keyboards made for use with Windows contain two or three keys specific to that operating system. These are usually located on either side of the space bar. QA+Win32 does not trap these keys when performing the keyboard test. Do not press them.

Checking the Cooling Fan Operation

Power on the instrument and visually inspect the left side panel of the instrument to verify that all six cooling fans are rotating.

Equipment required	None
Prerequisites	The instrument must be powered on and running.

Checking the Hardware and Operating System

To perform a minimal check of the hardware and Windows 98 operating system of this instrument, perform this procedure to run QA+Win32 diagnostics from the Windows 98 Start menu.

Equipment required	None
Prerequisites	A mouse and keyboard must be connected to the instrument and it must be powered on.

1. Push the **RUN/STOP** front-panel button to stop acquisition.
2. Use CTRL-ALT-DEL to close the TDS/CSA8000 application.
3. Click **Start**, then select **Programs**, and then **Sykes Diagnostics** in the Start Menu. Finally, click **QA+Win32**.

NOTE. *You may experience a delay before the program starts.*

4. Click **Tools** on the menu bar, then click **Customize Test...**
5. Click **Default** and exit this dialog by clicking **OK**.
6. Select and execute the following tests individually by clicking on the test buttons (see the illustration on page 1-44) one at a time (see note) and clicking **Start**:
 - a. COM Ports
 - b. LPT Ports
 - c. System Board
 - d. System Info
 - e. USB
 - f. Video

NOTE. A test button is not highlighted until you select it. As you select the button for each test (tool tip appears when you point to the button), a highlight box appears around the button. When you click Start, the button blinks until the test is complete and the highlight box changes color to indicate the test is complete.



Follow any instructions appearing on the screen.

7. Check test results in scrollable results listing in the Test Results window of the QAPLUS test window. All tests should pass.
8. Close the QA+Win32 diagnostics by selecting **Exit** in the File menu or click the Control Box (X) in upper right corner.
9. You can restart the **TDS/CSA8000** product software application by clicking **Start**, then selecting **Restart** from the Shutdown Windows dialog box.

End of Procedure

Accessories and Options

This section lists the standard and optional accessories available for the instrument, as well as the product options.

Accessories

Standard Table 1-3 lists the standard accessories that ship with the instrument.

NOTE. Table 1-3 lists only the standard accessories that ship with the instrument, not those shipped with any electrical or optical sampling modules ordered. Each sampling module ships individually in its own package. Consult the User manual found in the shipping package for any module you ordered:

071-0434-XX - 80E00 Electrical Sampling Modules User Manual

071-0435-XX - 80C00 Series Optical Sampling Modules User Manual

Table 1-3: Standard accessories

Item	Part number
■ Certificate of Traceable Calibration for product at initial shipment	Not orderable
■ Business reply card	Not orderable
■ 1 Windows-98 compatible keyboard	119-6297-00
■ 1 Windows-98 compatible mouse	119-6298-00
■ 1 Instrument front cover	200-4519-00
■ 1 Accessory pouch	016-1441-00
■ 2 Touchscreen styluses	119-6107-00
■ 1 ESD wrist strap with 6 foot coiled cord	006-3415-04
■ CSA8000 & TDS8000 Online Help (part of application software)	Not orderable
■ CSA8000B & TDS8000B User Manual	071-1099-01
■ CSA8000 & TDS8000 Reference	071-1096-00
■ CSA8000 & TDS8000 Programmer Online Guide (part of application software)	Not orderable
■ Oscilloscope Analysis and Connectivity Made Easy (manual and CD with connectivity examples)	020-2449-00

Table 1-3: Standard accessories (cont.)

Item	Part number
■ CSA8000 & TDS8000 Series OS Rebuild CDs (includes 2-disk set with a certificate of authenticity for software)	020-2436-XX
■ CSA8000 & TDS8000 Series Software Kit (includes Product Software CD and booklet, Read This First, and Release Notes)	020-2370-XX
■ 8000 Series Demo Applications Software CD	020-2480-XX
■ Power cord	Order by option number

Optional

The following accessories are orderable for use with the instrument at the time this manual was originally published. Consult a current Tektronix catalog for additions, changes, and details.

Table 1-4: Optional accessories

Item	Part number
■ SIU-800 Static Isolation Unit	SIU-800
■ Sampling Module Extender (1 meter)	012-1568-00
■ Sampling Module Extender (2 meter)	012-1569-00
■ 3.5 Male to 3.5 Female SMA	015-0552-00
■ Slip-on SMA connector	015-0553-00
■ 2X Attenuator (SMA Male-to-Female)	015-1001-00
■ 5X Attenuator (SMA Male-to-Female)	015-1002-00
■ 10X Attenuator (SMA Male-to-Female)	015-1003-00
■ Power Divider	015-1014-00
■ BNC Female 75 Ω to 50 Ω Type N Minimum Loss Attenuator	131-0112-00
■ P6209 4 GHz Active FET Probe	P6209
■ P6150 9 GHz Passive Probe	P6150
■ Replacement hard disk drive	119-6241-00
■ CSA8000B & TDS8000B Service Manual	071-0438-XX
■ Calibration Step Generator	067-1338-00

Options

The following options can be ordered for the instrument:

- Option 1K: Cart
- Option 1R: Rack Mount Kit (includes hardware and instructions for converting to rackmount configuration)
- Option GT: Gated Trigger option.
- International Power Cords Options:
 - Option A1 - Universal Euro 220 V, 50 Hz
 - Option A2 - UK 240 V, 50 Hz
 - Option A3 - Australian 240 V, 50 Hz
 - Option A5 - Switzerland 220 V, 50 Hz
 - Option AC - China 220 V, 50 Hz
 - Option A99 - No power cord shipped
- Service offerings:
 - Option C3: Three years of calibration services
 - Option C5: Five years of calibration services
 - Option D1: Calibration data report
 - Option D3: Test Data for calibration services in Option C3
 - Option D5: Test Data for calibration services in Option C5
 - Option R3: Repair warranty extended to cover three years
 - Option R5: Repair warranty extended to cover five years

Operational Maps

This chapter acquaints you with how the instrument functions and operates. It consists of several maps that describe the system, its operation, and its documentation:


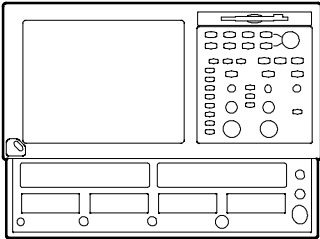
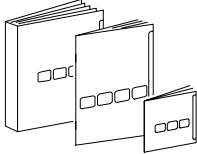
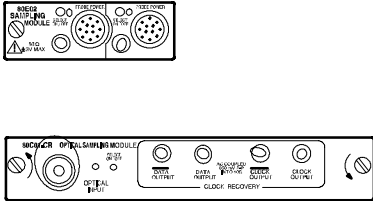
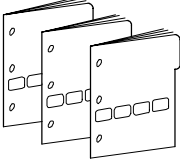
- *Documentation Map*, on page 2-2, lists the documentation that supports the instrument.
- *System Overview Maps* on page 2-4, describe the high-level operating blocks and operating cycle of the instrument.
- *User-Interface Map*, on page 2-7, describes the elements of the User Interface (UI) application, which provides complete control of the instrument.
- *Front-Panel Map*, on page 2-8, describes the elements, such as control buttons, of the instrument front panel and cross references information relevant to each element.
- *Display Maps*, on pages 2-9 and 2-10, describe elements and operation of single-graticule and multiple-graticule displays.
- *I/O Maps*, on pages 2-11 and 2-12, describe front and rear input/output ports and peripherals on the front and rear panels.

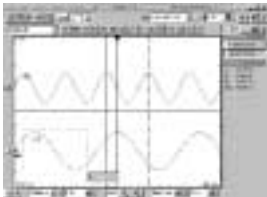



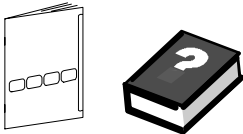
Tutorial procedures are available online, as part of the online help. To display, select the *Setup Procedures* from the UI application Help menu.

For information on configuring and installing your instrument, refer to Chapter 1, *Getting Started*.

Documentation Map

This instrument ships with documents individually tailored to address different aspects or parts of the product features and interface. The table below cross references each document to the instrument features and interfaces it supports.

To read about...	Refer to these documents:	Description
Standard accessories or packing list	Graphical packing list 	<p>The graphical packing list is one of the items you should find when you open the instrument box. It shows all items as they are packaged in the box.</p> <p>Additionally, all standard accessories are listed on page 1-45 of this manual.</p>
Installation, Specification, & Operation (overviews) 	Main User Manual Reference Manual CD booklets 	<p>Read the <i>Reference</i> for a quick overview of instrument features and their usage.</p> <p>Read the <i>User Manual</i> for general information about your instrument — procedures on how to put it into service, specifications of its performance, maps of its user interface controls, overviews and background on its features.</p> <p>Specific installation information for both the operating system (OS) and product software is located in each of the CD booklets accompanying the CDs.</p> <p>For more detailed usage information, see <i>Online Help System</i>, below.</p>
All about Sampling Modules 	Electrical, Optical, or Other Modules User Manual 	<p>Read these manuals for complete information about the sampling modules you purchased — how to install them in the instrument, how to use them, and how to protect them from ESD.</p> <p>Depending on the modules ordered, one or more of these manuals ship with this product. Insert these manuals in back of the manual that you are reading now.</p> <p>The user manual for the 80A01 Trigger Prescale Limiting Preamp Module is included as a standard accessory if you ordered this module. It is shipped in the module package, not the main instrument package.</p>

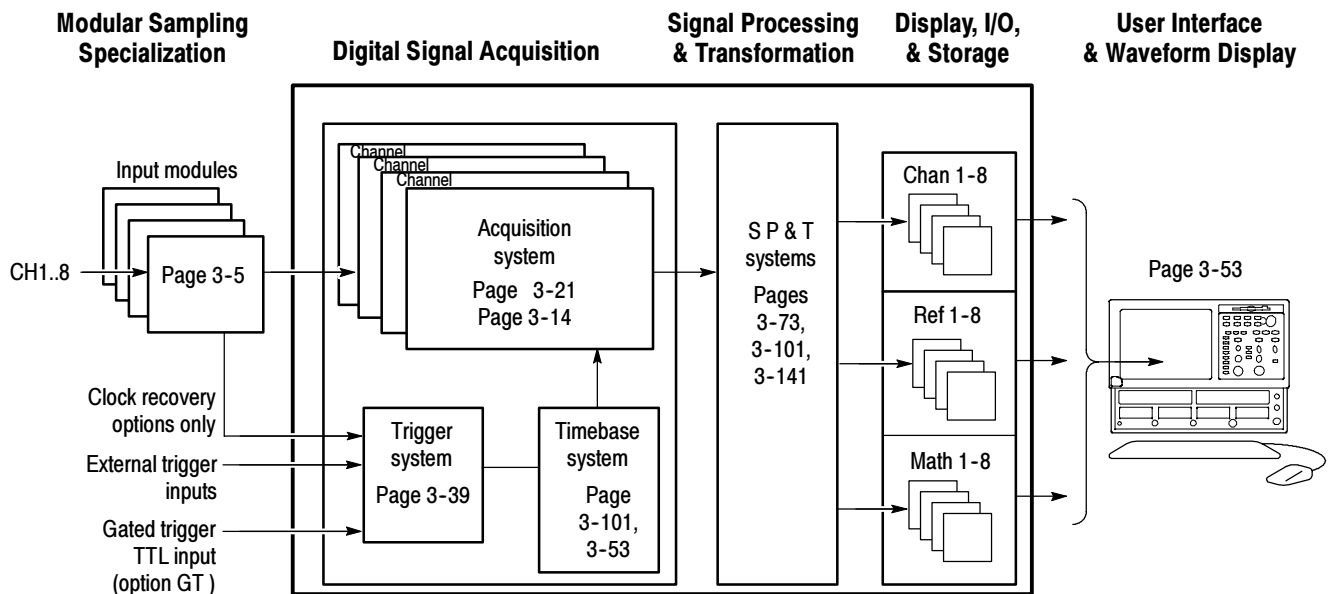
To read about...	Refer to these documents:	Description
In Depth Operation and UI Help 	Online Help System 	<p>Access online help from the instrument for context-sensitive information on virtually all controls and elements on screen.</p> <p>Online help includes a setup guide of procedures for applying all instrument functions. See <i>Accessing Online Help</i> on page 3-167.</p>
 GPIB Commands 	Online Programmers Guide 	<p>Access this online guide from the instrument from its Help menu. Quickly find the syntax for any command, and copy the command if desired. Read about communication, error handling, and other information on GPIB usage.</p> <p>Information about other products is available on the Tektronix website. See <i>Contacting Tektronix</i> for information on how to access our website.</p>
Analysis and Connectivity Tools	Oscilloscope Analysis and Connectivity Made Easy TekVISA Programming VXIplug&play Driver Help TekVISA Excel Toolbar Help 	<p>These documents help you use various connectivity and analysis tools that you can install. See <i>Analysis and Connectivity Support</i> in the instrument online help (described above) for more information. Note that earlier instrument models (TDS8000 and CSA8000) did not ship with these tools.</p>

You may also want to obtain the optional service manual for this product if you carry out self-service or performance test this instrument. See *Optional Accessories* on page 1-46.

System Overview Maps

The instrument and its sampling modules comprise a highly capable waveform acquisition, test, and measurement system. The following model provides background information on its operation, which, in turn, may provide you insight on how the instrument can be used.

Functional Model Map



The model comprises five high-level subsystems or processes (embodying a variety of hardware and software functions):

- Modular Sampling Specialization System.** Allows you to choose modules to begin tailoring your waveform acquisition based on the types of signals you want to acquire: electrical or optical; with clock recovery or without, with bandwidth filter or not. Provides cost-effective solution for users needing very high bandwidth with superb time resolution on repetitive waveforms. Sampling modules determine the size of the vertical acquisition window for each channel.

- **Digital Signal Acquisition System.** Acquires a waveform record from each signal you apply to each channel using the following subsystems:
 - **Acquisition System.** Sets vertical offset for the vertical acquisition window for each channel. Performs the actual A/D conversion and storing of digitized samples. Also performs post A/D sample-based corrections to compensate for non-linearities of various analog circuits.
 - **Trigger System.** Recognizes a specific event of interest on the input trigger signal and informs the Timebase of the trigger event's occurrence, gating the taking of a sample after a controlled, incremental delay (see page 3-17). The trigger event is defined as time zero for the waveform record, which means that all samples are displayed relative to this point.

There is no internal trigger pick off from the channels; rather, a trigger signal must be obtained through the external trigger inputs, from the system clock, or from the clock recovery when available from optical modules equipped with clock recovery.

For those CSA8000B and TDS8000B instruments equipped with the Gated Trigger option (Option GT), the system allows triggering to be enabled and disabled (gated) based on a TTL signal at a rear-panel input. See the *To Use Gated Trigger* section on page 3-51 for more information.

- **Timebase System.** Tells the Acquisition system to take a sample (i.e. convert from analog to digital) at some specific time relative to the trigger (or clock) event. In more general terms, synchronizes the capturing of digital samples in the Acquisition system to the trigger events generated from the Trigger system.
- **Signal Processing Transformation System.** Performs a variety of transformations or operations, beginning with the most fundamental data elements in the system, the channel waveforms. Waveform math operations, automatic measurements, and histogram generation are examples.
- **Display, Input/Output, Storage Systems.** Provides display control. Sets the vertical scale and position of the display, which controls how much of the vertical acquisition window appears on screen. Provides output (and sometimes input) of instrument-data elements in a form suitable to the user.

The process overview that follows describes each step in the top-level cycle of instrument operation.

Process Overview Map

Process overview	Process block description
<pre> graph TD Start(()) --> Idling[Idling...] Idling --> Setup[Implement setup] Setup --> WaitTrigger[Wait for trigger/accept trigger] WaitTrigger --> WaitDelay[Wait Delay time] WaitDelay --> TakeSample[Take 1 sample per active channel] TakeSample --> WaveformComplete{Waveform record complete?} WaveformComplete -- No --> AddInterval[Add one sample interval to Delay time] AddInterval --> WaitDelay WaveformComplete -- Yes --> WaveformAvailable[Waveform available] WaveformAvailable --> StopCondition{Stop condition?} StopCondition -- Yes --> Idling StopCondition -- No --> WaitTrigger </pre>	<ol style="list-style-type: none"> 1. The instrument starts in the idle state; it enters this state upon power up, upon receiving most control setting changes, or upon finishing acquisition tasks. 2. When you toggle its RUN/STOP control to RUN, the instrument implements its setup based on the current control settings (upon start up, these are default or last setup depending on user-set preferences). 3. The instrument then begins waiting for a trigger. No sampling takes place until triggering criteria are met or a free-run trigger is forced (Auto-trigger mode only). The instrument accepts trigger. 4. The instrument then waits a delay time, that is, it delays taking a sample until a specified time elapses, where: $\text{Delay time} = \text{Horizontal Pos.} + \text{Ch. Deskew} + N \text{ sample intervals}$ In the above calculation, $N = \text{Current sample count} - 1$ For example, if taking the 6th sample in the waveform record, 5 sample intervals are added. 5. The instrument takes one sample for each waveform record (channel) for each active (on) timebase. This instrument sequentially samples: one sample is taken per trigger for each active channel in each displayed timebase. 6. If averaging or enveloping is on, each record becomes part of a multi-acquisition record that these modes produce (see page 3-22). The process loops back to step 3 above to acquire additional records until the number of acquisitions required for the acquisition mode currently set are processed, and then processing continues as for step 8 below. 7. If FrameScan mode is on, the acquisition process is modified. See <i>FrameScan Acquisitions</i> on page 3-30 for information on how FrameScan works. 8. At this point the acquisition record is in channel acquisition memory and is available to the instrument for measurement of its parameters, display, output, and so on. The instrument then checks for user-specified stop condition and either returns to its idle state or continues at step 3, according to what it finds.
<p>¹ Note: if acquiring when powered down, the oscilloscope may skip the idle state and resume acquisition starting with step 3.</p>	

User Interface Map - Complete Control and Display

Menu Bar: Access to data I/O, printing, online help system, and set-up functions

Tool Bar: Handy access to key features, including the setup dialogs, acquisition modes, triggering modes, and online help

Measurements Bar: Quick access to automated measurements by signal type and category; click measurement buttons to measure the selected waveform

Display: Live, reference, and math waveforms display here, along with cursors, masks, etc. to analyze them

Waveform Bar: Access to waveform selection (click), waveform position (drag), and waveform properties (right-click)

Controls Bar: Quick access to waveforms and timebases for display, and to their scale, offset, and position controls for adjustment

Status Bar: Trigger status and waveform count

Readout Bar: Toggle individual readouts on and off by clicking its button

A Readout: Right click any readout to display a short-cut menu providing handy access to often-used setup controls and properties for the feature associated with the readout

Readouts: Display up to five readouts in this area, selectable from the Readout Bar

Front Panel Map - Quick Access to Most Often Used Features

Turn knob to adjust most control fields in setup dialogs. Press the Select button to switch among fields. Press the Fine button to toggle between normal and fine adjustment.

Press to start and stop acquisition or clear all channel waveforms at once. Page 3-26.

Press a Menu button to quickly access the setup dialog for its control group for more detailed set up.

Press to display measurement cursors and set the knob and Fine (adjust) and Select buttons to control them. Page 3-89.

Press to quickly return to instrument-default control settings. Page 3-13.

Press to automatically set up the instrument controls based on selected channels. Page 3-11.

Press to access print dialog for printing the display. Page 3-131.

Press to display the cluster of Setup Dialogs for comprehensive set up of the instrument.

Press to toggle the touch screen on and off. Use the touch screen to control UI when you haven't installed a mouse. Page 3-60.

Select a waveform type, Channel, Reference, or Math, to display or adjust on screen (selected button lights). Page 3-62.

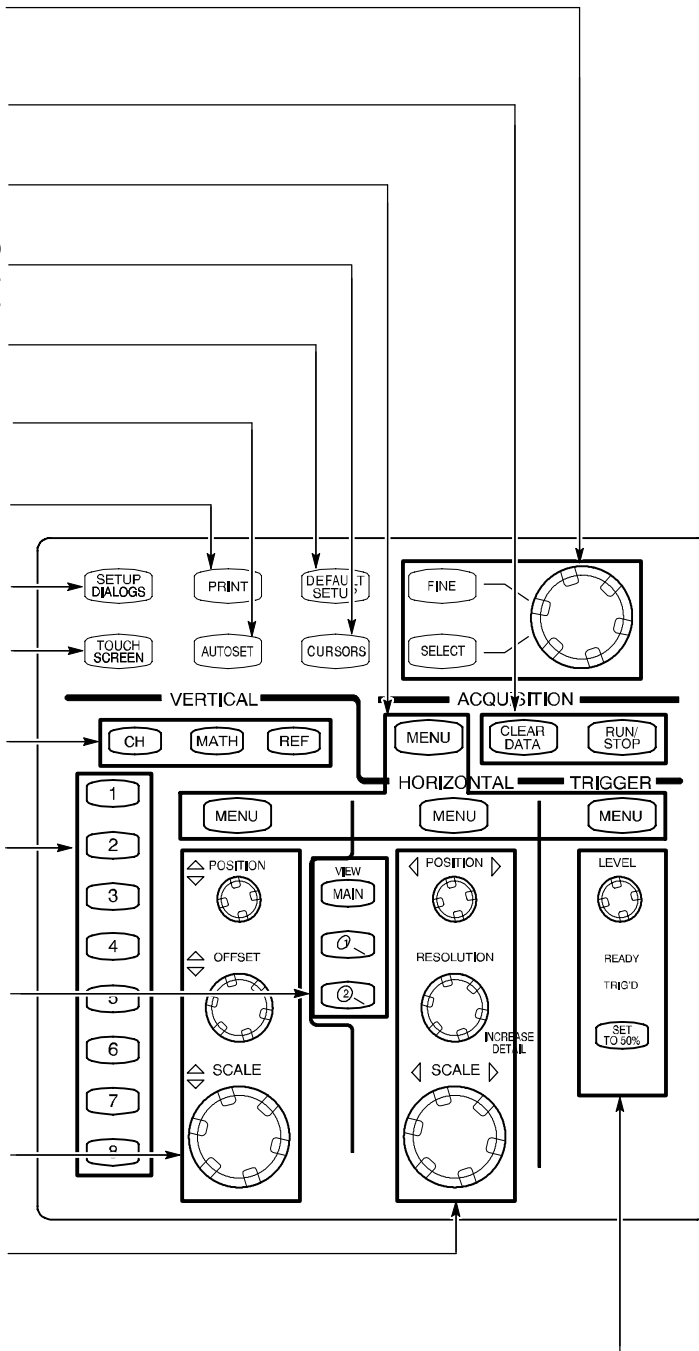
Press to display and select a waveform not yet displayed; press to select among displayed waveforms; press again to turn a selected waveform off. Button lights indicate displayed and selected waveforms. Page 3-62.

Press to display and select a time base view not selected, or to select among displayed views; press selected timebase again to toggle it off (except Main which is always on). Page 3-64.

Turn knobs to vertically scale, position, and offset selected waveform. Page 3-8.

Turn knobs to Horizontally scale, position, and set record length of selected waveform. Page 3-10.

Use controls to set trigger level and lights to monitor trigger state. Page 3-48.



Display Map - Single Graticule View

Drag cursors to measure waveforms on screen.

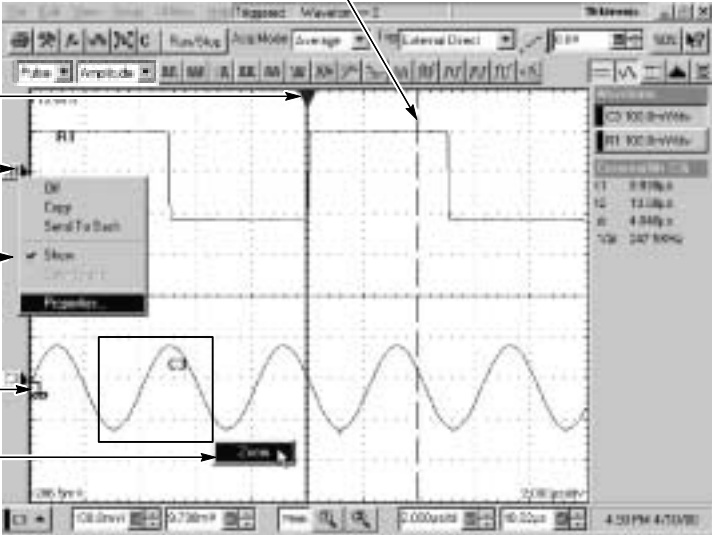
Drag the Horizontal Reference to move the point around which horizontal scaling expands and contracts the waveforms.

Drag the Waveform Icon vertically to position waveform.

Right click on a waveform or its icon for handy access to often used setup controls and properties.

Drag ground reference icon to add offset to a waveform.

Drag across the waveform area to zoom the boxed waveform segment to full screen width.

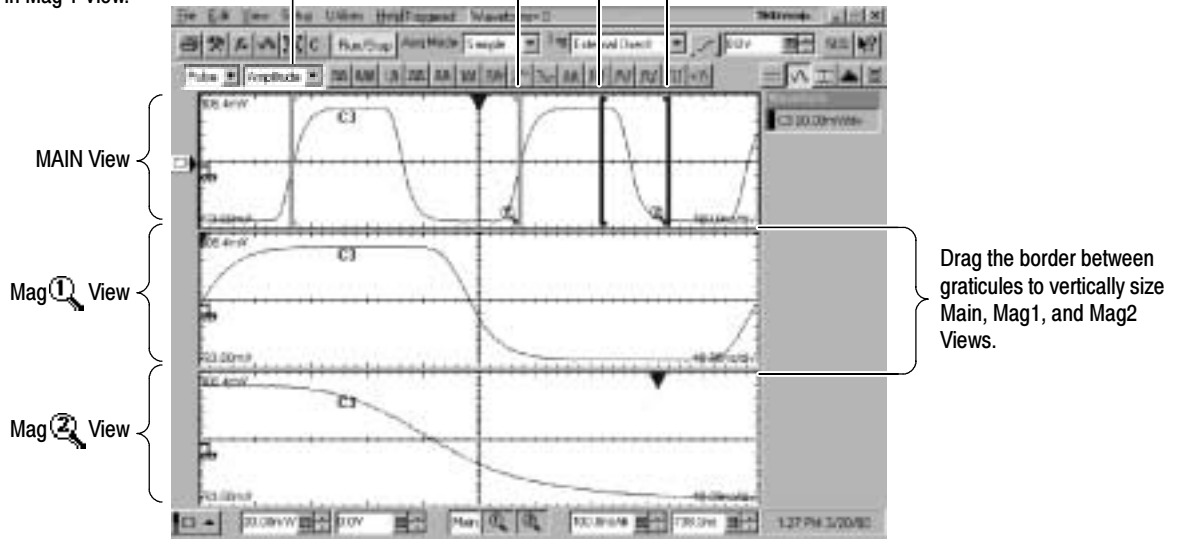


The screenshot shows a software interface for displaying waveforms. At the top, there is a menu bar with options like 'Triggered', 'Waveform 2', and 'Waveform 1'. Below the menu bar is a toolbar with various icons for waveform manipulation. The main display area shows two waveforms: a square wave at the top and a sine wave at the bottom. A vertical cursor is positioned on the square wave, and a horizontal reference line is drawn across the waveforms. A context menu is open over the sine wave, showing options like 'Off', 'Copy', 'Send To Bus', 'Show', and 'Properties...'. A small box highlights a segment of the sine wave, and a zoomed-in view of that segment is shown below it. The bottom of the screen shows a status bar with various indicators and the time '4:50 PM 4/10/00'.

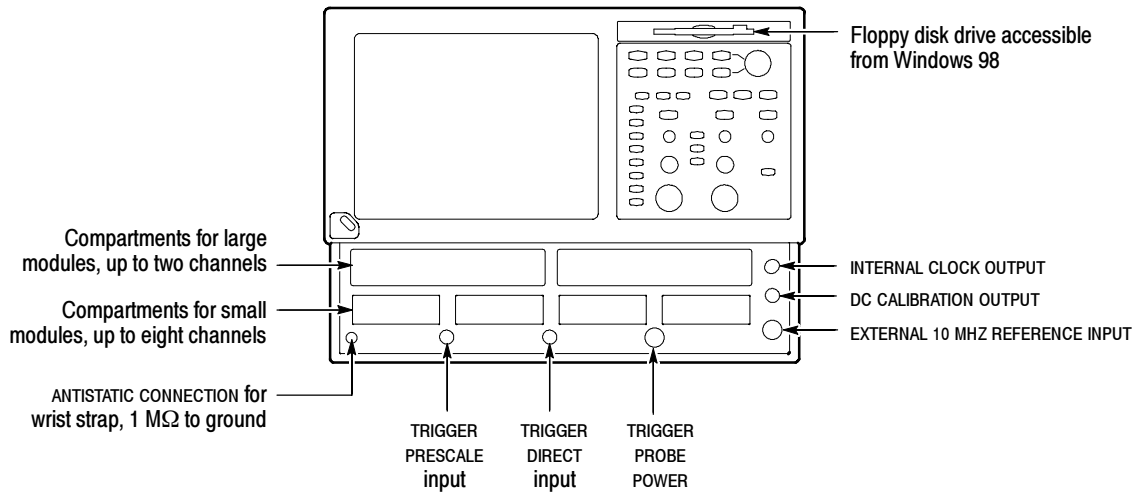
Display Map - Multiple Views

Drag the markers to enclose the portion of waveform to appear in Mag 2 View.

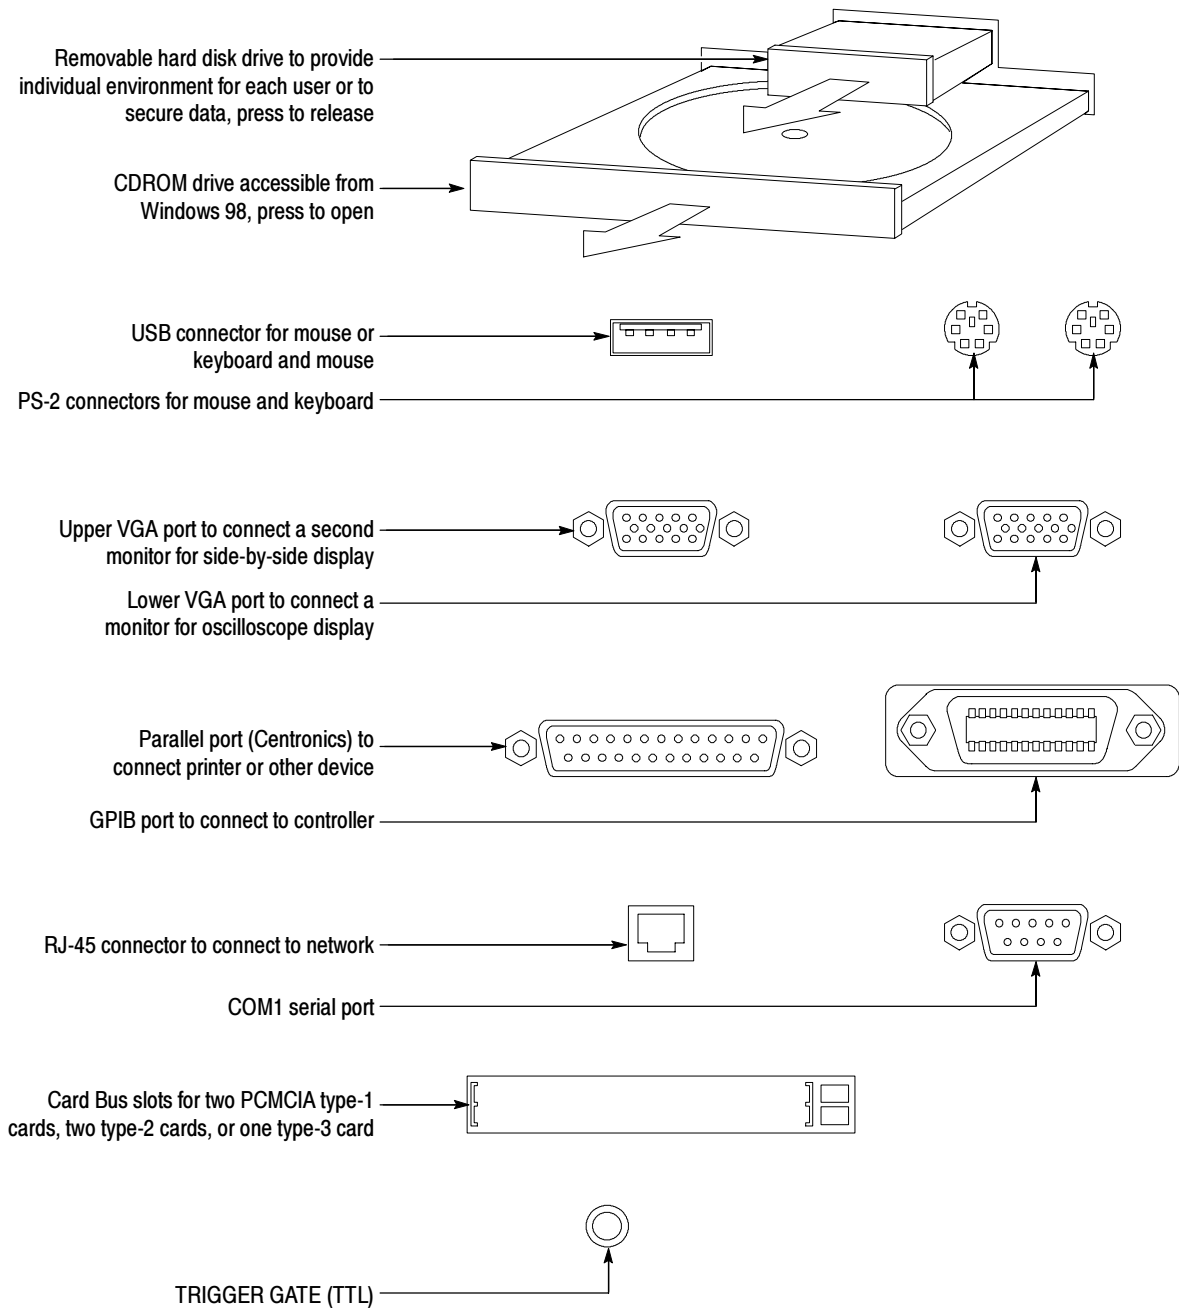
Drag the markers to enclose the portion of waveform to appear in Mag 1 View.



Front Panel I/O Map



Rear Panel I/O Map



Overview

This chapter describes how the many features of the instrument operate. Please note the following points on using this chapter:

- Each section in this chapter provides background information needed to operate the instrument effectively as well as the higher-level procedures for accessing and using the features. These procedures emphasize using the front panel when possible.
- Lower-level, detailed usage procedures are in the online help system.

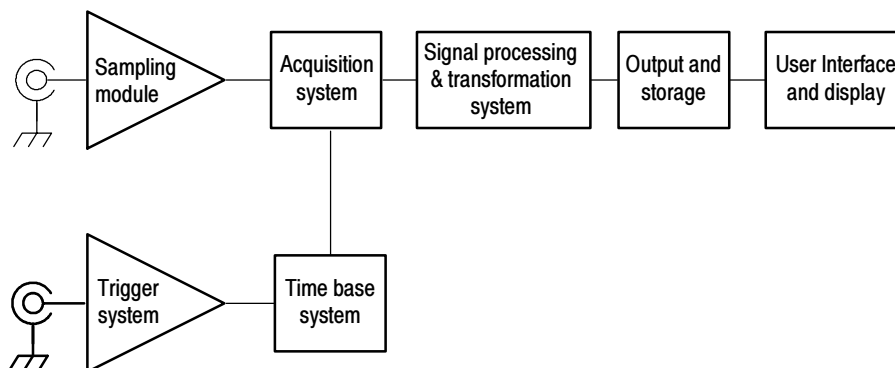
The table that follows lists the sections in this chapter.

Section	Description	Page no.
<i>Acquiring Waveforms</i>	Provides an overview of capturing signals and digitizing them into waveforms	3-3
<i>Triggering</i>	Provides an overview of the instrument trigger features and their use	3-39
<i>Displaying Waveforms</i>	Provides an overview of display operation	3-53
<i>Measuring Waveforms</i>	Provides an overview of the the cursors and automatic measurements tools this instrument provides and how to use them	3-73
<i>Creating Math Waveforms</i>	Provides an overview of how you can mathematically combine acquired waveforms and measurement scalars to create a math waveform that supports your data-analysis task	3-101
<i>Data Input and Output</i>	Provides an overview of the input and output capabilities of your instrument	3-113
<i>Using Masks, Histograms, and Waveform Databases</i>	Provides an overview of the statistical tools this instrument provides and how to use them: mask testing, histograms, and waveform databases	3-141
<i>Accessing Online Help</i>	Provides an overview of the help system, which is integrated as part of the instrument user interface, and describes how to access it	3-167
<i>Cleaning the Instrument</i>	Provides instructions on how to clean the exterior of the instrument and its touch screen	3-175

Acquiring Waveforms

Before you can display, measure, or analyze a waveform, you must acquire it from a signal. This instrument comes equipped with the features you need for capturing your waveforms. The following topics provide an overview of capturing signals and digitizing them into waveform records:

- *Signal Connection and Scaling*: How to connect signals to the instrument channels; how to offset channels and position and scale the time bases for acquiring waveforms; how to scale and position waveforms in the display.
- *Setting Acquisition Controls*: How to choose the appropriate acquisition mode for acquiring your waveforms; how to start and stop acquisition.
- *Acquisition Control Background*: Information describing the data-sampling and acquisition processes.
- *FrameScan Acquisitions*: How to use FrameScan acquisition to help analyze pattern-dependent failures in high bit-rate communications signals.



NOTE. This section describes how the vertical and horizontal controls define the acquisition of live, channel waveforms. These controls also define how all waveforms are displayed, both live and derived waveforms (math and reference waveforms). The following sections cover display-related usage:

- Displaying Waveforms on page 3-53.
 - Creating Math Waveforms on page 3-101.
-

Signal Connection and Scaling

This section presents an overview of the instrument features related to setting up the input signal for digitizing and acquisition. It addresses the following topics:

- Where to find information for installing sampling modules and connecting input signals
- How to turn on channels and adjust their vertical scale, position, and offset
- How to set the horizontal scale, position, and record length of the Main (time base) View

NOTE. *Terminology:* This manual uses the terms vertical acquisition window and horizontal acquisition window. These terms refer to the vertical and horizontal range of the acquisition window, which defines the segment of the input signal that the acquisition system acquires. The terms do not refer to any windows or display windows on screen. See Conventions on page xii.

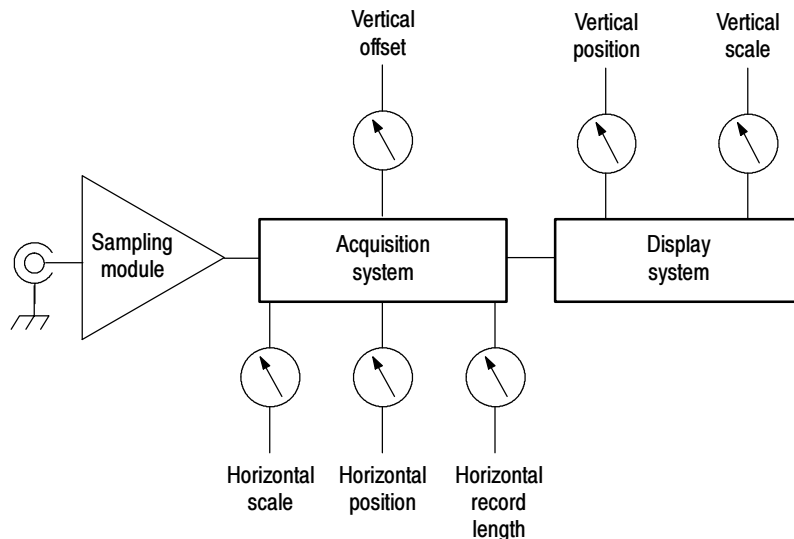


Figure 3-1: Acquisition and display controls

Why Use?

Use signal conditioning and scaling controls to ensure the instrument acquires the data that you want to display, measure, or otherwise process. To ensure the best possible data for further processing, you do the following:

- Set vertical scale to adjust the waveform size on screen. You can set vertical offset to shift the vertical acquisition window up or down on the signal to capture the portion you want.

- Set horizontal scale to control the time duration of the horizontal acquisition window to capture as much as you want of the input signal(s). To control where in the input signal (data stream) that the horizontal acquisition window acquires, you set horizontal position to delay the window relative to a trigger to capture the waveform portion you want. To increase or decrease the resolution between sample points, change the record length.

For more background on the acquisition window concepts, see *Signal Conditioning Background* on page 3-13.

What's Special?

A Versatile Autoset. Autoset can be defined to set up for a waveform edge, period, or an eye/bit pattern. Pushing the Autoset button automatically sets up the instrument controls for a usable display based on the property you choose and the characteristics of the input signal. Autoset is much faster and easier than a manual control-by-control setup. You can also reset the instrument to its factory default settings by pushing the Default Setup button.

What's Excluded?

The vertical offset cannot be adjusted for any reference waveform, because a reference waveform is a static, saved waveform, and offset adjusts the acquisition hardware for acquiring live waveforms. Also, TDR waveforms, if displayed in rho or ohm units, cannot be adjusted for vertical offset.

The vertical offset of a math waveform cannot be adjusted directly. You can adjust the offset of waveform sources (waveforms included in the math expression) for the math waveform if the sources are live waveforms.

Keys to Using

The key points that follow describe operating considerations for setting up input scaling, offset, and position to properly acquire your waveforms.

Sampling Modules Selection and Signal Connection. Select the sampling module, optical or electrical, that best fits your sampling task, whether it is connecting to a fiber or electrical cable to test a digital data stream, or to a test fixture through SMA cables to characterize a device. The connection to the sampling module depends on your application.

Tektronix provides 80E00-series (electrical) and 80C00-series (optical) sampling modules for this instrument; you can read about any sampling module and its connections in the sampling-module user manual(s) that shipped with your product. (Insert your sampling-module user manual(s) in Appendix C at the back of this manual for ready reference.) You can also check your Tektronix catalog for connection accessories that may support your application.

Up to eight acquisition channels are available, depending on the sampling modules installed. Each channel can be displayed as a waveform or can contribute waveform data to other waveforms (math and reference waveforms, for example).



CAUTION. *Install sampling modules before applying power and before connecting them to the signals you want to test. See your sampling-module user manual for instructions.*



CAUTION. *Sampling modules are inherently vulnerable to static damage. Always observe static-safe procedures and cautions as outlined in your sampling-module user manual.*

Coupling Concerns. Electrical sampling modules provide only straight-DC coupling to their sampling circuits, with no protection. All modules specify a maximum vertical nondestructive range that limits signals to small levels, typically about 2 to 3 volts (DC + AC_{pk-pk}). (See *Specifications* in the user manual for your sampling module for exact limits.) Do not exceed the limit, even momentarily, as the input channel may be damaged.

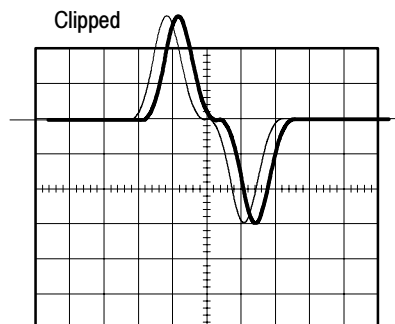
All modules also specify a dynamic range that, if exceeded, could cause acquisition and measurement errors due to nonlinearity. Do not exceed this limit. (See *Specifications* in the user manual for your sampling module for exact limits.)

NOTE. *Optical sampling modules may have dynamic range exceeded without obvious visual indications onscreen because the photo detector and/or filters used may not necessarily be able to pass through overloaded signals to the sampler.*

Use external attenuators if necessary to prevent exceeding the limits just described. Note that there are no hardware bandwidth filters in most sampling modules or in the instrument. (Some optical sampling modules have bandwidth filters settable from the Vertical Setup menu of the instrument. See the user manual for your optical sampling module for more information.)

Scaling, Offset, and Positioning Considerations. These key controls determine the portion of the input signal presented to the acquisition system:

- Set the vertical offset to display the features of interest on your waveform and avoid clipping. (See *Note* that follows.) Adjust the display control Vertical Scale to control the portion of the vertical window displayed on screen; adjust the display control Vertical Position to position the waveform on screen. Note that vertical offset affects the vertical acquisition window, but vertical scale and position do not. These last two controls are display controls only. *Vertical Acquisition Window Considerations* on page 3-14 describes the vertical acquisition window.



- Set horizontal scale, position, and resolution (record length) so that the acquired waveform record includes the signal attributes of interest with good sampling density on the waveform. The settings you make define the horizontal acquisition window, described in *Horizontal Acquisition Window Considerations* on page 3-17. (“Good sample density” might be at least five samples on each waveform transition when acquiring for timing measurements. The trade off for increased sample density is increased time to acquire.)

NOTE. *Waveform data outside the vertical acquisition window is clipped; that is, the data is limited to the minimum and/or maximum boundaries of the vertical acquisition window. This limiting can cause inaccuracies in amplitude-related measurements. See Vertical Acquisition Window Considerations on page 3-14.*

Trigger and Display. Set basic trigger controls to gate waveform acquisition, and use the display to interactively set scale, position, and offset waveforms. See the sections *Triggering* on page 3-39 and *Displaying Waveforms* on page 3-53.

Selected Waveform. Many of the controls of this instrument, especially the vertical controls, operate on the selected waveform. The instrument applies all actions that only affect one waveform at a time, such as applying a changes to the vertical control settings, to the selected waveform.

NOTE. *You can select a channel waveform, a math waveform, or a reference waveform. The procedures here describe how to select and set up channel waveforms for acquisition. See Displaying Waveforms on page 3-53 for information regarding using the controls for adjusting display of reference and math waveforms.*


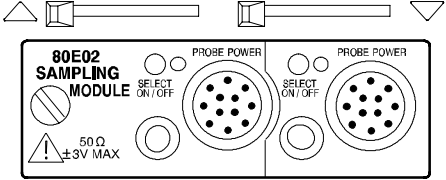
Flexible Control Access. The product provides multiple methods for adjusting acquisition controls. This manual focuses on basic setup through the front panel, and the use of the User Interface (UI) Application displayed full screen. See the display maps, beginning on page 2-9, for UI alternatives to controlling vertical and horizontal setup. The online help system also documents the UI.

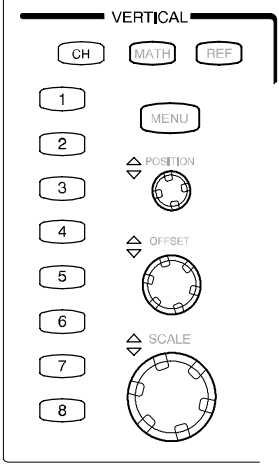
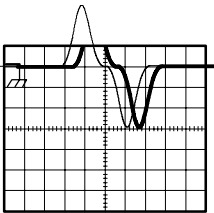
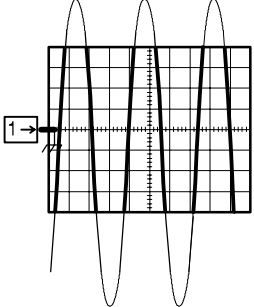
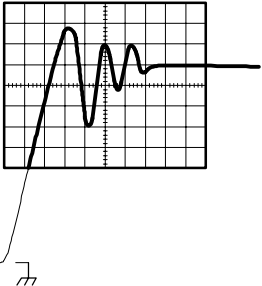
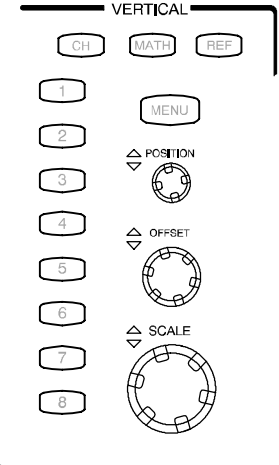
To Set Up the Signal Input

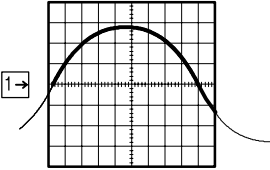
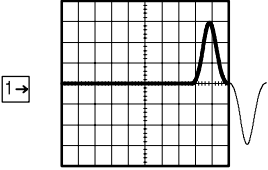
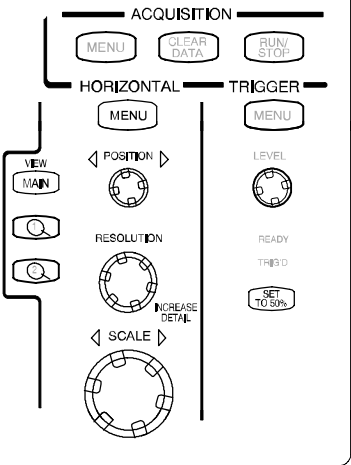


Use the procedure that follows when setting up the instrument to scale and position input signals for acquisition.



CAUTION. Sampling modules are inherently vulnerable to static damage. Always observe static-safe procedures and cautions as outlined in your sampling-module user manual.



Overview	To set the signal input	Related control elements and resources
<p>Prerequisites</p>	<p>1. The instrument must be installed with sampling modules in place. The acquisition system should be set to run continuously.</p> <p>Also, an appropriate trigger signal must be routed to the instrument and triggering must be set up.</p>	 <p>See the sampling-module user manuals for sampling module installation. See page 3-24 for acquisition setup and page 3-48 for trigger setup in this manual.</p>
<p>Connect the input signal</p>	<p>2. Connect to the signal to be acquired using proper probing/connecting techniques. See the user manual for the sampling module you have chosen.</p> <p>Note: For more details on controlling vertical setup, push the Vertical MENU button to display the Vertical Setup dialog box, and then click its HELP button.</p>	



Overview	To set the signal input (cont.)	Related control elements and resources
<p>Select the input signal channel</p>	<p>3. Push the channel button (turns amber) to assign the waveform buttons, 1 - 8, to operate on channel waveforms. Push a waveform button to select the signal channel (it displays).</p> <p>A waveform button lights when its channel is on:</p> <ul style="list-style-type: none"> ■ When on but not selected, its button is lighted green. ■ When on <i>and</i> selected, its button is lighted amber. <p>Hint. To select one of the channels already displayed, you can use a mouse and click its trace or its reference indicator to select it.</p>	
<p>Set the vertical acquisition window</p>	<p>4. Use the Vertical Offset knob to adjust the selected waveform on screen. Use the Vertical Scale and Position knobs to adjust the display.</p> <p>Positioned vertically</p>  <p>Scaled vertically</p>  <p>Offset vertically</p> 	

Overview	To set the signal input (cont.)	Related control elements and resources
<p>Set the horizontal acquisition window</p>	<p>5. Push the View Main button to make sure the main time base view is selected. Use horizontal knobs to scale and position the waveform on screen and to set sample resolution.</p> <div style="display: flex; justify-content: space-around; align-items: flex-start;"> <div style="text-align: center;"> <p>Scaled horizontally</p>  </div> <div style="text-align: center;"> <p>Positioned horizontally</p>  </div> </div> <p>The Resolution knob sets the record length. (See discussion on page 3-19.)</p> <p>Push Set to 50% if required to stabilize display.</p>	
<p>Continue with the acquisition setup</p>	<p>6. To finish the acquisition setup, you must set the acquisition mode and start the acquisition.</p>	 <p>See <i>To Set Up Acquisition Controls</i> on page 3-24.</p>
<p>For more help</p>	<p>7. For more information on the controls described in this procedure, push the Vertical or Horizontal MENU button. Click the HELP button in the setup dialog box that displays.</p>	

End of Procedure

To Autoset the Instrument With an input signal connected, use the procedure that follows to autoset based on the characteristics of the input signal. Autoset operates on the selected channel only.

Overview	To autoset	Control elements and resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. The instrument must be installed with sampling modules in place. Signals must be connected to channels. A triggering source must be provided. 2. At least one channel must be turned on (its front-panel button lighted). 	 <p>See the sampling-module user manuals for help with installing sampling modules. See page 3-48 in this manual for trigger setup information.</p>
<p>Execute</p>	<ol style="list-style-type: none"> 3. Push the Autoset button to to execute an autoset on the selected waveform. <p>If you use Autoset when one or more channels are displayed, the instrument uses the selected channel for horizontal scaling. Vertically, all channels in use are individually scaled.</p> <p>Note. Autoset can execute on live waveforms (either channel or math) in the Main time base.</p>	

Overview	To autaset (cont.)	Control elements and resources
<p>Define</p>	<p>4. Click Define Autaset in the Utilities menu to display the Autaset properties dialog box. To change the autaset criteria, select from:</p> <ul style="list-style-type: none"> ■ Edge to setup the default autaset for instrument to acquire the waveform data such that the center 20% of the record contains a rising edge. ■ Period to setup the default autaset for instrument to acquire the waveform data such that the record contains 2 or 3 periods. ■ NRZ Eye to setup the default autaset for instrument to acquire the waveform data as follows: <ul style="list-style-type: none"> ■ one bit (two eye crossings) is displayed over about 7.5 horizontal divisions, centered on the screen. ■ the high/low values are displayed over about 6 vertical divisions, also centered on screen. ■ RZ Eye Pattern to setup the default autaset for instrument to acquire the waveform data as follows: <ul style="list-style-type: none"> ■ three rise/fall edges are displayed over the center 6 horizontal divisions, with the first rising edge placed near the 20% horizontal location (second division). ■ amplitude (the high/low values) is displayed over the center 5 vertical divisions. <p>Click OK to set Autaset to use the current criteria. To execute, push the Autaset button.</p>	
<p>For More Information</p>	<p>5. For more information on the controls described in this procedure, push/click the HELP button in any dialog box or select Help Contents and Index in the Help menu.</p>	



End of Procedure

NOTE. Autoset sets the vertical position to zero and adjusts the vertical offset to center the signal in the display.

If a standard mask is active for the selected waveform, Autoset adjusts the selected waveform record to match the mask, if possible. Autoset adjusts the vertical scale and offset, horizontal scale, position, and reference parameters as required for the mask standard.

To Reset the Instrument

You may want to revert to the factory default setup; if so, use the following procedure to reset the instrument:

Overview	To reset to factory defaults	Control elements and resources
<p>Prerequisites</p>	<p>1. The instrument is powered on and running.</p>	 <p>See <i>Power On Instrument</i> on page 1-14.</p>
<p>Execute</p>	<p>2. Push the Default Setup button.</p>	

End of Procedure

Signal Conditioning Background

This section contains background information that can help you more effectively set up the acquisition window of each channel.

Input. This instrument samples sequentially, in order to provide superior bandwidth and time resolution. Sequential sampling systems sample the input without scaling it (they have a fixed dynamic range); therefore, input protection and dynamic range are necessarily limited.



CAUTION. Do not overdrive the inputs. Also observe static-safe procedures and cautions as outlined in the sampling-module user manual. Sampling modules are very sensitive to ESD.

Autoset Considerations. Autoset acquires samples from the input signal and attempts to take the following actions based on the input data:

- Evaluate the amplitude range of the input signals and offset of the vertical acquisition window to acquire the signal without clipping.
- Set the trigger level to the approximate midlevel of the trigger signal being applied (either an external trigger or a clock-recovery trigger).
- Evaluate the signal transitions and set the horizontal scale to produce a waveform display based on the Autoset mode selected: Edge, Period, or Bit/Eye Pattern.

Sometimes Autoset cannot produce a correct display due to the nature of the input signal; if so, you may have to adjust the scale, trigger, and acquisition controls manually. Some conditions that can cause Autoset to fail are:

- no signal present.
- signals with extreme or variable duty cycles.
- signals with multiple or unstable signal periods.
- signals with too low amplitude.
- no recognizable trigger signal.
- no eye diagram waveform present when autosetting in Bit/Eye Pattern autoset mode.

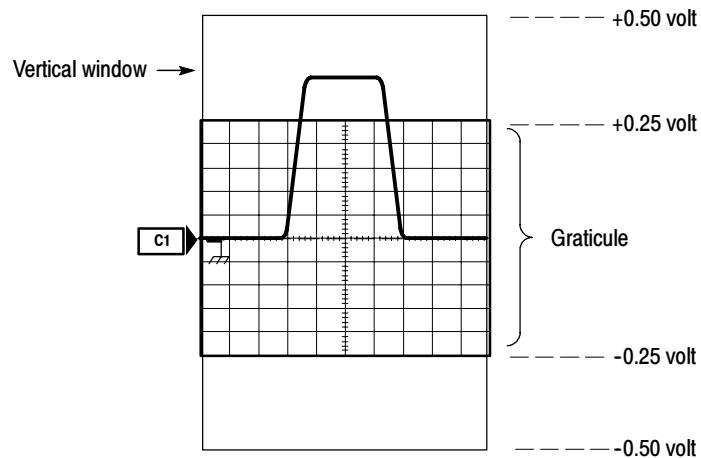
Vertical Acquisition Window Considerations. The size of the vertical acquisition window is determined by the operating range of the the sampling module and any probe connected to it. The vertical offset determines where the vertical window is positioned relative to ground. Parts of the signal amplitude that fall within the vertical window are acquired; parts outside (if any) are not (they are clipped).

As an example, consider that a basic 80E00-series sampling module, with a maximum 100 mV/div scale, covers 1 volt over 10 divisions. Changing the vertical scale setting only changes how much of the vertical window displays on screen; changing vertical position simply changes the space on the screen where the data is displayed.

You can set the vertical scale, position, and offset of each channel independently of other channels.

The vertical scale and position controls do not affect the vertical acquisition window, rather they adjust the display system to display the waveform as follows:

- The vertical scale (per division) setting determines the portion of the vertical acquisition window that appears in the graticule, allowing you to scale it to contain all of the window or only part. Figure 3-2 shows two vertical acquisition windows that contain the entire waveform, but only one window contains the entire waveform in the graticule on screen.
- a. Volts/Div setting determines the size of the display graticule within the vertical acquisition window (scale set to 50 mv/div.)



- b. Vertical position can change location of display graticule within ± 5 divisions (position set to -4 divisions)

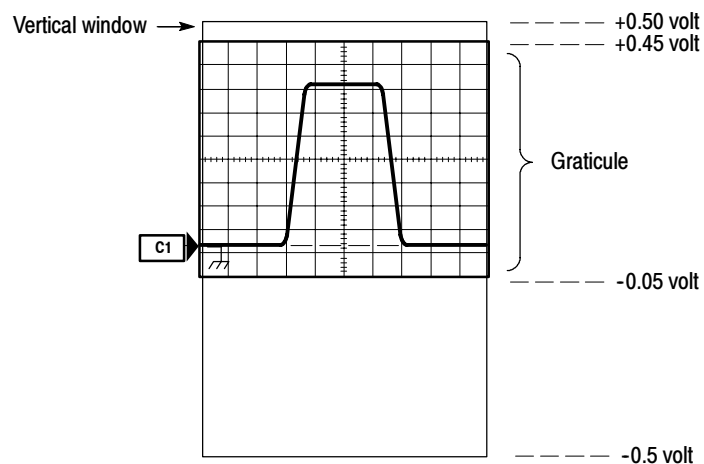


Figure 3-2: Setting vertical scale and position of input channels

NOTE. *Amplitude-related automatic measurements (for example, peak-to-peak and RMS) will be accurate for vertical windows like those shown in Figure 3-2 a and b on page 3-15 because neither waveform is clipped (that is, both waveforms are acquired). But if the signal amplitude were to extend outside the vertical acquisition window, the data acquired becomes clipped. Clipped data causes inaccurate results if used in amplitude-related automatic measurements. Clipping also causes inaccurate amplitude values in waveforms that are stored or exported for use in other programs.*

- The vertical position adjusts the display of the graticule relative to the vertical acquisition window (position is a display control). Figure 3-2 b shows how vertical position moves the waveform graticule vertically in the vertical acquisition window to place the acquired waveform in the graticule display. Position does not determine what data is acquired as does vertical offset.

The vertical offset control affects the vertical acquisition window and the displayed waveform as follows:

- The vertical range (window) is always centered around the offset value that is set. Vertical offset is the voltage level at middle of the vertical acquisition window. With no (zero) offset (see Figure 3-3), that voltage level is zero (ground).
- As you vary vertical offset, the middle voltage level moves relative to zero. This moves the vertical acquisition window up and down on the waveform. With input signals that are smaller than the window, it appears the waveform moves in the window. Actually, a larger signal shows what really happens: the offset moves the middle of the vertical acquisition window up and down on input signal. Figure 3-3 shows how offset moves the acquisition window to control the portion of the waveform amplitude the window captured.
- Applying a negative offset moves the vertical range down relative to the DC level of the input signal, moving the waveform up on the display. Likewise, applying a positive offset moves the vertical range up, moving the waveform down on the display. See Figure 3-3.

NOTE. *On screen, the channel icon in the waveform bar points to the offset value around which the vertical acquisition window is centered. The offset value pointed to is relative to the ground reference icon. Both icons are shown in Figure 3-3.*

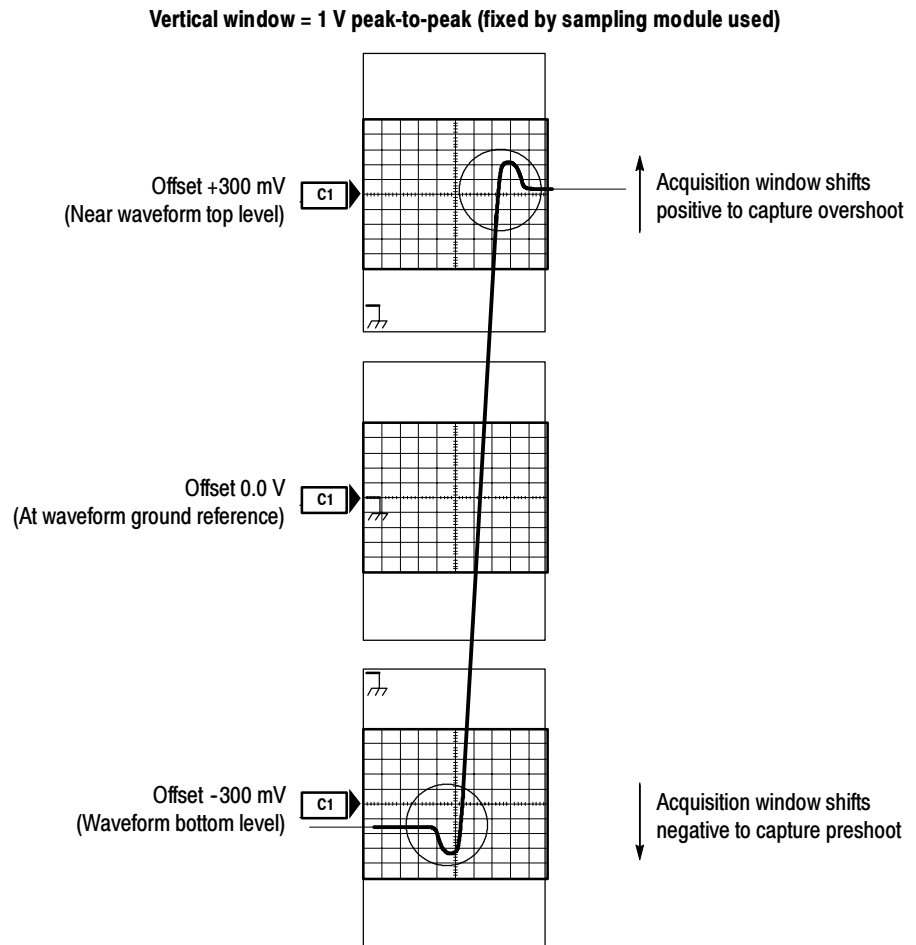


Figure 3-3: Varying offset positions vertical acquisition window on waveform amplitude

NOTE. Measurements use the entire portion of the waveform that the vertical window captures, not only the portion displayed on screen. Also, waveforms exported or saved (from the File menu or over the GPIB) contain data from the entire vertical window, not just the on-screen portion.

Horizontal Acquisition Window Considerations. You define the horizontal acquisition window, that is, you set several parameters that determine the segment of an incoming signal that becomes the waveform record when acquired. (For background, please read *Waveform Record* on page 3-28.) These common parameters specify a common horizontal acquisition window that is

applied to all channels in parallel. (See *Independent vs. Shared Window* on page 3-20.) These parameters are:

- The external trigger signal that you input and set the trigger system to recognize determines the point relative to the input waveform that triggers the instrument.
- The horizontal position you set determines the horizontal delay from the trigger point to the first sample point in the acquisition window.
- The horizontal scale you set, and the requirement that all waveforms fit within the 10 horizontal-division display, determines the horizontal duration of the window relative to any waveform, allowing you to scale it to contain a waveform edge, a cycle, or several cycles.

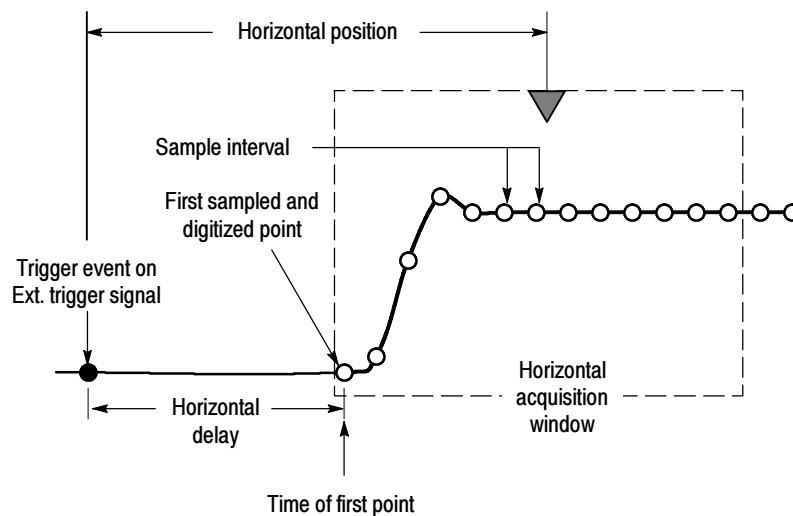


Figure 3-4: Horizontal acquisition window definition

- The record length (along with the horizontal scale) you set for the 10-division window determines the sample interval (horizontal point spacing or resolution) on the waveform.

NOTE. *The horizontal position controls the distance to the Horizontal Reference to indirectly set the time to the first sampled point. See Horizontal Position and the Horizontal Reference on page 3-59 for a discussion of this relationship.*

Horizontal Scale vs. Record Length vs. Sample Interval vs. Resolution. These parameters all relate to each other and specify the horizontal acquisition window. Because the horizontal acquisition window must fit in the 10 horizontal division display, for most cases, you just set the duration of the horizontal acquisition window (10 divs x the scale setting) as described in (1) below. By also setting a record length in samples, you indirectly set the resolution/sample interval/sample rate for the horizontal acquisition window (waveform record). The relationships between these horizontal elements follow:

1. $\text{Time Duration (seconds)} = 10 \text{ divs (window size)} \times \text{Horizontal Scale (sec/div)}$

2. $\text{Time Duration (seconds)} = \text{Sample Interval (seconds/sample)} \times \text{Record Length (samples)}$,

where:

Time Duration is the horizontal acquisition window time duration

3. $\text{Sample Interval (sec/sample)} = \text{Resolution (sec/sample)} = 1/\text{Sample Rate (samples/sec)}$

In (2) above, note that it is Sample Interval that varies indirectly to accommodate the window time duration (and its scale setting) and the Record Length setting as these later two elements can be set by you. These elements behave as follows:

- If Record Length or Time Duration vary, Sample Interval varies to accommodate, up to highest sample rate/lowest sample interval/highest resolution.
- If you set faster Horizontal Scale settings, decreasing Time Duration, and the Sample Interval reaches its lower limit, the horizontal scale becomes limited to a setting compatible with the record length and the lower limit of the sample interval.
- If you attempt to set longer Record Lengths and the Sample Interval reaches its lower limit, Time Duration remains constant and the record length becomes limited. The equation becomes:

$$\text{Maximum Record Length} = \text{Time Duration} \div \text{Min Sample Interval}$$

For example, at 1 ps/div and 10 divisions, the record length must be no more than 1000 points:

$$\text{Max Rec Length 1000 samples} = (10 \text{ divs} \times 1 \text{ ps/div}) \div 0.01 \text{ ps/sample}$$

$$\text{Max Rec Length} = 1000 \text{ samples}$$

NOTE. Resolution and the equivalent elements, sample interval and sample rate (see equation 3 above), are not settable directly, but are derived. You can, however, check the resolution at anytime in the resolution readout (push the Horizontal Menu button). Also note, that the Resolution knob actually adjusts the record length to increase sample density (detail).

Independent vs. Shared Window. For a given time base, the instrument applies the same horizontal acquisition window to all channels from which it acquires data. Unlike the vertical acquisition window that you set independently for each channel, the same time/division, resolution (record length), and horizontal delay (from the same trigger point) that you set for a time base, apply to all channels in that time base. In other words, one trigger, from a single trigger source, will locate a common horizontal acquisition window on all active channels, which you can shift by setting the horizontal position control.

The horizontal acquisition window determines the waveform records extracted from all signals present at all active channels and math waveforms. You can think of the horizontal acquisition window as cutting across any input signals present in the input channels to extract the same slice of time into waveform records. See Figure 3-5.

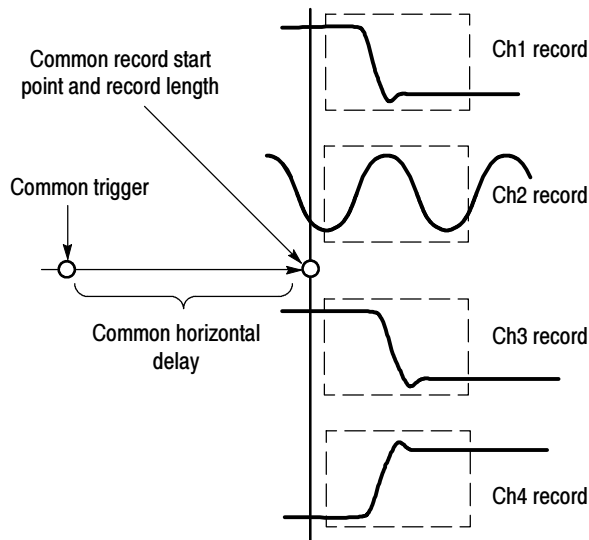
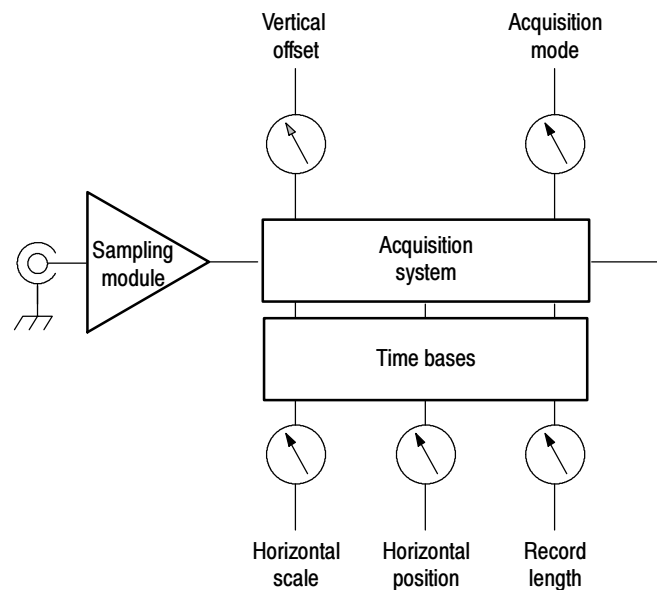


Figure 3-5: Common trigger, record length, and acquisition rate for all channels

Setting Acquisition Controls

This section overviews the instrument acquisition features—those that start and stop acquisitions and those that control how the instrument processes the data as it is acquired (just sampled, or averaged or enveloped). Special features, keys to using, and operation controls are covered.



Why Use?

Use the acquisition controls to optimize and tailor the acquisition of your waveforms. The mode controls described here operate on the data as the instrument acquires it—perhaps to reduce noise in the waveform record or to capture a record of min/max values for each data point in the waveform record. The acquisition controls also let you start and stop acquisition, as well as take certain actions after acquisition stops, such as to print the acquired waveform.

What's Special?

Stop After Options. You can set the condition upon which acquisition stops, such as after a number of acquisitions or a number of mask hits you specify. You can set the instrument to save waveforms or print the screen to a file or printer.

FrameScan Acquisition. You can alter the normal acquisition cycle to produce a waveform record suitable for acquiring and analyzing Pseudo-Random Bit Streams (PRBS's), which are contained within a repeating data frame. See *FrameScan Acquisitions* on page 3-30 for more information on using FrameScan acquisitions.

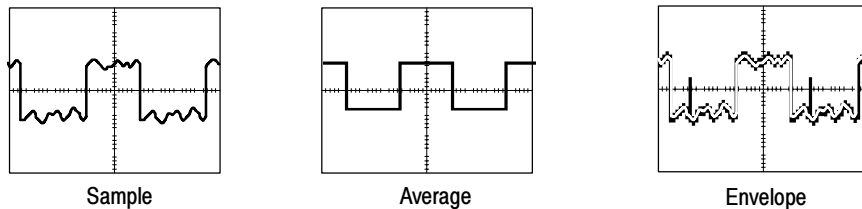
What's Excluded? Envelope acquisition mode can not be used with FrameScan acquisitions; you must use Sample or Average modes.

Keys to Using The key points that follow describe operating considerations for setting up the acquisition system so the waveforms acquired best fit your requirements.

Acquisition Modes. Consider the mode you want to use to acquire data:

- *Sample* - the instrument does no post-processing of acquired samples.
- *Average* - the instrument processes the number of waveforms you specify into the acquired waveform, creating a running exponential average of the input signal.
- *Envelope* - the instrument retains the running minimum (Min) and maximum (Max) values in adjacent sample intervals continuously, as subsequent waveforms are acquired, creating an envelope of all waveforms acquired for that channel.

Acquiring and displaying a noisy square wave signal illustrates the difference between the three modes. Note how Average reduces the noise while Envelope captures its extremes:



Acquisition Control. Also, consider how you want to control acquisition; you have two main options, either settable from the Acquisition Setup dialog box (push Acquisition MENU to display):

- **Run/Stop Button Only** - sets the instrument to start and stop the acquisition only when you use the Run/Stop button, which is available on the front panel, on the application toolbar, and in the Acquisition Setup dialog box. If toggled to Run, acquisition will start if a valid trigger occurs. If toggled to Stop, acquisition stops immediately.
- **Condition** - in addition to Run/Stop Button, which can always stop acquisition, the stop-after control provides additional conditions you can select from to stop an acquisition. See step 4, *Set the Stop Mode and Action*, on page 3-25, or access the online help in the Acquisition Setup dialog box for more information.

Global Controls. Like the horizontal controls, the acquisition controls apply to all active channels. For example, channel 1 cannot acquire in Sample mode while channel 2 acquires in Envelope mode; you cannot stop channel 8 from acquiring (if turned on) while other channels continue to acquire. Unlike horizontal controls, acquisition settings extend across time bases: you cannot set a different sample mode for channels acquired in the Mag1 time base; the sample mode you set extends across the Main, Mag1 and Mag2 time bases.

Preventing Aliasing. Under certain conditions, a waveform may be aliased on screen. Read the following description about aliasing and the suggestions for preventing it.

When a waveform aliases, it appears on screen with a frequency lower than that of the input signal or it appears unstable even though the TRIG'D light is lit. Aliasing occurs because the instrument sample interval is too long to construct an accurate waveform record. (See Figure 3-6.)

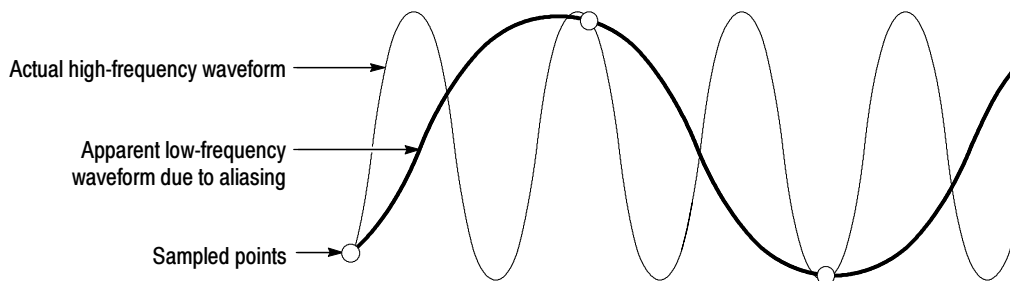







Figure 3-6: Aliasing

Methods to Check and Eliminate Aliasing. To quickly check for aliasing, slowly adjust the horizontal scale to a faster time per division setting. If the shape of the displayed waveform changes drastically or becomes stable at a faster time base setting, your waveform was probably aliased. You can also try pressing the AUTOSET button to eliminate aliasing.

To avoid aliasing, be sure to set resolution so that the instrument samples the input signal at a rate more than twice as fast as the highest frequency component. For example, a signal with frequency components of 500 MHz would need to be sampled with a sample interval less than 1 nanosecond to represent it accurately and to avoid aliasing.

To Set Acquisition Modes Use the procedure that follows to set the data-acquisition mode and specify acquisition start and stop methods. For more detailed information, display online help when performing the procedure.






Overview	To set acquisitions modes	Control elements and resources
<p>Prerequisites</p>	<p>1. Instrument must be installed with sampling modules in place before powering on the instrument. Instrument must be powered up, with horizontal and vertical controls setup. Triggering should also be set up.</p>	 <p>See the sampling-module user manuals for sampling module installation. See page 3-48 for trigger setup.</p>
<p>To select an Acquisition mode</p>	<p>2. Push the Acquisition MENU button to display the Acq Setup dialog box.</p>	
<p>Select the Acquisition mode</p> <p>Set a sample count</p>	<p>3. Click an option button to select the acquisition mode; choose from the following modes:</p> <ul style="list-style-type: none"> ■ Sample ■ Average ■ Envelope <p>For Average mode only, enter the number of samples to average in the Average box.</p>	

Overview	To set acquisitions modes (cont.)	Control elements and resources
<p>Set the Stop mode and action</p>	<p>4. Under Stop After, click one of the following options:</p> <ul style="list-style-type: none"> ■ Run/Stop Button Only ■ Condition <p>5. If you selected Condition, choose a condition from the drop-down list, such as Number of Acquisitions or Mask Total Hits, to stop on. If the condition requires a count (count box is enabled), enter a count.</p> <p>6. Select a Stop After action from the drop-down list box. Choose from the following actions:</p> <ul style="list-style-type: none"> ■ None ■ Print Screen to File ■ Print Screen to Printer ■ Save all Waveforms <p>Enter a filename for saving to if you've selected Print to File or Save all Waveforms.</p> <p>7. Click to check Ring Bell if you want audio notice when acquisition stops.</p>	
<p>Start acquisition</p>	<p>8. Push the RUN/STOP front-panel button to begin acquiring.</p>	 <p>See <i>To Start and Stop Acquisition</i> on page 3-26.</p>

End of Procedure

To Start and Stop Acquisition

Use the procedure that follows to start and stop acquisition.

Overview	To start and stop acquisition	Control elements and resources
<p>Prerequisites</p>	<p>1. Instrument must be installed with sampling modules in place before powering on the instrument. Instrument must be powered up, with horizontal and vertical controls set up. Triggering should also be set up.</p>	 <p>See sampling-module user manuals for sampling module installation. See page 3-24 for acquisition setup and page 3-48 for trigger setup in this manual.</p>
<p>To start acquiring</p>	<p>2. Make sure all the channels to be acquired are turned on (use the channel buttons; see page 3-9 if needed). Then push the RUN/STOP button to begin acquiring.</p>	
<p>To stop acquiring</p>	<p>3. Push the RUN/STOP button to stop acquisition. Acquisition will also stop when acquisition finishes if a selected stop condition is satisfied (see step 4 on page 3-25) or if triggering ceases while in Normal trigger mode.</p>	
<p>To clear an acquisition</p>	<p>4. Push the Acquisition CLEAR DATA button to discard the acquired data in all channels.</p>	
<p>For more information</p>	<p>5. For more information on the controls described in this procedure, push the Acquisition MENU button. Click the HELP button in the setup dialog box that displays. Also, see references listed at right.</p>	 <p>See <i>To Set Up Acquisition Modes</i> on page 3-24.</p>

End of Procedure

Acquisition Control Background

This section contains background information on the data sampling and acquisition process that can help you more effectively setup the acquisition window of each channel. This section:

- describes the acquisition hardware.
- defines the sampling process, sampling modes, and the waveform record.
- describes the acquisition cycle in Normal and FrameScan modes.

Acquisition Hardware

Before a signal can be acquired, it must pass through the input channel where it is sampled and digitized. Each channel has a dedicated sampler and digitizer as shown in Figure 3-7; each channel can produce a stream of digital data from which waveform records can be extracted. See *Signal Connection and Scaling* on page 3-4 for further description of scaling, positioning, and DC offsetting of channels.

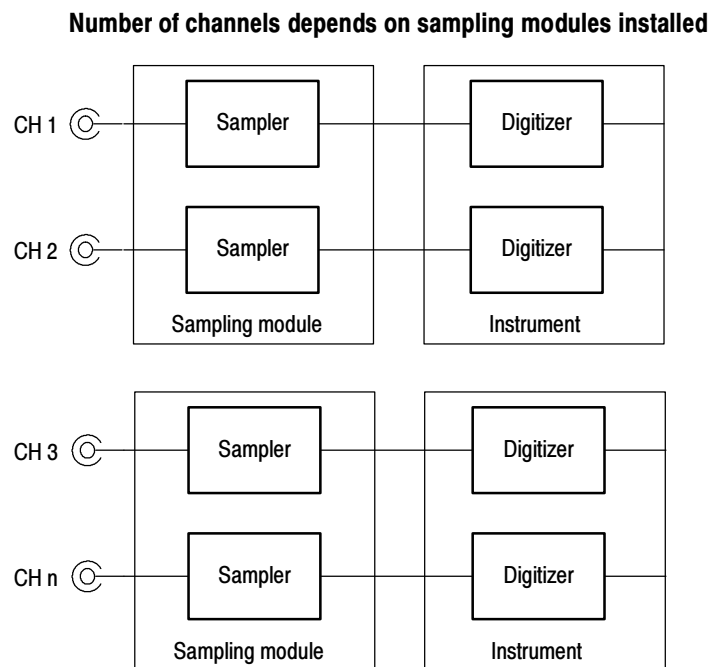


Figure 3-7: Channel configuration

Sampling Process

Acquisition is the process of sampling an analog input signal of an input channel, converting it into digital data, and assembling it into a waveform record, which is then stored in acquisition memory. Sampling, then, is the process that provides one sample per trigger event and, when taken from

repeated trigger events, also provides the digitized signal data from which the instrument assembles the waveform record (see Figure 3-9 on page 3-29). The signal parts within the vertical range of the sampler are digitized. See Figure 3-8.

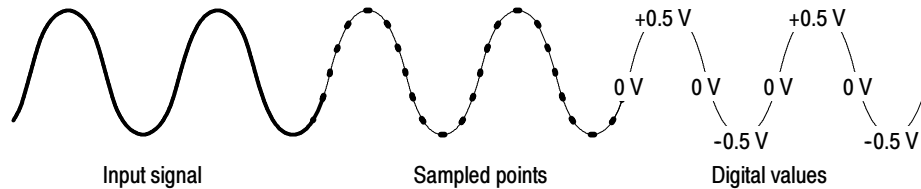


Figure 3-8: Digital acquisition — sampling and digitizing

Sampling Modes

The instrument acquisition system can process the data as it is acquired, averaging or enveloping the waveform data to produce enhanced waveform records. Once the waveform record exists (enhanced or not), you can use the post-processing capabilities of the instrument to further process that record: perform measurements, waveform math, mask tests, and so on. Refer to *Keys to Using* on page 3-22 for description of all three acquisition modes.

Waveform Record

While sampling the input signal provides the data that makes up the waveform record for any given channel, the instrument builds the waveform record through use of some common parameters (“common” means they affect the waveforms in all channels).

Figure 3-9 shows how these common parameters define the waveform record; as shown in the figure, they define where in the data stream data is taken and how much data is taken. Locate the following parameters in the figure:

- **Sample Interval.** The precise time between sample points taken during acquisition.
- **Record Length.** The number of samples required to fill a waveform record.
- **Trigger Point.** The trigger point marks the time zero in a waveform record. All waveform samples are located in time with respect to the trigger point.
- **Horizontal Delay.** The time lapse from the trigger point to the first sample taken (first point in the waveform record). It is set indirectly by setting the horizontal position (see *Horizontal Position and the Horizontal Reference* on page 3-59).

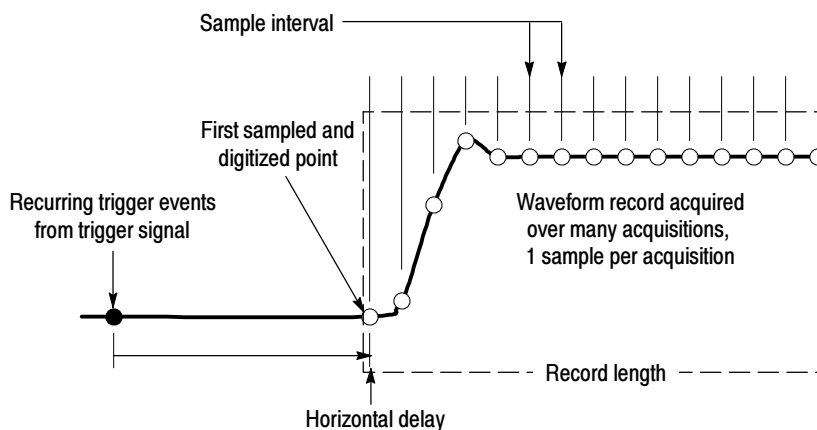


Figure 3-9: The waveform record and its defining parameters

As Figure 3-9 shows, the instrument acquires points in order from left to right, with each point from a separate trigger event, and delayed from that event by:

$$\text{horizontal delay} + (\text{sample interval} \times (\text{sample number} - 1))$$

When all the points in the waveform record have been sampled and digitized, the waveform record is in acquisition memory and becomes available for display (or use in math waveforms, storing, exporting, and elsewhere). See *Acquisition Cycle*, which follows.

For a control-oriented discussion of the waveform record, see:

- *Horizontal Acquisition Window Considerations* on page 3-17.
- *Horizontal Scale vs. Record Length vs. Sample Interval vs. Resolution* on page 3-19.

Acquisition Cycle

The process of building a record is a subpart the acquisition cycle, which describes how the instrument cycles through recognizing a trigger, taking a sample and processing it according to sample mode, and adding it to a waveform record. This manual describes the normal acquisition cycle in *Process Overview Map* on page 2-6. Note the following points regarding acquisition cycles:

- A waveform record exists, either on display or as an icon on the waveform bar, until it is replaced by a more recent acquisition or until you clear the record. The process of clearing waveform records is described on page 3-26.
- Choose the FrameScan cycle when you want to test for anomalies in Pseudo-Random Bit Streams. See *FrameScan Acquisitions* on page 3-30.

FrameScan Acquisitions

This instrument can modify its normal acquisition process to help you analyze pattern-dependent failures in high bit-rate communications signals.

Why Use?

FrameScan acquisitions allow detailed display and analysis of individual, complete waveforms or of the bit sequences leading up to a failure. This ability to identify the specific patterns that caused the failures makes using FrameScan mode superior to traditional methods. Traditional methods include:

- creating an eye diagram, which is a statistical representation of signal, using clock-triggered sampling oscilloscope.
- bit-error testing to find the total number of errors in a frame.

These methods are time consuming to use and neither can examine in detail the pattern driving the failure.

What's Special?

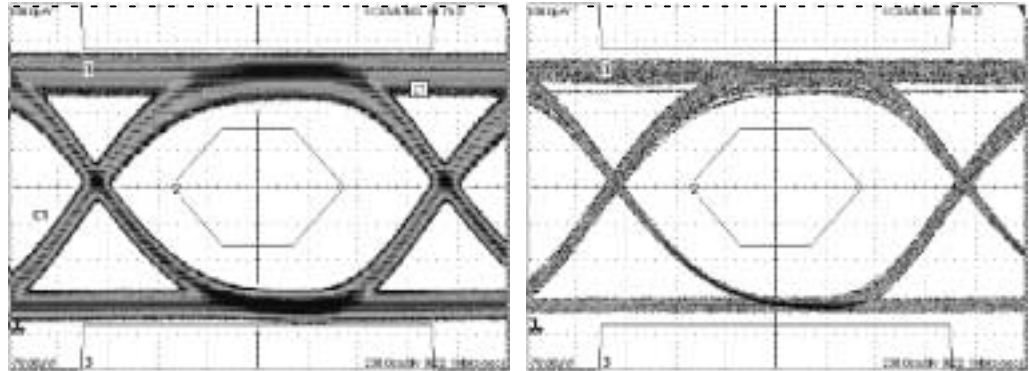
FrameScan acquisition mode offers the following advantages.

Breakthrough time base stability. Timing accuracy varies no more than 0.1 part per million from trigger event to data point, providing the stability needed to examine signals of almost any length for pattern-dependent failures.

Flexible set-up support. Set bit rates manually or set a bit rate based on a communication standard. Then set the horizontal scale manually or invoke a custom autoset: Bit/Eye-Pattern Autoset, if you have set an independent bit rate, or Standard-Mask Autoset, if you set bit rate based on a communication standard.

Identification and analysis of pattern-dependent failures. FrameScan acquisition, when used with mask testing and Stop After condition acquisition, can automatically determine the bit at which a pattern-dependent failure occurred.

Improved noise resolution on low-power communication signals. The instrument can use Average acquisition mode on Eye diagrams when acquiring using FrameScan mode. Averaging provides the noise resolution that the examination of many of today's low-power communication signals can require. FrameScan mode results in sequentially acquired data which can be averaged; normal eye diagrams acquire data randomly and cannot be averaged. Compare the noise of the waveforms that follow. The right waveform is averaged; the left is not.



What's Excluded? The instrument must be in Average or Sample acquisition modes; FrameScan excludes Envelope acquisition mode.

Keys to Using The key points that follow describe FrameScan mode operating behavior and provide background to help you to use this feature.

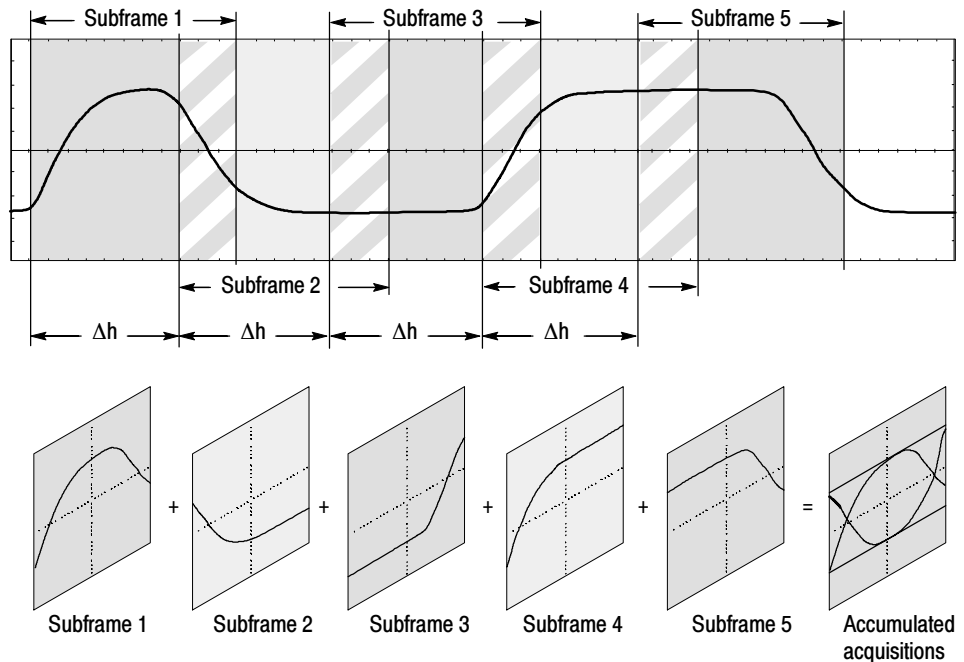
Determine Start Bit and Scan Bits. You need to know the bit in the bit stream at which you want to start the scan, the appropriate horizontal scale, the starting horizontal position, and the total number of bits for the desired FrameScan cycle.

How FrameScan Mode Acquires. FrameScan mode alters the normal acquisition sequence in order to scan a pseudo-random bit sequence (PRBS) or another repetitive bit stream to acquire one bit at a time in the same sequence found in the bit stream:

- Triggering is synchronous with the bit streams (framing signal) of the communication signal you want to scan, which results in the acquisition of a single sample prior the scanning of the next bit. You must supply an external trigger source that is synchronous with the frame; possible sources are external frame trigger/sync signals from a pattern generator or from a BERT (Bit Error Rate Tester).
- Acquisition operates in a scanning mode, where:
 - a. horizontal position is set to acquire the first bit, which the acquisition system acquires as a subframe (see Figure 3-10 on page 3-32).
 - b. horizontal position is incremented one-bit period ($1/\text{bit rate}$), and then the acquisition system acquires the second bit as a subframe. The duration of each subframe acquisition is set to provide about a 20% overlap between frames.
 - c. This sequence of incrementing, and then acquiring the next bit, continues until the instrument acquires the number of bits you specify

for the frame, or until acquisition stops due to a specific test condition, such as the failure of a mask test.

The resulting horizontally skewed FrameScan acquisitions display successive individual bits acquired in increasing time order. FrameScan acquisitions can continue through an entire frame of data if needed to help you to uncover faulty bit sequences leading up to pattern-dependent failures.


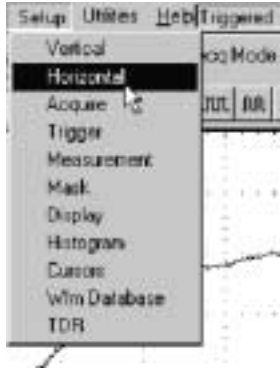
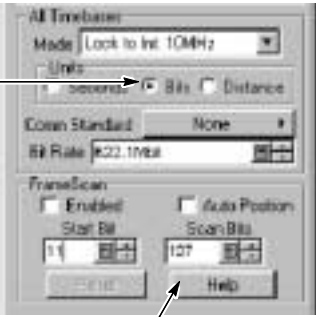


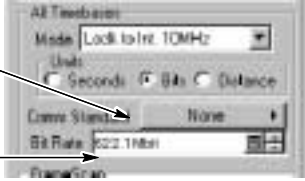
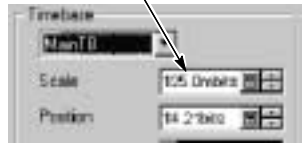

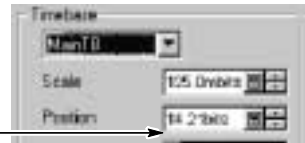

Notes:
 Δh is the horizontal position change = one bit period (=1/bit-rate)
 Subframe acquisition duration is 40% greater than the bit period

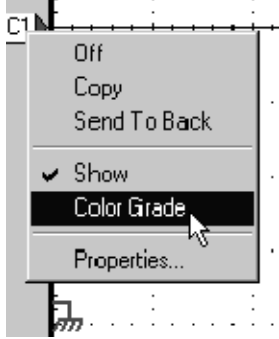

Figure 3- 10: How FrameScan acquisition works (scanning on a 127-bit PRBS shown)

To Acquire in FrameScan Mode

Use the procedure that follows to set up the instrument to acquire in FrameScan mode.


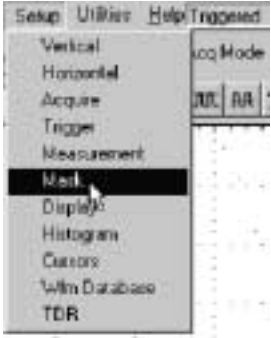
Overview	To acquire in FrameScan mode	Control elements and resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. The instrument must have an appropriate sampling module in place before powering on the instrument. Instrument must be powered up. 2. The signal to be scanned must be input to a channel and an appropriate external framing signal must be applied to the trigger input. 3. The acquisition mode must be set to Sample or Average. Envelope cannot be used with FrameScan acquisitions. 4. The vertical and horizontal controls and triggering must be set to acquire the signal. 	 <ul style="list-style-type: none"> ■ See sampling-module user manuals for sampling module installation. ■ See page 3-24 for acquisition setup and page 3-48 for trigger setup in this manual.
<p>Access the FrameScan controls</p>	<ol style="list-style-type: none"> 5. From the application menu bar, select Setup, and then select Horizontal. See right. 	
<p>Set the frame duration</p>	<ol style="list-style-type: none"> 6. In the Horz Setup dialog box, click the Units Bits option button. 7. Enter the total number of bits you wish to scan (the frame duration) in the Scan Bits box. You must always set this parameter manually. <p>Tip. You can set Units to Seconds if you prefer, but Bits usually makes the set up and use of FrameScan acquisition easier.</p>	 <p>Check for bits units →</p> <p>Enter bits to be scanned →</p>


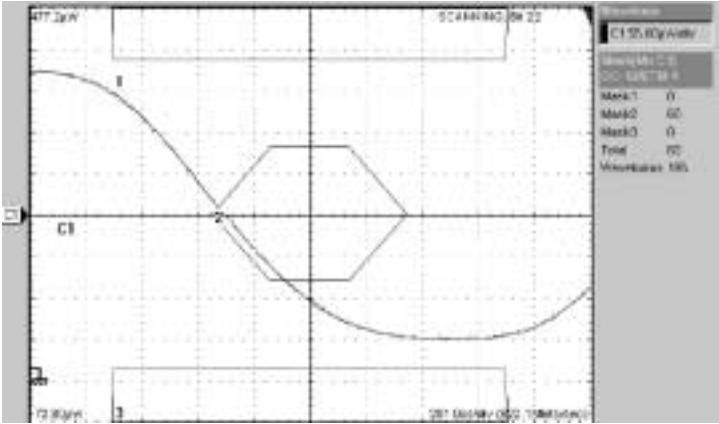

Overview	To acquire in FrameScan mode (cont.)	Control elements and resources
<p>Set the bit rate</p>	<p>8. Set the horizontal scale so one acquisition record is equal to one bit. Use one of the two methods that follow:</p> <ul style="list-style-type: none"> ■ Automatic: If your signal to be scanned matches a communications standard, select it from the Comm Standard list. Choosing a standard sets the bit rate and start bit; otherwise, if you know the bit rate, you can set the bit rate manually using the Bit Rate box. ■ Manual: Adjust the Scale control to a setting that results in a display of both edges of the bit. For example, setting 1/8 of a bit per division (0.125 bits/div) yields 1 bit in 8 divisions, which fits nicely on screen. 	 <p>Select a comm. standard, or...</p> <p>Set the bit rate manually</p>  <p>Set to 1/8 bit per division</p>
<p>Set the starting horizontal position</p>	<p>9. Set the initial horizontal position to the first bit you want to acquire. Use one of the two methods that follow:</p> <ul style="list-style-type: none"> ■ Automatic: Enter your desired start bit location, and then check the Auto Position box to enable the instrument to set the position as near as possible to match the bit specified in the Start Bit box. ■ Manual: Adjust the Position control to align the start of a bit to desired location in the frame. <p>Tip. The latter method is useful when you need to manually align a bit or waveform to a mask on the display.</p>	 <p>First set the start bit, ... and then enable Auto Position</p>  <p>Or set manually</p>
<p>Enable FrameScan</p>	<p>10. In the dialog box, click to check the FrameScan Enabled box. See right.</p> <p>11. To restart the scan at the first bit at any time, click the Reset button.</p>	 <p>Check to start scan</p> <p>Click to restart scan</p>

Overview	To acquire in FrameScan mode (cont.)	Control elements and resources
<p>Set a display mode</p>	<p>12. If you want to display the frame-scanned acquisition as an eye diagram, set one of the following display modes:</p> <ul style="list-style-type: none"> ■ Select Infinite Persistence or Variable Persistence in the Display Setup dialog box (from the application menu bar, select Setup, and then select Display). ■ Right click the waveform icon (left side of the screen in the waveform bar) of the waveform being scanned and select Color Grade in the menu. 	
<p>For more information</p>	<p>13. For more help on FrameScan acquisitions, click the Help button in the Setup dialog box to access contextual help on screen.</p>	 <p>See page 3-167 to learn about using online help.</p>

End of Procedure

To Catch a Bit Error FrameScan Acquisition, when coupled with mask testing, provides the tool you need to capture a defective bit and examine the pattern leading up to it.

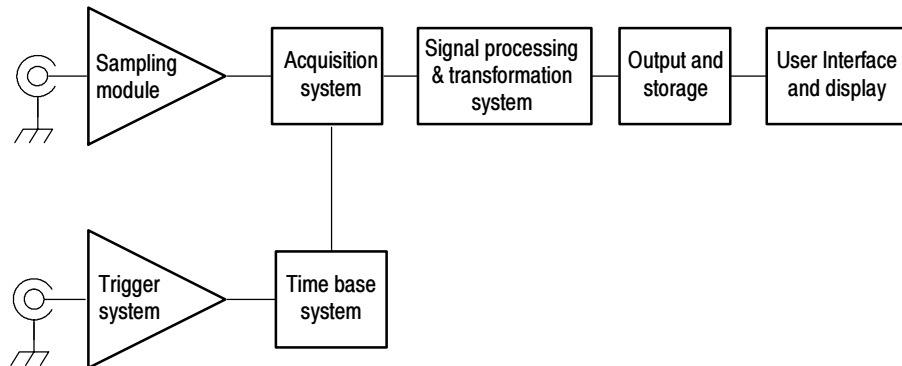
Overview	To catch a bit error	Control elements and resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. The instrument should be set up per the previous procedure. 2. Pause the acquisition system (push the Run/Stop button on the front-panel). 3. Infinite persistence and color grading display modes should be off if turned on in the previous procedure. 	 <ul style="list-style-type: none"> ■ See <i>To Acquire in FrameScan Mode</i> page 3-33.
<p>Enable mask testing</p>	<ol style="list-style-type: none"> 4. From the application menu bar, select Setup, and then select Mask. (See right.) 5. Use the Mask Setup dialog box to set up for mask testing as you would for nonFrameScan acquisitions. See <i>Using Mask Testing</i> on page 3-141 for information about using Mask testing. Be sure to enable the mask. <p>Tip. If you selected a communication standard when you set the FrameScan bit rate (see step 8 on page 3-34), the same standard will be preselected in the Mask Setup dialog box.</p>	

Overview	To catch a bit error (cont.)	Control elements and resources
<p>Set conditional acquisition and start testing</p>	<ol style="list-style-type: none"> 6. From the application menu bar, select Setup, and then select Acquire. 7. In the Acq Setup dialog box (see right), check the Condition option under Stop After. 8. In the Condition pulldown list, select Mask Total Hits and set a count of one in the count box. These settings will stop acquisition on a violation of any of the masked areas on screen. See below.  	 <p>See page 3-167 to learn about using online help.</p>
<p>For more information</p>	<ol style="list-style-type: none"> 9. For more help on using FrameScan acquisitions, click the Help button in the Horz Setup dialog box to display contextual help on screen. 	

End of Procedure

Triggering

To properly acquire waveforms — to sample a signal and assemble it into a waveform record — you need to set up the instrument trigger conditions. This section provides an overview of the instrument trigger features and their use.



Edge Triggering

The instrument supports direct-edge triggering, which triggers as described in *Keys to Using* on page 3-40. You must provide an external trigger source, except when using clock-recovery triggering from an optical sampling module equipped with the clock-recovery option or using the internal clock (as when TDR testing).

Why Use?

Use triggering controls to control the acquisition window, so that the instrument acquires the waveform data you want. The trigger event, when synchronized to the input signal, defines the horizontal acquisition window. By choosing the trigger event and adjusting the horizontal position (delay between trigger event and the horizontal reference point) you control the location in the data stream (the input signal) from which the waveform record is taken.

What's Special?

Clock Recovery. If you use optical sampling modules that include a clock-recovery option, you can use this recovered clock to trigger the instrument for specific DATA rates and formats that are compatible with the specific CR option in the optical module. Also, if you use optical sampling modules that support continuous-rate clock recovery, you can specify any custom clock-recovery rate within the range supported by the module. Refer to *Sampling Modules Supported* on page 1-4 to see those modules that support continuous-rate clock recovery.

Gated Triggering. For instruments equipped with Option GT, the system allows triggering to be enabled and disabled (gated) based on a TTL signal at a rear panel input. See *To Use Gated Trigger* on page 3-50.

Keys to Using

The key points that follow describe operating considerations for setting up to trigger on your waveforms.


Triggering Process. When a trigger event occurs, the instrument acquires a sample in the process of building a waveform record. The trigger event establishes the time-zero point in the waveform record and all samples are measured with respect to that event.

The trigger event starts waveform acquisition. A trigger event occurs when the trigger source (the signal that the trigger circuit monitors) passes through a specified voltage level in a specified direction (the trigger slope). When a trigger event occurs, the instrument acquires one sample of the input signal. When the next trigger event occurs, the instrument acquires the next sample. This process continues until the entire record is filled with acquired samples. Without a trigger, the instrument does not acquire any samples. See Figure 3-9 on page 3-29. This behavior differs from that of real time acquisition systems, which can acquire a complete waveform record from a single trigger event.

Triggering is Global. The instrument uses the trigger event to acquire across all active channels. This same trigger is also common across all time bases currently active (one or more of Main, Mag1 and Mag2).



Edge-Trigger Type. This instrument supports edge triggering only, in which edge triggers gate a series of acquisitions.



The slope control determines whether the instrument recognizes the trigger point on the rising or the falling edge of a signal. See Figure 3-11. You can set the trigger slope from the toolbar at the top of the display or in the Trigger Setup dialog box.



The level control determines where on that edge the trigger point occurs. The instrument lets you set the trigger level from the front panel with the Trigger LEVEL knob.

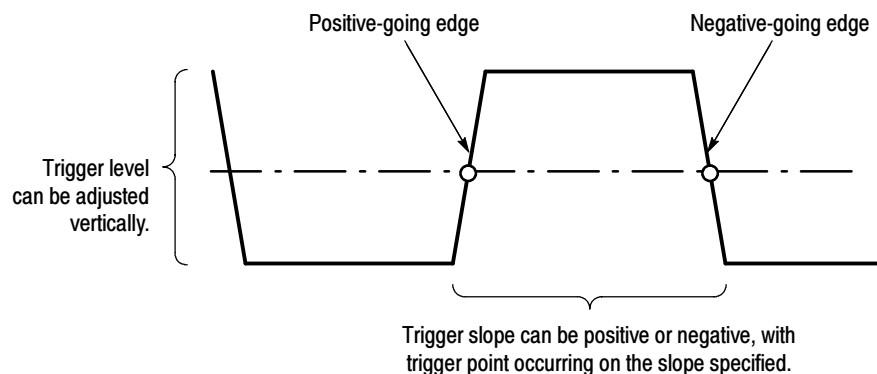


Figure 3-11: Slope and level define the trigger event

Trigger Modes. The trigger modes control the behavior of the instrument when not triggered:

- *Normal* mode sets the instrument to acquire a waveform only when triggered. Normal mode does not acquire data if triggering stops, rather the last waveform records acquired remains “frozen” on the display (if the channels containing them are displayed). If no last waveform exists, none is displayed. See Figure 3-12, *Normal trigger mode*.
- *Auto* mode sets the instrument to acquire a waveform even if a trigger event does not occur. Auto mode uses a timer that starts after trigger rearm. If the trigger circuit does not detect a trigger after this timeout (about 100 ms), it auto triggers, forcing enough trigger events to acquire all active channels. In the case of repetitive acquisitions in automatic trigger mode, waveform samples are acquired, but at different places in the data stream (synchronization is lost). See Figure 3-12, *Automatic trigger mode*. If you do not apply a signal to any channel displayed, a baseline is displayed for that channel.

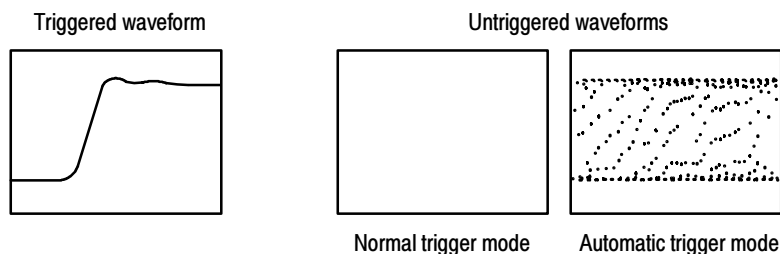


Figure 3-12: Triggered versus untriggered displays

Trigger Sources. The trigger source provides the signal that the trigger system monitors. The source can be:

- the internal clock of the instrument (TDR clock rate), with user-selectable clock frequencies. The Internal Clock Out connector supplies a replica of the internal clock at the instrument front panel. See Figure 3-13 on page 3-42.
- an external signal coupled to one of the trigger input connectors (see Figure 3-13) on the front panel:
 - External Direct, DC coupled and usable with signals up to at least 3.0 GHz
 - External Prescale, divided by 8 and usable with signals up to at least 12.5 GHz

NOTE. *The upper limit is determined by signal input level; this is enhanced by the optional accessory 80A01.*

- an internal clock-recovery trigger provided by an optical sampling module equipped with a clock-recovery option. Clock recovery is user-selectable for triggering rates that depend on the sampling module used; for example, either 622 Mbps (OC-12/STM-4 standards) or 2.488 Gbps (OC-48/STM-16 standards) for the 80C01-CR Optical Sampling Module.

Some optical sampling modules support continuous-rate clock recovery. If you have such a module installed, a user-defined custom clock recovery rate is selectable from the Trigger Source Setup menu.

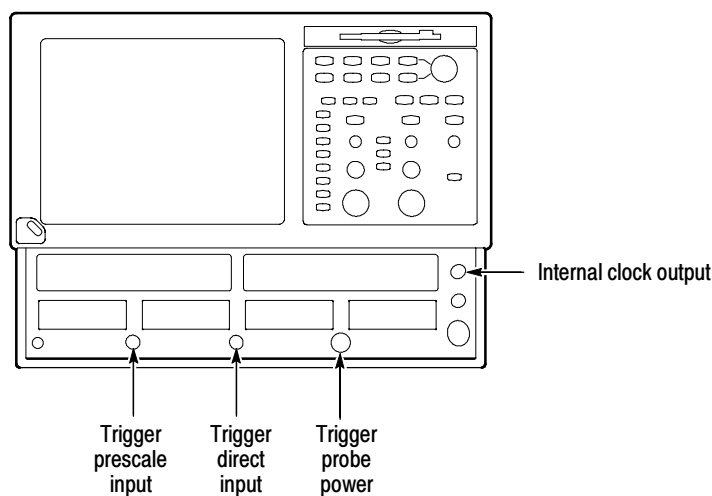


Figure 3-13: Trigger inputs

Use a trigger source that is synchronized with the signal you are sampling and displaying. Selection of your trigger source depends on your application, as shown in Table 3-1.

Table 3-1: Application-based triggering

Application	Source to use
Communications (optical) serial NRZ data signals	Set source to Clock Recovery, set the clock-recovery type, and use an optical sampling module equipped with a clock-recovery option supporting the specific data rate of the serial optical signal. A custom clock recovery rate can be defined by the user if the optical module supports a continuous-rate clock recovery. Refer to <i>Sampling Modules Supported</i> on page 1-4 to see those modules that support continuous-rate clock recovery.
TDR measurement using an electrical sampling module equipped with TDR	Set source to Internal Clock to use the internal clock of the instrument (TDR clock), and select the appropriate clock frequency. Disconnect any signal connected to the External 10MHz Reference Input when using the Internal clock.
Measurements on systems with a synchronized pretrigger signal	Set source to External Direct or External Prescaler as appropriate (see <i>Trigger Source Connectors</i>) and connect the pretrigger signal.
Any application requiring that the input signal provide the trigger	Set source to External Direct or External Prescaler as appropriate (see <i>Trigger Source Connectors</i>). Use a signal splitter or power divider to couple to both the Ext Direct or Prescaler input and the input channel, so that the sampled signal is also the trigger signal.
Any application requiring that you probe the trigger source	Set source to External Direct, and use a Tektronix probe as described in <i>Probe-to-Trigger Source Connection</i> on page 3-44.
Any application requiring that you perform special measurements using gated trigger.	Set source to External Direct, and use a TTL connection to trigger gate as described in <i>To Use Gated Trigger</i> on page 3-50.

Trigger Source and ESD. Observe static precautions when coupling trigger sources to this instrument.



CAUTION. *Electrostatic-static damage can permanently degrade and damage the inputs to this instrument, its sampling modules, and accessory probes. You must take proper precautions; please read your sampling module user manual for more information.*

Trigger Source Connectors. External triggers can be connected to either the Trigger DIRECT or Trigger PRESCALE connectors on the front panel (see Figure 3-13):

- Signals connected to the PRESCALE connector are divided by eight and then fed to the trigger circuits.
- Signals connected to the DIRECT connector are fed directly to the trigger circuitry. The signal is DC coupled and can be up to 3.0 GHz.

When using a given trigger source, you should disconnect any other trigger source from the front panel to ensure specified performance. Specifically:

- Do not connect a signal to the Trigger Direct or Trigger Prescale front-panel connector unless you've selected that input as the trigger source.
- Do not connect a signal to the External 10 MHz Reference front-panel connector unless you have selected that input as the timebase mode in the Horizontal setup dialog box.

Probe-to-Trigger Source Connection. You can connect probes, such as the P6207 and P6209, to the Trigger DIRECT input connector of the instrument. Observe all static precautions outlined in the documentation for the probe you choose while following these steps:

- Connect the probe-power connector to the TEKPROBE-SMA compatible probe (Level 1 or 2 only).
- Connect the probe signal connector (probe must have an SMA connector) to the Trigger DIRECT source input (not the PRESCALE source input).
- Connect the probe input to the signal that is to supply the trigger source.

The probe you attach preconditions the trigger signal for its input just as other probes do for the vertical inputs. More specifically, a probe attached to the Trigger DIRECT input may affect trigger-level range, resolution, and units as follows:

- Trigger-level units will match those of the probe.
- The trigger level for probes that have offset control is adjusted by changing the offset of the connected probe and is limited by the range, resolution, and offset characteristics of the probe.
- When a connected probe is removed and a different probe installed, the instrument attempts to keep the same absolute trigger level as the current trigger-level setting.

Note that the probe parameters (range, resolution, offset scale, and units) that are relevant to the trigger circuit affect the Trigger Level control.

Gated Trigger Connector (Option GT equipped). You can attach a BNC cable to the External Gate input at rear panel (TTL connection). Two conditions must be satisfied to get a stable display of waveform data:

- The channel and trigger must be otherwise triggerable without the trigger gate.
- The gating signal must be at a TTL high; the triggering system enabled and the instrument will acquire.

Note that the function of the trigger gate is to selectively exclude data from acquisition by means of gating the trigger on and off, and it need not be synchronized with either channel or trigger. See procedure on page 3-50 for more information on setting up gated trigger.

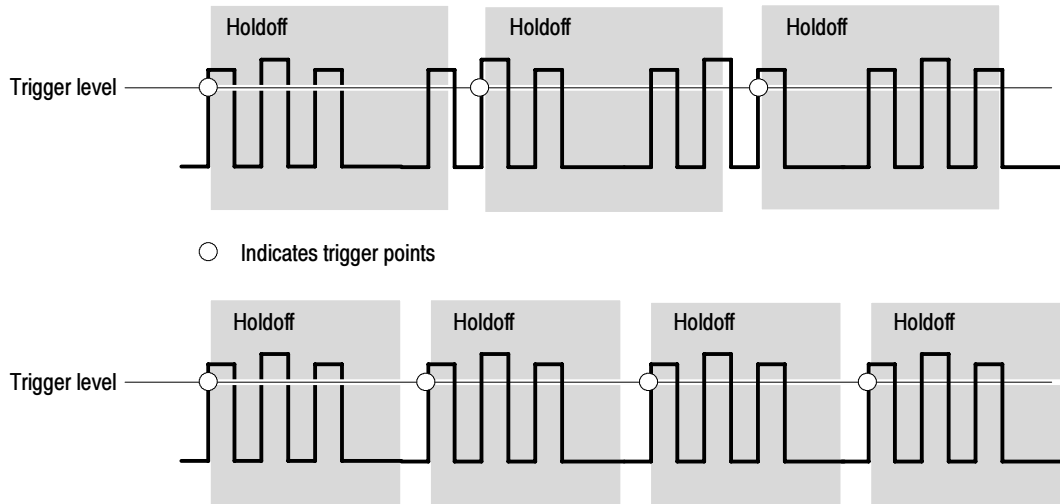
Enhanced Triggering. These features (see note) can help stabilize triggering and perform special measurements:

- **High Frequency Triggering.** When you enable the High Frequency triggering control, the instrument increases trigger sensitivity of the trigger circuit by decreasing hysteresis (a transition or noise band), allowing triggering on higher frequency signals.
- **Metastability Reject.** When you enable Metastability Reject, the instrument replaces the acquired sample with a null sample if it detects a potential metastable condition. A metastable condition occurs when both the trigger input signal and the holdoff-generated enable signal arrive at the internal trigger recognizer at virtually the same time.
- **Gated Triggering.** When you enable the Gated trigger control, the trigger and the External Gate input are applied to the instrument through what is in effect an AND function. Gated triggering is applied to acquire and to mask test or otherwise characterize signals like those found in extremely long transmission carriers, such as undersea communication fibres. Since long fibres are difficult to test, user-supplied test fixtures are used to repeat the test signal through a short loop of the cable to simulate traveling longer distances along its entire length. The signal is picked off and connected to the instrument.

NOTE. *Gated trigger is available only when ordered as Option GT at the time the instrument ships.*

Adjusting Holdoff. Trigger holdoff can help stabilize triggering. When you adjust holdoff, the instrument changes the time it waits before rearming its trigger circuit after acquiring a sample. Before rearming, trigger circuitry cannot

recognize when the next trigger conditions are satisfied and cannot generate the next trigger event. When instrument is triggering on undesired events (Figure 3-14, top waveform), you adjust holdoff to obtain stable triggering.



At the longer holdoff time for the top waveform, triggering occurs at valid, but undesired, trigger events. With a shorter holdoff set for the bottom waveform, triggers all occur on the first pulse in the burst, which results in a stable display.

Figure 3- 14: Holdoff adjustment can prevent false triggers

Usable Holdoff. The holdoff time the instrument can use varies within limits. The maximum holdoff the instrument can achieve is the 50 ms specified in *Specification* on page Table A-3 on page A-3.

The minimum holdoff used depends on hardware constraints, which do not change, and certain control settings, which you can control:

- The instrument hardware constrains the minimum usable holdoff time to the greater of the trigger-to-end-of-record time or 5 μs.
- The trigger-to-end-of-record time (EORT) is the time from the trigger event to the last sample in the waveform record and is calculated as:

$$EORT = Horiz. Position + (1 - 0.01 \times Horiz. Ref.) \times Time/Div \times 10 \text{ divisions} + Channel Deskew$$

For example:

$$\begin{aligned} EORT &= 6 \mu\text{s} + (1-0.1(.5)) \times 1 \mu\text{s}/\text{div} \times 10 \text{ div} + 0 \\ &= 6 \mu\text{s} + 5 \mu = 11 \mu\text{s}, \text{ when:} \end{aligned}$$

$$\text{Horizontal position} = 6 \mu\text{s}$$

$$\text{Horizontal Ref} = 50\%$$

$$\text{Time/Division} = 1 \mu\text{s}/\text{div}$$

$$\text{Channel Deskew} = 0 \text{ (set to minimum)}$$

In this example, because 11 μs is greater than 5 μs , the current control settings determine the minimum usable holdoff the instrument can use.

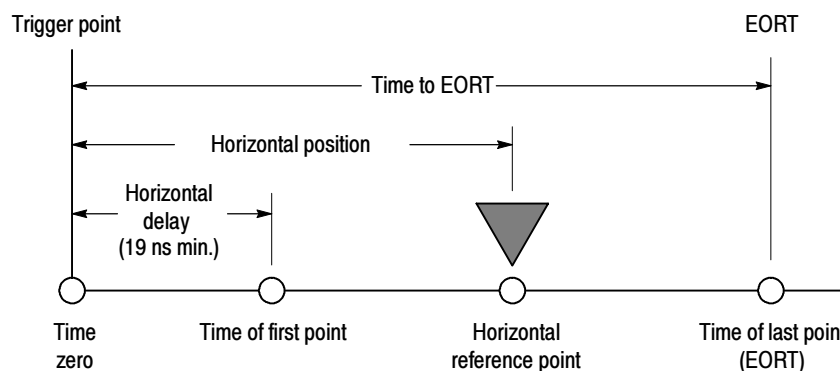



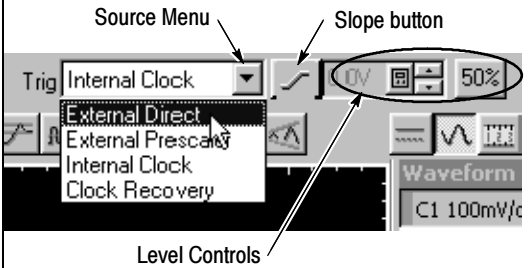


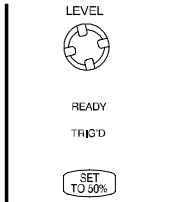
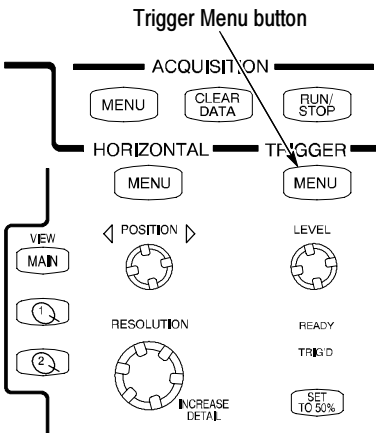

Figure 3-15: Trigger to End Of Record Time (EORT)

Requested vs Actual Holdoff. The instrument operates with two holdoff values:

- **Requested** - the last value requested in the Trigger Setup dialog box. You can set times from 5 μs - 50 ms, but the time requested becomes the actual time used only if it meets the requirements just described for *Actual*. Otherwise, the holdoff-time value requested is held for later use as described for *Actual*.
- **Actual** - in effect the holdoff time; that is, the time the instrument is using or will use when acquiring data. The instrument uses it when the minimum usable holdoff (determined as described in *Usable Holdoff*, on page 3-46) is greater than the requested value. The instrument retains and changes to the requested value if the user changes control settings such that the requested value exceeds the minimum usable holdoff. Actual values can range from 5 μs - 55 ms.


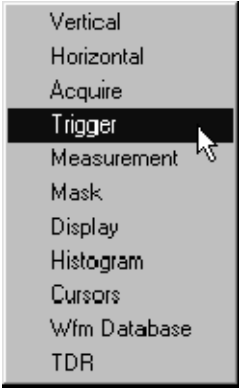
To Trigger Use the procedure that follows when setting up the instrument to trigger acquisitions.




Overview	To trigger	Control elements and resources
<p>Prerequisites</p>	<p>1. The instrument must be installed with sampling modules in place. Acquisition system should be set to Run, and the vertical and horizontal controls should be set appropriately for the signal to be acquired.</p>	 <p>See Sampling Module User Manuals for sampling module installation. See page 3-24 of this manual for acquisition setup.</p>
<p>Apply a trigger signal</p>	<p>2. Connect the signal to be triggered on using proper probing/connecting techniques for your application. Typical approaches include using:</p> <ul style="list-style-type: none"> ■ External Trigger, Direct or Prescale. Portion of the input signal coupled to the appropriate input (see right) using a power divider on input signal. ■ Internal Clock. No external trigger required. ■ Clock Recovery. Recovered clock signal obtained from those optical sampling modules supporting clock recovery (connection internal through the sampling module; no external trigger connection required). <p>A custom clock recovery rate can be defined by the user if the optical module supports a continuous-rate clock recovery. Refer to <i>Sampling Modules Supported</i> on page 1-4 to see those modules that support continuous-rate clock recovery.</p> <p>Note. When using any of the above sources, disconnect any signal connected to the other source trigger and clock sources. See External 10MHz Reference Input when using the Internal clock).</p>	<p>PRESCALE TRIGGER INPUT 2-10 GHz 2.5V P-P MAX</p>  <p>TRIGGER DIRECT INPUT DC-3,0 GHz ±1.5V MAX</p>  <p>See Table 3-1 on page 3-43 for more information.</p>
<p>Select source, slope, and level</p>	<p>3. Click the Trig Source menu, and select the trigger source to match your trigger signal in the pull-down menu (upper right corner of display).</p> <p>4. Click the Slope button to toggle to the trigger slope you want, positive or negative.</p> <p>5. Adjust the trigger level using the (Set Level to) 50% button or the Level list box as show at right, or using those on the front panel, shown in step 7.</p>	 <p>Source Menu</p> <p>Slope button</p> <p>Level Controls</p>

Overview	To trigger (cont.)	Control elements and resources
<p>Verify triggering</p>	<p>6. When the instrument is triggered, the word Triggered is displayed in the toolbar on screen. You can use also the trigger lights to verify triggering status as follows:</p> <ul style="list-style-type: none"> ■ READY lights when the instrument acquisition system is running but the trigger system is not receiving valid trigger events. This includes when auto triggering in absence of a trigger. ■ TRIG'D lights when the instrument acquisition system is running and the trigger system is triggered. ■ READY and TRIG'D are always off if acquisition is stopped. 	
<p>Other trigger parameters</p>	<p>7. If you need to change the trigger mode or other settings, push the Trigger MENU button to display the Trig Setup dialog box. From there, you can:</p> <ul style="list-style-type: none"> ■ Switch between Auto and Normal trigger modes ■ If you have trouble triggering, you can adjust holdoff, which may help. For assistance with this control, see step 8. ■ You may on occasion want to turn off metastable rejection; again, see step 8 for more information. 	
<p>For more information</p>	<p>8. Press the Help button in the Trig Setup dialog box to access the online assistance specific to triggering commands. You can also read about key trigger features in <i>Keys to Using</i> on page 3-40.</p>	 <p>See page 3-167 for information on online help.</p>

End of Procedure

To Use Gated Trigger Use the procedure that follows when setting up the instrument to use the gated trigger. Gated trigger is only available with Option GT installed.

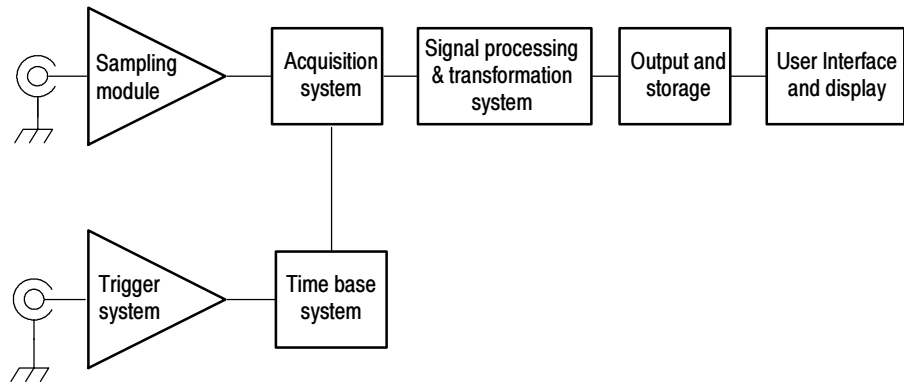
Overview	To use gated trigger	Control elements and resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. The Acquisition system should be set to Run, and the vertical and horizontal controls should be set appropriately for the signal to be acquired. 2. Trigger on your input signal. Use the procedure <i>To Trigger</i> on page 3-48 as needed. <p>Note that you must supply the input signal and the TTL gating signal to the appropriate instrument inputs. The instrument does not control or generate these signals.</p>	 <p>See Sampling Module User Manuals for sampling module installation. See page 3-24 of this manual for acquisition setup.</p>
<p>Access the Setup trigger dialog box</p>	<ol style="list-style-type: none"> 3. From the application menu bar, select Setup, and then select Trigger. See right. You also can select this menu by pushing the Trigger MENU button. 	

Overview	To use gated trigger (Cont.)	Control elements and resources
<p>Enable gated triggering</p>	<p>4. In the Enhanced Triggering options section of the dialog box, check Gated Trigger.</p>	
<p>Complete set up</p>	<p>5. Attach an appropriate TTL-gating signal to the TRIGGER GATE (TTL) rear-panel connector. Operation is as follows:</p> <ul style="list-style-type: none"> ■ Triggering system will be disabled when the gating signal is a TTL low, and instrument will not acquire. ■ The triggering system will be enabled when the gating signal is a TTL high, and the instrument will acquire. ■ There is an internal pull-up on the Gated Trigger input such that if no drive signal is supplied or if the input is left unconnected, triggering will be enabled even if the Gated Trigger is selected in the Trig Setup dialog box. 	<p style="text-align: center;">TRIGGER GATE (TTL)</p> 
<p>For more information</p>	<p>6. Press the Help button in the Trig Setup dialog box to access the online assistance specific to triggering commands. You can also read about key trigger features in <i>Keys to Using</i> on page 3-40.</p>	 <p style="text-align: center;">See page 3-167 for information on online help.</p>

End of Procedure

Displaying Waveforms

To make use of the waveforms you acquire, you will often want to display them. This instrument includes a flexible, customizable display that you can control to examine and analyze acquired waveforms. This section presents an overview of display operation in the topics *Using the Waveform Display* and *Customizing the Display*.



Using the Waveform Display

The waveform display (see Figure 3-16) is part of the User Interface (UI) application. The UI takes up the entire screen of the instrument and the waveform display takes most of the UI. Some terms that are useful in discussing the waveform display follow.

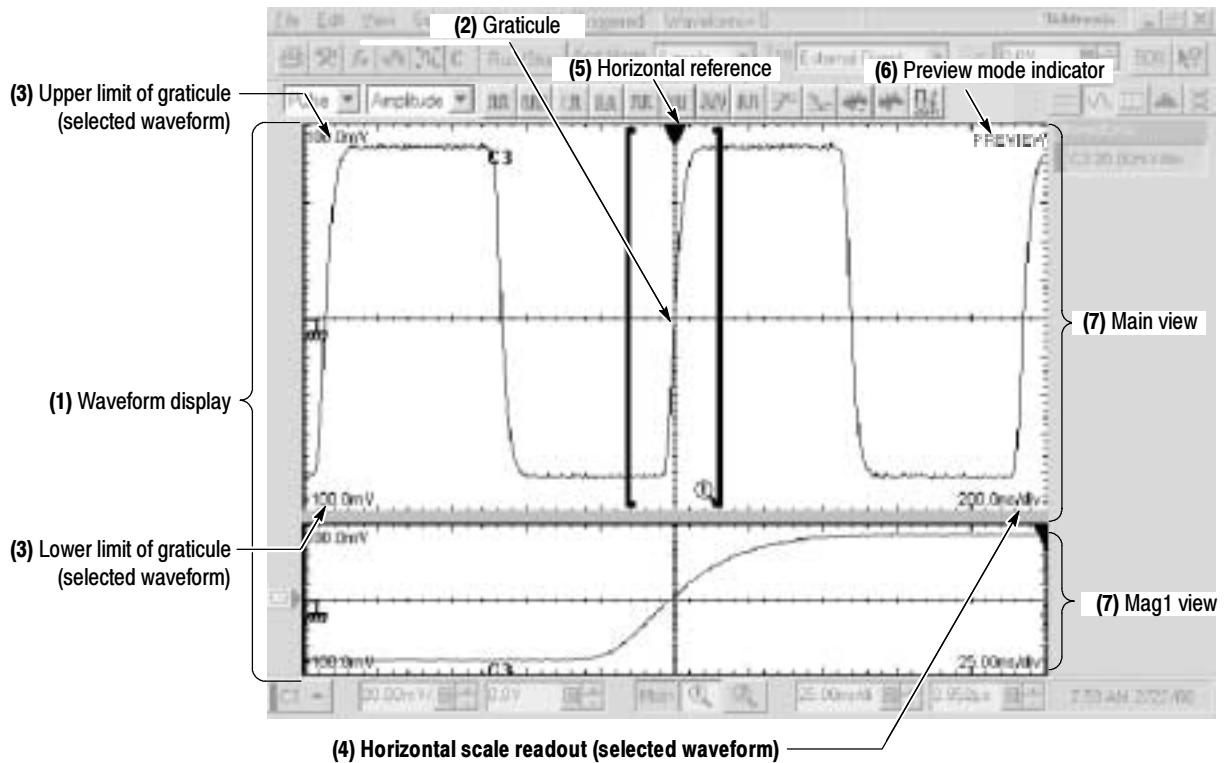


Figure 3-16: Display elements

(1) Waveform display: the area where the waveforms appear. The display comprises the time bases and graticules, the waveforms, masks, histograms, and readouts.

(2) Graticule: a grid marking the display area of a view. Each graticule is associated with its time base.

(3) Upper and lower amplitude-limits readouts: the upper and lower boundary level of the graticule for the selected waveform.

(4) Horizontal-scale readout: the horizontal scale of the selected waveform.

(5) Horizontal reference: a control that you can position to set the point around which channel waveforms expand and contract horizontally on screen as you change the Horizontal Scale control.

(6) Preview: a status field that indicates when all waveforms are being previewed (that is, displaying an approximation of the waveforms as they will appear when acquisition completes). This indicator may appear when you alter acquisition controls.

(7) Main, Mag1, and Mag2 views: selectable objects displaying on screen in the display, each with its own display of any waveform that is currently turned on. A

view is a representation of a signal on an associated time base—the Main time base with the Main view, which is always displayed, or one of the two Mag views, each with its own time base and graticule. The display of the Mag views can be turned on or off. You can display up to three views on screen (Main plus Mag1 and Mag2) at the same time.

Touchscreen (not shown): a feature that lets you touch controls on screen to operate the instrument. See *Mouse and Touchscreen Operation* on page 3-60.

Why Use? Use display features and controls to view, test, measure, and otherwise analyze your waveforms.

What's Special? This instrument provides a robust display. Some features of note follow.

Flexible Display Control. Front-panel knobs and buttons support quick access to the most often used adjustments—those that display, position, and scale waveforms. Mouse, keyboard, and touchscreen interfaces support complete setup of all the display parameters.

Multiple Time base Views. Three views, Main, plus Mag1 and Mag2, can be displayed simultaneously, each with its own time base. Live waveforms are acquired independently in each time base (C1 in Main is a different waveform than C1 in Mag1 or Mag2).

All the displayed waveforms appear in each view that you display: if C1 and M1 are displayed in Main, they also appear in Mag1 and Mag2 if you display those views. Reference waveforms will appear in all views as well, but, since they have a static time base setting (the time base setting with which they were saved), they will be identical in all views.

Fast Access to Zoom. Waveform inspection has never been easier. Just click and drag a box around the feature of interest and it zooms horizontally to fill the screen, reacquired at a higher resolution.

Preview Mode. The instrument automatically uses a preview display when control changes initiate reacquisition of waveform data. A preview display shows how the waveforms will look when acquisition completes. When the instrument finishes the processing of state changes, it removes the preview and displays the actual waveforms.

What's Excluded? Previewing of changes does not occur when the acquisition system is stopped; the data will not update on screen until acquisition is restarted.

Keys to Using

The key points that follow describe operating considerations for setting up the instrument time base views so that they best support your data-analysis tasks.

Waveform Display. In general, the method of displaying a waveform is to define the waveform, and then turn it on. Table 3-2 summarizes this process as it applies to the different waveforms.

Table 3-2: Defining and displaying waveforms

Waveform ¹	To define:	To turn on:
Channel: C1 - C8	Install sampling modules in the instrument compartments.	Push the Vertical CH button, and then push one of the numbered buttons 1 - 8.
Reference: R1 - R8	<p>Define an active reference waveform by:</p> <ul style="list-style-type: none"> ■ saving a channel, reference, or math waveform to one of locations R1 - R8. ■ recalling a waveform previously saved to a file into one of locations R1 - R8. <p>Both of these operations can be performed from the File menu.</p>	<p>Defining a reference waveform as is described at left turns on its display.</p> <p>After a waveform is defined, use the Vertical REF button with the waveform number buttons to turn the waveform on and off.</p>
Math: M1 - M8	<p>Define a math waveform using existing sources (channel and reference waveforms, and measurement scalar values).</p> <p>This operation can be performed by selecting the Edit menu and then selecting Define Math.</p>	<p>When defining a math waveform, you turn it on in the Define Math dialog box.</p> <p>After the waveform is defined, use the Vertical MATH button with the waveform number buttons to turn the waveform on and off.</p>

¹ The waveform number buttons affect C1-C8, R1-R8, or M1-M8, depending on the Vertical Source button you push CH, REF, or MATH.

Operations on Selected Waveforms. In general, the method of adjusting (vertically scaling, offsetting, position, and so on) is from the front panel: select the waveform using the Vertical source and waveform selection buttons, and then adjust it using the Vertical Scale, Offset, and Position knobs.

Table 3-3 on page 3-57 summarizes operations you can perform for the three waveform types.

Table 3-3: Operations performed based on the selected waveform

Control function	Waveform supports?			Operating notes
	Ch	Ref	Math	
Vertical Scale	Yes	Yes	Yes	If more than one time base is displayed, these controls adjust the <i>selected</i> channel waveform in all time bases. Vertical offset is unavailable for channel waveforms displayed with rho or ohm units.
Vertical Position	Yes	Yes	Yes	
Vertical Offset	Yes	No	No	
Horizontal Scale	Yes	No	No	All channel waveforms are adjusted globally in the selected time base. Math waveforms are not adjusted because their horizontal parameters are derived from their sources. Reference waveforms are not adjusted because they have fixed horizontal parameters determined at the time the waveform was saved.
Horizontal Position	Yes	No	No	
Horizontal Record Length	Yes	No	No	
Automatic Source Selection for Automatic Measurements	Yes	Yes	Yes	Measurements, if selected from Measurements toolbar, use the selected waveform as the measurement target.
Automatic Target Selection for Cursors	Yes	Yes	Yes	If cursors are off, pushing the Cursor button on the front panel turns cursors on with the selected waveform as their target.
Quick Horizontal Scale Adjust (Zoom)	Yes	No	No	Dragging a box around a portion of the selected waveform adjusts horizontal scale to fill the screen with the boxed portion (see <i>Quick-adjust the time base</i> on page 3-63).

Graticules. One graticule is displayed for the Main time base, and an additional graticule is displayed for each Mag time base that you turn on. Figure 3-16 on page 3-54 shows the elements of the time base graticules; the elements are the same for each time base displayed.

Using Multiple Views. The methods of displaying (turning on) and selecting any time base view follow:

- *Turn the view on:* Press the Mag1 or Mag2 front-panel button once to turn on the Mag1 or Mag2 time base. The Main view is always (displayed); you cannot turn it off. Turning on a time base makes it active (selects it for adjustment).
- *Select among displayed views:* Press any time base view button to make it the active, selected time base. The button of the selected view is always lit amber.
- *Turn off the selected Mag view:* Once selected, press the Mag1 or Mag2 button to turn off the time base. The Main time base becomes the selected time base.

Operations on the Selected Time Base View. The method of adjusting (horizontal scaling and positioning, setting resolution/record length, and so on) is from the front panel: select the time base using the Horizontal time base selection buttons,

and then adjust it using the Horizontal Scale, Resolution, and Position knobs. Only channel waveforms can have their horizontal parameters set directly.

Table 3-3 shows how horizontal operations relate to the waveform types; the key points to remember follow:

- As Table 3-3 shows, horizontal operations affect all channel waveforms, but in the selected view only. For example, you can select each time base in turn and set one horizontal scale for all channel waveforms in the Main view, another horizontal scale for those in the Mag1 view, and a third for those in the Mag2 view.
- The instrument displays a reference waveform with horizontal settings in effect at the time it was saved. You cannot adjust these settings; the instrument disables the horizontal controls when you select a reference waveform. See *Saving and Recalling Waveforms* on page 3-120 for more information on reference waveforms.
- The instrument displays a math waveform with the horizontal settings derived from its math expression. You cannot change these directly; the instrument disables the horizontal controls when you select a math waveform. See *Creating Math Waveforms* on page 3-101 for more information on math waveforms.
- All waveforms in each time base are displayed fit-to-screen; that is, within the full 10 horizontal divisions that the graticule provides.

Waveform Operations that Cross Time Base Views. Unlike the horizontal controls just described, some controls apply to all time base views:

- Turning a waveform on or off in any view displays or removes it from all views.
- Selecting a waveform in any view makes it the selected waveform in all views; for example, select C1 in Main, and then select Mag1. C1 is the selected waveform in Mag1. Turn on Mag2, and Mag2 displays on screen with C1 selected.
- Vertical adjustments on a waveform in any time base adjust the waveform in all time bases.

Display Controls vs. Acquisition Controls. For channel waveforms, the vertical offset control and the horizontal controls you set adjust the instrument acquisition parameters. See the following descriptions for more information:

- *Vertical Acquisition Window Considerations* on page 3-14
- *Horizontal Acquisition Window Considerations* on page 3-17

Mag1 and Mag2 are Magnifying Timebases. The Mag1 and Mag2 time bases are so named because they cannot be set to a more coarse (slower) horizontal scale than that of the Main. When set to a more fine (faster) horizontal scale, they can be thought of as magnifying a segment of the Main time base. In short:

- each Mag time base scale sets the size of an aperture on the Main time base.
- each Mag time base position setting locates the aperture within the Main time base.
- each Mag time base graticule displays, across its full horizontal width (10 divisions), the contents of the aperture.

See *To Display Waveforms in a Mag View* on page 3-64 for a procedure that demonstrates this operating characteristic.

Horizontal Position and the Horizontal Reference. The time values you set for horizontal position are from the trigger point to the horizontal reference point. This is not the time from the trigger point to the start of the waveform record unless you set the horizontal reference to 0%. See Figure 3-17.

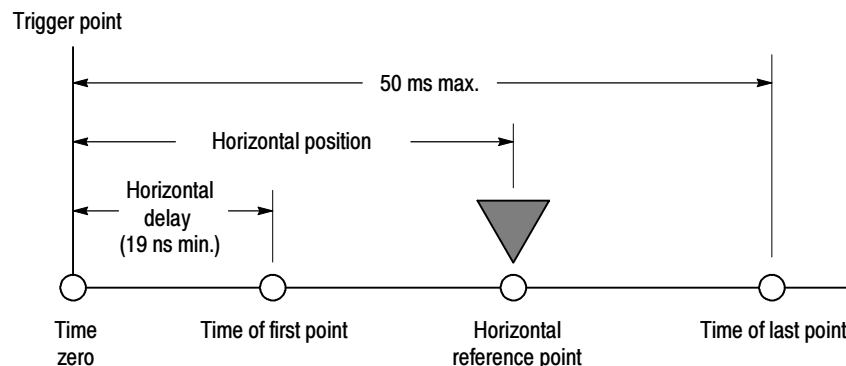


Figure 3-17: Horizontal position includes time to Horizontal Reference

NOTE. *The time from the trigger to the time of the first point sampled is the horizontal delay. Note that horizontal delay is set indirectly by the horizontal position and horizontal reference settings:*

$$\text{Time of first point} = \text{Horizontal Position} - (10 \text{ divs} \times \text{horizontal scale in sec/div} \times \text{Horizontal Reference} / 100)$$

Horizontal Units. You can specify the time values in seconds, bits or distance from the Horizontal Setup dialog box. When you select Distance as the timebase units, the timebase scale and position controls and the readouts use (appear with) distance units. You can select from meters, feet, or inches as your distance unit. The timing measurement results remain as seconds.

The dialog box also provides a Dielectric Const(ant) and Prop(agation) Velocity controls with which you can select either the effective dielectric constant of the device under test or its propagation velocity (they interact, so set one or the other). Distance units and these other two controls are useful when doing TDR measurements and testing. You may want to turn on distance units and set the dielectric constant or propagation velocity when making such measurements.

The formula is:

$$D = v_p T$$

where: $D = \text{distance per division}$

$$v_p = \text{propagation velocity,} = \frac{c_o}{\sqrt{\text{DielectricConst}}}$$

$$c_o = \text{speed of light in a vacuum,} = 2.997925 \text{ e8 meters/s}$$

$$T = \text{time per division}$$

Velocity of Propagation (v_p) is a measure of how fast a signal travels in that transmission line.





DielectricConst is the relative effective dielectric constant of the propagation media.



Mouse and Touchscreen Operation. This instrument ships with a mouse and keyboard to give you more options for instrument control. However, for some installations, you might not have sufficient work space to install the mouse or keyboard. For most operations, you can use the touchscreen instead.


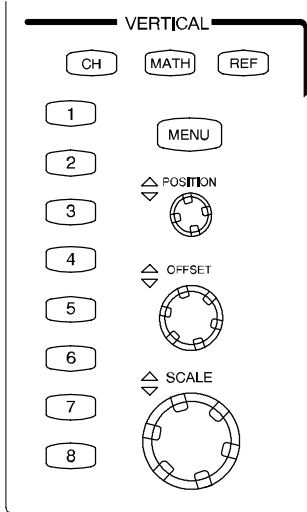
Table 3-4 lists some operations and the mouse/touchscreen equivalents. The instrument ships with two styluses. Using a stylus can make it easier to perform touchscreen operations.

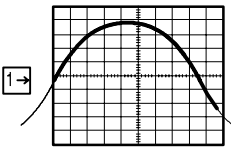
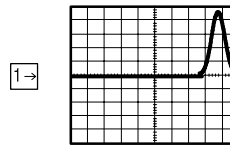
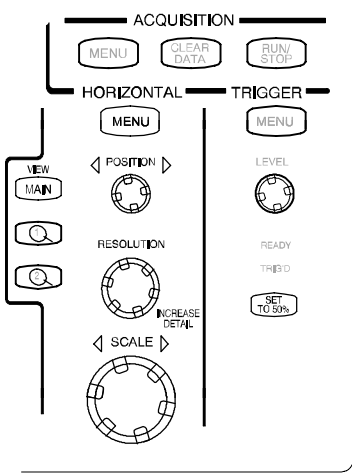

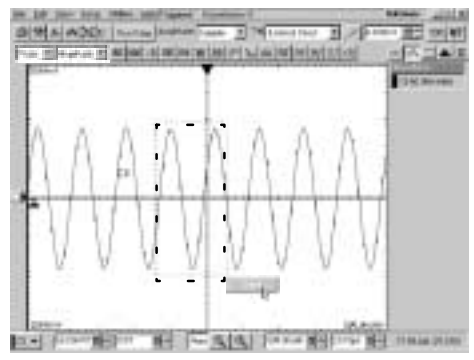
Table 3-4: Equivalent mouse and touchscreen operations


Operations	Mouse	Stylus or finger
Select waveforms Push toolbar and dialog box buttons Display menus and select menu items Activate list boxes	Left click object on screen	Touch object on screen
Position cursors on screen, draw a zoom box	Left click and drag	Touch and drag
Display a pop up menu for a channel or a readout	Right click object	Touch and hold (don't move stylus)
Type a value in a list box	Click the keyboard icon to pop up the virtual keyboard; click to type in the value you want (or use the peripheral keyboard if installed)	Touch the keyboard icon to pop up the virtual keyboard; touch to type in the value you want
Display a tool tip	Rest pointer over UI button or label	None
Display What's This Help	Click the appropriate button (see below), and then click a control in the UI application  main screen button  dialog box button	Touch the appropriate button (see below), and then touch a control in the UI application  main screen button  dialog box button

To Display Waveforms in the Main Time Base View

Use the procedure that follows to become familiar with the display adjustments you can make.

Overview	To control the Main view	Related control elements and resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. The instrument must be installed with sampling modules in place. 2. The acquisition system should be set to run continuously. 3. Also, an appropriate trigger signal must be applied to the instrument and triggering must be set up. 	 <p>See the sampling Module user manuals for sampling module installation. See page 3-24 for acquisition setup and page 3-48 for trigger setup in this manual.</p>
<p>Set the vertical display parameters</p>	<ol style="list-style-type: none"> 4. Push a Vertical Source button (turns amber) to assign the numbered buttons 1-8 to operate on channel, reference, or math waveforms. Push a numbered button 1-8 to select the waveform (it displays). <p>A waveform button lights when its waveform is on:</p> <ul style="list-style-type: none"> ■ Lighted green: waveform is on but not selected ■ Lighted amber: waveform is on <i>and</i> selected <p>Hint. Step 4 assumes any reference or math waveforms you select are defined. See Table 3-2 on page 3-56 if you need help defining these waveforms.</p> 5. Use the Vertical knobs to achieve a good display of each waveform you select. 	 <p>The diagram shows a control panel labeled 'VERTICAL'. At the top are three buttons: 'CH', 'MATH', and 'REF'. Below them are eight numbered buttons (1-8) arranged in a vertical column. To the right of these buttons are three knobs: 'MENU' (top), 'POSITION' (middle), and 'SCALE' (bottom). Each knob has a circular dial with a pointer and a small square marker. The 'POSITION' knob has a vertical double-headed arrow to its left. The 'OFFSET' knob (labeled 'OFFSET' in the diagram) is located between the 'POSITION' and 'SCALE' knobs and also has a vertical double-headed arrow to its left.</p>


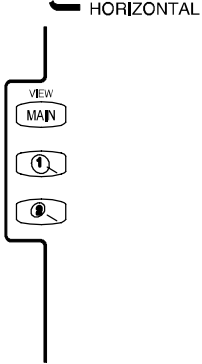
Overview	To control the Main view (cont.)	Related control elements and resources
<p>Set the horizontal display parameters</p>	<p>6. Push the View Main button to make sure the Main time base view is selected. Use the Horizontal knobs to scale and position the waveform on screen and to set sample resolution.</p> <div style="display: flex; justify-content: space-around; align-items: flex-start;"> <div style="text-align: center;"> <p>Scaled Horizontally</p>  </div> <div style="text-align: center;"> <p>Positioned Horizontally</p>  </div> </div> <p>The Resolution knob sets the record length. (See discussion on page 3-19.)</p> <p>Push the Set to 50% button if required to stabilize display.</p>	
<p>Adjust the Horizontal Reference</p>	<p>7. To adjust the point around which the waveforms expand and contract, click the Horizontal reference and drag it left or right on screen.</p> <p>Move the Horizontal reference along the horizontal axis until it aligns to the point on the waveform you want to be stationary on screen.</p> <p>8. Release the Horizontal reference, and then adjust the Horizontal Scale knob.</p>	
<p>Quick-adjust the time base (Zoom)</p>	<p>9. To quickly rescale a portion of a channel waveform so it expands to fill the 10 divisions on screen. Click on the screen and drag a box around the portion of the waveform you want to zoom.</p>	

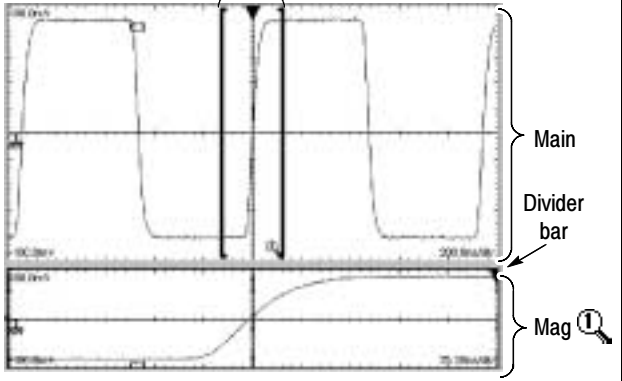
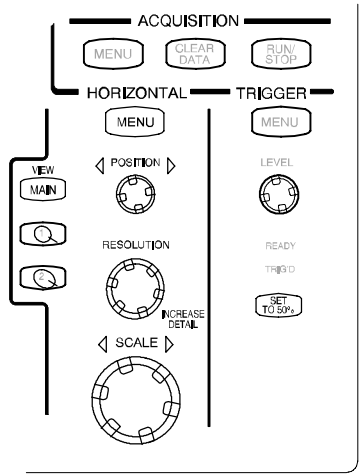


Overview	To control the Main view (cont.)	Related control elements and resources
<p>Explore the Mag time base controls</p>	<p>10. The next procedure describes how to set up and control the Mag time bases.</p>	<div style="text-align: center;">  <p>See <i>To Display Waveforms in a Mag View</i> on page 3-64.</p> </div>

End of Procedure

To Display Waveforms in a Mag View

Use the procedure that follows to become familiar with the display adjustments you can make when using the Mag 1 and Mag 2 time base views.

Overview	To control a Mag view	Related control elements and resources
<p>Prerequisites</p>	<p>1. Set up as from the last procedure. See right.</p>	<div style="text-align: center;">  <p>See <i>To Display Waveforms in the Main Timebase</i> on page 3-62.</p> </div>
<p>Turn on a Mag view</p>	<p>2. Push the Mag1 or Mag2 View button (turns amber) to display a Mag view. (See right.)</p> <p>A numbered button lights when its waveform is on:</p> <ul style="list-style-type: none"> ■ Lighted green: view is on but not selected ■ Lighted amber: view is on and selected <p>Tip. Drag the divider bar between the two views to adjust the display height between them. See the figure in step 3.</p>	<div style="text-align: center;">  </div>

Overview	To control a Mag view (cont.)	Related control elements and resources
<p>Set horizontal display parameters</p>	<p>3. Use the Horizontal knobs (see right) to achieve a good display of the waveform in the Mag time base.</p> <p>Time base settings for Channel waveforms will be adjusted as you use the controls; the controls will be inoperable if you have a reference or a math waveform selected.</p> <p>Note that the Mag1 markers enclose a segment of Main view that appears across the 10 division width of the Mag view. See below.</p> <p>Portion magnified in the Mag1 time base view</p> 	
<p>For more information</p>	<p>4. Press the Horizontal Menu front-panel button. Click the  icon in the the upper-right corner of the Horiz Setup dialog box, and then click any dialog-box control to pop up help on that control.</p> <p>5. Click the Help button in the Horiz Setup dialog box to access a context-sensitive overview on the horizontal controls and their set up.</p>	 <p>See <i>Accessing Online Help</i> on page 3-167 for an overview of the online help system.</p>

End of Procedure

Customizing the Display

Why Use? Use the display customizing features this instrument provides to present the display elements—color, graticule style, waveform representation, and so on—according to your preferences.

What’s Special? Color grading. You can select color grading of a waveform so that its data color or intensity reflects the frequency of occurrence of the data.

Keys to Using The key points that follow describe operating considerations for setting up the the display system so that it presents waveforms and other display elements.

Display Settings. Table 3-5 lists display attributes that you can set and where they are accessed.

Table 3-5: Customizable display attributes

Display attribute	Access		Options	
	Menu name ¹	Entry		
Graticule Style	Utility	User Preferences	Choose from Full, Grid, Cross-hair, and Frame styles.	
	Setup	Display		
Display Mode	Utility	User Preferences	Choose from Normal, Infinite Persistence, and Variable Persistence Modes.	
	Setup	Display		
Show Vectors (normal display mode only)	Utility	User Preferences	Choose No to display each waveform as a series of dots.	
	Setup	Display	Choose Yes to display vectors or lines between the dots.	
Waveform Label	Shortcut	Properties	Enter a new label for the waveform you have selected.	
	Utilities	Waveform Prop's		
Waveform Color	Utility	Waveform Prop's	Choose from six different colors for each waveform; choose from 16 different colors for a cursor, graticule, histogram, or mask.	
	Shortcut	Properties		
Cursor Colors	Setup	Cursors		
Graticule Colors	Setup	Display		
Histogram Color	Setup	Histogram		
Mask Color	Setup	Mask Test		
Waveform Color Grading	Shortcut	Color Grading		Choose to display a waveform with its data color graded based on its frequency of occurrence. See <i>Color grade a waveform</i> on page 3-70.
Virtual Keyboard	Utility	User Preferences		Choose from alphabetic or QWERTY styles.

¹ Except for “Shortcut,” the Menu Names refer to the menus found in the Menu bar at the top of the instrument screen. The shortcut menu for a waveform can be displayed by right clicking on a displayed waveform or on its icon, which is displayed in the waveform bar (left of the graticule).

Normal and Persistence Displays. Use display persistence to control how waveform data ages:


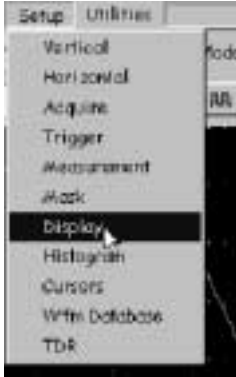
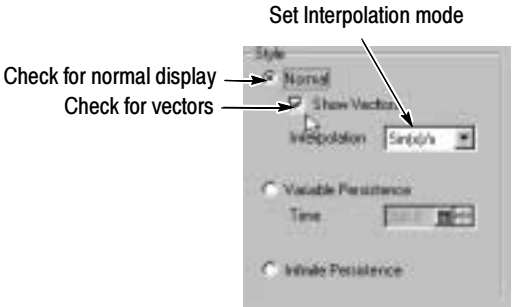
- Normal style displays waveforms without persistence: each new waveform record replaces the previously acquired record for a channel. You can choose to display normal waveforms as vectors, which displays lines between the record points, or dots (vectors off) which displays the record points only. You can also choose an interpolation mode. See *Interpolation* below.
- Variable Persistence style accumulates the waveform-record points on screen and displays them for a specific time interval. The oldest waveform data continuously fades from the display as new waveform records acquire.
- Infinite Persistence style accumulates the data record points until you change some control (such as scale factor) or explicitly clear the data, causing the display to be erased. Waveform data builds up as new data records acquire.

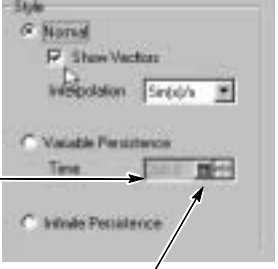

Persistence style applies to all waveforms, except for channel waveforms and reference waveforms displayed with color or intensity grading.

Interpolation. For record lengths of less than 500 points, you can choose to have the instrument interpolate between the sampled points it acquires. Interpolation affects the display only; mask testing, histograms, and automatic measurement results are based on acquired, not interpolated, data. There are three options for interpolation:

- Sin(x)/x interpolation computes record points using a curve-fit between the actual values acquired. The curve-fit assumes all the interpolated points fall along that curve. Sin(x)/x interpolation is particularly useful when acquiring more rounded waveforms, such as sine waves. Sin(x)/x interpolation may introduce some overshoot or undershoot in signals with fast rise times.
- Linear interpolation computes record points between actual acquired samples by using a straight-line-fit. The straight-line-fit assumes all the interpolated points fall in their appropriate point in time on that straight line. Linear interpolation is useful for many waveforms such as pulse trains.
- None turns interpolation off. Only points actually sampled appear in the displays of waveform records.

To Set Display Styles Use the procedure that follows to become familiar with the display styles you can set.


Overview	To set display styles	Related control elements and resources
<p>Prerequisites</p>	<p>1. The instrument must be powered up, with any waveform you want to display on screen.</p>	 <p>See page 3-24 for acquisition setup and page 3-48 for trigger setup.</p>
<p>Access the Display setup dialog box</p>	<p>2. From the application menu bar, select Setup, and then select Display. See right.</p>	
<p>Select normal style, vectors, and interpolation</p>	<p>3. From the Display Setup dialog box (see right) , choose Normal to select a display with no acquisition data persistence.</p> <p>Waveforms display with the new data from ongoing acquisitions replacing that data in the same time intervals/slots but acquired as part of the last, previous waveform.</p> <p>4. Check Vectors to turn on display lines between waveform dots; uncheck to display only dots.</p> <p>5. Select an Interpolation mode from the pulldown list. Choose from Sin(x)/x, Linear, or None.</p>	

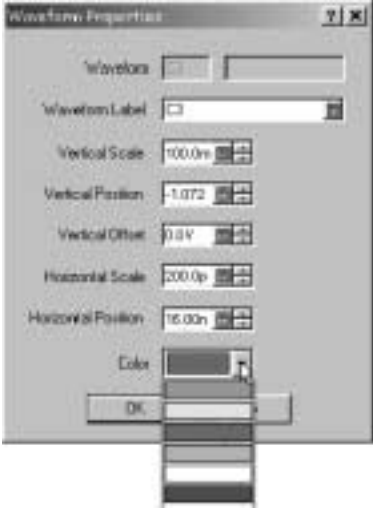

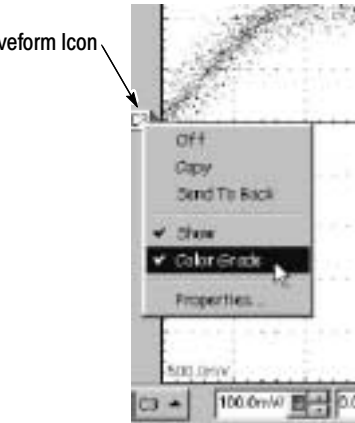
Overview	To set display styles (cont.)	Related control elements and resources
<p>Select a persistence Mode</p>	<p>6. From the the Setup Display dialog box (see right), choose:</p> <ul style="list-style-type: none"> ■ Infinite Persistence to make data persist until you change some control (such as scale factor) or explicitly clear the data. Waveform displays accumulate data as new waveform records acquire, resulting in a build up of data in all time slots. ■ Variable Persistence to make data persist for a specified time. New waveform displays accumulate data as new waveform records acquire, but with continuous replacement of the oldest data. <p>If you select Variable Persistence, set a time at which the oldest data is removed.</p>	 <p>Set variable persistence time</p> <p>Access to virtual keyboard</p>
<p>Continue with the next procedure</p>	<p>7. For more ways to customize the display, see the next procedure.</p>	 <p>See <i>To Customize Graticule and Waveforms</i> on page 3-69.</p>



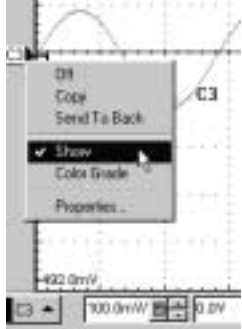




End of Procedure

To Customize the Graticule and Waveforms

Use the procedure that follows to become familiar with the display adjustments you can make.

Overview	Customizations you can make	Related control elements and resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. Display the waveforms to be measured on screen. The waveform may be a channel, reference, or math waveform. 2. If the source to be measured is in the Mag1 or Mag2 view, turn that view on. 	 <p>See page 3-24 for acquisition setup and page 3-48 for trigger setup.</p>

Overview	Customizations you can make (cont.)	Related control elements and resources
<p>Change waveform color or label</p>	<ol style="list-style-type: none"> Right click on the waveform or its icon. See right. Choose Properties from the menu that pops up. Type a new name in the Waveform Label box. The instrument will use the new label to mark the selected waveform in the graticule area.  <ol style="list-style-type: none"> Choose a color from the Color pulldown list. Click OK to dismiss the dialog. 	<p>Waveform Icon</p> 
<p>Color grade a waveform</p>	<ol style="list-style-type: none"> Right click on the channel waveform or its icon. See right. Choose Color Grade from the menu that pops up. <p>Color grading a waveform is one of several instrument operations that uses a waveform database. There are four available, so no more than four waveforms can be color graded at the same time.</p>	<p>Waveform Icon</p> 

Overview	Customizations you can make (cont.)	Related control elements and resources
<p>Reduce a waveform to its icon</p>	<p>9. Right click on the waveform or its icon. See right.</p> <p>10. Choose Show from the menu that pops up to toggle the waveform between shown (checked) and hidden (unchecked).</p> <p>Tip. Hiding a waveform is useful when you temporarily want to remove the display of a waveform without turning it off. Hidden waveforms change their waveform icons (in the Waveform bar left of screen) as shown:</p> <div style="display: flex; justify-content: space-around; align-items: center;"> <div style="text-align: center;">  <p>Waveform shown</p> </div> <div style="text-align: center;">  <p>Waveform hidden</p> </div> </div>	
<p>Change graticule style and color</p>	<p>11. From the application menu bar, select Setup, and then select Display. See right.</p> <p>12. Use the graticule controls to select a graticule style.</p> <p>13. Select the color of the screen from the Background pulldown list. Select the color of the graticule from the Foreground pulldown list.</p> <p>14. Click the  button to close the Setup Display dialog box.</p>	
<p>For further assistance</p>	<p>15. Click the  icon in the the upper-right corner of the Display Setup dialog box, and then click any dialog-box control to pop up help on that control.</p> <p>16. Click the Help button in the Display Setup dialog box to access a context-sensitive overview of the display controls and their set up.</p>	<div style="text-align: center;">  <p>See <i>Accessing Online Help</i> on page 3-167 for overview of the online help system.</p> </div>

End of Procedure

Measuring Waveforms

To assist you in analyzing the waveforms you acquire, the instrument comes equipped with cursors and automatic measurements. This section describes these tools and how you use them:

- *Taking Automatic Measurements*, on page 3-74, describes how you can set up the instrument to automatically measure and display a variety of waveform parameters. See Figure 3-18.
- *Taking Cursor Measurements*, on page 3-85, describes using cursors to make amplitude and time measurements on waveforms. See Figure 3-18.
- *Optimizing Measurement Accuracy*, on page 3-92, tells you how to run compensation routines and deskew channels to optimize the accuracy of your measurements.

NOTE. You can also make graticule measurements, counting graticule divisions and multiplying them by the vertical or horizontal scales set for the waveform you are measuring.

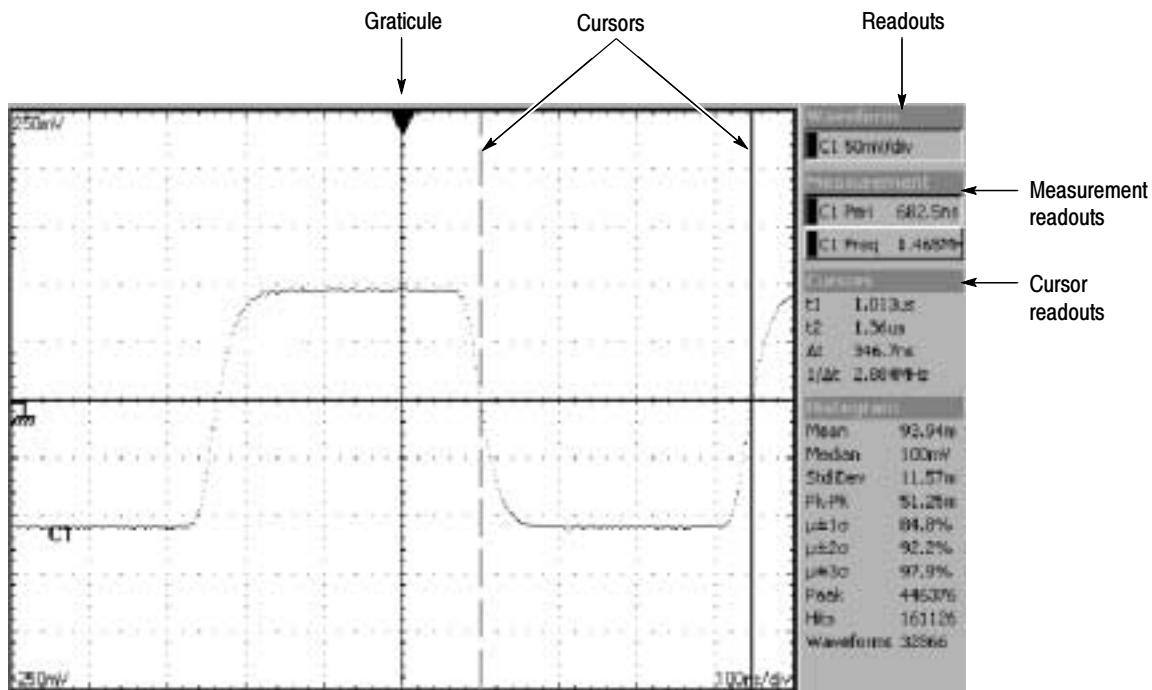


Figure 3-18: Graticule, cursor and automatic measurements

Taking Automatic Measurements

Why Use? This powerful and flexible tool provides automatic extraction of various parameters from the waveforms that this instrument acquires. Automated measurements quickly give you immediate, continuously updating, measurement results for a rich selection of waveform parameters, such as risetime or extinction ratio. You also can display statistics on how the measurement results vary as they continuously update. See *What's Excluded* on page 3-76 for information on the ??? indicator when measuring waveform parameters.

What's Measured? You get to choose:

- Most automatic measurements require both a source selection and a measurement selection. To quickly select a measurement, use the measurement toolbar to first set the waveform type, Pulse, RZ, or NRZ, and then select a category, Amplitude, Timing, or Area, in the pulldown lists of the toolbar. Next, click the icon of the measurement that you want to use to measure the selected waveform (or drag the icon to any waveform, selected or not, on screen to measure that waveform). The results appear in the measurements readout at the right of the screen. See the procedure that starts on page 3-80.
- Select from the extensive range of parameters this instrument can measure; for a list, see *Appendix B: Automatic Measurements Supported*. This section of the manual defines the supported measurements (selections) for each category.
- Feed the entire waveform to a measurement or limit the measurement to a segment of the waveform. By default, the instrument takes each automatic measurement over the entire waveform record, but you can use measurement gates to localize each measurement to the section of a waveform (see *To Localize a Measurement* on page 3-83).
- Select from these measurement sources: channel, reference, and math waveforms, and waveform databases 1 through 4.

What's Special? This instrument implements a robust automatic measurement system. Some of the features adding value to this system follow.

Annotate Waveforms On Screen. You can turn on annotations that mark characterization levels that each measurement uses to compute results. See Figure 3-19.

Annotations indicate the waveform region determining measurement

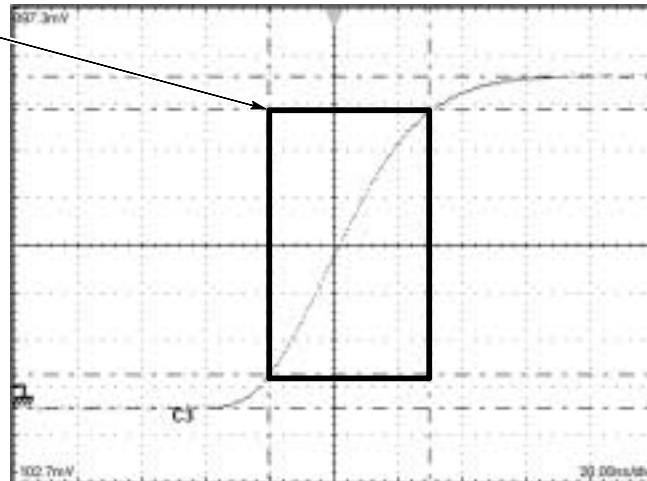


Figure 3-19: Measurement annotations on a waveform

Use Databases as Sources. If you define the source you want to measure as a database in the Meas Setup dialog box, you can use the database of that waveform as source. The measurement you select operates on the accumulated waveform data (databases accumulate repetitive instances of a source waveform over time).

For example, consider the Max measurement. Max will capture and update the maximum (most positive) value encountered. For a database source, the ongoing Max measurements can only result in a higher max value as the database accumulates ongoing acquisitions. This process causes the Max measurement readout to track max up but not down. In contrast, the Max measurement for a waveform source not included in a database will track variation up and down as new waveforms are acquired.

Characterize Measurements Independently. To allow you control over how your waveform data is characterized by each measurement, the instrument lets you set the methods used independently for each measurement. See *High/Low Tracking Method* on page 3-77 and *Reference Levels Method* on page 3-79.

See Statistics on Measurement Results. To see how any automatic measurement varies statistically, you can display a readout of the Min, Max, Mean, and Standard Deviation the measurement results. See step 6 on page 3-81 for instructions. See also the following topic for information about questionable measurements.

What's Excluded?

The following exclusions apply when using automatic measurements:

- More than eight measurements at one time are not allowed.
- Except for Average Optical Power, all measurements of the category RZ or NRZ must be performed on a waveform database (see *Use Databases as Sources* on page 3-75). The Average Optical Power measurement cannot use a waveform database as its source.
- The Average Optical Power measurement cannot display Annotations (see page 3-74) and cannot use gates or user-defined High/Low methods (see page 3-77).
- If the waveform parameter that is to be automatically measured cannot be acquired (incorrect control setup, out-of-range input signals), this instrument displays the indicator “???” For example, if the instrument acquires less than a full waveform cycle, it cannot measure frequency or period and displays ???.

Keys to Using

The key points that follow describe operating considerations for setting up automatic measurements to obtain the best measurement results.

Measurement Selection. The instrument takes automatic measurements of the following categories: Amplitude, Timing, and Area. Check *Appendix B: Automatic Measurements Supported* for a listing of the measurements that you can choose from in each signal type category.

Number of Measurements. The instrument can take and update up to eight measurements at one time. You can apply measurements to any combination of sources (described below). You can take all eight measurements on C1, for example, or one measurement each on C1 - C8.

Measurement Sources. All channel, reference, and math waveforms can serve as sources for automatic measurements. You can also measure any of the four waveform databases that the instrument supports. You can specify a waveform as source in the Meas Setup dialog box even if the waveform is not displayed.

Some measurements, such as Gain, Delay, and Phase, require two sources. For example, Gain would be used to measure an input from one measurement source (such as C1) with respect to an output in another source (such as C2).

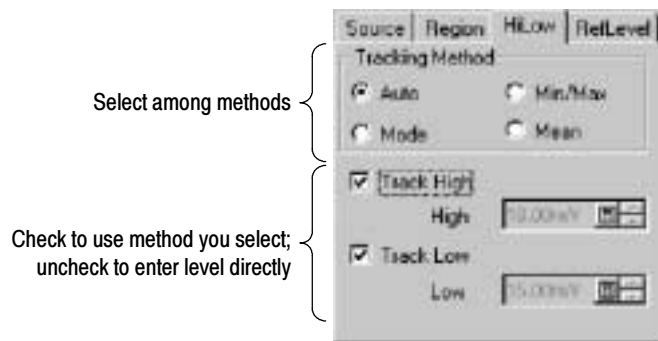
Databases as Sources Behavior. Consider the following operating behaviors regarding measurements and databases:

- When enabling a measurement, it will always measure the waveform database *if* the measurement source you choose is currently displayed as a

waveform database. You can measure the waveform instead of its database if you turn off Use Wfm Database in the Meas setup dialog box.

- If you assign a database to a waveform already being used as a source for an automatic measurement, it will not automatically measure the waveform database; you must explicitly specify its use by turning on Use Wfm Database in the Meas Setup dialog box.

High/Low Tracking. The levels that the automatic measurement system derives as the High (Top) or Low (Bottom) for a waveform influence the fidelity of amplitude and aberration measurements. For many of the automatic measurements supported, the instrument automatically determines these levels and disables all or some of the High/Low tracking method controls (for example, RMS). If the measurement you select has High/Low methods that are appropriate to adjust (or example, RISE time), the instrument automatically enables the method controls for your adjustment as shown below.



High/Low Tracking Method. Depending on which measurement you select, High, Low, or both, tracking will be enabled with their boxes checked as shown above. You can select among the several modes the instrument provides for determining these levels:

- *Mode (of Histogram)* sets the values statistically. Using a histogram, it selects the most common value either above or below the midpoint (depending on whether it is defining the high or low reference level). Since this statistical approach ignores short term aberrations (overshoot, ringing, and so on), Mode is the best setting for examining pulses. See Figure 3-20.

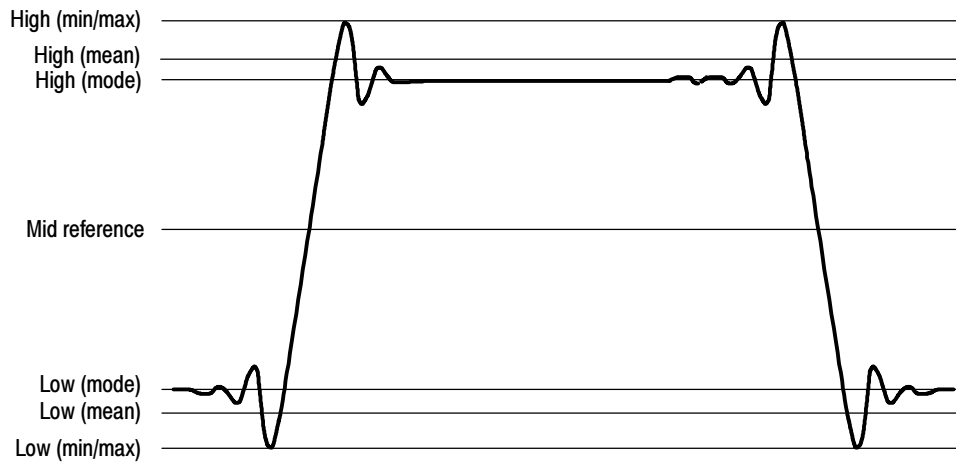


Figure 3-20: High/Low tracking methods

- *Mean (of Histogram)* sets the values statistically. Using a histogram, it selects the mean or average value derived using all values either above or below the midpoint (depending on whether it is defining the high or low reference level). This setting is best for examining eye patterns and optical signals. See Figure 3-20.
- *Min-max* uses the highest and lowest values of the waveform record. This setting is best for examining waveforms that have no large, flat portions at a common value, such as sine waves and triangle waves — almost any waveform except for pulses. See Figure 3-20.
- *Auto* switches between methods. Auto method first attempts to calculate the high and low values using the Mode method. Then, if the histogram does not show obvious consistent high and low levels, Auto method automatically switches to the Min/Max or Mean method.

For example, the Mode histogram operating on a triangle wave would not find consistent high and low levels, so the instrument would switch to the Min/Max mode. Consistent high and low levels would be found on a square wave, so the Auto mode would use the Mode method.

When setting High/Low method, be aware of these operating behaviors:

- The tracking settings are not global; that is, you can independently set the method used for each of Meas 1 - Meas 8.
- You can turn off tracking for either or both the High and Low levels and enter them directly.
- Not all tracking methods are appropriate for all measurements. If you cannot set the tracking method, the controls will be disabled.

Reference Levels Method. You can choose the method that the instrument uses to determine a second group of levels when taking time-related measurements. These levels are the High, Mid, and Low references. For example, the measurement system takes risetime from the waveform-edge segment that transitions from the Low to the High reference levels.

The instrument provides the following calculation methods; refer to Figure 3-21 as you read about each method:

1. *Relative Reference* is calculated as percentage of the High/Low range.
2. *High Delta Reference* is calculated as absolute values from the High Level.
3. *Low Delta Reference* is calculated as absolute values from the Low Level.
4. *Absolute Reference* is set by absolute values in user units.
5. *AOP* (not shown) measures the Average Optical Power of the waveform and uses it as the Mid Ref level. See *Pulse Crossings and Mid-reference Level AOP* on page B-58 for more information.

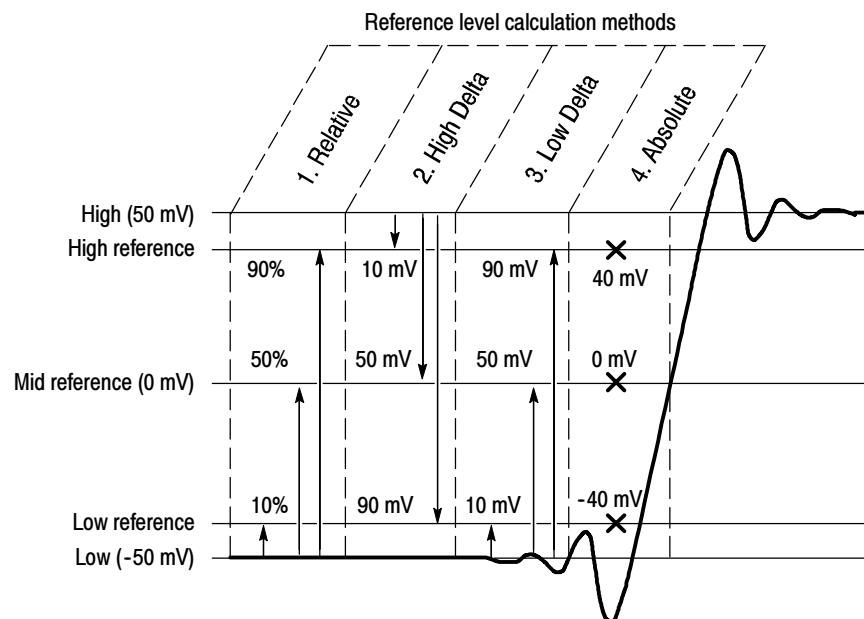


Figure 3-21: Reference-level calculation methods

The High and Low levels from which the reference levels are calculated in methods 1 - 3 above are the levels established using the selected High/Low tracking method described in *High/Low Tracking Method* on page 3-77.

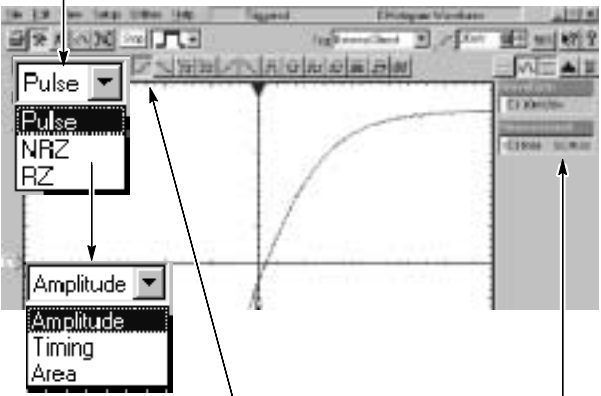

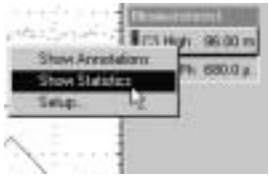
The AOP method is the Average Optical Power reference level. This reference level selection is best used when taking the Optical Modulation Amplitude (OMA) measurement on a pulse waveform. (The AOP setting is ignored for NRZ waveforms.) This method is selected by default when measurement type is set to OMA. See the OMA measurement on page B-5.


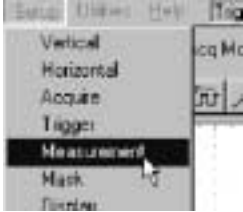

Default Methods. The waveform-characterization methods just covered—the High/Low-tracking and the reference-level-calculation methods used—can be set for each measurement and its waveform source in the Meas Setup dialog box. If you do not set the methods individually, the instrument uses its default characterization methods.

To Take Automatic Measurements

Use the procedure that follows to quickly take a measurement based on the default settings for High/Low method and for reference-level method.

Overview	To take automatic measurements	Related control elements and resources
<p>Prerequisites</p>	<p>1. The instrument must display the waveform to be measured on screen.</p>	<div data-bbox="1149 968 1240 1087" data-label="Image"> </div> <p>See page 3-24 for acquisition setup and page 3-48 for trigger setup.</p>
<p>Select the waveform</p>	<p>2. Use the Vertical buttons to select the waveform to be measured.</p> <p>The waveform may be a channel, reference, or math waveform.</p>	<div data-bbox="1052 1230 1338 1444" data-label="Image"> </div>


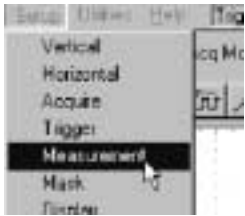
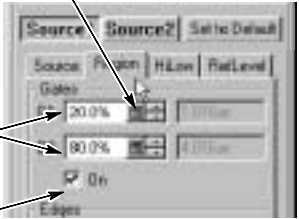
Overview	To take automatic measurements (cont.)	Related control elements and resources
<p>Take Automatic measurements</p>	<p>3. Select one of the signal (waveform) types and then select a category from the measurement bar.</p>  <p>4. Click the measurement you want in the measurement tool bar.</p> <p>5. Read the results in the measurements readout.</p> <p>Tip. To show the levels (see page 3-74) on which your measurement is based, turn on Annotations: Right click on measurement in the readout, and select Show Annotations from the menu as shown at right.</p>	
<p>To see statistics</p>	<p>6. Right click on any measurement readout to display its context menu.</p> <p>7. Select Show Statistics to display measurement statistics in the measurement readout. See What's Excluded on page 3-76 for information about the ??? indicator.</p>	

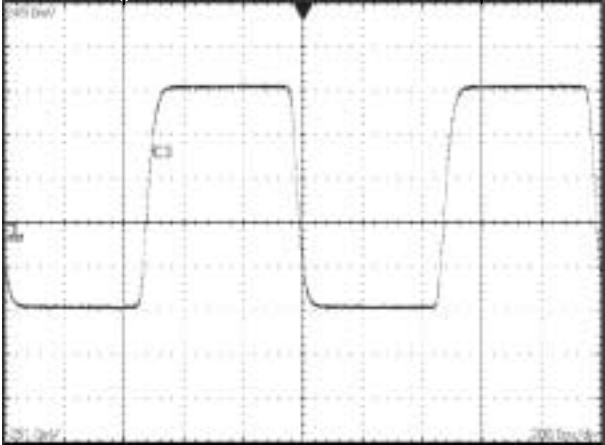
Overview	To take automatic measurements (cont.)	Related control elements and resources
<p>To measure a database</p>	<p>8. From the application menu bar, select Setup, and then select Measurement. See right.</p> <p>9. In the Meas Setup dialog box, make sure the measurement (one of Meas1 through Meas8) is selected.</p> <p>10. In the Source tab, check the Use Wfm Database option as shown below.</p>  <p>Tip. If, at the time you first create a measurement, the measurement source you select is displayed as a waveform database, the database will automatically be measured. Uncheck the User Wfm Database option if you want to measure the waveform instead of the database.</p>	
<p>For more information</p>	<p>11. Press the Help button in the Meas Setup dialog box to access the online help.</p> <p>12. See <i>Appendix B: Automatic Measurements Reference</i>, on page B-1 for a list of the measurements and their definitions.</p>	 <p>See page 3-167 to learn about using online help.</p>

End of Procedure

To Localize a Measurement

Use the procedure that follows to set gates on a measurement source, which forces the measurement to be taken over a segment of the waveform (otherwise, the entire waveform feeds the measurement).

Overview	To gate a measurement	Related control elements and resources
<p>Prerequisites</p>	<p>1. Set up as from last procedure.</p>	 <p>See <i>To Take an Automatic Measurement</i> on page 3-24</p>
<p>Access the gates</p>	<p>2. From the application menu bar, select Setup, and then select Measurement. See right.</p>	
<p>Enable and position the gates</p>	<p>3. Select the Region tab to expose the gate controls. Click to check the box as indicated at right to turn gating on and to display the gates on screen.</p> <p>4. If Annotations are not on, click the Annotations box, or the gates will not display.</p> <p>5. Use the G1 (Gate1) and G2 spin controls (or click and type in values-see right) to adjust the gates on screen such that the area to measure is between the gates.</p> <p>Tip. Values are entered as a % of the waveform, displayed from left to right. If no keyboard is installed, access the virtual keyboard and use the touch screen to enter values.</p>	<p>Access to virtual keyboard</p>  <p>Vary to position gates</p> <p>Check to display gates</p>

Overview	To gate a measurement (cont.)	Related control elements and resources
	 <p>The image shows a digital oscilloscope screen with a grid. A square wave signal is displayed. Two vertical arrows point to specific regions of the waveform, labeled 'Gate G1' and 'Gate G2'. Gate G1 is positioned over the first rising edge of the square wave. Gate G2 is positioned over the second rising edge. The signal is high during the pulses and low during the troughs.</p>	

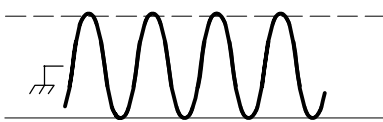

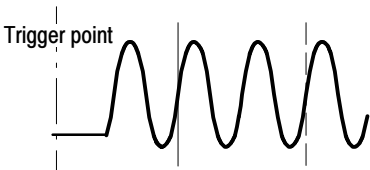

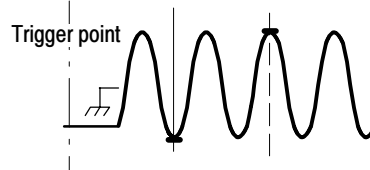

End of Procedure

Taking Cursor Measurements

Why Use? Use cursors to measure amplitude and time quickly and with more accuracy than when using graticule measurements. Because you position cursors wherever you want on the waveform, they are easier to localize to a waveform segment or feature than automatic measurements.

What's Measured? Time or amplitude or both. Vertical cursors measure time or bits on screen; horizontal cursors measure amplitude: voltage, watts, rho, or ohms; and waveform cursors measure both. Table 3-6 expands on these definitions.

Table 3-6: Cursor functions (types)

Cursor function	Parameter measured	Cursor readout
 <p>Horizontal cursors</p>	<p>Horizontal cursors measure amplitude (volts, watts). Each cursor measures with respect to:</p> <ul style="list-style-type: none"> ■ v1 = Level at Cursor 1 with respect to its source ground level ■ v2 = Level at Cursor 2 with respect to its source ground level ■ Δv = Level at Cursor 2 - Level at Cursor 1 <p>Level is cursor displacement from the source ground times the source volts/div. Note that the two cursors may have different sources and therefore can have different volts/div settings.</p>	
 <p>Vertical cursors</p>	<p>Vertical cursors measure distance (time in seconds or bits). Each cursor measures with respect to:</p> <ul style="list-style-type: none"> ■ t1 = Time at Cursor 1 with respect to the trigger point ■ t2 = Time at Cursor 2 with respect to the trigger point ■ Δt = Time at Cursor 2 - Time at Cursor 1 ■ $1/\Delta t = 1/(\text{Time at Cursor 2} - \text{Time at Cursor 1})$ <p>Time is divisions of displacement of the cursor from its source trigger point times the source time/div. Note that the two cursors may have different sources and, therefore, can have different time base (Main, Mag1, Mag2) settings.</p>	
 <p>Waveform cursors</p>	<p>Waveform cursors measure both voltage and time. Each cursor is, in effect, both a vertical and horizontal cursor. Neither of these paired cursors can be moved off the waveform.</p> <p>Note that sources can have different volts/div settings.</p>	

What Sources Can I Measure?

Cursors can measure channel, reference, and math waveforms, as well as waveform databases. You may set the source of each cursor explicitly in the Cursor Setup dialog box.

Keys to Using Cursors

The key points that follow describe operating considerations for setting up cursors to obtain best measurement results.

Cursor Types. The three cursor types are described in Table 3-6 on page 3-85. There are two cursors displayed for all types, Cursor 1 and Cursor 2; the cursor currently selected for adjustment is the solid cursor (bottom cursor in Figure 3-22)

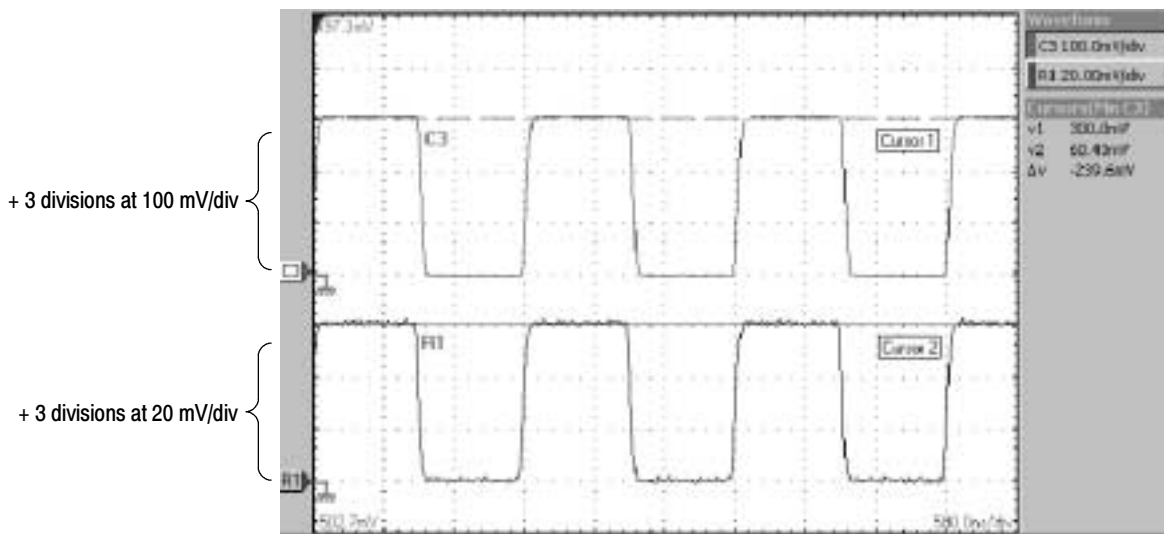


Figure 3-22: Horizontal cursors measure amplitudes

Cursors are Display-Limited. You cannot move a cursor off screen. Also, if you resize waveforms, the cursors do not track. That is, a cursor stays at its screen position, ignoring changes to horizontal and vertical scale and position and to vertical offset. However, waveform cursors track the waveform point vertically; they work differently than vertical and horizontal cursors.

Cursors Default to the Selected Waveform. Each cursor measures its source, defined in the Cursors Setup dialog box. Note the following behavior regarding source selection:

- When cursors are first turned on, the instrument automatically assigns them to use the waveform currently selected on screen as the source for each

cursor. Up to the time you turn cursors on, you can select a waveform on screen to use it as the source for the cursors.

- Once cursors are on, selecting a different waveform does not change the source the cursors measure. To change the source while cursors are on, you must change the source in the Cursors Setup dialog box.
- Turning cursors off restores the default cursor source assignment so that assignment again tracks the currently selected waveform.

Cursors Can Treat Sources Independently. Each cursor can take a different, independent source, with each source having its own amplitude scale and time scale. Consider the example presented by Figure 3-22 on page 3-86:

- Cursor1 is set to measure channel 3 (C3), which is set to 100 mV/div, so the cursor readout v1 measures C3 relative to its ground as 3 divisions x 100 mV/div, or about 300 mv.
- Cursor 2 is set to measure reference 1 (R1), which is set to 20 mV/div, so the cursor readout v2 measures R1 relative to its ground as 3 divisions x 20 mV/div, or about 60 mv.
- Note that the value of each graticule division, relative to the delta readout, is not readily apparent because the delta-amplitude readout (Δv) must account for the different amplitude-scale settings of the sources. To do so, the Δv readout displays the results of $v2 - v1$ ($-60 \text{ mv} - 300 \text{ mv} = -240 \text{ mv}$), automatically accounting for the different scales of the cursor sources.

Time readouts behave similarly with regard to different sources with different time bases. Each cursor displays its time readout, t1 or t2, with respect to the time base of its source, and Δt is calculated as $t2 - t1$, automatically accounting for any difference in the time base of each cursor source.

NOTE. *If a cursor readout does not seem correct, check the source of each cursor in the Cursor Setup dialog box. Each cursor readout relates to the amplitude and time base settings of their source.*

Vertical Cursors Measure from the Trigger Point. Remember that each vertical cursor measures the time from the trigger source to itself. This relationship is shown in Figure 3-23 on page 3-88.

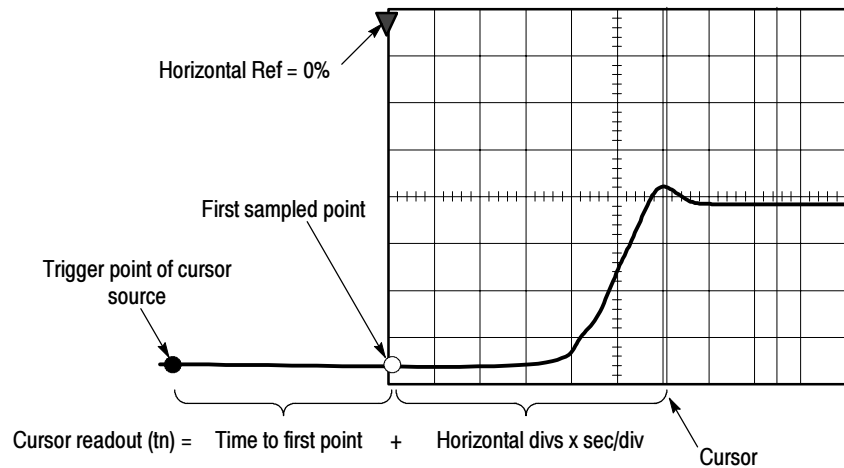


Figure 3-23: Components determining Time cursor readout values

Note that a vertical cursor readout (t1 or t2) includes and varies directly with the time-to-first-point component, which varies directly with the horizontal position set for the time base used by the cursor-source waveform. To see the amount of time to the first point, press Horizontal Menu on the front panel and set Horizontal Ref to 0% in the dialog box that displays. Now the Horizontal position readout shows the time to first point, and subtracting this value from the cursor readout yields the cursor position on screen relative to first point. (You can find the horizontal readout both in the dialog box and in the control bar at the bottom of the screen.) The following relationships hold:

$$\text{Time to First Point} = \text{Horiz Position (when Horiz Ref Position is set to zero)}$$

$$t1 \text{ or } t2 \text{ readouts} = \text{Time to First Point} + \text{Additional Time to Cursor}$$

Cursor Units Depend on Sources. A cursor that measures amplitude or time will read out in the units of its source as indicated in Table 3-7. Note mixed sources require the delta readouts to follow the units of the cursor 1 source.


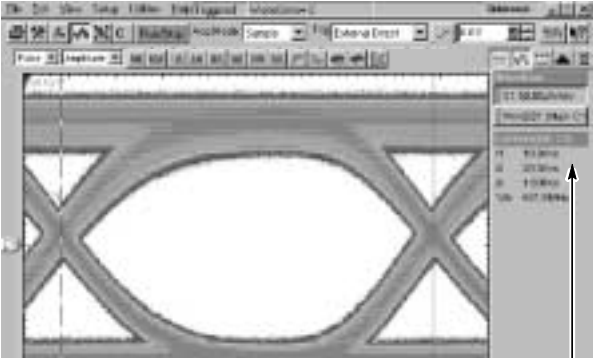
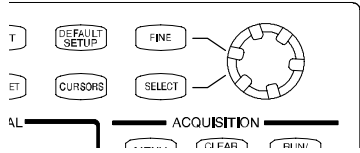
Table 3-7: Cursor units

Cursors	Standard units ¹	Readout names
Horizontal	volts, watts, rho, ohms	v1, v2, Δv
Vertical	seconds, bits	t1, t2, Δt
Waveform	volts, watts, seconds, bits	v1, v2, Δv, t1, t2, Δt

¹ If the v1 and v2 units do not match, the Δv readout defaults to the units used by the v1 readout; if the t1 and t2 units do not match, the Δt readout units defaults to t1 readout units.

To Take a Cursor Measurement

Use the procedure that follows to take cursor measurements on waveforms.

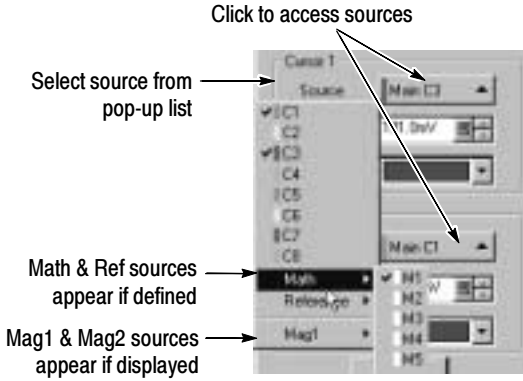
Overview	To take cursor measurements	Related control elements and resources
<p>Prerequisites</p>	<p>1. At least one waveform must be selected on screen. Or you can set cursor values directly using the procedure referenced at right.</p>	 <p>See <i>To Set the Cursor Sources</i> on page 3-90.</p>
<p>Take cursor measurements</p>	<p>2. Press the CURSORS button (see right). Press:</p> <ul style="list-style-type: none"> ■ once to display vertical bar cursors (shown below). ■ twice to display horizontal bar cursors. ■ a third time to display waveform-based cursors. <p>3. Press the SELECT button to toggle selection between the two cursors. The active cursor is the solid cursor.</p> <p>4. Turn the General Purpose knob to position each cursor on the waveform to measure the feature that interests you.</p>  <p>5. Read the results in the cursor readout. In the figure shown above, waveform cursors are used to measure the bit-time of the eye diagram.</p> <p>Tip. The cursor readout indicates the source time base and waveform for the selected cursor; in this case, the main time base, M1, and channel 1, C1.</p>	

Overview	To take cursor measurements (cont.)	Related control elements and resources
<p>To reassign cursors</p>	<p>6. Press the Cursor button repeatedly to toggle through the cursor selections until the cursors are off. Then select a new waveform on screen.</p> <p>Tip. You can set the cursors source(s) directly using the procedure listed at right.</p>	<div data-bbox="1133 373 1227 489" data-label="Image"> </div> <p>See <i>To Set the Cursor Sources</i> on page 3-90.</p>

End of Procedure

To Set the Cursor Sources You can target each cursor to the source it is to measure. (See *Cursors Treat Sources Independently* on page 3-87). To do so, use the procedure that follows.

Overview	To set the cursor sources	Related control elements and resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. Display the waveforms to be measured on screen. The waveform may be a channel, reference, or math waveform. 2. If the source to be measured is in the Mag1 or Mag2 time base, turn that time base on. 	<div data-bbox="1133 1066 1227 1182" data-label="Image"> </div> <p>See page 3-24 for acquisition setup and page 3-48 for trigger setup.</p>
<p>Display the Cursor Setup dialog box</p>	<ol style="list-style-type: none"> 3. From the application menu bar, select Setup, and then select Cursors. See right. 	<div data-bbox="1073 1325 1325 1640" data-label="Image"> </div>

Overview	To set the cursor sources (cont.)	Related control elements and resources
<p>Select the cursor sources</p>	<p>4. From the pop-up list (see right) for each of Cursor 1 and Cursor 2, select a source:</p> <ul style="list-style-type: none"> ■ To measure a single source, choose the same source for both cursors — Main C1, for example. ■ To measure two different sources in the same time base, make sure the time bases match — Main C1 and Main C2, for example. ■ To measure two different sources in different time bases, select different waveforms and time bases — Main C1 and Mag1 C2, for example. <p>Tip. References and Math waveforms are listed as sources only if defined and turned on. All sources listed for the Main time base are also listed for the Mag1 and Mag2 time bases if the time base views are displayed on screen.</p>	

End of Procedure

Optimizing Measurement Accuracy

Why Use? The procedures given here will increase the accuracy of the measurements you take.

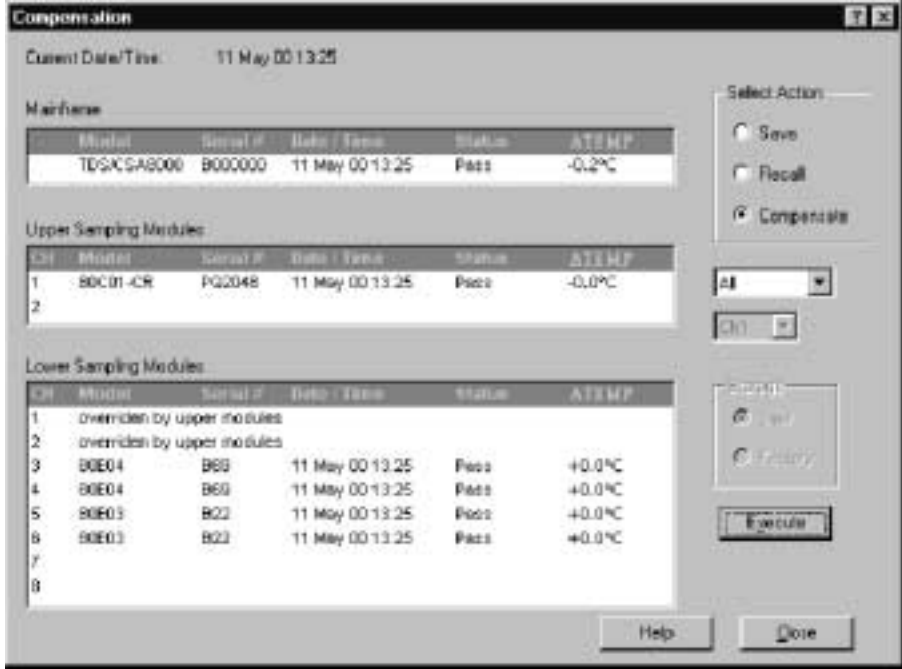
Compensation This instrument can compensate itself and the sampling modules installed, optimizing the internal signal path used to acquire the waveforms you measure. Compensation optimizes the capability of the instrument to make accurate measurements based on the ambient temperature.

NOTE. After first installing a sampling module(s) or moving a sampling module from one compartment to another, you should run compensation from the Utilities menu to ensure the instrument meets its specifications when reaching a stable equilibrium after power-up (normally 20 minutes is recommended).

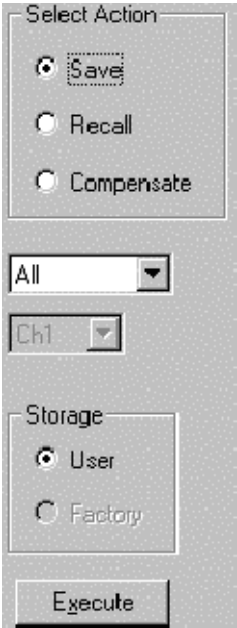

You must save the compensation results or they will be lost when the instrument is powered down.

To Compensate the Instrument and Modules Use the following procedure to optimize the instrument for the current temperature to enhance measurement results.

Overview	To perform a compensation	Related control elements and resources
<p>Prerequisites</p>	<p>1. Instrument should have the sampling modules installed and be powered on. Allow a 20 minute warm up.</p>	<div data-bbox="1133 1266 1227 1381" data-label="Image"> </div> <p>See <i>Install the Sampling Modules</i> on page 1-10.</p>
<p>Display the Compensation dialog box</p>	<p>2. From the application menu bar, select Utilities, and then select Compensation. See right.</p> <p>In the Compensation dialog box, the main instrument (mainframe) and sampling modules are listed. The temperature change from the last compensation is also listed. See below.</p>	<div data-bbox="1073 1493 1325 1713" data-label="Image"> </div>

Overview	To perform a compensation (cont.)	Related control elements and resources																																																																																		
	 <p>The screenshot shows a 'Compensation' dialog box with the following data:</p> <p>Current Date/Time: 11 May 00 13:25</p> <p>Mainframe:</p> <table border="1"> <thead> <tr> <th>Module</th> <th>Serial #</th> <th>Date / Time</th> <th>Status</th> <th>ΔTEMP</th> </tr> </thead> <tbody> <tr> <td>TDSXCSA8000</td> <td>B000000</td> <td>11 May 00 13:25</td> <td>Pass</td> <td>-0.2°C</td> </tr> </tbody> </table> <p>Upper Sampling Modules:</p> <table border="1"> <thead> <tr> <th>Ch</th> <th>Module</th> <th>Serial #</th> <th>Date / Time</th> <th>Status</th> <th>ΔTEMP</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>B0C01-CR</td> <td>PQ2048</td> <td>11 May 00 13:25</td> <td>Pass</td> <td>-0.0°C</td> </tr> <tr> <td>2</td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table> <p>Lower Sampling Modules:</p> <table border="1"> <thead> <tr> <th>Ch</th> <th>Module</th> <th>Serial #</th> <th>Date / Time</th> <th>Status</th> <th>ΔTEMP</th> </tr> </thead> <tbody> <tr> <td>1</td> <td colspan="5">overridden by upper modules</td> </tr> <tr> <td>2</td> <td colspan="5">overridden by upper modules</td> </tr> <tr> <td>3</td> <td>B0E04</td> <td>B60</td> <td>11 May 00 13:25</td> <td>Pass</td> <td>+0.0°C</td> </tr> <tr> <td>4</td> <td>B0E04</td> <td>B60</td> <td>11 May 00 13:25</td> <td>Pass</td> <td>+0.0°C</td> </tr> <tr> <td>5</td> <td>B0E03</td> <td>B22</td> <td>11 May 00 13:25</td> <td>Pass</td> <td>+0.0°C</td> </tr> <tr> <td>6</td> <td>B0E03</td> <td>B22</td> <td>11 May 00 13:25</td> <td>Pass</td> <td>+0.0°C</td> </tr> <tr> <td>7</td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> <tr> <td>8</td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table>	Module	Serial #	Date / Time	Status	ΔTEMP	TDSXCSA8000	B000000	11 May 00 13:25	Pass	-0.2°C	Ch	Module	Serial #	Date / Time	Status	ΔTEMP	1	B0C01-CR	PQ2048	11 May 00 13:25	Pass	-0.0°C	2						Ch	Module	Serial #	Date / Time	Status	ΔTEMP	1	overridden by upper modules					2	overridden by upper modules					3	B0E04	B60	11 May 00 13:25	Pass	+0.0°C	4	B0E04	B60	11 May 00 13:25	Pass	+0.0°C	5	B0E03	B22	11 May 00 13:25	Pass	+0.0°C	6	B0E03	B22	11 May 00 13:25	Pass	+0.0°C	7						8						<p>Select Action:</p> <p><input type="radio"/> Save</p> <p><input type="radio"/> Recall</p> <p><input checked="" type="radio"/> Compensate</p> <p>All</p> <p>Execute</p> <p>Help Done</p>
Module	Serial #	Date / Time	Status	ΔTEMP																																																																																
TDSXCSA8000	B000000	11 May 00 13:25	Pass	-0.2°C																																																																																
Ch	Module	Serial #	Date / Time	Status	ΔTEMP																																																																															
1	B0C01-CR	PQ2048	11 May 00 13:25	Pass	-0.0°C																																																																															
2																																																																																				
Ch	Module	Serial #	Date / Time	Status	ΔTEMP																																																																															
1	overridden by upper modules																																																																																			
2	overridden by upper modules																																																																																			
3	B0E04	B60	11 May 00 13:25	Pass	+0.0°C																																																																															
4	B0E04	B60	11 May 00 13:25	Pass	+0.0°C																																																																															
5	B0E03	B22	11 May 00 13:25	Pass	+0.0°C																																																																															
6	B0E03	B22	11 May 00 13:25	Pass	+0.0°C																																																																															
7																																																																																				
8																																																																																				

Overview	To perform a compensation (cont.)	Related control elements and resources
<p>Select the scope of the compensation</p>	<p>3. Wait until the Status for all items you want to compensate changes from Warm Up to Comp Req'd or Pass.</p> <p>4. In the Select Action fields, select Compensate.</p> <p>5. From the top pulldown list, select the target to compensate. Choose from:</p> <ul style="list-style-type: none"> ■ All to select the main instrument and all its modules (default selection). ■ Mainframe to select only the main instrument. ■ Module to select an individual module for compensation. <p>If you have selected Module as the target, also choose the channel to be compensated from the pulldown list of channels.</p>	
<p>Run the compensation</p>	<p>6. Click the Execute button to begin execution of the compensation.</p> <p>Instructions to disconnect inputs and install dust covers on optical module channels and 50 Ω terminations on electrical module channels will appear on screen. Be sure to follow static precautions (see the user manual for your sampling module) when following these instructions.</p> <p>Note. <i>Failing to install the 50 Ω terminations can yield erroneous compensation failures or results. See Equipment Required on page 1-24.</i></p> <p>The compensation may take several minutes to complete. Pass should appear as Status in the dialog box when compensation completes.</p> <p>If Fail appears as Status, rerun the compensation. If Fail status continues after rerunning compensation and you have allowed warm up to occur, the module or main instrument may need service.</p>	<p>Click to start compensation</p>

Overview	To perform a compensation (cont.)	Related control elements and resources
<p>Save the compensation</p>	<p>7. In the Select Action fields, select Save.</p> <p>8. Click the Execute button to save the new compensation results. The new compensation results will be lost when the instrument is powered down if they are not saved.</p> <p>The Storage destination for the compensation results is limited to the User area. The Factory settings cannot be overwritten.</p>	
<p>Recalling a compensation</p>	<p>9. In the Select Action fields, select Recall.</p> <p>10. In the Storage field, select the compensation to recall, User or Factory.</p> <p>User recalls the last saved user compensation. Factory recalls the compensation established at the factory.</p> <p>Note. Before proceeding, make sure you want to rewrite the compensation you just saved.</p> <p>11. Click the Execute button to recall the compensation results.</p> <p>Note. The Factory compensation should only be recalled to bring the instrument to a known state. Recalling the Factory compensation does not guarantee measurement accuracy.</p>	

End of Procedure

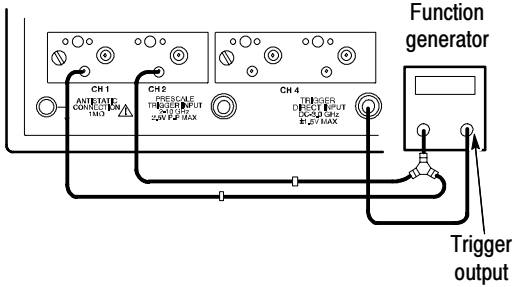
To Deskew Channels

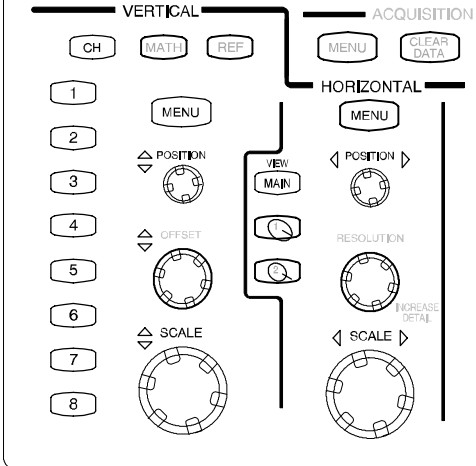
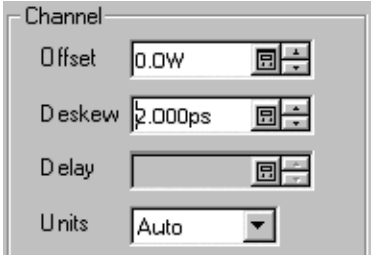

When making differential, common-mode, or other measurements, you may need to null out the propagation delay contributed by the input cabling between two or more channels. Use the following procedure to adjust the deskew between channels.

NOTE. When deskew is applied between channels within the same sampling module, the time shift is accomplished by making a second waveform acquisition. In this case, waveform sample points for the two channels are not acquired on the same trigger event. This means that if the input signals are eye patterns (multi-valued from one trigger event to the next), then math waveforms that depend on correlation between samples from the two channels will not operate as expected.

For instance, the difference between two channels (C1-C2) will result in an eye pattern with a line of data points through the vertical center of the eye. If you intend to create an eye pattern with a math waveform between two channels in the same sampling module, deskew should be set to exactly zero. Skew must be eliminated with external accessories.

When deskew is applied between channels in different sampling modules, the independent time base for each slot is programmed with a different delay value and the sample points are acquired on the same trigger event.

Overview	To deskew between channels	Control elements and resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. Drive the channels with signals requiring deskew. 2. Drive the trigger direct input with the function generator trigger output. 3. Set the instrument to trigger on the slope of the waveform that matches that of the edges you want to deskew. 4. Display the signals on screen. 	

Overview	To deskew between channels (cont.)	Control elements and resources
<p>Set up the reference channel</p>	<p>5. Set up the channel to be used as the reference channel:</p> <ul style="list-style-type: none"> a Push the channel numbered button under Vertical on the front panel. b Use the Vertical SCALE knob and POSITION knobs to display the waveform edge to be deskewed to fill the screen vertically. <p>6. Use the Horizontal SCALE knob and POSITION knobs to display the waveform edges to be deskewed to fill the screen horizontally.</p>	
<p>Deskew the channel</p>	<p>7. Set up the channel to be deskewed: repeat step 5 for the channel to be deskewed.</p> <p>8. Push Vertical MENU front panel button, and from the Vertical Setup dialog box, adjust the Deskew value (see right) to make the edges of the reference and the deskew channel coincide (or are as close as possible).</p> <p>9. If you cannot align the edges completely, try selecting the reference channel and adjusting its deskew.</p>	
<p>Deskew more channels</p>	<p>10. If you need to, you can deskew additional channels:</p> <p>11. Turn off the channel just deskewed, and leave the reference channel on.</p> <p>12. Set up the channel to be deskewed: repeat step 7 and step 8 for the new channel to be deskewed.</p> <p>13. Continue this process for as many channels as you want to deskew.</p> <p>14. Disconnect the deskew hookup.</p>	

End of Procedure


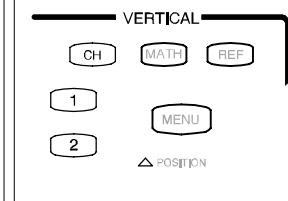

To Perform Dark-Level and User Wavelength Gain Compensations

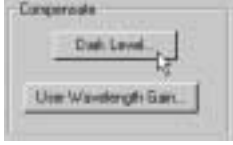

Performing a dark-level compensation maximizes the accuracy of the extinction ratio and other optical automatic measurements you take. Performing a User Wavelength Gain compensation optimizes an optical channel for your custom input signal.

NOTE. *Dark level compensation performs a subset of the module compensation process. It is designed to be fast so it can be performed frequently, just before measurements are taken. This compensation is not saved and are only valid for the selected bandwidth or filter path and the internal optical power meter.*

You should perform the procedure To Compensate the Instrument and Modules on page 3-92 to compensate all vertical bandwidth and filter selections.

Use the following procedure to perform either compensation; this procedure applies only to optical modules.

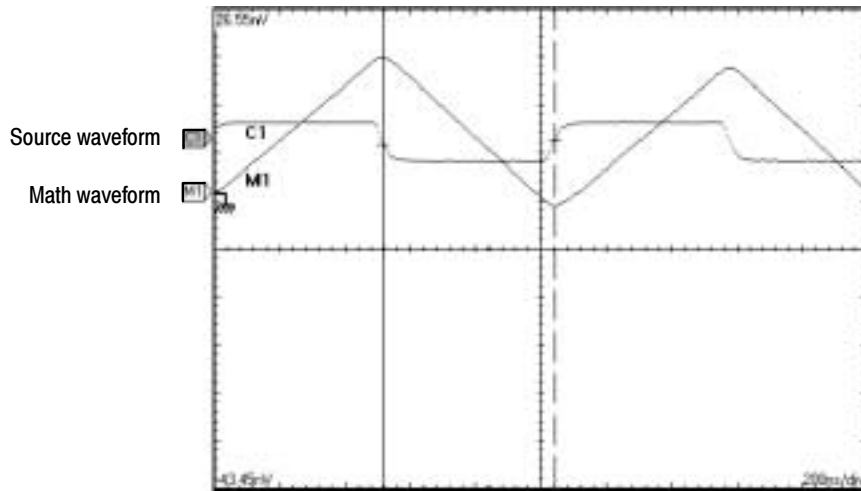
Overview	To perform optical compensations	Control elements and resources
<p>Prerequisites</p>	<p>1. The instrument must be installed with at least one optical sampling modules to be dark-level calibrated in place. The acquisition system should be set to run continuously.</p>	 <p>See the sampling-module User Manuals for sampling module installation.</p>
<p>Select the waveform</p>	<p>2. Use the Vertical buttons to select the channel to be compensated.</p>	
<p>Access dark-level compensation</p>	<p>3. From the application menu bar, click Setup, and then click Vertical. See right.</p>	

Overview	To perform optical compensations (cont.)	Control elements and resources
<p>Run the dark-level compensation</p>	<ol style="list-style-type: none"> 4. In Vert Setup dialog box, click the Dark Level button under Compensation. See right. Follow the instructions on screen. 5. Repeat steps 2 and 4 for any additional optical channels you want to compensate. 	
<p>Run the user wavelength gain compensation</p>	<p>If you want, you can compensate an optical channel for a custom input signal:</p> <ol style="list-style-type: none"> 6. In Vert Setup dialog box, click the User Wavelength Gain button under Compensation. See right. Follow the instructions on screen. 7. In the User Wavelength Gain Compensation dialog box, set the wavelength and power of the signal to be applied to the channel. See right. <ul style="list-style-type: none"> ■ User should have an optical signal attached to module input with a precisely known amount of optical power. An independently-calibrated average optical power meter is used to measure this power precisely. Then signal is connected to the 80C0X with the same fiber cables. 8. Press the OK button to execute the compensation. 9. Repeat steps 2, 6, and 7 for any additional optical channels you want to compensate. 	

End of Procedure

Creating Math Waveforms

Once you have acquired waveforms or taken measurements on waveforms, the instrument can mathematically combine them to create a waveform that supports your data-analysis task. For example, you can define a math waveform that combines waveforms mathematically (+, -, /, x). You can also integrate a single waveform into an integral math waveform as is shown below.



Defining Math Waveforms

This instrument supports mathematical combination and functional transformations of waveforms that it acquires. Figure 3-24 shows this concept:

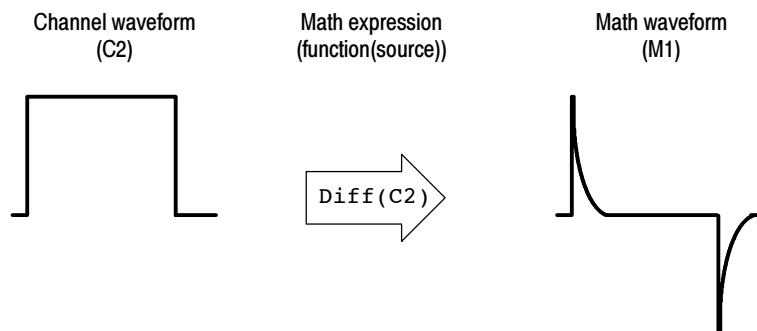


Figure 3-24: Functional transformation of an acquired waveform

Why Use?

Create math waveforms to support the analysis of your channel and reference waveforms. By combining and transforming source waveforms and other data into math waveforms, you can derive the data view that your application requires. You can create math waveforms that result from:

- mathematical operations on one or several waveforms or measurements: add, subtract, multiply, and divide.
- function transforms of waveforms, such as integrating, differentiating, and so on.

You can create up to eight math waveforms; see *Keys to Using* on page 3-103 for more examples.

What's Special?

Some features of note follow:

Functions. Powerful functions, such as integrate, differentiate, average, can be taken on single waveforms or more complicated expressions.

Measurement Scalars. The results (scalars) from automatic measurements can be used in expressions. For example, you can use the measurement Mean on a waveform and subtract, from the original waveform, the scalar that results to define a new math waveform.

What's Excluded?

Some operations that you cannot use with math waveforms follow:

- **Math-on-Math.** You cannot use math waveforms as sources for other math waveforms. For example if you have a math waveform defined as $M1 = C1 - C2$, you cannot define a second math waveform as $M2 = M1 + C3$. You can however expand the second math waveform to $M2 = C1 - C2 + C3$.
- **Mag Time Base Expressions.** Sources for math expressions must be sources associated with the Main time base. For example, $M3 = C1 + C2$ uses these sources as acquired and displayed by the Main time base, not by the Mag1 or Mag2 time base. You cannot create $M3 = C1(\text{Main}) - C2(\text{Mag1})$. See Table 3-8 on page 3-103.
- **Waveform Databases as Sources.** If you assign a channel to a waveform database and then use the channel in a math-waveform expression, the data currently acquired in the channel is used, not the data accumulated in the waveform database over time.

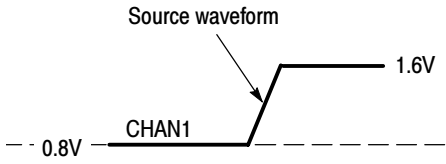
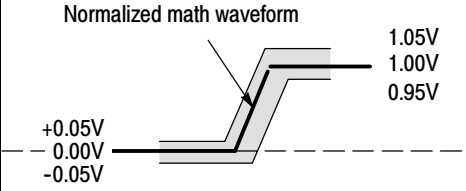
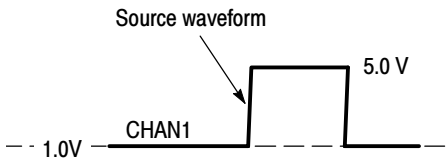
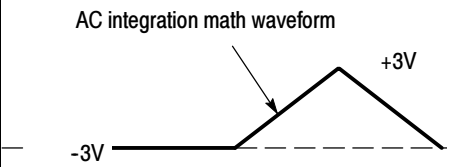
Keys to Using

The key points that follow describe considerations for creating math waveforms that best supports your data-analysis tasks.

How to Create. You create math waveforms when you create a math expression. You do so by applying numerical constants, math operators, and functions to operands, which can be channel, waveforms, reference waveforms, measurements (scalars), or fixed scalars. You can display and manipulate these derived math waveforms much like you can the channel and reference waveforms (see *Operations on Math Waveforms* on page 3-107).

Some examples of typical math waveforms follow.

Table 3-8: Math expressions and the math waveforms produced

To...	Enter this math expression...	and get this math waveform...
<p>...normalize a waveform</p> 	<p>...</p> <p>$(C1 - \text{Meas1}) / \text{Meas2}$, where C1 is waveform shown left Meas1 = Low of C1 Meas2 = amplitude of C1</p>	<p>...shifted and scaled to fit a std. template</p> 
<p>...simulate ac coupling and integrate</p> 	<p>...</p> <p>$\text{Intg}(C1 - \text{Meas1})$, where C1 is waveform shown left Meas1 is set to take the Mean of C1</p>	<p>...DC component removed before integration</p> 

Sources. Math Waveforms can incorporate the following sources:

- Channel waveforms
- Reference waveforms
- Measurement scalars (automated measurements) that measure channel or reference waveforms in any time base
- Fixed scalars that you enter as numerical constants in expressions

Source Dependencies. In general, math waveforms that include sources as operands are affected by updates to those sources:

- Shifts in amplitude or DC level of input sources that cause the source to clip also clip the waveform data supplied to the math waveform.
- Changes to the vertical offset setting for a channel source that clip its data also clip the waveform data supplied to the math waveform.
- Changes to the acquisition mode globally affects all input channel sources, thereby modifying any math waveforms using them. For example, with the acquisition mode set to Envelope, a C1 + C2 math waveform will receive enveloped channel 1 and channel 2 data and, therefore, will also be an envelope waveform.
- Clearing the data in a waveform source causes a baseline (zero-volt level) to be delivered to any math waveform that includes that source until the source receives new data.

Time Base Dependencies. Selections for math-waveform sources (operands) consist of channel and reference waveforms that are acquired or defined and viewed in the main time base.

The math waveforms derive their time base and record lengths from waveform sources. You cannot change them directly; you can only change them indirectly by changing the time base for the source.

In case of sources having different record lengths, the math waveform created matches the shorter waveform, and the additional trailing data from the longer waveform is not used.

You may also want to read the section about deskewing channels on page 3-96.

Expression Syntax. You build math waveforms using the Define Math Waveform dialog box. To help you create valid math waveforms, this dialog box blocks illegal entries by disabling any dialog-box element that would create an invalid entry in the math waveform expression.

The syntax that follows describes valid math expressions, which can be quite complex (in excess of 100 characters long):

<Expression> := <UnaryExpression> | <BinaryExpression>


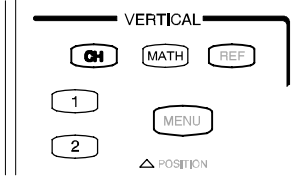
<UnaryExpression> := <UnaryOperator> (<Term>)
 | <UnaryOperator> (<Expression>)

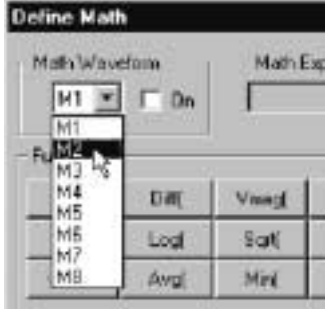
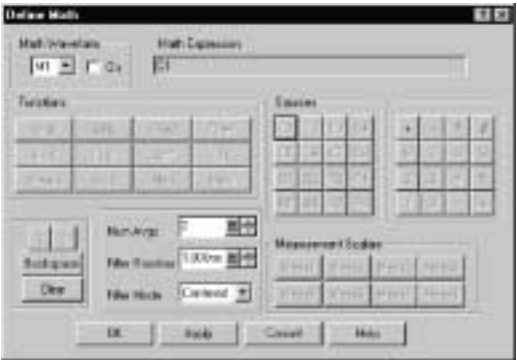
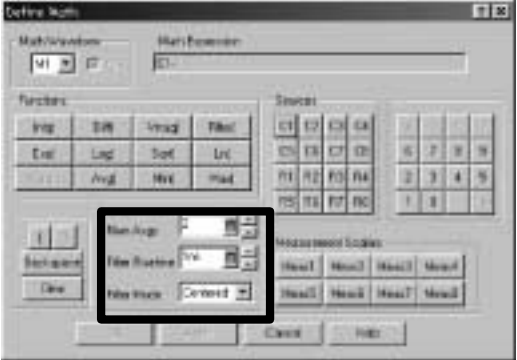
<BinaryExpression> := <Term> <BinaryOperator> <Term>
 | <Scalar> <BinaryOperator> <Term>
 | <Term> <BinaryOperator> <Scalar>



$\langle \text{Term} \rangle := \langle \text{Waveform} \rangle | (\langle \text{Expression} \rangle)$
 $\langle \text{Scalar} \rangle := \langle \text{Integer} \rangle | \langle \text{Float} \rangle | \langle \text{Meas-Result} \rangle$
 $\langle \text{Waveform} \rangle := \langle \text{ChannelWaveform} \rangle | \langle \text{ReferenceWaveform} \rangle$
 $\langle \text{ChannelWaveform} \rangle := C1 | C2 | C3 | C4 | C5 | C6 | C7 | C8$
 $\langle \text{ReferenceWaveform} \rangle := R1 | R2 | R3 | R4 | R5 | R6 | R7 | R8$
 $\langle \text{UnaryOperator} \rangle := \text{Integrate} | \text{Differentiate} | \text{Average} | \text{Max} | \text{Min}$
 $| \text{Filter} | \text{Vmag} | \text{Exp} | \text{log} | \text{ln} | \text{sqrt}$
 $\langle \text{BinaryOperator} \rangle := + | - | / | *$
 $\langle \text{Meas-Result} \rangle := \text{meas1} | \text{meas2} | \text{meas3} | \text{meas4} | \text{meas5} | \text{meas6} | \text{meas7} | \text{meas8}$

To Define a Math Waveform

Use the procedure that follows when defining a math waveform. Remember, you should first ensure that the sources you use exist. Channel sources will be acquired when used in a math expression, reference waveform sources should contain saved waveforms, and so on. These sources do not have to be displayed to be used.

Overview	To define a math waveform	Related control elements & resources
<p>Prerequisites</p>	<p>1. All channel and reference waveforms and automatic measurement scalars that you will use in your math waveform must be available (channels and references contain data, measurement scalars are defined, and so on.)</p> <p>Note. If you use a channel that is not acquiring, including it in a math waveform that you turn on will implicitly cause it to be acquired.</p>	 <p>See sampling-module user manuals for sampling module installation. See page 3-24 for acquisition setup and page 3-48 for trigger setup in this manual.</p>
<p>Display the Math dialog box</p>	<p>2. Press the Vertical MATH button twice if it is unlit, once if lit, to display the Define Math dialog box.</p>	

Overview	To define a math waveform (cont.)	Related control elements & resources
<p>Select a math waveform</p>	<p>3. Click the Math Waveform drop-down list in the dialog box and select a one of the eight available math waveforms, M1 through M8. Be sure to click to check the On box, so that the waveform displays.</p> <p>Tip. If the waveform you select already exists, its math expression appears in the dialog box. You can still use the waveform by clicking the Clear button, which discards its previous math expression. Or repeat step 3 to select another waveform.</p>	
<p>Build a math expression</p>	<p>4. Use the dialog box at right to define a math expression. See Table 3-8 on page 3-103 for expression examples; some guidelines for creating your expression follow:</p> <ul style="list-style-type: none"> ■ Sources — C1 - C8, R1 - R8, and Meas1 - Meas8 — should be set up before you use them (references and automated measurement scalars defined). ■ Elements that appear grayed out cannot be selected because they would result in an illegal entry. For example, the sources are grayed out because a source was just entered. You must enter an operator before entering another source. ■ Use the backspace button to remove the last entry; use the clear key to remove the entire expression and start over. ■ Use parentheses to group terms in the expression to control execution order, for example, $5*(C1 + C2)$. 	
<p>Apply a filter</p>	<p>5. Use the filter controls in the dialog box to apply a filter to the math waveform defined by the expression. Here are some guidelines:</p> <ul style="list-style-type: none"> ■ Num Avgs. Set the number of averages applied by the Avg(function. Only affect waveforms if the Avg(function is used. ■ Filter Risetime. Set to limit risetime to improve TDR measurement results. ■ Filter Mode. Choose Centered or Shifted for causal or noncausal filtering. 	

Overview	To define a math waveform (cont.)	Related control elements & resources
Apply the expression	<p>6. Once you have defined the math expression to your satisfaction, click the Apply button. Then click on the OK button to dismiss the dialog box. See <i>To Use Math Waveforms</i> on page 3-109 for more procedures.</p>	
For more information	<p>7. Click the  icon in the the upper-right corner of the Define Math dialog box, and then click any dialog-box control to pop up help on that control.</p> <p>8. Click the Help button in the Define Math dialog box to access context-sensitive overview on math waveforms.</p>	<div style="text-align: center;">  <p>See <i>Accessing Online Help</i> on page 3-167 for overview of the online help system.</p> </div>

End of Procedure

Operations on Math Waveforms

This instrument supports many of the same operations that it provides for channel (live) and reference waveforms. For example, you can measure math waveforms with cursors. This section introduces these operations:

- Vertical display scaling and positioning
- Taking automatic measurements
- Taking cursor measurements

Why Use?

Use math waveform operation, such as those listed above, to enhance the displaying, processing, and analyzing of math waveforms. For example, in addition to the operations listed, you can save math waveforms as references and make them the source of either of two onboard waveform data bases.

What's Excluded?

Some operations allowed on channel waveforms are not allowed on math waveforms:

- Independent horizontal scaling. Each math waveform that you create derives its horizontal scale and position from the sources you include in its math expression. Horizontal controls will not operate with math waveforms.

You can adjust these controls for the source waveforms and your adjustments will reflect in the math waveform as the sources update. You can also magnify math waveforms using the Mag1 or Mag2 derived time bases.

- Independent vertical offset. You cannot adjust the offset for a math waveform; you can adjust the offset of channel waveforms used as sources to a math waveform.
- Explicit gating of waveforms. The entire math waveform is used as input to the automatic measurement system.

Keys to Using


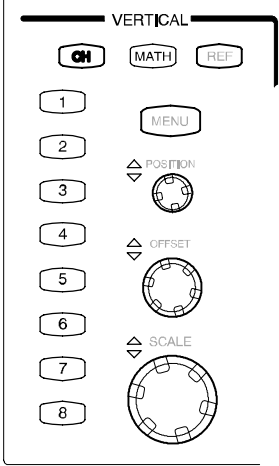
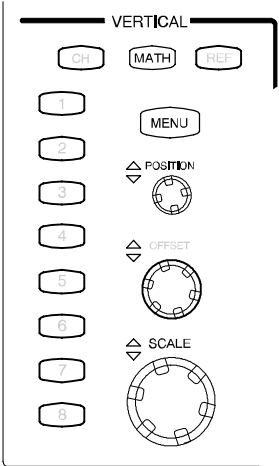
Basically, you use the same techniques to work with math waveforms that work with channel waveforms. The key points that follow describe operating considerations to take into account when using math waveforms.

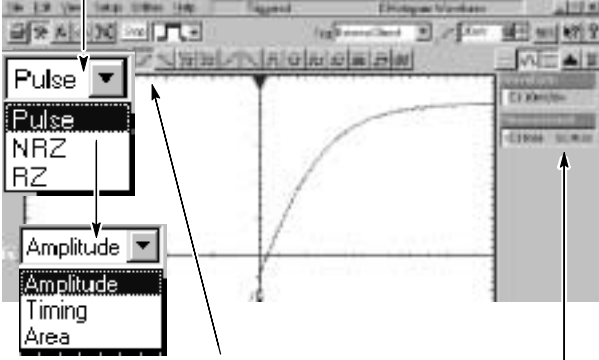
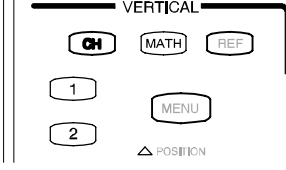
Source Considerations. In general, be aware that changes to source waveforms that you include as math-expression operands are reflected in the math waveform. See *Source Dependencies* on page 3-104.

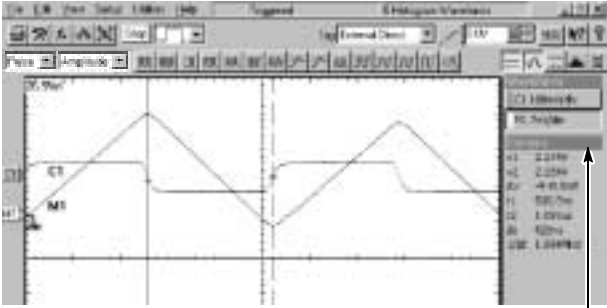
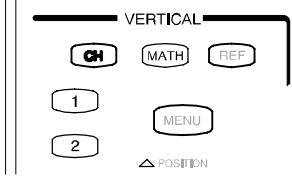
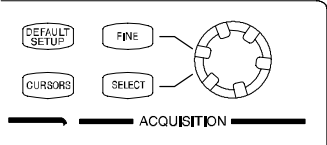
Display Considerations. Turn on and off the display of math waveforms like you do channel and reference waveforms. Use the same front-panel controls (waveform selection buttons, vertical position and scale knobs) and application controls (waveform control bar elements at the bottom of the display; vertical setup menu). Mouse operation for positioning waveforms on screen work also.

As is true for channel and reference waveforms, turning a math waveform on or off in any time base display, Main, Mag1, or Mag2, also turns it on or off in all the time bases.

To Use Math Waveforms The procedure that follows demonstrates some common operations you can perform on math waveforms:

Overview	To use math waveforms	Related control elements & resources
<p>Prerequisites</p>	<p>1. The Math waveform must be defined and displayed. See the reference listed at right.</p>	 <p>See To Define Math Waveforms on page 3-105</p>
<p>Select and display</p>	<p>2. Press the Vertical MATH button. The button of the currently displayed and selected math waveform will light amber; the buttons of all other currently displayed math waveforms will light green. Math waveforms not displayed remain unlighted.</p> <p>3. Press any waveform button to make it the selected waveform. If the waveform was not displayed, operation is as follows:</p> <ul style="list-style-type: none"> ■ If the waveform you select is defined, it displays, otherwise.. ■ the Define Math dialog box displays so that you can define and turn on the waveform you just selected. (See <i>To Define a Math Waveform</i> on page 3-105 for a procedure for doing so.) <p>Tip. You can also click the math waveform in the display, or its icon at the left of the display, to select it.</p>	
<p>Set scale and position</p>	<p>4. Use the Vertical Scale and Position knobs to size and position the waveform on the screen.</p> <p>Tip. You can't adjust the offset of a math waveform. However, adjustments of offset settings in the source waveforms will reflect in the math waveform as determined by its expression.</p> <p>Tip. You can't adjust horizontal scale, position, and sample density (resolution) of math waveforms. If adjusting these settings affect sources for a math waveform, the adjustment will be reflected in the math waveform.</p>	

Overview	To use math waveforms (cont.)	Related control elements & resources
<p>Take automatic measurements</p>	<p>5. Press the Vertical MATH button, and use the numbered front-panel button to choose a math waveform from M1 - M8. (See right.)</p> <p>6. Select one of the signal types, such as Pulse, and then select a measurement category from the measurement bar.</p>  <p>7. Click a measurement button. The instrument automatically takes the measurement on the waveform you selected in step 5.</p> <p>8. Read the results in the measurements readout.</p> <p>Tip. For more control of your measurement, go to the Setup menu (in the application menu bar) and select Measurements. Click the Help button in the Measurements Setup dialog box that displays for more information.</p>	

Overview	To use math waveforms (cont.)	Related control elements & resources
<p>Take cursor measurements</p>	<ol style="list-style-type: none"> 9. Press the Vertical MATH button, and use the numbered front-panel button to choose a math waveform from M1 - M8. The button will light amber when you have chosen the waveform. (See figure at upper right.) 10. Press the CURSORS button (see figure at lower right). Press: <ul style="list-style-type: none"> ■ Once to display vertical bar cursors (shown below) ■ A second time to display horizontal bar cursors ■ A third time to display waveform-based cursors 11. Press the SELECT button to toggle selection between the two cursors. 12. Turn the knob to position each cursor on the math waveform to measure the feature that interests you.  <ol style="list-style-type: none"> 13. Read the results in cursor readout. In the figure shown above, waveform cursors are used to measure the V of the integral math waveform, which could be used to compute its area ($\int v dt$). 	 

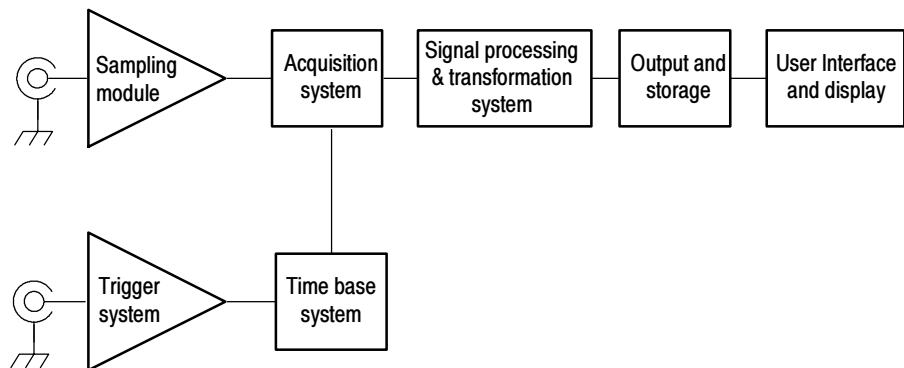
End of Procedure

For more information on taking automatic and cursor measurements of waveforms, see *Measuring Waveforms* on page 3-73.

Data Input and Output

This section describes the input and output capabilities of your instrument. Specifically, it covers:

- *Saving and Recalling Setups* on page 3-113
- *Saving and Recalling Waveforms* on page 3-120
- *Exporting Waveforms and Histograms* on page 3-128
- *Printing Waveforms* on page 3-132.
- *Remote Communication* on page 3-139



Saving and Recalling Setups

This instrument can save a number of different instrument setups for later recall, limited only by the space you have to store the setups.

Why Use?

Save and recall different setups to switch from setup to setup without having to first manually record your settings and then manually set them. This capability is helpful when you want to:

- save and recall a setup that optimizes the instrument for displaying and analyzing a certain signal.
- save a series of setups to help automate a procedure through recall of a sequence of saved setups as part of performance of the procedure.
- export a setup for sharing with a second instrument.

What's Special?

Some features of note follow:

Commenting. The Save-Setup and the Recall-Setup dialog boxes provide for including and viewing comments with your saved setups. That way, you can store information, readable upon recall, that describes each setup you save and its intended application.



Virtual Keyboarding. If you do not have a keyboard connected, you can still enter comments and name setup files. The Save and Recall Setup dialog boxes include the Virtual Keyboard button, shown left. When you touch or click it, the instrument displays a virtual keyboard on screen that you can use with your mouse or the touch screen to enter the setup-path name, setup-file name, and comment.

What's Excluded?

The instrument excludes the following items when saving setups:

- Waveforms in channels (C1-C8) or references (R1-R8). Control settings (scale, position, and so on) are saved but not the waveform data. Upon recall of the setup, the settings are applied, but the data is not restored.
- Waveforms in Math Waveforms (M1-M8). Control settings and the math expression are retained but not the waveform data. Upon setup recall, the recalled math waveform expressions will be applied, but there is no math waveform data to restore. Instead, a new math waveform will be generated based on the recalled expression.
- User Options that are stored in the Windows Registry. These include all options accessed by first selecting Utilities (menu bar), and then User Preferences (Utilities menu).
- Standard Masks. Standard masks are not stored with the setups. However, if your recalled setup includes display of a mask, recalling the setup will, in turn, display the mask. Also, masks you define are stored with the setups.

Keys to Using

The key points that follow describe operating considerations for setting up the saving and recalling of setups.

All Settings are Retained. The instrument includes almost all instrument settings, with a few exceptions (such as user options) in the saved setup.

Retaining Current Settings. Recalling a setup replaces the current setup with the recalled setup. If you do not want to lose your current setup, save it to its own setup file for later recall before you recall the new setup.


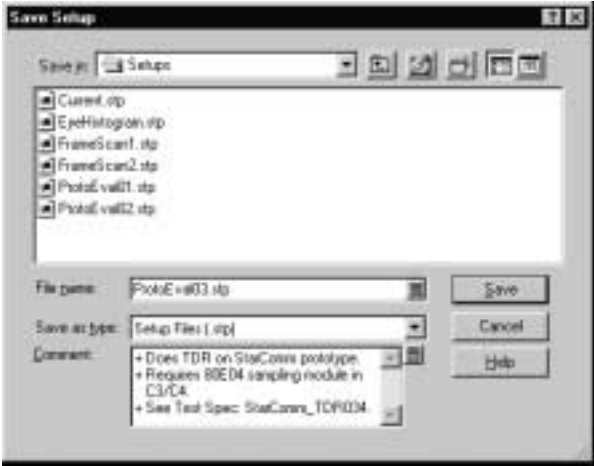


Avoiding Setup and Waveform Mismatches. Saved setups may contain settings inappropriate for waveforms currently in your instrument. For example, you might have saved a setup that displayed a fiber channel mask, such as FC531, for testing channel 1. If later you display a gigabit ethernet signal in channel 1 and recall your saved setup, the FC531 mask will display.





Avoiding Setup and Sampling Module Mismatches. Recall of a setup assumes that the sampling module appropriate to the recalled setup is installed. For example, recalling a setup that saved optical vertical-control settings requires that an optical sampling module be installed. If not, the instrument substitutes default settings for the affected vertical controls settings instead of recalled settings. Other examples of such mismatches include:

- Recalling a setup that includes TDR without the TDR-capable sampling module installed. You must have the TDR-capable module installed in the same compartment it was in when the setup was saved.
- Recalling a setup that includes a clock-recovery setup without the appropriate clock-recovery-capable sampling module installed. You must have the clock recovery-capable module installed in the same compartment as when the setup was saved.

To Save Your Setup

Use the procedure that follows to save a setup to the instrument hard disk, a floppy disk, or third-party storage device.

Overview	To save your setup	Control elements & resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. The instrument must have appropriate sampling modules in place before powering on the instrument. 2. Instrument must be powered up. 3. Set up the instrument controls as you want them saved as part of a recallable setup. <p>For help in making your setup, check the references at right and other sections in this chapter specific to the setup you wish to make.</p>	 <ul style="list-style-type: none"> ■ See Sampling Module User Manuals for sampling module installation. ■ See <i>Power On Instrument</i> on page 1-14. ■ See page 3-24 for acquisition setup. ■ See page 3-48 for trigger setup.
<p>Display the Save Setup dialog box</p>	<ol style="list-style-type: none"> 4. From the application menu bar, select File, and then select Save Setup. See illustration at right. <p>The Save Setup dialog box allows for the entry of a file name, file type, and includes a field for adding your comments. See below.</p> 	
<p>Name a destination</p>	<ol style="list-style-type: none"> 5. Use the Save in: drop-down list and buttons (see right) to navigate to the directory in which to save your setup. 	


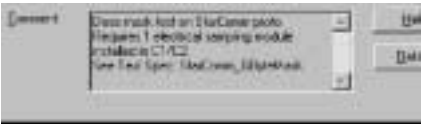
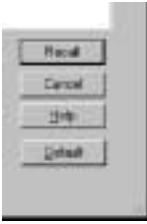

Overview	To save your setup (cont.)	Control elements & resources
<p>Name your setup</p>	<p>6. Name your setup file by either:</p> <ul style="list-style-type: none"> ■ accepting the default file name that appears in the File name: text box. ■ clicking in the File name text box and typing a new name, replacing the default file name. ■ clicking an existing name in the file list (if any are listed). Data in existing file will be overwritten. <p>Tip. If your instrument lacks a keyboard, touch or click on the virtual keyboard icon (indicated right) to display a virtual keyboard. You can use the mouse or touch screen with the virtual keyboard to type entries in the name fields and comments fields.</p> <p>7. If not selected, select *.stp in the Save as type list box as the type of file. (Setup files are always type *.stp).</p> <p>Tip. Only change the type if you want to temporarily see any other types of files in the current directory. Otherwise, leave it set at *.stp.</p>	 <p>Access to virtual keyboard</p>
<p>Add a comment (optional)</p>	<p>8. Enter a useful comment about each setup you save. Write the comment such that it explains the purpose of the saved file when that file is later accessed (see right).</p> <p>Tip. Use comments frequently. The comment that you enter appears when you (or others) later select your setup in this dialog box or in the Recall Setup dialog box. In the first case, it might help you avoid overwriting a setup you wanted to keep; in the second case, it can help determine the purpose of the setups saved earlier.</p>	
<p>Save your setup</p>	<p>9. Click the Save button to save the setup file. To cancel without saving, click Cancel button.</p>	
<p>For more information</p>	<p>10. For more help on saving setups, click the Help button in the Setup dialog box to access contextual help on screen.</p>	 <p>See page 3-167 to learn about using online help.</p>

End of Procedure

To Recall Your Setup

Use the procedure that follows to recall a setup to the instrument. Remember that recalling a setup replaces the existing setup, which is lost.

Overview	To recall your setup	Control elements & resources
<p>Prerequisites</p>	<p>1. The instrument should have appropriate sampling modules in place for the setup to be recalled. You must have access to a setup saved by the instrument.</p>	<div data-bbox="1133 485 1224 596" data-label="Image"> </div> <ul style="list-style-type: none"> ■ See Sampling Module User Manuals for sampling module installation. ■ See <i>Power On Instrument</i> on page 1-14. ■ See <i>Keys to Using</i> on page 3-114.
<p>Display the Recall Setup dialog box</p>	<p>2. From the application menu bar, select File, and then select Recall Setup. (See right.)</p> <p>The Recall Setup dialog box allows navigation to directories, lists setup files in the directory, and provides for selection of a setup file. Comments for selected files appear in the comment box. (See below.)</p> <div data-bbox="326 1089 915 1551" data-label="Image"> </div>	<div data-bbox="1068 850 1318 1199" data-label="Image"> </div>
<p>Name a destination</p>	<p>3. Use the Look in: drop down list and buttons (see right) to navigate to the directory which contains a setup that you want to recall.</p>	<div data-bbox="938 1619 1455 1696" data-label="Image"> </div>

Overview	To recall your setup (cont.)	Control elements & resources
<p>Select your setup</p>	<p>4. If not selected, select *.stp in the Save as type list box of file to include in the dialog box file listing. (Setup files are always type *.stp).</p> <p>Tip. Only change the type if you want to temporarily see any other types of files in the current directory. Otherwise, leave it set at *.stp.</p> <p>5. Choose your setup file by either:</p> <ul style="list-style-type: none"> ■ Clicking an existing name in the file list. ■ Clicking in the File name field and typing a new name, replacing the default file name. <p>Tip. If your instrument lacks a keyboard, touch or click on the icons as indicated right to display a virtual keyboard. You can use the mouse or touch screen with the virtual keyboard to type entries in the name fields and comments fields.</p>	 <p>Access to virtual keyboard</p>
<p>View any included comment (optional)</p>	<p>6. Read the comment associated with the setup you choose if any is present. It can contain information about using the setup you are about to restore (see right).</p> <p>Tip. Selecting a file displays any comments that were entered when the setup was saved. Comments can help you ascertain the purpose of the setups saved earlier.</p>	
<p>Recall your setup</p>	<p>7. Click the Recall button to save the setup file. To cancel without recalling a setup, click the Cancel button.</p> <p>Tip. You can also recall the default setup from this dialog box; clicking the Default button recalls the the factory default setup.</p>	
<p>For more information</p>	<p>8. For more help on recalling setups, click the Help button in the dialog box to display contextual help on screen.</p>	 <p>See page 3-167 to learn about using online help.</p>

End of Procedure

Saving and Recalling Waveforms

This instrument can save any number of waveforms, limited only by the space you have to store them.

Why Use?

By saving a waveform, you can recall it at a later time for comparison, evaluation, and documentation. This capability is helpful when you want to:

- recall a waveform for further evaluation or comparison with other waveforms.
- extend the waveform carrying capacity of the instrument. The instrument supports eight reference, eight channel, and eight math waveforms. If you want more than eight references, you can save the additional reference to disk for recall later.

What's Special?

Some features of note follow:

Commenting. The Save-Waveform dialog box and the Recall Waveform dialog box contain a comments field for including and reading comments with your saved waveforms. That way, you can store information, readable upon recall, describing each waveform that you save.


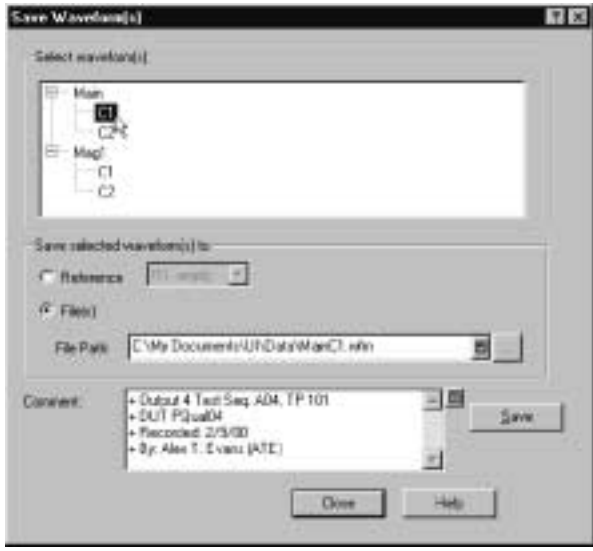
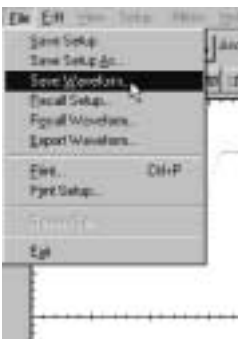


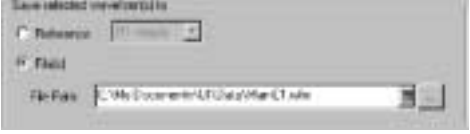

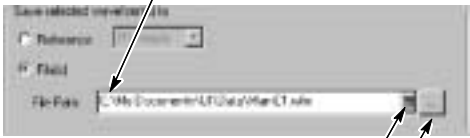
Virtual Keyboarding. If you do not have a keyboard connected, you can still enter comments and name waveform files. The Save and Recall Setup Waveform dialog boxes include the Virtual Keyboard button shown left. When you touch or click it, the instrument displays a virtual keyboard on screen that you can use with your mouse or the touch screen to enter the waveform-path name, file name, and comment.




What's Excluded?

You cannot recall *into* a channel or a math waveform. The instrument recalls each waveform into one of the reference waveform locations (R1-R8). Also, you cannot save and recall waveform databases.

To Save Your Waveform Use the procedure that follows to save a waveform or waveforms to the instrument hard disk, a floppy disk, or third party storage device.

Overview	To save a waveform	Control elements & resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> The instrument must have appropriate sampling modules in place before powering on the instrument. Instrument must be powered up. Make sure the waveform to be saved exists; that is, your source must be a channel, an active math waveform, or an active reference. Display the waveform in the timebase in which you want to save it, Main1, Mag1, and/or Mag2, or the waveform will not appear in the Save Waveform dialog box. <p>For help in setup and acquiring waveforms, check the references at right.</p>	 <ul style="list-style-type: none"> See Sampling Module User Manuals for sampling module installation. See <i>Power On Instrument</i> on page 1-14. See page 3-24 for acquisition setup. See page 3-48 for trigger setup. See page 3-57 for time base display.
<p>Display the Save Waveform dialog box</p>	<ol style="list-style-type: none"> From the application menu bar, select File, and then select Save Waveform. See right. <p>The Save Waveform dialog box lists all available waveforms for all displayed timebases, allows for browsing to destination directory (saving to file) or for selecting a reference (saving to one of R1-R8). It also includes a field for adding your comments. See below.</p> 	

Overview	To save a waveform (cont.)	Control elements & resources
<p>Select a destination</p>	<p>4. Navigate to the directory in which to store your waveform. You can:</p> <ul style="list-style-type: none"> ■ Save to a reference: Click to check Reference, and then use the pulldown list to select any reference (R1-R8). You can save to empty references or save over existing references. Skip to step 8 to finish. ■ Save to a file: Click to check File(s) and continue with step 5 that follows. 	
<p>Select your waveform(s) to save</p>	<p>5. Select one or more waveform to save:</p> <ul style="list-style-type: none"> ■ Click a waveform in the tree view (see right). Note that only displayed timebases and their waveforms appear. ■ Extend your selection, if desired, by holding down the control key and clicking additional waveforms, or... ■ Select all waveforms in a given timebase by clicking the timebase (for example, click Main). <p>Tip. If your instrument lacks a keyboard, you can't use the control key to extend selections. However, you can touch or click individual waveforms or timebases to select them.</p>	
<p>Select directory and name file</p>	<p>6. Specify the directory and filename(s) in which to save your waveform(s). If you've selected a single waveform, you can:</p> <ul style="list-style-type: none"> ■ Use the default name and directory appearing in the File Path field. ■ Click to access the file system (see right) and navigate to a new directory. ■ Rename the file and/or change the directory by typing a new name and path into the File Path field. <p>If you've selected multiple waveforms, the File Path field will change to Dir\Prefix. You can edit the path and the prefix used for the filenames as just described. All files will save into the same directory. The File Path field will change to Dir\Prefix.</p>	

Overview	To save a waveform (cont.)	Control elements & resources
<p>Add a comment (optional)</p>	<p>7. For saves to files or to references, you can enter a useful comment about the each waveform you save. Write each comment such that it explains the purpose of the saved waveform when its waveform file is later accessed (see right).</p> <p>Tip. If you save multiple waveforms, the instrument saves your comment with all the resulting files, so make such a comment pertain to all the waveforms.</p>	
<p>Save your waveform</p>	<p>8. Click the Save button to save the waveform file or reference. To cancel without saving, click Cancel button.</p>	
<p>For more information</p>	<p>9. For more help on saving waveforms, press the Help button in the dialog box to access the contextual online help.</p>	 <p>See page 3-167 to learn about using online help.</p>


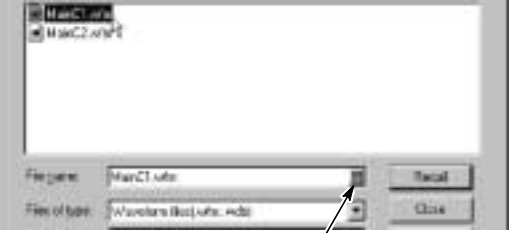


End of Procedure


To Recall Your Waveform

Use the procedure that follows to recall a waveform to a reference. You can only recall waveforms into references.

NOTE. Reference waveforms do not recall because they are already instrument resident. You can copy a reference waveform to another reference: first display the reference to be copied, and then use the Save Waveform procedure to save it to another reference (R1-R8).

Overview	To recall a waveform	Control elements & resources
<p>Prerequisites</p>	<p>1. The instrument must have appropriate sampling modules in place before powering on the instrument. Instrument must be powered up.</p>	<div data-bbox="1133 688 1224 800" data-label="Image"> </div> <ul style="list-style-type: none"> ■ See Sampling Module User Manuals for sampling module installation. ■ See <i>Power On Instrument</i> on page 1-14.
<p>Display the Recall Waveform dialog box</p>	<p>2. From the application menu bar, select File, and then select Recall Waveform. (See illustration at right.)</p> <p>The Recall Waveform dialog box allows navigation to directories, lists waveform files in the directory, and provides for selection of a waveform file. Comments for selected files appear in the comment box. (See below.)</p> <div data-bbox="321 1228 915 1738" data-label="Image"> </div>	<div data-bbox="1024 989 1369 1392" data-label="Image"> </div>



Overview	To recall a waveform (cont.)	Control elements & resources
<p>Name a destination</p>	<p>3. Use the Look in: drop down list and buttons (see right) to navigate to the directory which contains a waveform that you want to recall.</p>	
<p>Select your waveform</p>	<p>4. If not selected, select *.wfm in the Files of type field to force the dialog-box file listing to only include these types. Use *.wfm for waveforms.</p> <p>Tip. Only change the type if you want to temporarily see any other types of files in the current directory. Otherwise, leave it set at *.wfm.</p> <p>5. Choose your waveform file by either:</p> <ul style="list-style-type: none"> ■ Clicking an existing name in the file list. ■ Clicking in the File name field and typing a new name, replacing the default file name. <p>Tip. If your instrument lacks a keyboard, touch or click on the icons as indicated right to display a virtual keyboard. You can use the mouse or touch screen with the virtual keyboard to type entries in the File name and Files of type boxes.</p>	 <p style="text-align: center;">Access to virtual keyboard</p>
<p>View any included comment (optional)</p>	<p>6. Read the comment associated with the waveform file you choose, if a comment is present. It can contain information that help you use the waveform you are about to restore (see right).</p> <p>Tip. Selecting a file displays any comments that were entered when the waveform was saved.</p>	
<p>Recall your waveform</p>	<p>7. Click the Recall button to save the waveform file. To cancel without recalling a waveform, click the Close button.</p>	

Overview	To recall a waveform (cont.)	Control elements & resources
For more information	8. For more help on recalling waveforms, press the Help button in the dialog box to access contextual online help.	 See page 3-167 to learn about using online help.

End of Procedure

To Clear References

You can clear individual references of data individually or all at once. If a reference is listed as active and you are sure you do not want the data it contains, use the procedure that follows to clear it. You can clear any of the active references R1-R8.

Overview	To clear a reference	Control elements & resources
<p>Display the Clear References dialog box</p>	<p>1. From the application menu bar, select Edit, and then select Clear References. See illustration at right.</p>	 <p>The screenshot shows the application menu bar with 'File', 'Edit', 'View', 'Setup', 'Utilities', and 'Help'. The 'Edit' menu is open, displaying options: Cut, Copy, Paste, Undo, Redo, Clear References (highlighted), and Clear Data. A mouse cursor is pointing at 'Clear References'. Below the menu, the reference 'R2' is visible.</p>
<p>Select Refs</p>	<p>2. Click to select the reference to clear. If you have a keyboard installed, you can hold down the control key and click to select multiple references for deletion. Click the Clear button to delete; click the Close button to dismiss the dialog box.</p>	 <p>The screenshot shows the 'Clear References' dialog box. It has a title bar 'Clear References' and a list box containing 'R1', 'R2', and 'R3'. 'R2' is selected. To the right of the list are buttons for 'Clear', 'Select All', and 'Deselect All'. At the bottom are 'Close' and 'Help' buttons.</p>

End of Procedure

Exporting Waveforms and Histograms

This instrument also supports export of a waveform or histogram to a file. The instrument exports the data as comma-separated ASCII text.

Why Use? By exporting a waveform or a histogram, you can use it with other analysis tools, such as spreadsheets or math-analysis applications.

Keys to Using The key points that describe operating considerations for setting up the exporting of waveforms and histograms follow:

- Waveforms export as a series of comma-separated values (CSV), which are amplitudes without units. There is no timing information, but data is placed in the file in sequence from the first sample in the waveform record to the last.
- Histograms also export as a series of comma-separated values (CSV), which are values without units. One value is present for each bin in the histogram.
- Because the waveforms are exported as CSV, without timing and scaling information, the instrument does not import these waveforms directly. If you intend to recall a waveform later, save it (see the procedure *To Save Your Waveform* on page 3-121) instead of exporting it. You cannot import histograms.
- You may also choose to copy a waveform and paste directly into some applications such as Microsoft Word or Excel. If so, select your waveform, and then select Copy in the Edit menu.

To Export Your Waveform The procedure to export waveforms is almost the same as the procedure to save a waveform. Use the procedure *To Save Your Waveform* on page 3-121 while observing the following differences:

- Select Export Waveform from the the File menu instead of Save waveform. The Export dialog box displays (see Figure 3-25 that follows).
- You can only select and export one waveform at a time.
- You cannot include comments with your exported waveform.
- Your exported waveform will contain the waveform data as a series of comma separated values (no timing information, but data is sequential).




Figure 3-25: Export dialog box

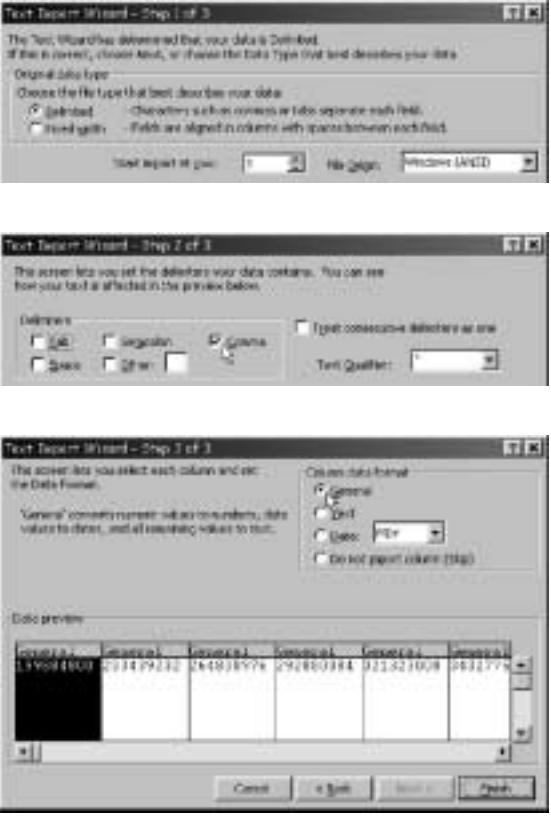
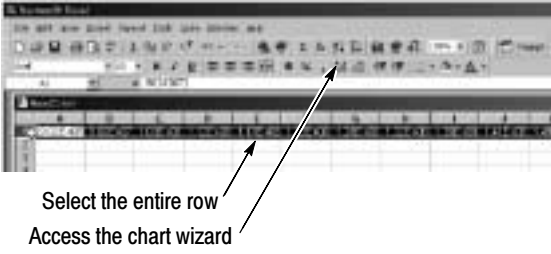
To Export Your Histogram

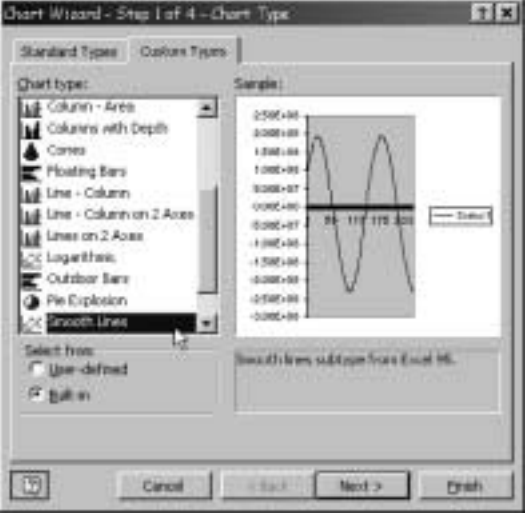
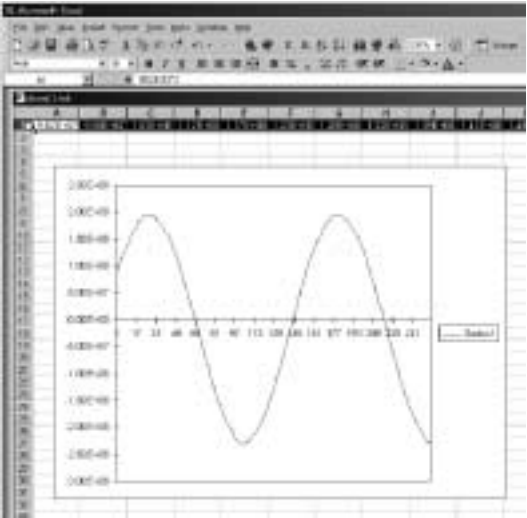

Use the process just described for exporting a waveform on page 3-128, select the Histogram button in the Export dialog box (see Figure 3-25). Also skip selecting a source. The instrument supports a single histogram, so the current histogram is automatically selected. If no histogram is enabled in the Hist Setup dialog box, the Histogram button will be disabled in the Export dialog box.

To Use an Exported Waveform (or Histogram)

How you use the exported waveform or histogram depends on your application. The following example is a simple application using a waveform; the procedure is general and may require adapting for your spreadsheet or other data-analysis tool.

Overview	To use exported waveforms	Control elements & resources
Prerequisites	<ol style="list-style-type: none"> 1. MS Excel 97 running on a PC or on the instrument. 2. Access to a waveform exported by the instrument. 	 <ul style="list-style-type: none"> ■ See <i>To Export Your Waveform</i> on page 3-128.

Overview	To use exported waveforms (cont.)	Control elements & resources
<p>Import the waveform data</p>	<p>3. In Excel, select Open from the File menu. Use the dialog box that pops up to navigate to the directory containing the file.</p> <p>4. In the dialog that displays, make the selections as shown right as you navigate through the Text Import Wizard. You must select delimiter as your data type, comma as the delimiter type, and General as your data type.</p> <p>Tip. This step assumes MS Excel 97; your tool may have similar import features for comma-separated data. Check its documentation.</p>	
<p>Begin your chart</p>	<p>5. Click on the row number to select the entire row containing your imported waveform values (See illustration at right.)</p> <p>6. Select the Chart button from the toolbar (See illustration at right.) or from the Insert menu.</p>	 <p>Select the entire row Access the chart wizard</p>



Overview	To use exported waveforms (cont.)	Control elements & resources
<p>Specify a line-graph chart</p>	<p>7. From the Chart Wizard, make sure Built In is checked. Then select the either Lines in the Standards Types tab or Smooth lines in the Custom Types tab. (See illustration at right.)</p>	
<p>Finish the chart</p>	<p>8. Click Next to step through the next two steps accepting the defaults settings at each step. Click the Finish button in step 4. You should have a waveform display similar to that show right.</p> <p>Tip. This procedure assumes MS Excel 97. You can likely specify titles, customize the treatment and labeling of the x and y axes, etc. in your data-analysis application—either as you create the chart or afterward. Use the help for your data-analysis application to determine if it has these capabilities and for instructions in using them.</p>	
<p>For more information</p>	<p>9. For more help on exporting waveforms., press the Help button in the dialog box to access contextual online help.</p>	<div style="text-align: center;">  <p>See page 3-167 to learn about accessing online help.</p> </div>


End of Procedure

Printing Waveforms

You can print the display screen, including any waveforms displayed. Before doing so, you must install and set up your printer.

To Print Waveforms To print the display and its waveforms, do the following steps:



Overview	To print waveforms	Control elements & resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. Waveforms must be displayed on screen. 2. Your printer must be accessible and configured properly. 	 <ul style="list-style-type: none"> ■ See <i>Acquiring Waveforms</i> on page 3-3. ■ See <i>Triggering</i> on page 3-39. ■ See <i>Displaying Waveforms</i> on page 3-53. ■ See your printer instructions and/or the Windows Help. (See page 3-161 for information on accessing Window help.)
<p>Access the Print dialog box</p>	<ol style="list-style-type: none"> 3. Select the File menu from the application menu bar, and then select Print in the menu. 	


Overview	To Print Waveforms (cont.)	Control elements & resources
<p>Configure and Print</p>	<p>4. Configure your print job using the the standard Microsoft Windows 98 Print dialog box that displays. Press the OK button to print your display.</p> <p>Tip. Access the printer instructions or the Windows Help system if you require more information on printing.</p>	 <p>The screenshot shows the 'Print' dialog box for a 'QMS 2425 Print System'. The printer name is selected in a dropdown menu. Below this, the status is 'Default printer: Ready', the type is 'QMS 2425 Print System', and the where is 'W:\EXADM1\B42932'. A comment is also present: 'QMS 2425 Print System: B50-L2 (Std K14)'. There is a 'Print to file' checkbox which is unchecked. The 'Print range' section has three radio buttons: 'All' (selected), 'From page', and 'To page'. The 'Copies' section has a 'Number of copies' field set to '1' and a 'Copies' checkbox which is checked. At the bottom, there are 'Help', 'OK', and 'Cancel' buttons.</p>

End of Procedure

To Print Using Ink-saver Mode

To conserve ink and improve print quality when printing images of waveform displays, you can use Ink-saver mode. Do the following steps:

Overview	To print using ink-saver mode	Control elements & resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. Waveforms must be displayed on screen. 2. Your Printer must be accessible and configured properly. 	 <ul style="list-style-type: none"> ■ See <i>Acquiring Waveforms</i> on page 3-3. ■ See <i>Triggering</i> on page 3-39. ■ See <i>Displaying Waveforms</i> on page 3-53. ■ See your printer instructions and/or the Windows Help. (See page 3-161 for information on accessing Window help.)
<p>Access the Print dialog box</p>	<ol style="list-style-type: none"> 3. Select the File menu from the application menu bar, and then select Page Setup in the menu. 	

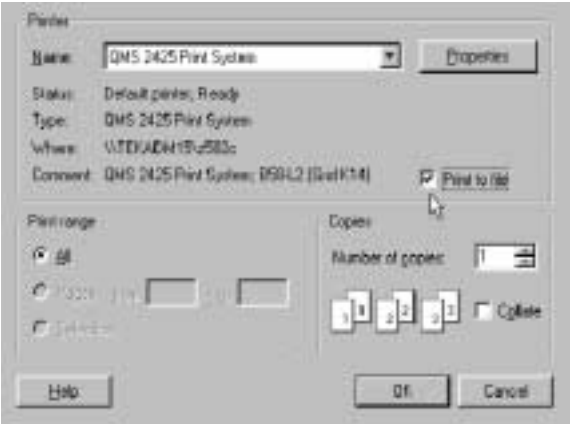
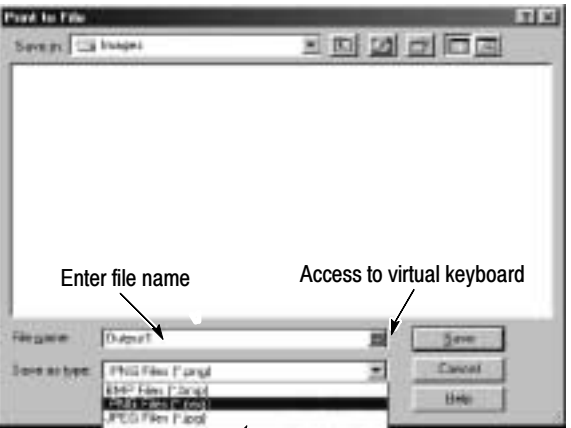
Overview	To print using ink-saver mode (cont.)	Control elements & resources
<p>Set Ink-saver mode</p>	<ol style="list-style-type: none"> 4. In the Page Setup dialog box that displays, click Ink-saver Mode. 5. Click OK to set the instrument to use Ink-saver mode, or click Print... to set up your print job and print the display. 	 <p>The screenshot shows the 'Page Setup' dialog box. At the top, there is a preview of a printed page. Below the preview, the 'Paper' section has 'Size' set to 'Letter' and 'Source' set to 'AutoSelect Tray'. The 'Orientation' section has 'Portrait' selected. The 'Margins (inches)' section shows 'Left: 0.5"', 'Right: 0.5"', 'Top: 0.5"', and 'Bottom: 0.5"'. The 'Image' section has 'Normal' selected, and 'Ink-saver Mode' is selected with a radio button. At the bottom, there are 'OK', 'Cancel', and 'Print...' buttons.</p>

End of Procedure

To Print to a File

You can also print the instrument screen and its waveforms to a file. This instrument currently supports printing to BMP, JPEG, TIFF, PNG and Targa image-file formats.



NOTE. Screen images saved using the PNG (Portable Network Graphics) format can consistently achieve compression ratios better than 10:1, and often better than 50:1 compared to a BMP screen image file. PNG is a lossless format similar to GIF format.

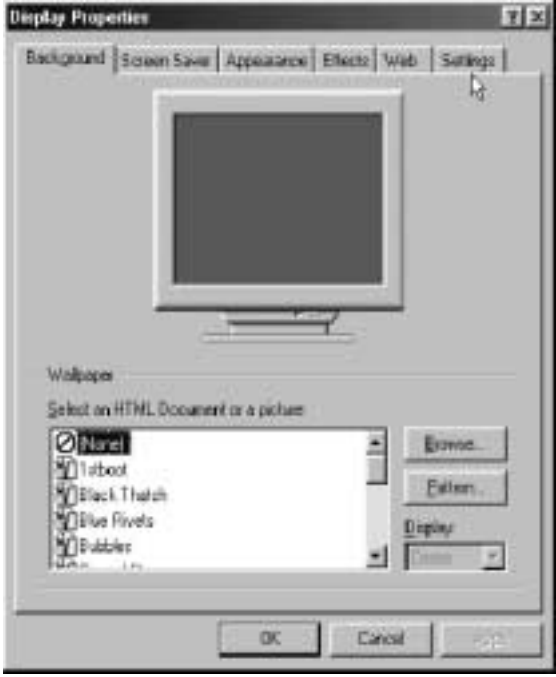

Overview	To print to a file	Control elements & resources
<p>Access the Print dialog box</p>	<ol style="list-style-type: none"> 1. Select the File menu from the application menu bar, and then select Print in the menu. 2. Click the Print to File box in the Print dialog box, and click OK. 	
<p>Select format and save</p>	<ol style="list-style-type: none"> 3. In the Print to File dialog box, navigate to the folder you want. Then type a name for your file in the File name box. 4. In the Save as type menu, click the down-arrow and select a file image format from the drop-down menu. 5. Click Save to place the instrument screen in the file and image format that you selected. <p>Tip. Access the printer instructions or the Windows Help system if you require more information on printing.</p>	 <p>Enter file name</p> <p>Access to virtual keyboard</p> <p>Select the image format</p>

End of Procedure

To Set High Color

If the display screen printouts have missing information such as blacked-out readouts, your instrument may need to be set to a higher color setting. To do so, follow the steps below:

Overview	To set high color	Control elements & resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> 1. Waveforms must be displayed on screen. 2. Your Printer must be accessible and configured properly. 	 <ul style="list-style-type: none"> ■ See <i>Acquiring Waveforms</i> on page 3-3. ■ See <i>Triggering</i> on page 3-39. ■ See <i>Displaying Waveforms</i> on page 3-53. ■ See your printer instructions and/or the Windows Help. (See page 3-161 for information on accessing Window help.)
<p>Access the Display Properties dialog box</p>	<ol style="list-style-type: none"> 3. Click the minimize (-) button in the upper right corner of the UI application to expose the desktop. 4. Right click the desktop, and select Properties from the menu that pops up. 	

Overview	To set high color (cont.)	Control elements & resources
<p>Select the Settings Tab</p>	<p>5. In the Display Properties dialog box that displays, click the Settings tab.</p>	 <p>The screenshot shows the 'Display Properties' dialog box with the 'Settings' tab selected. The 'Wallpaper' section is visible, showing a list of wallpaper options: Planet, Turbo, Black Hatch, Blue Rivets, and Bubbles. The 'Planet' wallpaper is currently selected. Buttons for 'Browse...', 'Enter...', 'Display', and 'Cancel' are visible.</p>
<p>Select and Set High Color</p>	<p>6. Click the monitor 1 icon (if necessary) in the Settings dialog box.</p> <p>7. Select High Color in the Colors list box.</p> <p>8. Click OK to apply changes. If a confirmation box appears, click its OK button.</p>	 <p>The screenshot shows the 'Display Properties' dialog box with the 'Settings' tab selected. The 'Display' section shows '1. Default Monitor on Chips and Tech. 6900E PD'. The 'Colors' dropdown menu is open, showing options: 'High Color (16 bit)', '256 Colors', 'High Color (18 bit)', and 'True Color (24 bit)'. The 'High Color (16 bit)' option is selected. The 'Screen size' section shows '140 by 480 pixels' and an 'Advanced...' button.</p>

End of Procedure

NOTE. *If you print the screen infrequently, you may want to return the colors setting to 256 colors except when printing. To return to 256 colors, repeat the procedure above, but select 256 colors in step 4.*

Remote Communication

Remote communication is performed through the GPIB interface. Consult the online *Programmer Guide* for help with establishing remote communication and control of the instrument.

To access the Programmer Guide, select *Programmer Guide* in the Help menu from the front screen.

Using Masks, Histograms, and Waveform Databases

The instrument comes equipped with statistical tools to help you display, test, and evaluate waveforms. This section describes these tools and how you use them:

- *Mask Testing Waveforms*, on page 3-141, describes how you can use standard or user-defined masks to set up the instrument to automatically detect mask violations in communications and other waveforms.
- *Taking Histograms*, on page 3-154, describes how to take histograms to view the horizontal or vertical distribution of data on your waveforms.
- *Using Waveform Databases*, on page 3-159, describes how to accumulate a waveform into the database and use the waveform database to view the waveform data weighted with respect to how frequently it reoccurs in the database.

Mask Testing Waveforms

This section overviews the instrument features related to mask testing, including how to create, edit, delete, and activate masks. You can select a standard mask, edit a mask, or create a new mask from scratch.

Why Use?

Use mask testing to test your waveforms for time or amplitude violations. Mask testing will count waveform samples (called hits or violations) that occur within a specific area (the mask).

Use the communications-standard masks that this instrument provides (SONET/SDH, Fiber Channel Optical and Electrical, and Ethernet) to test your signals, or define your own masks.

What's Special?

Some mask testing features of note follow:

Flexible Mask Editing. You can use the controls in Mask Setup dialog box to completely specify custom masks or edit existing masks, selecting, adding/deleting, and placing a vertices in user-defined (waveform source) units. For quick edits, you can use the mouse or touchscreen to drag to resize and reposition the masks directly on the screen.

Mask-Specific Autoselect. You can set Autoselect to either Auto or Manual in the Mask Setup dialog box. When set to Auto, the instrument automatically performs a standard, mask-specific autoselect whenever you select a standard mask.

What's Excluded?

GPIB editing. You cannot edit masks through the programmable interface (GPIB). You can, however, still create and/or delete entire masks through this interface.

Concurrent Mask Tests. Only one mask standard (or user defined set) is active at any time. If you have a mask selected/enabled and then select a new mask, the new mask replaces the previous mask. You cannot test to multiple standards simultaneously.

Keys to Using

The key points that describe operating considerations for using and editing masks follow:

Mask Standards and Masks. A mask standard contains one or more masks that, when applied against the waveforms for which they are intended, test the waveform for violations of an industry standard. The supported standards are listed in Table 3-9.

Masks are numbered polygons that define an area within a mask standard (or within a user mask) in which to count waveform samples as hits.

Table 3-9: Standard masks

SONET/SDH	Fiber channel	Ethernet / Other
OC-1/STM-0 51.84 Mb/s	FC133 Optical 132.8 Mb/s	Gigabit Ethernet
OC-3/STM-1 155.52 Mb/s	FC266 Optical 265.6 Mb/s	10GBASE-X4 (Ethernet)
OC-9 466.56 Mb/s	FC531 Optical 531.2 Mb/s	10GBASE-W (Ethernet)
OC-12/STM-4 622.08 Mb/s	FC1063 Optical 1.0625 Gb/s	10GBASE-R (Ethernet)
OC-18933.12 Mb/s	FC2125	Infiniband (Other)
OC-24 1244.2 Mb/s	FC4250	2GbE
OC-36 1866.2 Mb/s	FC133 Electrical 132.7 Mb/s	XAUI-Near
OC-48/STM-16 2488.3 Mb/s	FC266 Electrical 265.6 Mb/s	XAUI-Far
FEC2666	FC531 Electrical 531.2 Mb/s	FEC11.10 Gb/s
OC-192/STM-64	FC1063 Electrical 1.0625 Gb/s	
FEC1066	10 GFC	
FEC1071		
OC-768/STM-256		
FEC4266		
FEC4302		

Mask Counts. The instrument lists statistics for each mask (polygon) in the enabled standard (or user) in the Mask readout on the right side of the instrument screen. Each mask is listed by its number, with its count of hits, the number of hits common to all masks, and the total count of waveforms acquired.

Mask Editing. Masks can be edited, in which case they become a User mask. Some tips on creating and using masks follow:

- When editing, locate one point along the left edge or right edge of the mask further left or further right than any other point. You can still create straight lines along the edge; just place one point further left or right than the others on the edge.
- The vertices numbers increase according to their order from left to right. The instrument reassigns numbers to vertices during mask creation or editing to hold to this rule.
- When adding new points to a mask, the instrument determines their location in the mask as follows (see Figure 3-26):
 - a. Defines an imaginary line between the left-most vertex and right-most vertex in the mask.
 - b. Defines all points above the imaginary line as the top of the mask; all points below as the bottom of the mask.
 - c. Inserts new user-added points above the imaginary line into the top of the mask; inserts new user-added points below the imaginary line into the bottom.
- To create a mask with a concave area, create several masks to cover the same area. Data falling into two overlapping masks is counted only once as part of the total mask hits.

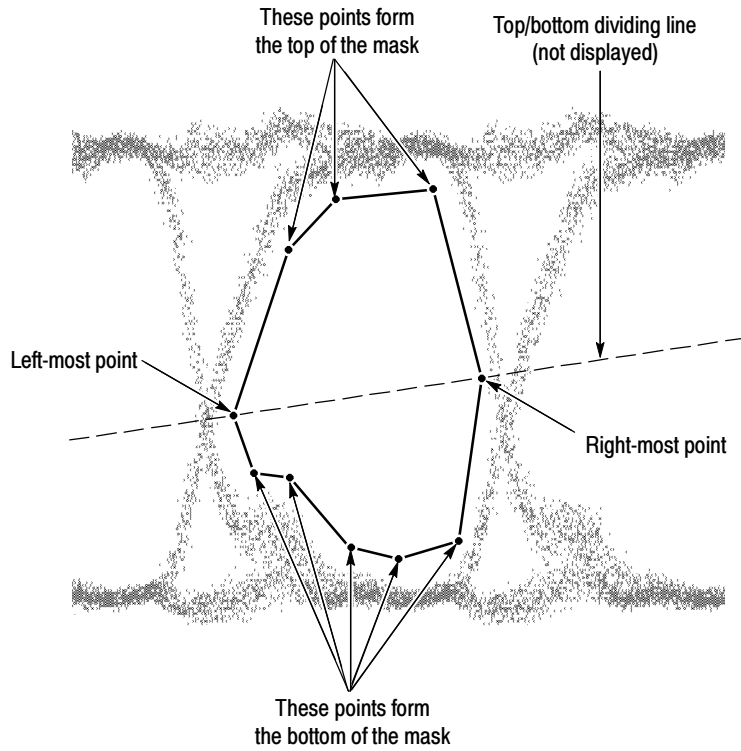


Figure 3-26: Creating a user mask

Note in Figure 3-27 that a new vertex has been added to the mask shown in Figure 3-26. Since the point is added above the line, it's added to the top.

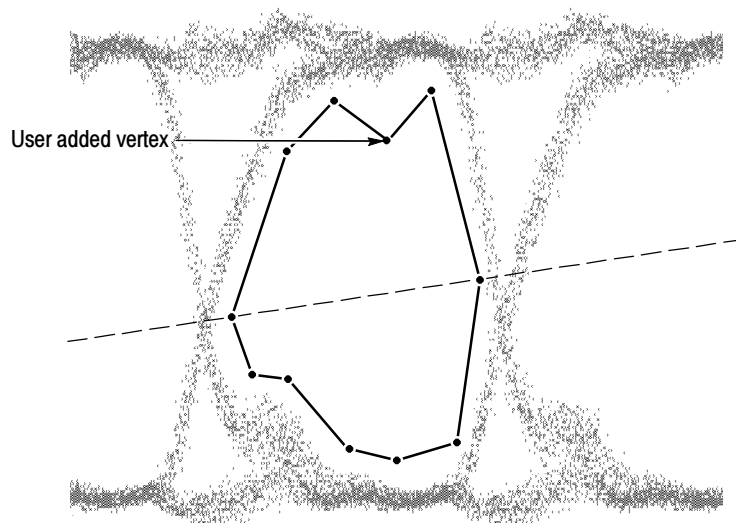



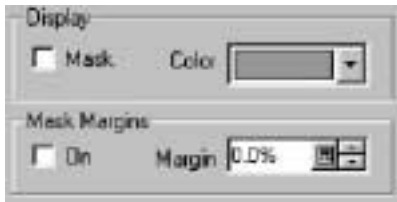




Figure 3-27: Adding a new vertex

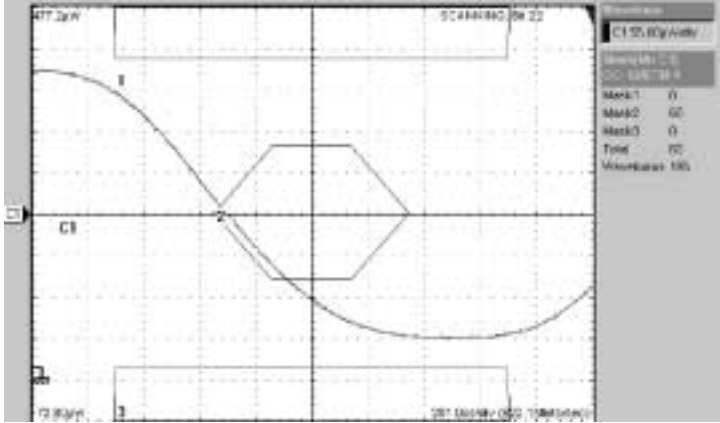
- Masks are saved with setups, so you can save sets of masks by defining them, and then storing the instrument setup. Displayed masks are overwritten when you recall a stored setup, select a standard mask, or initialize the instrument.

To Mask Test a Waveform Use the procedure that follow to set up the instrument to mask test a waveform against a mask standard or user-defined mask set.

Overview	To mask test a waveform	Related control elements & resources
Prerequisites	1. The instrument must have at least one waveform turned on.	 <p>See <i>Displaying Waveforms</i> on page 3-53 for information on displaying waveforms.</p>
Access the Mask Setup dialog box	2. Select Mask from the Setup menu to display the Mask Setup dialog box.	

Overview	To mask test a waveform (cont.)	Related control elements & resources
<p>Select the mask source and turn on a mask</p>	<p>3. Select the waveform to be mask tested from the drop-down list under Source.</p> <p>4. Use the Comm Standard drop-down list to select a standard or user-defined mask. See Table 3-9 on page 3-142 for a list of available standard masks.</p> <p>Selecting a communication standard or user-defined mask automatically:</p> <ul style="list-style-type: none"> ■ displays the mask on screen, and autosets for the mask, if Automatic is checked in the dialog box. ■ automatically enables mask testing; uncheck Enable Mask Counts if you want to turn off mask counting. ■ displays mask count statistics in the mask readout right of the display. A mask does not have to be displayed to have mask counting enabled. <p>5. Check Use Wfm Database to use a waveform database as the waveform source.</p> <p>The Clear Data button resets all mask counts. In addition, if the source for mask testing is a waveform database, clicking this button clears the waveform database.</p> <p>Tip. Selecting a source that is currently displayed as a waveform database automatically enables mask testing on the database. To mask test the waveform instead of its database, uncheck the Use Wfm Database box.</p>	
<p>Adjust the mask</p>	<p>6. You can use the color pulldown list to change the color of the selected masks on screen.</p> <p>7. You can add or subtract from the masks on screen. Check On to turn on mask margins. Adjust the Margin percentage box control to increase (positive %'s) or decrease the masks on screen.</p>	




Overview	To mask test a waveform (cont.)	Related control elements & resources
<p>Autoset the waveform to mask</p>	<p>8. Click the Autoset button to perform a manual autoset on the mask-source waveform.</p> <p>Tip. You can choose to autoset the mask-source waveform to the mask anytime you select a new mask standard; just check Automatic option under Autoset.</p> <p>9. Select the HiLow Method used to determine the High and Low values when aligning the input signal to the masks.</p> <p>Mean sets the Mask Autoset to use the mean value of the High level (topline) and Low level (baseline), taken within the fixed eye aperture (center 20% of the eye), to align the input signal to the NRZ mask.</p> <p>Mode sets the Mask Autoset to use the High level (topline) and Low level (baseline), taken across one unit interval of the eye diagram, to align the input signal to the NRZ mask.</p>	
<p>Set Stop Action & start testing</p>	<p>10. From the application menu bar, select Setup, and then select Acquisition.</p> <p>11. In the Acq Setup dialog box (see right), check the Condition option under Stop After.</p> <p>12. In the Condition pulldown list, select a mask-related criteria, such as Mask Total Hits and set a count, such as 1, in the count box.</p> <p>These settings will stop acquisition when mask violations satisfy the criteria you set here. See below.</p> <p>13. Push the RUN/STOP front-panel button to restart acquisition, if stopped.</p>	


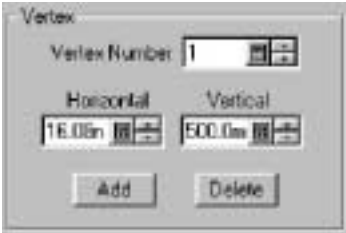
Overview	To mask test a waveform (cont.)	Related control elements & resources
		
<p>Restart testing</p>	<p>14. To restart after a Stop After condition occurs, push the front-panel CLEAR DATA front-panel button.</p> <p>Tip. If you want to acquire one, and only one, more waveform after the Stop After condition occurs, push the RUN/STOP front-panel button instead of CLEAR DATA.</p>	<p>ACQUISITION</p> <p>MENU CLEAR DATA RUN/STOP</p> <p>ACQUISITION</p> <p>MENU CLEAR DATA RUN/STOP</p>

End of Procedure

To Edit a Mask

When you edit a mask in an existing communications standard, the mask type switches from the selected standard to type User, and uses the masks from the Standard as a basis for editing. Use the procedure that follows.

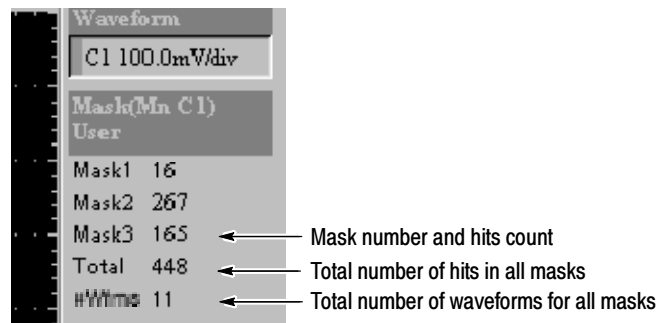
Overview	To edit a mask	Related control elements & resources
<p>Prerequisites</p>	<p>1. The instrument must have at least one waveform turned on and the Mask Setup dialog box displayed.</p>	 <p>See <i>Displaying Waveforms</i> on page 3-53 for information on displaying waveforms.</p>
<p>Select a mask</p>	<p>2. Next, you need to select and enable a standard mask set. To start with a standard mask, pull down the Comm Standard list and choose a standard mask. To create a mask from scratch or edit an existing user-defined mask, select User in the Comm Standard selection list.</p>	
<p>Open Mask Edit dialog box</p>	<p>3. Click Mask Edit... to display the Mask Edit dialog box.</p> <p><i>Note. The Mask Setup dialog box and Mask Edit dialog box are both within the Mask tab. Use the Edit Mask and End Mask Edit buttons to toggle back and forth between the two Mask dialog boxes.</i></p>	

Overview	To edit a mask (cont.)	Related control elements & resources																
<p>Select a mask to edit</p>	<p>4. Select a mask to edit from the Mask list. This section of the Mask Edit dialog box lists all masks available for edit and the number of vertices each mask has.</p>	 <p>The screenshot shows a dialog box titled "Mask" with a list of masks. Mask 1 is selected and highlighted. The list is as follows:</p> <table border="1"> <tr><td>Mask 1</td><td>4 Vertices</td></tr> <tr><td>Mask 2</td><td>4 Vertices</td></tr> <tr><td>Mask 3</td><td>4 Vertices</td></tr> <tr><td>Mask 4</td><td>Not Defined</td></tr> <tr><td>Mask 5</td><td>Not Defined</td></tr> <tr><td>Mask 6</td><td>Not Defined</td></tr> <tr><td>Mask 7</td><td>Not Defined</td></tr> <tr><td>Mask 8</td><td>Not Defined</td></tr> </table>	Mask 1	4 Vertices	Mask 2	4 Vertices	Mask 3	4 Vertices	Mask 4	Not Defined	Mask 5	Not Defined	Mask 6	Not Defined	Mask 7	Not Defined	Mask 8	Not Defined
Mask 1	4 Vertices																	
Mask 2	4 Vertices																	
Mask 3	4 Vertices																	
Mask 4	Not Defined																	
Mask 5	Not Defined																	
Mask 6	Not Defined																	
Mask 7	Not Defined																	
Mask 8	Not Defined																	
<p>Add, edit, or delete mask vertices</p>	<p>5. Once you have selected a mask, use the Vertex section of the Mask Edit dialog to add, edit, or delete individual vertices. Use the Vertex Number box to select a vertex number for the selected mask.</p> <p>6. Use the Horizontal and Vertical box controls to set the horizontal and vertical positions of the selected vertex.</p> <p>Tip. You may also drag and drop vertices directly on the mask to new locations. Click on the mask on the graticule to select it. Vertices are designated with an X.</p> <p>7. Click Add to add a vertex to the selected mask. After clicking Add, click the location on the selected mask (in the graticule) where you want to the new vertex added.</p> <p>8. Click Delete to delete the selected vertex from the selected mask.</p> <p><i>Note.</i> When you add or delete a vertex, the Mask list is updated to show the new number of vertices for each mask.</p> <p>9. Click End Mask Edit to close the Mask Edit dialog box and return to the Mask Setup dialog box.</p>	 <p>The screenshot shows the "Vertex" section of a dialog box. It includes a "Vertex Number" field with the value "1", and two numeric input fields for "Horizontal" (value "16.00in") and "Vertical" (value "500.00in"). Below these are "Add" and "Delete" buttons.</p>																

End of Procedure

Counting Masks

Mask-counting statistics are displayed in the mask readout at the right-side of the display. Mask counting statistics are displayed as soon as you enable a mask, and stay visible even if the mask isn't displayed on screen.



If mask counting is enabled, read the results as follows:

- **Mask (n):** Each mask in the standard is listed by number (Mask 1 for example) along side the number of hits in that mask.
- **Total:** Displays the total of all hits in all masks.
- **#Wfms:** Displays the number of waveforms that have been tested against the masks.


To zero the counts for all masks, click Clear in the Mask Setup dialog box.

NOTE. Executing Clear will clear not only the mask counts, but also the underlying waveform data. For example, if mask testing on a waveform database the database data is cleared and accumulation is restarted, and if mask testing on a waveform being averaged or enveloped, Clear restarts the averaging or enveloping.

To Create a New Mask

Masks are created by connecting the points independently of the order they are entered. Points are connected by sorting the points in left-to-right order and grouping them across a diagonal from the left-most point to the right-most point. If two points share a horizontal position along either the left or right edge of the mask, the diagonal runs from the top left-most point to the bottom right-most point. Points below the diagonal form the bottom boundary of the mask; points above it form the top boundary. Use this procedure to create a new mask:

Overview	To create a new mask	Related control elements & resources
<p>Prerequisites</p>	<p>1. The instrument must have at least one waveform turned on and the Mask Setup dialog box displayed.</p>	<div data-bbox="1166 655 1253 768" data-label="Image"> </div> <p>See <i>Displaying Waveforms</i> on page 3-53 for information on displaying waveforms.</p>
<p>Select and display a user-defined mask</p>	<p>2. To create a mask from scratch, select User in the Comm Standard selection list.</p>	<div data-bbox="1052 911 1425 1205" data-label="Image"> </div>

Overview	To create a new mask (cont.)	Related control elements & resources
<p>Create a new mask</p>	<ol style="list-style-type: none"> 3. Click Mask Edit to display the Mask Edit dialog box. 4. In Mask list, select the user-defined mask you wish to edit. 5. Use the Vertex controls to add, position, and delete vertices on your new mask. You may also drag and drop vertices directly on the graticule display. 6. Click End Mask Edit when you are finished creating your mask to apply all additions/changes and return to the Mask Setup dialog box. 7. Read Helpful Hints (immediately following this procedure) for more information on creating masks. 	

End of Procedure

Taking Histograms

The instrument can display histograms constructed of waveform data. You can display both vertical (voltage) and horizontal (time) histograms, but only one at a time.

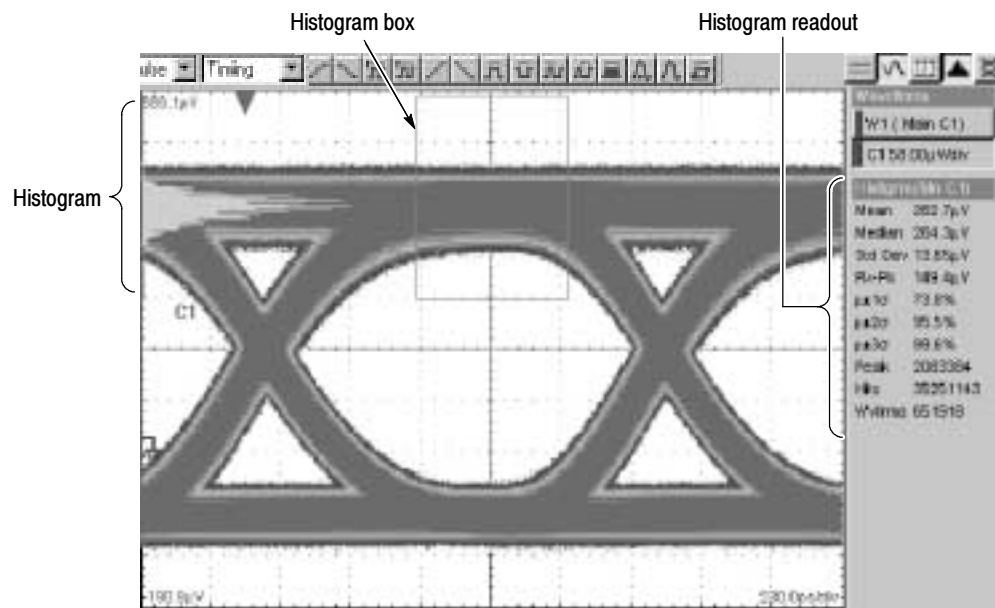


Figure 3-28: Vertical histogram view and statistics on data

Why Use? Use histogram statistics to analyze a range of data that you select.

What's Special? Some histogram features of note follow:

Flexible Histogram Editing. You can use the controls in Hist Setup dialog box to completely specify the histogram box on the waveform, in waveform units or as a percent of the graticule. For quick edits, you can use the mouse or touchscreen to drag to resize and reposition the box directly on the screen.

Any Waveform or database as Source. Histograms can be taken on all channel, math, and reference waveforms. You can also take a histogram on any of the waveform databases that this instrument provides.

Continuous Operation. The histogram that you set up can run, and its results can be displayed even if you turn off the display of the histogram or of the waveform

selected as its source. Histogram data is continuously accumulated and displayed until you explicitly turn it off or clear the waveform data of the histogram source.

What's Excluded?

Histograms longer than 500 bins. Histograms are limited to the on screen resolution, limiting horizontal sizes of 500 bins.

Multiple histograms. One histogram can be displayed on one source at a time. The source can be any waveform in any of the three Views, Main, Mag1, or Mag2.

Keys to Using Histograms

The following key points describe operating considerations for setting up the histograms so that they best support your data-analysis tasks.




Histogram Counting Stays On. Once you check Enable Histogram in the Histogram Setup dialog, histogram counting starts and continues until you turn disable the histogram or clear the histogram counts. If the histogram is not displayed on the graticule but histogram statistics still appear on the display, histogram counting is still running.

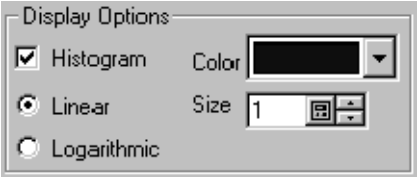
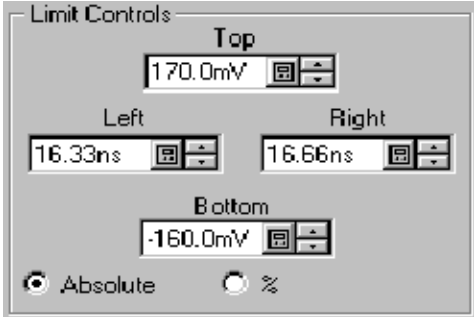
NOTE. Histogram counts are cleared when push Clear button in the Hist Setup dialog box or when you push CLEAR DATA on the front panel. Also, changing any acquisition control will implicitly clear all acquired data and the histogram count as well.

Histogram Size. The maximum vertical histogram size is 400 bins. The maximum horizontal size is 500 bins.

Recalling Setups. The histogram state is restored to what it was when the setup was saved.

To Take a Histogram Use the procedure that follows to quickly take a measurement based on the default settings for histograms.

Overview	To take a histogram	Related control elements & resources
<p>Prerequisites</p>	<ol style="list-style-type: none"> The instrument must have at least one waveform displayed to access the Hist Setup dialog box. 	 <p>See page 3-62 for waveform-display instructions if needed.</p>
<p>Access the histogram</p>	<ol style="list-style-type: none"> Open the Hist Setup dialog box by selecting Histogram in the Setup menu. 	
<p>Set, display, and reset histogram source and type</p>	<ol style="list-style-type: none"> Use the Source pulldown list to select a waveform source for the histogram. Check Enable Histogram to start histogram counting, display the histogram on screen, and turn on the Histogram readout. Click the Vertical or Horizontal histogram option button of your choice. You can only display one type of histogram at a time. Check if you want the data taken on an accumulation of the source waveforms (a waveform database) instead of on the currently acquired waveform. Press Clear to reset the histogram count and to clear the data in the source waveform. Histograms track numbers of counts. Clicking Clear resets those counts to zero and begins counting from zero. 	

Overview	To take a histogram (cont.)	Related control elements & resources
<p>Set histogram display options</p>	<p>8. Use the Histogram to turn on and off the display of the selected histogram (histogram counting remains enabled). Use the color list to select a color for the histogram. Select a value in the Size box to adjust the histogram display on screen.</p> <p>9. Select Linear to display histogram data linearly. Bin counts are scaled linearly by dividing the bin count by the maximum bin count.</p> <p>10. Select Logarithmic to display histogram data logarithmically. Bin counts are scaled logarithmically. Logarithmic scaling provides better visual details for bins with low counts.</p>	
<p>Set histogram limit controls</p>	<p>11. Use the Top, Bottom, Left, and Right boxes to set the size and location of the histogram box. The histogram box selects the section of the waveform used for histograms.</p> <p>12. Select Absolute to use units based on the source waveform. Select % to display the histogram box as a percentage of the graticule. This display setting considers the top-left corner of the graticule to be 0,0 and the bottom-right corner to be 100,100.</p> <p>Tip. It is quicker to use the mouse or touchscreen to drag to size the histogram box on screen, then fine tune the values if needed with the Limit Controls.</p>	

End of Procedure

Histogram Statistics

After you check Enable Histogram in the Histogram Setup dialog box, histogram statistics appear on the right-hand side of the screen. The following table is a list of the available histogram statistics and a brief description of each.

Table 3- 10: Histogram statistics

Name	Description
Mean	The average of all acquired points within (or on) the histogram box.
Median	Half of all acquired points within (or on) the histogram box are less than and half are greater than this value.
Standard Deviation	The standard deviation (Root Mean Square (RMS) deviation) of all acquired points within (or on) the histogram box.
Peak-to-Peak (Pk-Pk)	The peak-to-peak value of the histogram. Vertical histograms display the amplitude of the highest nonzero bin minus the amplitude of the lowest nonzero bin. Horizontal histograms display the time of the rightmost nonzero bin minus the time of the leftmost nonzero bin.
Mean \pm 1 StdDev($\mu \pm 1\sigma$)	The percentage of points in the histogram which are within 1 standard deviation of the histogram mean.
Mean \pm 2 StdDev($\mu \pm 2\sigma$)	The percentage of points in the histogram which are within 2 standard deviations of the histogram mean.
Mean \pm 3 StdDev($\mu \pm 3\sigma$)	The percentage of points in the histogram which are within 3 standard deviations of the histogram mean.
Peak Hits	Displays the number of points in the largest bin of the histogram.
# of Histogram Hits	Displays the number of hits within or on the histogram box.
# of Waveforms	Displays the number of waveforms that have contributed to the histogram.

Using Waveform Databases

A waveform database is a three-dimensional accumulation of a source waveform as it is repeatedly acquired. In addition to the standard vertical and horizontal dimensions, each waveform sample in a waveform database has a third dimension of count. The count reflects the number of times a specific waveform point has been acquired or generated.

Why Use? Use waveform databases for measurements, histogram calculations, mask testing, and generating a density-style graded display. Waveform databases may be automatically allocated for measurements, histograms, and mask testing.

What's Special? Some waveform database features of note follow:

- Waveform record length is not limited to 500 (horizontal waveform database dimension and number of horizontal display columns) when waveform databases are active. Record lengths can vary over the entire allowable range.
- To emphasize the data that occurs less frequently, you can toggle the Invert Color/Intensity control in the Waveform Database setup dialog box, which reverses the intensity/color assignments to each pixel in the database display.
- You can set any selected database to use a persistence mode to accumulate and display data. Infinite persistence mode continues displaying waveforms as they accumulate until the selected database is cleared manually or by a control change. Variable persistence mode keeps and displays accumulated data in the specified database until the user-specified waveform count is surpassed. Each waveform accumulated beyond the count removes the oldest waveform accumulated earlier in the database.

What's Excluded? The following operations are excluded:

References as sources. Because references contain static data that does not update, they are not available as a waveform source for waveform databases.

More than four waveform databases. More than four waveform databases cannot be created at one time. Note the following behaviors regarding waveform databases:

- There are four waveform databases; you can explicitly assign and reassign Database1 through Database4 to waveform sources in the Wfm Database dialog box.
- Once all databases are allocated, the only way to assign a new waveform is to change the waveform source of one of the databases in the same dialog box, which releases its existing source.

- If all four databases are assigned and you attempt to implicitly assign a waveform source to a database (for example, by right clicking a waveform icon in the Waveform bar and selecting color grading), the instrument will display a notice that no databases are available.

NOTE. *The above exclusion does not mean that a waveform database cannot be used by multiple systems or features. For example, you can use the same database as the source for a histogram, an automatic measurement, and a mask test.*

Interpolation or vector displays. Waveform database accumulation is always a dot mode accumulation; therefore, no interpolation or vectoring is performed.

Keys to Using

The key points that follow describe operating considerations for setting up a waveform database.

Dimensions. Waveform database dimensions match those of the database source and are described as follows:

- **Horizontal (columns):** Always 500 columns, which is the maximum horizontal graticule view size. Columns are in horizontal units that match the horizontal units of the source.
- **Vertical (rows):** Always 402 rows, which is the maximum vertical graticule size plus one row each for overrange (OR) and underrange (UR). Rows are in vertical units that match the vertical units of the source.
- **Count (weights or density):** up to 32 bits.

Display. When you assign a waveform database to a waveform source (using the Waveform Database Setup dialog box) you must explicitly turn on the waveform database display if you wish to see it on screen; otherwise, the waveform source displays using the default (vector) display. The waveform database still accumulates in the background and can be turned on later without clearing the database.

Display Options. The Color, Intensity, and Invert controls determine whether the instrument displays its databases graded by color or intensity.

- **Color:** Different colors are used to indicate data-accumulation density.
- **Intensity:** Different shades of one color are used to indicate density.
- **Invert:** When Invert is selected, colors and intensities that are indicating high data-accumulation counts toggle to indicate low counts. Inverting the colors or intensities can sometimes make the data that occurs least in the waveform database easier to see.

- **Grading Method:** The Grading Method control determines the method by which database data (bin counts) are converted into display colors/intensities.

EMPH8 selects a curve-driven grading method that utilizes eight display colors/intensities. The curve is specified by the Emphasize Counts setting, see Emphasize Counts, below.

EMPH7 selects a curve-driven grading method that utilizes seven display colors/intensities. The curve is specified by the Emphasize Counts setting, see Emphasize Counts, below.

BIN8 selects a binary grading method that uses eight display colors/intensities. This method assigns ranges of counts to colors/intensities by successively halving the maximum bin count and assigning the resultant ranges in brightest-to-darkest color/intensity order. If the maximum bin count is less than the number of display colors, then a one-for-one mapping of counts to colors/intensities is used.

BIN7 selects a binary grading method that uses eight display colors/intensities. This method assigns ranges of counts to colors/intensities by successively halving the maximum bin count and assigning the resultant ranges in brightest-to-darkest color/intensity order. If the maximum bin count is less than the number of display colors, then a one-for-one mapping of counts to colors/intensities is used.


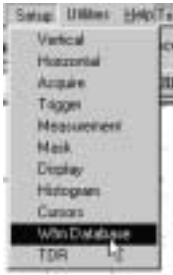
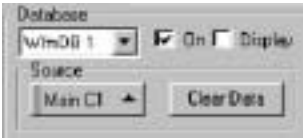

Emphasize Counts controls specify what range of counts you want emphasized when EMPH7 or EMPH8 Grading is selected. The slide bar selects a percentage value; the entry box allows direct entry or the percentage value, where the lowest value, 0%, emphasizes bins with low counts and the highest value (100%) emphasizes bins with high counts.

NOTE. *Changes made to the display options affect all waveform databases.*

Persistence. You set the persistence controls independently for each waveform database the instrument supports.

To Set Up a Waveform Database

To assign a waveform to one of the four waveform databases of the instrument, use the procedure that follows:

Overview	To set up a waveform database	Related control elements & resources
<p>Prerequisites</p>	<p>1. The instrument must have a waveform displayed to enable the waveform database controls.</p>	 <p>See page 3-62 for information on displaying waveforms.</p>
<p>Open the Wfm Database Setup dialog box</p>	<p>2. Open the Waveform Database dialog box by selecting Wfm Database in the Setup menu.</p>	
<p>Select the source and turn on the database</p>	<p>3. Use the Source pulldown list to select a waveform source for the waveform database. By default, the first available waveform is used as the waveform source unless you select a different source.</p> <p>4. Check On to begin accumulating into the waveform database.</p> <p>5. Check Display to turn on the display of the waveform database. Uncheck this box to display the vector waveform selected as the source for the database.</p> <p>6. Click the Clear Data button to clear the data accumulated in the selected database. If the database is turned on, the data is cleared and data accumulation starts over.</p> <p>NOTE. An alternative method of turning on a waveform database for the selected waveform is by clicking the waveform database button in the toolbar. See right.</p> <p>See Figures 3-29 and 3-30 on next page to see what both normal and waveform database waveform data look like on the graticule.</p>	 

End of Procedure

As you can see in the illustrations below, the normal vector view of a waveform displays the waveform data in dot mode: the waveform display is updated with each acquisition to reflect the current data. In Fig 3-30, waveform database display has been turned on and you can see the waveform data accumulation is displayed all at once, with subsequent acquisition data being “added” to the display as it is acquired.

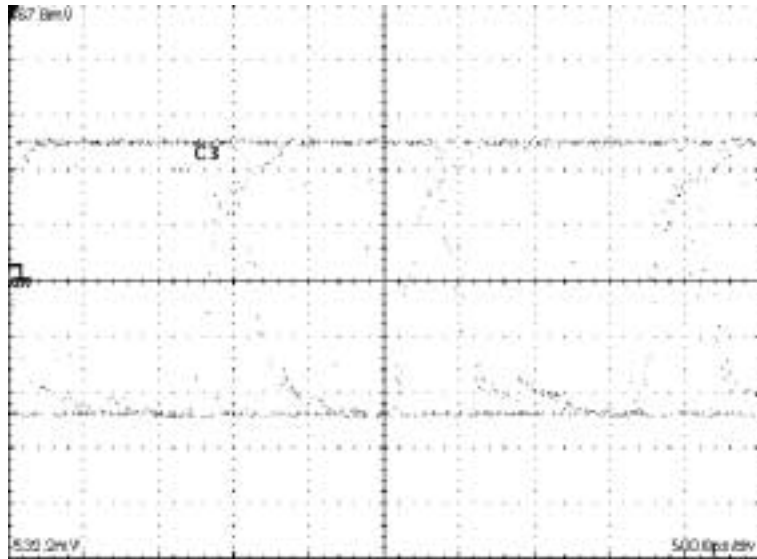


Figure 3-29: Normal vector view of a waveform

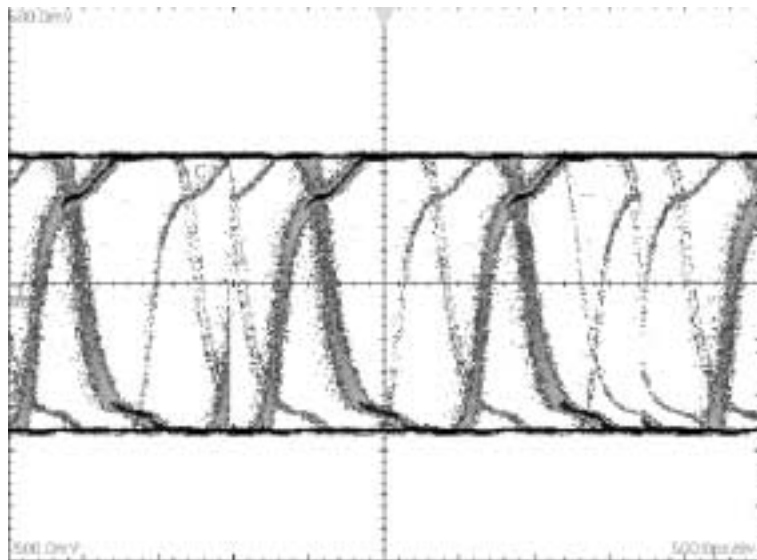

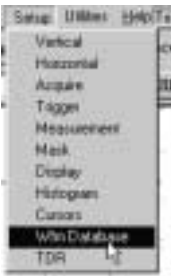
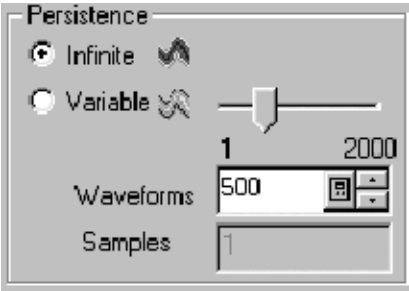
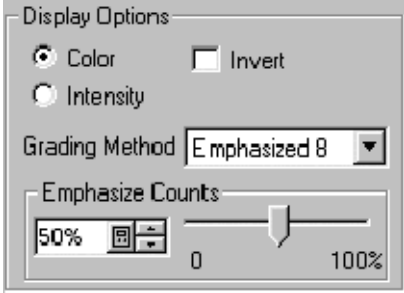


Figure 3-30: Waveform database view of a waveform

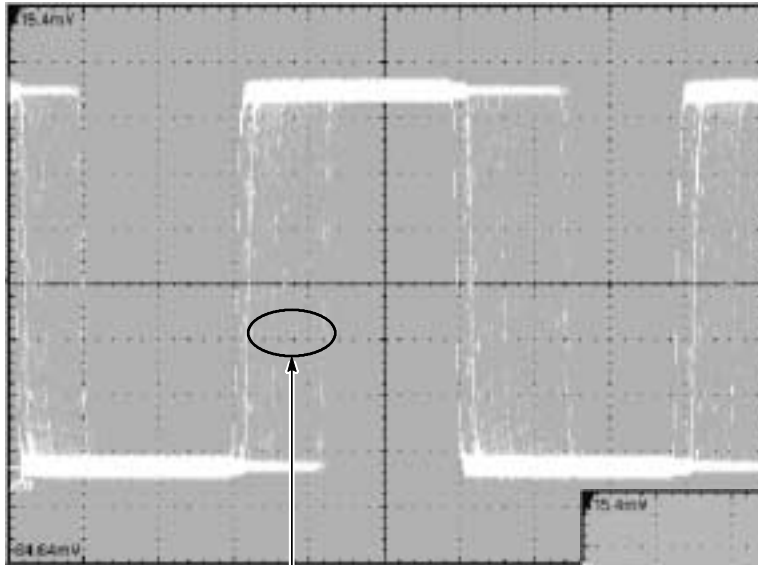
To Customize the Database Display

To change the display options of waveform database data on the graticule, use the procedure that follows:

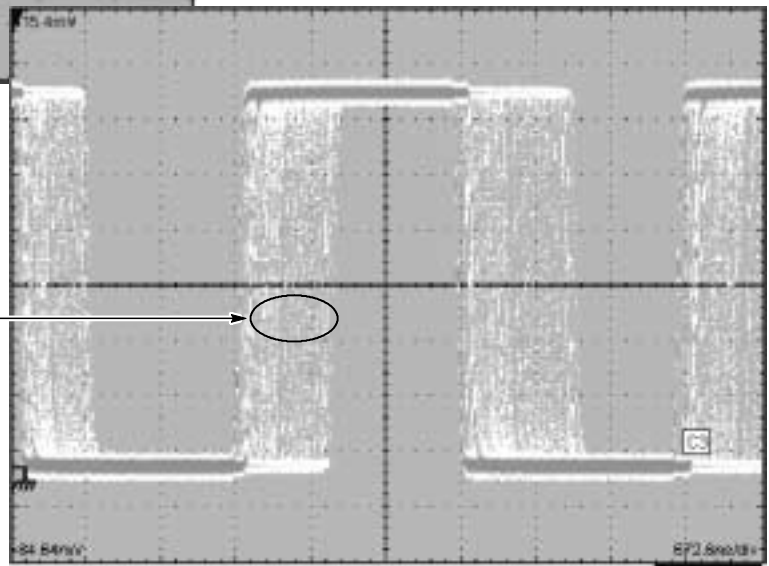
Overview	To customize the database display	Related control elements & resources
<p>Prerequisites</p>	<p>1. The instrument must have a waveform assigned to one of the waveform databases.</p>	 <p>See <i>To Set Up a Waveform Database</i> on page 3-162.</p>
<p>Access the Wfm Database Setup dialog box</p>	<p>2. Open the Waveform Database dialog box by selecting Wfm Database in the Setup menu.</p>	
<p>Set Persistence</p>	<p>3. Choose a persistence mode.</p> <p>Infinite: Choose Infinite to continue displaying waveforms as they accumulate until the selected database is cleared manually or by a control change.</p> <p>Variable: Choose Variable to display accumulated data in the specified database until the user-specified waveform count is surpassed. Each waveform accumulated beyond the count removes the oldest waveform accumulated earlier in the database.</p> <p>Waveforms: For Variable persistence, use the Waveforms entry box (or the sliding control above it) to set the Waveforms count. The count applies to the currently selected database when Variable persistence mode is set. Enter values directly with this control using the up/down arrows, the pop-up keypad, or an externally connected keyboard.</p> <p>Samples: The Samples field is a readout sample count currently in effect for the currently selected database when Variable persistence mode is set. This count is not settable directly, but instead derives from the product two values: the current Waveforms setting in this dialog box and the setting for Record Length in the Horizontal Setup dialog box.</p>	

Overview	To customize the database display (cont.)	Related control elements & resources
<p>Set display options</p>	<p>4. Choose from the following display options:</p> <p>Color: Choose color to draw the waveform database in colors that vary with how frequently each sample value occurs in the database.</p> <p>Invert: Choose this option to reverse the color or intensity assignments to each grading partition. Inverting the colors may make it easier to view the variations of color or intensities, and makes it easier to see frequencies or occurrences with smaller numbers of counts.</p> <p>Intensity: Choose Intensity to draw the waveform database with varying intensities that vary with how frequently each sample value occurs in the database.</p> <p>Grading Method: Select any one of four grading methods available from the pull down menu.</p> <p>Emphasize Counts: If you select one of the two Emphasized grading methods, slide the Emphasize Counts percentage control to specify the range of counts you want emphasized.</p> <p><i>Note. The Display Options controls apply globally to all four databases that this instrument provides.</i></p>	 <p>Additional information about Grading Method is located on page 3-161.</p>
<p>Examples</p>	<p>5. See the following illustrations to see examples of waveform database data using different display options.</p>	

Overview	To customize the database display (cont.)	Related control elements & resources
----------	---	--------------------------------------



Notice the difference in intensities of the same data between these two illustrations. In the top illustration, this portion of data is lighter in intensity signalling it is least-occurring. In the illustration to the right, with Invert Color/Intensity turned on, this data appears much darker, allowing you to see the data more clearly.



End of Procedure

Accessing Online Help

This manual represents only part of the user assistance available to you — the online help system, integrated as part of the instrument user interface, provides quick-to-access support for operating the instrument. This section describes the help system and how to access it.

What's Available?

The instrument provides the following help resources online:

- Tool tips
- What's This? Help
- Overview Help
- Topical index
- Getting Started Guide
- Measurements Center and Measurements Reference
- Setup procedures
- Programmers Guide

NOTE. A PDF version of the Programmer Reference Guide is available on the Tektronix Web site (see *Contacting in the Preface* on page xiii). Go to the link for *User Manuals* and select the document name from the download selection list.

Why Use?

Use online help as your primary, always-on-hand, user information source for this instrument. Most of the information you need to operate this instrument and use it effectively is found in the online help, where you can quickly access it and display on your instrument screen.

Keys to Using

The key points that describe operating considerations for using the online and other documentation for this instrument follow:


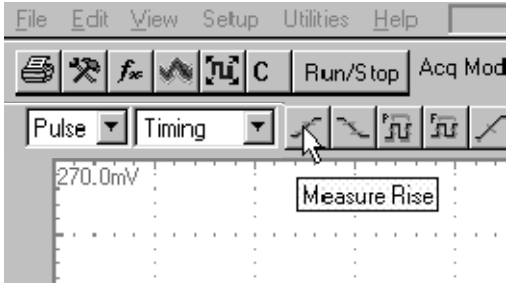
- Use online help when you want to minimize interruption to your work flow. Often a tool tip or What's This? Help, each of which is a pop-up of brief information in a bubble displayed on screen, gives you enough support to



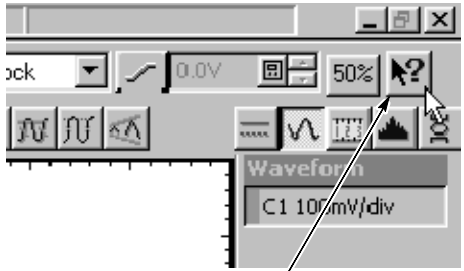
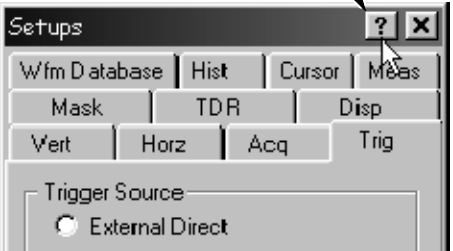

continue your setup. Overview help is there when you need to probe more deeply into feature operation.

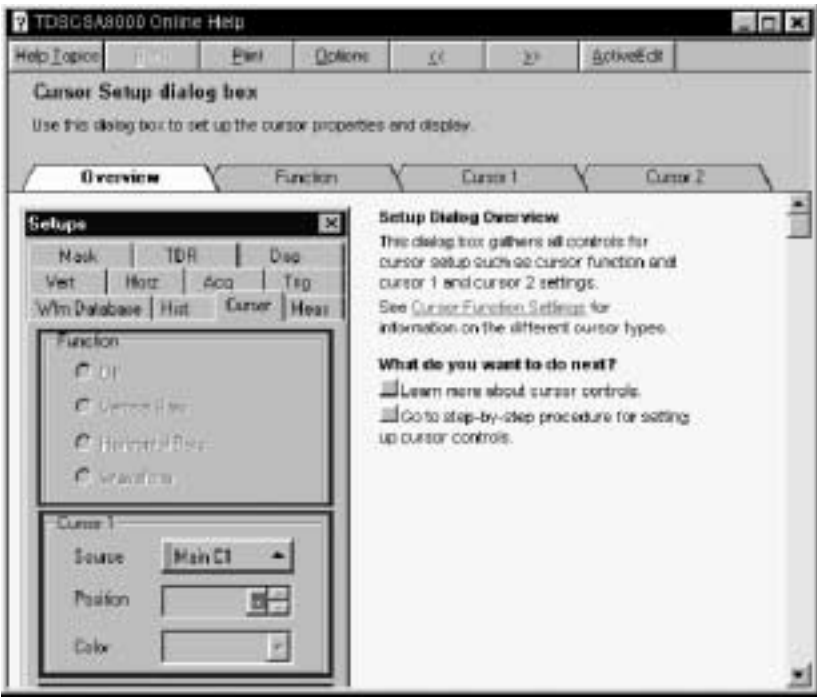
- Use the manuals to read instructions on putting the instrument into service, procedures on reinstalling its product software, listings of specifications, and overviews of features and their operation. See *Documentation Map* on page 2-2 for a description of the documents for this instrument and their purposes.
- Use the online programmers guide, either displayed on the instrument screen, or on any windows-equipped PC, for support on operating the instrument from the GPIB.



How to Use Online Help

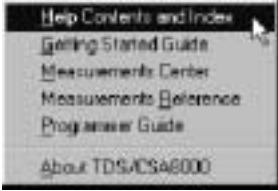
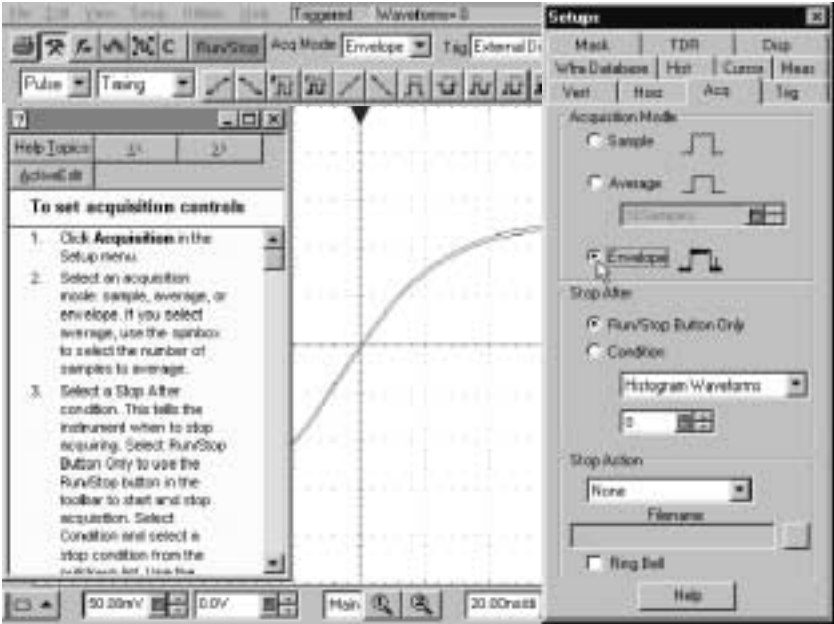
Use the procedure steps that follow to access contextual help and to learn how to search the help system for more information.



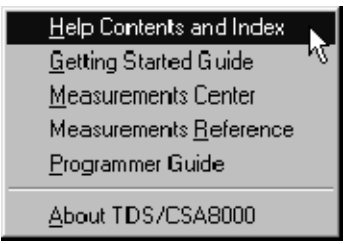
Overview	To use the online help	Control elements & resources
<p>Prerequisites</p>	<p>1. The instrument must be powered up and running.</p>	<div style="text-align: center;">  </div> <ul style="list-style-type: none"> ■ See <i>Installation</i>, page 1-9.
<p>For a brief description of controls</p>	<p>2. Move your mouse pointer and let it rest over a control; that is, a menu name, a menu item, tool-bar button, tool-bar readout, etc.</p> <p>When you perform this step, the help system pops up a short definition or a label of the control. See right.</p>	


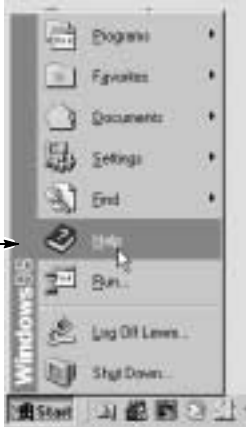
Overview	To use the online help (cont.)	Control elements & resources
<p>For a more robust description</p>	<p>3. Click the What's This? button in the main display or in a dialog box. The button varies in form as shown at right. After clicking, the mouse pointer changes to the following icon: </p> <p>4. Now click the control you want described. A bubble pops up describing the control. See below.</p> 	 <p>What's This? button for main display</p>  <p>What's This? button for dialog boxes</p>
<p>For in depth, contextual overviews</p>	<p>5. Most dialog boxes, whether setup or other types, have a Help button as shown right. Click the button to open the help system with an overview of the dialog box that's currently displayed. See the following illustration.</p>	 <p>Click or touch here</p>

Overview	To use the online help (cont.)	Control elements & resources
		 <p>The screenshot shows the 'TDBC8A8000 Online Help' window. The main content area is titled 'Cursor Setup dialog box' and includes a description: 'Use this dialog box to set up the cursor properties and display.' Below this are four tabs: 'Overview', 'Function', 'Cursor 1', and 'Cursor 2'. The 'Overview' tab is selected, displaying a 'Setup' dialog box. This dialog box has several sections: 'Mask' with options TDR and Day; 'Vert' with options Horiz, Acc, and Tag; 'W/m Database' with options Hist, Cursor, and Hous; 'Function' with radio buttons for Off, Vertical Bar, Horizontal Bar, and Waviness; and 'Cursor 1' with a Source dropdown menu (set to 'Main C1'), Position, and Color input fields. To the right of the dialog box is a 'Setup Dialog Overview' section with text explaining the dialog's purpose and a 'What do you want to do next?' section with two links: 'Learn more about cursor controls' and 'Go to step-by-step procedure for setting up cursor controls'.</p>

Overview	To use the online help (cont.)	Control elements & resources
<p>To dig deeper</p>	<p>6. You can search for in depth help using methods with which most users of PCs are familiar: from the application menu bar, select Help, and then select Contents & Index. See illustration at right.</p> <p>7. From the online help finder (see below), choose from the three tabs.</p>  <p>8. Click the book icons to expose topic titles, and then click a topic to highlight it. Click the Display button to open the topic in a help window.</p>	

Overview	To use the online help (cont.)	Control elements & resources
<p>For instruction procedures</p>	<p>9. You can display step-by-step setup instructions for setups you want to make: From the application menu bar, select Help, and then select Help Contents and Index. See right. From the list of topics (book icons) that displays, double-click Setup Procedures and double-click Setup dialog procedures.</p> <p>10. Select a procedure from the list that displays. The procedure will display in a help window that is sized and located to minimize interference with the controls needed to perform it. See below.</p>	 

Overview	To use the online help (cont.)	Control elements & resources
<p>To enable full-text search</p>	<p>11. If you cannot find the information in the Contents or Index tabs of the online finder, you may want to enable full text search: From the application menu bar, select Help, and then select Contents & Index. See illustration at right.</p> <p>12. From the online help finder (see below), choose the Find tab.</p>   <p>13. Choose the method for word list generation and select next or finish. Once the word list generation finishes, future accesses of the find tab will immediately access a pane for searching with full text search without requiring the word to be regenerated.</p>	

Overview	To use the online help (cont.)	Control elements & resources
<p>To Access Operating System Help</p>	<p>14. Click the minimize button to reduce the User Interface Application to an icon on the operating system toolbar. See upper right.</p> <p>15. Click the Start button to pop up the Start menu, and then select Help from the menu. See lower right. The online help for the Windows operating system displays.</p> <p>16. When your done with the online help, you can dismiss it. To restore the user interface application to the screen, click its icon in the tool bar.</p> <p>Tip. To switch between online help and the application, you can hold down the ALT key while you press Tab repeatedly to alternate between bringing help to the front and the application.</p>	<p>Click to minimize to the toolbar</p>  <p>Click for Windows 98 Help</p> 

End of Procedure

Cleaning the Instrument

Periodically you may need to clean the exterior of your instrument. To do so, follow the instructions in this section.



WARNING. Before performing any procedure that follows, power down the instrument and disconnect it from line voltage.

Exterior Cleaning



CAUTION. To prevent getting moisture inside the instrument during external cleaning, use only enough liquid to dampen the cloth or applicator.

Clean the exterior surfaces of the chassis with a dry lint-free cloth or a soft-bristle brush. If any dirt remains, use a cloth or swab dipped in a 75% isopropyl alcohol solution. Use a swab to clean narrow spaces around controls and connectors. Do not use abrasive compounds on any part of the chassis that may damage the chassis.

Clean the On/Standby switch using a dampened cleaning towel. Do not spray or wet the switch directly.



CAUTION. Avoid the use of chemical cleaning agents which might damage the plastics used in this instrument. Use a 75% isopropyl alcohol solution as a cleaner and wipe with a clean cloth dampened with deionized water. (Use only deionized water when cleaning the menu buttons or front-panel buttons.) Before using any other type of cleaner, consult your Tektronix Service Center or representative.

Flat Panel Display Cleaning

The instrument display is a soft plastic display and must be treated with care during cleaning.



CAUTION. *Improper cleaning agents or methods can damage the flat panel display.*

Avoid using abrasive cleaners or commercial glass cleaners to clean the display surface.

Avoid spraying liquids directly on the display surface.

Avoid scrubbing the display with excessive force.

Clean the flat panel display surface by gently rubbing the display with a clean-room wipe (such as Wypall Medium Duty Wipes, #05701, available from Kimberly-Clark Corporation).

If the display is very dirty, moisten the wipe with distilled water or a 75% isopropyl alcohol solution and gently rub the display surface. Avoid using excess force or you may damage the plastic display surface.

Optical Connector Cleaning

When using optical modules, the measurement accuracy is increased (or maintained) by keeping the optical connectors clean. It's important to follow the procedures for cleaning optical connectors provided in the user manual supplied with your optical module.

Appendix A: Specifications

NOTE. *This specification is for the instrument; there are also specifications associated with the optical and electrical modules. Please refer to the user manual that shipped with your module for those specifications.*

This appendix contains the specifications for the CSA8000B Communications Signal Analyzer and the TDS8000B Digital Sampling Oscilloscope. All specifications are guaranteed unless noted as “typical.” Typical specifications are provided for your convenience but are not guaranteed. Specifications that are marked with the ✓ symbol are checked in *Performance Verification* chapter of the service manual, an optional accessory.

All specifications apply to the instrument and sampling modules, unless noted otherwise. To meet specifications, three conditions must first be met:

- The instrument must have been calibrated/adjusted at an ambient temperature between +10 °C and +40 °C.
- The instrument must have been operating continuously for 20 minutes within the operating temperature range specified.
- The instrument must be in an environment with temperature, altitude, humidity, and vibration with the operating limits described in these specifications.

NOTE. *“Sampling Interface” refers to both the electrical sampling module compartments and the optical module compartments, unless otherwise specified.*

Table A-1: System - Signal acquisition

Description	Characteristics
Number of input channels	8 acquisition channels, maximum
Number of small sampling modules compartments	4 compartments, for a total of 8 channels ¹
Number of large sampling modules compartments	2 compartments, for a total of 2 channels ¹

Table A-1: System - Signal acquisition (cont.)

Description	Characteristics
Small Sampling Module Interface	Tekprobe-Sampling Level 3. Hot switching is not permitted on this interface.
Large Sampling Module Interface	Tekprobe-Sampling Level 3. Hot switching is not permitted on this interface.

¹ Total actively-acquired channels ≤ 8.

Table A-2: System - Timebase

Description	Characteristics	
Sampling rate	DC-200 kHz maximum, dictated by trigger rate and actual holdoff setting. If trigger rate is less than the maximum, or the requested holdoff exceeds the minimum, the trigger rate and/or holdoff will dictate the sampling rate.	
Record length ¹	20, 50, 100, 250, 500, 1,000, 2,000, or 4,000 samples.	
Horizontal scale range	1 ps/div to 5 ms/div in 1, 2, 5 steps or 1 ps increments. Maximum record lengths apply at certain ranges (per table, below).	
	<i>Scale set to an integer multiple of:</i>	<i>Maximum record length</i>
	1 ps/div	1000
	2 ps/div	2000
	4 ps/div	4000
Horizontal position range	50 ms maximum.	
Horizontal resolution	10 fs minimum	
Horizontal position setting resolution	1 ps minimum	
Horizontal modes	Two modes, Short Term Optimized and Locked to 10 MHz Reference. The 10 MHz reference may be internal or external.	
✓ Time interval accuracy, short term optimized mode ²	Strobe placement accuracy for a given horizontal interval and position on same strobe line per table below. (Contribution from 80E04 sampling module is included in specification.)	
	<i>Range</i>	<i>Time Interval Accuracy</i>
	≤ 20 ps/div	1 ps + 1% of interval
	≥ 21 ps/div	8 ps + 0.1% of interval

Table A-2: System - Timebase (cont.)

Description	Characteristics	
✓ Time interval accuracy, locked to internal 10 MHz reference mode ²	Strobe placement accuracy for a given horizontal interval and position on same strobe line per table below. Contribution from 80E04 sampling module is included in specification.	
	<i>Range</i>	<i>Time Interval Accuracy</i>
	≤ 20 ps/div	1 ps + 1% of interval
	≥ 21 ps/div	8 ps + 0.01% of interval
Horizontal deskew range and resolution	-500 ps to +100 ns on any individual channel in 1 ps increments.	

¹ **The total number of samples contained in a single acquired waveform record (memory length in IEEE 1057, 2.2.1).**

² **This is for ≤ 100 kHz trigger rate. The 80E04 sampling module is included in this specification.**

Table A-3: System - Trigger

Description	Characteristics
Trigger sources	External Direct Edge Trigger, External Prescaled Trigger, Internal Clock Trigger, and Clock Recovery (with appropriately equipped optical modules)
Auto/normal mode	Normal mode: wait for trigger Auto mode: Trigger automatically generated after 100 ms time-out
Slope + or - select	Edge + mode: Triggers on positive-slewing edge Edge - mode: Triggers on negative-slewing edge
High frequency on/off select	High Frequency ON mode: Removes trigger hysteresis and improves sensitivity. Should be used when trigger slew rate exceeds 1 V/ns. High Frequency OFF mode: Retains trigger hysteresis and improves noise rejection at low slew rates.
Metastability Reject On/Off select	Metastability Reject On mode: Upon detection of trigger and holdoff collision, time base will reject the sampled point. Metastability Reject Off mode: Allows metastable points caused by trigger/holdoff collisions to display.
Gated Trigger	±5 V maximum. See the Gated Trigger Input descriptions, on beginning page A-8.
Variable trigger hold off range and resolution	Adjustable 5 μs to 50 ms in 0.5 ns increments. When External Prescaled Trigger mode is used, holdoff period applies to the Prescaled input divided by 8.

Table A-3: System - Trigger (cont.)

Description	Characteristics
External direct trigger capabilities and conditions	<p>Direct edge triggering on signal applied to dedicated front panel connector with Holdoff, Level Adjust, Auto/Normal, High Frequency On/Off, and Enhanced Triggering On/Off controls.</p> <p>External direct trigger specifications apply only under the condition that no other trigger signal is applied to respective connectors.</p> <p>Short term optimized mode and locked to internal 10 MHz reference specifications only apply under the condition that there is no external 10 MHz reference applied to the front panel connector.</p>
External direct trigger input characteristics ¹	50 Ω input resistance, DC coupled only
External direct trigger input range	± 1.5 V (DC + peak AC) maximum input voltage
External direct trigger maximum operating trigger signal ²	1 Vpp
External direct trigger level range	Adjustable between ± 1.0 V
✓ External direct trigger sensitivity ³	100 mV, DC-3 GHz
External direct trigger sensitivity	50 mV typical, DC-4 GHz
External direct trigger level resolution	1 mV
✓ External direct trigger level accuracy	50 mV + 0.10 x level
✓ External direct trigger delay jitter, short term optimized mode maximum	1.2 ps RMS + 10 ppm of horizontal position, or better
External direct trigger delay jitter, short term optimized mode (typical)	800 fs RMS + 5 ppm of horizontal position, typical
✓ External direct delay jitter, locked to internal 10 MHz reference mode maximum	2.5 ps RMS + 0.04 ppm of horizontal position, or better
External direct delay jitter, locked to internal 10 MHz reference mode (typical)	1.6 ps RMS + 0.01 ppm of horizontal position, typical
External direct trigger minimum pulse width	167 ps, typical

Table A-3: System - Trigger (cont.)

Description	Characteristics	
External direct trigger metastability	Metastability Reject on: Zero, typical	
External direct trigger real time accessory interface	Tekprobe-SMA, Levels 1 and 2. Hot switching is permitted on this real time accessory interface.	
External prescaled trigger capabilities	<p>Prescaled triggering on signal applied to dedicated front panel connector with Holdoff, Auto/Normal, Metastability Reject On/Off.</p> <p>External prescaled trigger specifications apply only under the condition that no other trigger source is applied to respective connectors.</p> <p>Short term optimized mode and locked to internal 10 MHz reference specifications only apply under the condition that there is no external 10 MHz reference applied to the front panel connector.</p>	
External prescaled trigger input characteristics	50 Ω AC coupled input resistance; divide-by-eight prescaler ratio, fixed level zero volts	
External prescaled trigger absolute maximum input	± 2.5 Vpp	
✓ External prescaled trigger sensitivity	The limits are as follows:	
	<i>Frequency range</i>	<i>Sensitivity</i>
	2-3 GHz	800 mV _{pp}
	3-10 GHz	600 mV _{pp}
External prescaled trigger sensitivity (typical)	<i>Frequency range</i>	<i>Sensitivity</i>
	10-12.5 GHz	1000 mV _{pp} , typical
✓ External prescaled trigger delay jitter, Short term optimized mode maximum	1.3 ps RMS + 10 ppm of horizontal position, or better	
External prescaled trigger delay jitter, Short term optimized mode (Typical)	0.9 ps RMS + 5 ppm of horizontal position, typical	
✓ External prescaled delay jitter, locked to internal 10 MHz reference mode maximum	2.5 ps RMS + 0.04 ppm of horizontal position, or better	
External prescaled delay jitter, locked to internal 10 MHz reference mode (Typical)	1.6 ps RMS + 0.01 ppm of horizontal position, typical	
External prescaled trigger metastability	Enhanced Triggering, Metastability Reject on: Zero, typical	

Table A-3: System - Trigger (cont.)

Description	Characteristics
Internal clock trigger rates	Rate selectable at 25, 50, 100, and 200 kHz internally and is provided to the trigger, to the TDR stimulus drives in small sampling module interfaces, and to the Internal Clock Out connector on the front panel.
1	The input resistance at the external direct trigger input and the maximum input voltage.
2	Maximum signal input for maintaining calibrated time base operation.
3	Section 4.10.2 in IEEE standard number 1057. The minimum signal levels required for stable edge triggering of an acquisition.

Table A-4: System - Environmental

Description	Characteristics
Dynamics	<p>Random vibration (operating): 0.22 g rms, from 5 to 500 Hz, 10 minutes each axis, (3 axis, 30 minutes total).</p> <p>Random vibration (nonoperating): 2.00 g rms, from 5 to 500 Hz, 10 minutes each axis, (3 axis, 30 minutes total) non-operating.</p>
Atmospherics	<p>Temperature:</p> <p>Operating: 10 °C to +40 °C 0 °C to +35 °C for 80E0X modules on Tektronix part number 012-1569-00 2-meter extender</p> <p>Nonoperating: -22 °C to +60 °C</p> <hr/> <p>Relative humidity:</p> <p>Operating: 20% to 80%, with a maximum wet bulb temperature of 29 °C at or below +40 °C (upper limits derates to 45% relative humidity at +40 °C, non-condensing)</p> <p>Nonoperating (no floppy disk in floppy drive): 5% to 90%, with a maximum wet bulb temperature of 29 °C at or below +60 °C (upper limits derates to 20% relative humidity at +60 °C, non-condensing)</p> <hr/> <p>Altitude:</p> <p>Operating: 3,048 m (10,000 ft.)</p> <p>Nonoperating: 12,190 m (40,000 ft.)</p>
Electrostatic discharge susceptibility	<p>Up to 8 kV with no change to control settings, or impairment of normal operation</p> <p>Up to 15 kV with no damage that prevents recovery of normal operation</p>

Table A-5: Power consumption and cooling

Specifications	Characteristics
Power requirements	<p>240 watts (fully loaded); 160 watts (mainframe alone with no modules)</p> <p>An example of a “fully loaded” mainframe for these characteristic loads has installed optical modules, electrical modules, and active probes comprised of 1x80C02-CR, 1x80C04-CR2, 3x80E04, 1x80A01, and 7xP6209.</p> <p>There is typically a slight ± 10 W deviation in the dissipation for various line conditions ranging from 48 Hz through 400 Hz as well as operating ambient temperature.</p>
Source voltage and frequency	<p>Range for the line voltage needed to power the instrument within which the instrument meets its performance requirements.</p> <p>100-240 V RMS $\pm 10\%$, 50/60 Hz 115 V RMS $\pm 10\%$, 400 Hz CAT II</p>
Fuse rating	<p>Current and voltage ratings and type of the fuse used to fuse the source line voltage.</p> <p>Two sizes can be used:</p> <p>(0.25 x 1.25 inch size): UL 198G & CSA C22.2, No. 59 Fast acting: 8 Amp, 250 V; Tek p/n 159-0046-00, BUSSMAN p/n ABC-8, LITTLE-FUSE p/n 314008</p> <p>(5 x 20 mm size): IEC 127, sheet 1, fast acting “F”, high breaking capacity, 6.3 Amp, 250 V; Tek p/n none, BUSSMAN p/n GDA ± 6.3, LITTLEFUSE p/n 21606.3</p>
Cooling requirements	<p>Six fans with speed regulated by internal temperature sensors.</p> <p>A 2 inch (51 mm) clearance must be maintained on the left side, and right sides of the instrument, and a 0.75” (19 mm) clearance must be maintained on the bottom of the instrument for forced air flow. It should never be operated on a bench with the feet removed, nor have any object placed nearby where it may be drawn against the air vents.</p> <p>No clearance is required on the front, back, and top.</p>

Table A-6: Display

Specifications	Characteristics
Display type	211.2 mm (wide) x 158.4 mm (high), 264 mm (10.4 inch) diagonal, liquid crystal active matrix color display (LCD).
Display resolution	640 horizontal by 480 vertical pixels.
Pixel pitch	Pixels are 0.33 mm (horizontal) and 0.33 mm (vertical)

Table A-7: Ports

Specifications	Characteristics
Video outputs	Two 15-pin D-subminiature connectors on the rear panel. Useable to connect external monitors that provide a duplicate of the primary display and/or a second monitor on which to view other applications. Support at least the basic requirements of the PC99 specification.
Parallel port (IEEE 1284)	25-pin D-subminiature connector on the rear panel. Supports the following modes: Standard mode, output only Bi-directional, PS/2 compatible Bi-directional Enhanced Parallel Port (IEEE 1284 standard, Mode 1 or Mode 2, v1.7) Bi-directional high speed Extended Capabilities Port (ECP)
Serial port	9-pin D-subminiature serial-port connector using NS16C550 compatible UARTs supporting transfer speeds up to 115.2 kbits/sec.
PS/2 Keyboard and Mouse Interface	PS/2 compatible keyboard and mouse connectors.
LAN interface	RJ-45 LAN connector supporting 10 base-T and 100 base-T
External audio connectors	External audio jacks for MIC IN and LINE OUT
USB interface	One USB connector (the second USB is disabled because of internal use)
GPIB interface	Complies with IEEE 488.2
Gated Trigger Input - Logic Polarity (Option GT equipped instruments only)	A TTL logic 1 enables triggers to be accepted A TTL logic 0 disables all triggering A pull-up resistor is present to hold the input high (enable triggers) when no control signal is present.
Gated Trigger Input - Maximum Non-destruct Input Levels (Option GT equipped instruments only)	±5V maximum

Table A-7: Ports (cont.)

Specifications	Characteristics
Gated Trigger Input - Enable-to-Acquire Delay (Option GT equipped instruments only)	<p>3 trigger cycles, where each cycle is defined as (holdoff time + trigger latency). For example:</p> <p>With holdoff set to its minimum 5 μs setting, and a 2.500 GHz clock signal applied to the External Direct Trigger input (a period of 400 ps), the Enable-to-Acquire delay is approximated as $3 \times (5 \mu\text{s} + 0.0004 \mu\text{s}) = 15.0012 \mu\text{s}$.</p> <p>The Enable-to-Acquire delay is the amount of time after the Gated Trigger has been enabled (the level goes from TTL LOW to HIGH) when the first valid sample is retained by the system as the beginning of the waveform record length. When the Gated Trigger is enabled and triggers begin to occur, the system will reject the first three samples to avoid system recovery conditions. Once the first three points have been discarded, then the next valid trigger cycle will be the first point of the record section.</p>
Gated Trigger Input - Maximum Disable Time (Option GT equipped instruments only)	The system checks the status of the gated Trigger approximately once per holdoff and re-arm cycle. If the Gated Trigger is disabled immediately after this system check, it will allow nominally a maximum time of (holdoff + trigger period) to elapse before the checking for the status of the Gated Trigger input, recognizing the disable condition, and halting any further sampling of the signal.
Internal clock trigger out	<p>Square wave out from 50 Ω. back termination synchronized to the TDR internal clock drive signal. Refer to <i>Trigger System - Internal Clock</i>.</p> <p>Typical performance into 50 Ω termination:</p> <p>-0.20 to +0.20 V low level</p> <p>+0.90 to +1.10 V high level</p>
✓ DC calibration output	DC voltage from low impedance drive, programmable to 1 mV over ± 1.25 V range maximum. Accuracy is 0.2 mV + 0.1% into 50 Ω .
DC calibration output, typical	Typical Accuracy is 0.2 mV + 0.1% into 50 Ω .
External 10 MHz reference input	± 5 V maximum

Table A-8: Data storage

Specifications	Characteristics
Floppy disk drive	3.5 in floppy disk, 1.44 Mbyte, compatible with DOS 3.3, or later, format for storing reference waveforms, image files, and instrument setups.
Hard disk drive capacity	≥ 20 Gbytes

Table A-9: Mechanical

Specifications	Characteristics
Construction material	Chassis: Aluminum alloy Cosmetic covers: PC/ABS thermoplastic Front panel: Aluminum alloy with PC/thermoplastic overlay Module doors: Nickel plated stainless steel Bottom cover: Vinyl clad sheet metal Circuit boards: Glass-laminate. Cabinet: Aluminum.
Weight	19.5 kg (43.0 lb.) (no keyboard, no mouse, no top pouch, no power cord, and no modules or front shield installed) 22.0 kg (48.5 lb.) (keyboard, mouse, top pouch, power cord, front shield installed, and no modules installed)
Overall Dimensions	Height 343 mm (13.5 in.) Width 457 mm (18.0 in.) Depth 419 mm (16.5 in.) The dimensions do not include feet, rack mount kit, or protruding connectors.
Overall mass, packaged product	36.3 kg (80 lb. 1 oz.)
Overall Dimensions, packaged product	Height 622 mm (24.5 in.) Width 711 mm (28.0 in.) Depth 787 mm (31.0 in.)

Certifications

Table A- 10: Certifications and compliances

Category	Standards or description
EC Declaration of Conformity - EMC	<p>Meets intent of Directive 89/336/EEC for Electromagnetic Compatibility when configured with sampling head modules designed for use with this instrument as identified in this manual. Compliance was demonstrated to the following specifications as listed in the Official Journal of the European Union:</p> <p>EN 61326 EMC Requirements for Electrical Equipment for Measurement, Control and Laboratory use.</p> <p>Class A Radiated and Conducted Emissions</p> <p>IEC 1000-4-2 Performance Criterion B^{1,2}</p> <p>IEC 1000-4-3 Performance Criterion A¹</p> <p>IEC 1000-4-4 Performance Criterion B¹</p> <p>IEC 1000-4-5 Performance Criterion B¹</p> <p>IEC 1000-4-6 Performance Criterion A¹</p> <p>IEC 1000-4-11 Performance Criterion B¹</p> <p>1 Performance Criteria C for USB keyboard and mouse. Note that operation of the USB keyboard and mouse can be restored by unplugging and then reconnecting the USB connector at the rear panel of the main instrument.</p> <p>2 Horizontal timing susceptibility of the optical sampling modules and their internal clock recovery trigger signals usually increase the horizontal timing jitter when external electromagnetic fields are applied. For fields up to 3 V/m, the increase in the horizontal high-frequency RMS jitter is typically less than 3 ps RMS of jitter, added using the square-root-of-the-sum-of-the-squares method. An example follows:</p> <p>If an 80C01-CR operating in clock-recovery trigger mode exhibits 3.5 ps RMS of edge jitter, with no EMC field applied and for an ideal jitterless input, then for applied fields up to 3 V/m the edge jitter, degradation would typically result in a total RMS jitter of:</p> $Jitter \leq \sqrt{3.5ps^2 + 3ps^2} = 4.61ps$ <p>EN 61000-3-2 AC Power Harmonic Current Emissions</p> <p>Radiated emissions may exceed the levels specified in EN 61326 when this instrument is connected to a test object.</p>
Australia/New Zealand Declaration of Conformity - EMC	<p>Complies with EMC Framework per the following standard:</p> <p>AS/NZS 2064.1/2 Class A Radiated and Conducted Emissions</p>
General EMC	<p>To ensure compliance with EMC requirements, only high quality shielded cables having a reliable, continuous outer shield (braid & foil) with full coverage, low impedance connections to shielded connector housings at both ends should be connected to this product.</p>
EC Declaration of Conformity - Low Voltage	<p>Compliance was demonstrated to the following specification as listed in the Official Journal of the European Union:</p> <p>Low Voltage Directive 73/23/EEC, amended by 93/68/EEC</p>

Table A- 10: Certifications and compliances (cont.)

Category	Standards or description
	EN 61010-1/A2:1995 Safety requirements for electrical equipment for measurement control and laboratory use.
U.S. Nationally Recognized Testing Laboratory Listing, mainframe	UL3111-1 Standard for electrical measuring and test equipment.
Canadian Certification, mainframe	CAN/CSA C22.2 No. 1010.1 Safety requirements for electrical equipment for measurement, control, and laboratory use.
Installation (Overvoltage) Category Description	<p>Terminals on this product may have different installation (overvoltage) category designations. The installation categories are:</p> <p>CAT III Distribution-level mains (usually permanently connected). Equipment at this level is typically in a fixed industrial location.</p> <p>CAT II Local-level mains (wall sockets). Equipment at this level includes appliances, portable tools, and similar products. Equipment is usually cord-connected.</p> <p>CAT I Secondary (signal level) or battery operated circuits of electronic equipment.</p>
Pollution Degree Descriptions	<p>A measure of the contaminates that could occur in the environment around and within a product. Typically the internal environment inside a product is considered to be the same as the external. Products should be used only in the environment for which they are rated.</p> <p>Pollution Degree 2 Normally only dry, nonconductive pollution occurs. Occasionally a temporary conductivity that is caused by condensation must be expected. This location is a typical office/home environment. Temporary condensation occurs only when the product is out of service.</p>
Equipment Type	Test and measuring
Safety Class	Class 1 (as defined in IEC 61010-1, Annex H) - grounded product
Overvoltage Category	Overvoltage Category II (as defined in IEC 61010-1, Annex J)
Pollution Degree	Pollution Degree 2 (as defined in IEC 61010-1). Note: Rated for indoor use only.

Appendix B: Automatic Measurements Reference

This reference describes the automatic measurement system of this instrument. Automatic measurements support Pulse, Return-to-Zero (RZ), and Non-Return-to-Zero (NRZ) signals, providing measurements in three categories, Amplitude, Timing, and Area.

This reference gathers reference information for automatic measurements. Specifically, it lists:

- A definition for each auto-measurement type (for example, risetime, period, and suppression ratio), organized according to the signal measured (Pulse, Return-to-Zero eye pattern, or Non-Return-to-Zero eye pattern):
 - Pulse signals - see *Pulse Measurements* on page B-2.
 - Return-to-Zero eye patterns - see *RZ Measurements* on page B-15.
 - Non-Return-to-Zero eye patterns - see *RZ Measurements* on page B-37.
- Descriptions of the reference parameters (levels and crossings) that the automatic measurement system uses when taking automatic measurements. See *Measurement Reference Parameters and Methods* on page B-56.
- Descriptions of the methods for tracking the High and Low values that the automatic measurement system uses when in taking automatic measurements. See *High/Low Tracking Method* on page 3-77.

To learn about the controls that set up the automatic measurements, see the *Tracking Methods* section on page B-66 or *Measurement Setup dialog box* topic in the online help system.

Pulse Measurements - Amplitude

Table B-1 describes on page B-2 describes each pulse measurement in the amplitude category. See Table B-2 on page B-8 for timing category measurements; see Table B-3 on page B-14 for area category measurements.

Table B-1: Pulse Measurements — Amplitude

Name	Definition
AC RMS	<p>The root-mean-square voltage, minus the DC component, of the waveform that is sampled within the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
Amplitude	<p>The vertical difference between the High and Low of the signal. The method used to determine the High and the Low values can be controlled independently by the tracking method. See <i>Tracking Methods</i> on page B-66. Also see <i>High/Low Tracking Method</i> on page 3-77.</p> $\text{Amplitude} = \text{High} - \text{Low}$ <p>Where High and Low are measured values.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
Average Optical Power (dBm)	<p>The true average component of an optical signal, expressed in decibels. This measurement results from the use of a hardware average-power monitor circuit rather than from the calculation of digitized waveform data.</p> <p>Note: Average optical power measurements return valid results only on channels that contain average power monitors. In general, all optical sampling module channels contain average power monitors.</p> <p>To determine Average Optical Power (dBm), this measurement simply converts average optical power (watts) to decibels using a log10 function, referenced to 1 mW. To see how average optical power in watts is determined, see the Average Optical Power (Watts) measurement on the following page.</p> <p>For best measurement results:</p> <ul style="list-style-type: none"> ■ Use a factory-calibrated wavelength. If using the USER wavelength setting, ensure that it is properly compensated by performing the User Wavelength Gain compensation found by clicking the Optical button in the Vertical Setup dialog box. ■ Compensate the optical channel (found in the Utilities->Compensation dialog box). A portion of this overall optical channel compensation will correct for minor DC variances in the average power monitor.

Table B-1: Pulse Measurements — Amplitude (cont.)

Name	Definition
<p>Average Optical Power (watts)</p>	$\text{Average Optical Power (watts)} = \frac{\text{DC Signal current (DC amps)}}{\text{Conversion Gain (amps/watts)}}$ <p>Where:</p> <ul style="list-style-type: none"> ■ DC Signal Current is the O/E-converter photo detector current in DC amps ■ Conversion Gain is the O/E-converter photo detector gain in amps/watt <p>Note: Average optical power measurements return valid results only on channels that contain average power monitors. In general, all optical sampling module channels contain average power monitors.</p> <p>To obtain accurate results, the O/E converter is calibrated at a fixed number of factory-calibrated wavelengths to determine the conversion gain of the O/E converter at each wavelength.</p> <p>For best average optical power measurement results:</p> <ul style="list-style-type: none"> ■ Use a factory-calibrated wavelength. If using the USER wavelength setting, ensure that it is properly compensated by performing the User Wavelength Gain compensation found by clicking the Optical button in the Vertical Setup dialog box. ■ Compensate the optical channel, which corrects for minor DC variances in the average-power monitor as part of the compensation routine. To access, choose Compensation in the Utilities menu of the application.
<p>Cycle Mean</p>	<p>The arithmetic mean of the waveform over the first cycle of the measurement region. The waveform cycle is determined at the crossings of the mid-reference level. See <i>Measurement Reference Parameters and Methods</i> on page B-56. Also see <i>Reference Levels Method</i> on page 3-79.</p> <p>The mid-reference level is adjustable and defaults to 50% of the pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
<p>Cycle RMS</p>	<p>The root-mean-square amplitude of the waveform within the first period of the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>

Table B-1: Pulse Measurements — Amplitude (cont.)

Name	Definition
Gain	<p>The amplitude gain between two waveforms. The measurement returns the ratio between the amplitudes measured within the measurement regions of the two sources.</p> $Gain = \frac{Amplitude1}{Amplitude2}$ <p>Where Amplitude1 and Amplitude2 are the Amplitude measurements of the two source waveforms. See <i>Amplitude</i> on page B-2.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2) of the two sources. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
High	<p>The top reference level for a measured waveform. Several methods can be applied to the data sampled in the upper half of the waveform to determine the High value. You can use the Tracking Method control to select among them. See <i>Tracking Methods</i> on page B-66. Also see <i>High/Low Tracking Method</i> on page 3-77.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
Low	<p>The bottom reference level for a measured waveform. Several methods can be applied to the data sampled in the lower half of the waveform to determine the Low value, and you can use the Tracking Method control to select among them.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
Max	<p>The largest amplitude peak of the waveform over the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
Mean	<p>The arithmetic mean of the waveform over the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>

Table B- 1: Pulse Measurements — Amplitude (cont.)

Name	Definition
Mid	<p>The computation of the middle point between the maximum and minimum amplitude peaks of the waveform over the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
Min	<p>The smallest amplitude value of the waveform over the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
Optical Modulation Amplitude	<p>The difference between the average power levels of the logic 1, High, and the logic 0, Low, of the optical pulse signal. The levels are the Mean values of the logical levels sampled within an Aperture of the logical 1 and 0 regions of the pulse. The logical 1 and 0 time intervals are marked by the crossings of a reference level determined by the Average Optical Power (AOP) of the signal.</p> $\text{Pulse OMA [watts]} = P1 - P0$ <p>Where:</p> <ul style="list-style-type: none"> ■ P1 and P0 are the average power levels of the logical 1 and 0, determined within the respective apertures. ■ The adjustable Aperture defaults to 20% center respectively of the logical 1 and logical 0 time intervals. <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best measurement results:</p> <p>Perform a vertical compensation. See <i>Perform the Compensation</i> on page 1-24.</p> <p>Perform a Dark Level compensation before taking this measurement. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98.</p>

Table B-1: Pulse Measurements — Amplitude (cont.)

Name	Definition
<p>+Overshoot</p>	<p>The ratio of the maximum peak to the signal amplitude over the measurement region, expressed as a percentage.</p> $+ Overshoot = 100 \times \frac{(Max - High)}{(High - Low)}$ <p>Where:</p> <ul style="list-style-type: none"> ■ Max is the signal maximum ■ High and Low are the 100% and 0% reference levels <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement.</p>
<p>-Overshoot</p>	<p>The ratio of the minimum waveform value to the signal amplitude over the measurement region, expressed as a percentage.</p> $- Overshoot = 100 \times \frac{(Low - Min)}{(High - Low)}$ <p>Where:</p> <ul style="list-style-type: none"> ■ Min is the signal minimum ■ High and Low are the 100% and 0% signal reference levels. <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement.</p>

Table B-1: Pulse Measurements — Amplitude (cont.)

Name	Definition
Peak-to-Peak Noise	<p>The maximum range of the waveform amplitude variance sampled within a fixed width vertical slice located at the center of the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-69.</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
Pk-Pk	<p>The absolute difference between the maximum and minimum amplitude values of the waveform in the measurement region. See example on page B-63.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
RMS	<p>The true root-mean-square value of the waveform over the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
RMS Noise	<p>One standard deviation of the waveform amplitude variance, sampled within a fixed-width vertical slice located at the center of the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
Signal-to-Noise Ratio	<p>The ratio of the signal amplitude to the noise level. The noise level is defined as one standard deviation of the waveform amplitude variance within a fixed width vertical slice located at the center of the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Pulse Measurements - Timing

Table B-2 describes each pulse measurement in the timing category. See Table on B-1 on page B-2 for amplitude category measurements; see Table B-3 on page B-14 for area category measurements.

Table B-2: Pulse Measurements - Timing

Name	Definition
Burst width	<p>The time between the first and last crossings, either positive or negative, of the waveform at the mid-reference level in the measurement region. See <i>Measurement Reference Parameters and Methods</i> on page B-56 or in the online help. Also see <i>Reference Levels Method</i> on page 3-79.</p> <p>The mid-reference level is adjustable and defaults to 50% of the pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p>
Cross+	<p>The time of the first positive crossing of the data sampled at the mid-reference level in the measurement region.</p> <p>$Cross+ = T_{cross}$</p> <p>Where T_{cross} is the horizontal coordinate of the first positive crossing. See <i>Pulse Sources</i> on page B-57.</p> <p>The mid-reference level is adjustable and defaults to 50% of the pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default, searching is forward from the Start Gate for the first rising edge, but can be reversed, so that searching is backward from the Stop Gate.</p>
Cross-	<p>The time of the first negative crossing of the data sampled at the mid-reference level in the measurement region.</p> <p>$Cross- = T_{cross}$</p> <p>Where T_{cross} is the horizontal coordinate of the first negative crossing.</p> <p>The mid-reference level is adjustable and defaults to 50% of the pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default, searching is forward from the Start Gate for the first falling edge, but can be reversed, so that searching is backward from the Stop Gate.</p>

Table B-2: Pulse Measurements - Timing (cont.)

Name	Definition
Delay	<p>The time interval between the crossings of the two mid-reference levels on the two sources of the measurement.</p> $\text{Delay} = T_{\text{cross}}(\text{source1}) - T_{\text{cross}}(\text{source2})$ <p>Where Tcross is the first positive or negative crossing time at mid-reference level. See <i>Pulse Crossings and Mid-reference Level</i> on page B-58.</p> <p>The mid-reference levels are adjustable and default to 50% of the pulse amplitude.</p> <p>The slope can be selected to be the first positive, the first negative, or the first crossing (positive or negative) in the region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2) of the two sources. By default, searching is forward from the Start Gate for each source, but can be reversed, so that searching is backward from the Stop Gate. Direction can be controlled independently for the two waveform sources. See <i>To Localize a Measurement</i> on page 3-83.</p>
+Duty Cycle	<p>The ratio (expressed as a percentage) of the first positive pulse width within the measurement region to the period of the signal. The time intervals are determined at mid-reference level.</p> <p>If Tcross1 is positive, then:</p> $+ \text{Duty Cycle} = 100 \times \frac{(T_{\text{cross2}} - T_{\text{cross1}})}{(T_{\text{cross3}} - T_{\text{cross1}})}$ <p>If Tcross1 is negative, then:</p> $+ \text{Duty Cycle} = 100 \times \frac{(T_{\text{cross3}} - T_{\text{cross2}})}{(T_{\text{cross3}} - T_{\text{cross1}})}$ <p>Tcross1, Tcross2 and Tcross3 are the times of the first three consecutive crossings at the mid-reference level.</p> <p>The mid-reference levels are adjustable and default to 50% of the pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>See <i>Measurement Reference Parameters and Methods</i> on page B-56 or in the online help.</p>

Table B-2: Pulse Measurements - Timing (cont.)

Name	Definition
<p>- Duty Cycle</p>	<p>The ratio (expressed as a percentage) of the first negative pulse width within the measurement region to the period of the signal. The time intervals are determined at mid-reference level.</p> <p>If Tcross1 is positive, then:</p> $- \text{Duty Cycle} = 100 \times \frac{(T_{\text{cross3}} - T_{\text{cross2}})}{(T_{\text{cross3}} - T_{\text{cross1}})}$ <p>If Tcross1 is negative, then:</p> $- \text{Duty Cycle} = 100 \times \frac{(T_{\text{cross2}} - T_{\text{cross1}})}{(T_{\text{cross3}} - T_{\text{cross1}})}$ <p>Tcross1, Tcross2 and Tcross3 are the times of the first three consecutive crossings at the mid-reference level.</p> <p>The mid-reference levels are adjustable and default to 50% of the pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p>
<p>Fall Time</p>	<p>The time interval between times of the high reference level and the low reference level crossings on the negative slope of the pulse.</p> $RZ \text{ Fall Time} = T_{\text{crossL}} - T_{\text{crossH}}$ <p>Where:</p> <ul style="list-style-type: none"> ■ TcrossL is the time of the crossing of the low reference level ■ TcrossH is the time of crossing of the high reference level. <p>The low reference and high reference levels are adjustable and default to 10% and 90% of the pulse amplitude. There are four Reference Level Calculation methods available for determining these reference levels. See <i>Measurement Reference Parameters and Methods</i> on page B-56 or in the online help and in Also see <i>Reference Levels Method</i> on page 3-79.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default, the algorithm searches forward from the Start Gate for the first falling edge, but the Direction of traversal can be reversed, so that the search will be backward from the Stop Gate. See <i>To Localize a Measurement</i> on page 3-83.</p>
<p>Frequency</p>	<p>The inverse of the Period of the signal.</p> $\text{Frequency} = \frac{1}{(T_{\text{cross3}} - T_{\text{cross1}})}$ <p>Where Tcross3 and Tcross1 are the times of the first two consecutive crossings on the same slope at the mid-reference level. See <i>Pulse Crossings and Mid-reference Level</i> on page B-58.</p> <p>The mid-reference level is adjustable and defaults to 50% of the pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p>

Table B-2: Pulse Measurements - Timing (cont.)

Name	Definition
Period	<p>The time interval between two consecutive crossings on the same slope of the signal at the mid-reference level.</p> $Period = T_{cross3} - T_{cross1}$ <p>Where T_{cross3} and T_{cross1} are the times of the first two consecutive crossings on the same slope at the mid-reference level.</p> <p>The mid-reference level is adjustable and defaults to 50% of the pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>See <i>Measurement Reference Parameters and Methods</i> on page B-56 or in the online help and also see <i>Reference Levels Method</i> on page 3-79.</p>
Phase	$Phase = \frac{T_{cross1 \text{ of source2}} - T_{cross1 \text{ of source1}}}{T_{cross3 \text{ of source1}} - T_{cross1 \text{ of source1}}} \cdot 360$ <p>Where:</p> <ul style="list-style-type: none"> ■ T_{cross1} of source1 is the time of the first crossing of either polarity on source 1. ■ T_{cross3} of source1 is the time of the next crossing on source 1 of the same polarity as T_{cross1}. ■ T_{cross1} of source2 is the time of the first crossing of either polarity on source 2 after T_{cross1} of source1 ■ All $T_{crossings}$ are at the mid-reference levels, which are adjustable and default to 50% of the pulse amplitude. <p>If measurement gates are enabled, the measurement region is constrained between the Start Gate (G1) and Stop Gate (G2) of the sources.</p>
Pk-Pk Jitter	<p>The delta between the minimum and maximum of time crossings of data sampled at the at the mid-reference level.</p> $Pk-Pk \text{ Jitter} = T_{crosspp}$ <p>Where $T_{crosspp}$ is the difference between the maximum crossing time and the minimum crossing time for a histogram of the T_{cross} values. T_{cross} is the horizontal coordinate of the first positive or negative crossing.</p> <p>The mid-reference level is adjustable and defaults to 50% of the pulse amplitude.</p> <p>The slope can be selected to be the first positive, the first negative, or the first crossing (positive or negative) in the region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default, the algorithm searches forward from the Start Gate for the first specified edge, but the Direction of traversal can be reversed, so that the search will be backward from the Stop Gate.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>

Table B-2: Pulse Measurements - Timing (cont.)

Name	Definition
<p>Rise Time</p>	<p>The time interval between the low-reference level and the high reference level crossings on the positive slope of the pulse.</p> $RZ\ Rise\ Time = T_{crossH} - H_{crossL}$ <p>Where:</p> <ul style="list-style-type: none"> ■ T_{crossH} is the time of crossing of the high reference level. ■ T_{crossL} is the time of crossing of the low reference level. <p>The low reference and high reference levels are adjustable and default to 10% and 90% of the pulse amplitude. There are four Reference Level Calculation methods available for determining these reference levels. See <i>Measurement Reference Parameters and Methods</i> on page B-56 or in the online help. Also see <i>Reference Levels Method</i> on page 3-79.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default the algorithm searches forward from the Start Gate for the first rising edge, but the Direction of traversal can be reversed, so that the search will be backward from the Stop Gate. See <i>To Localize a Measurement</i> on page 3-83.</p>
<p>RMS Jitter</p>	<p>The time variance on the time crossings of data sampled at the mid-reference level. RMS Jitter is defined as one standard deviation (σ) of that variance.</p> $RMS\ Jitter = T_{cross}\sigma$ <p>Where T_{cross}σ is one standard deviation of the variance of crossing times for a histogram of the T_{cross} values. T_{cross} is the horizontal coordinate of the first positive or negative crossing.</p> <p>The mid-reference level is adjustable and defaults to 50% of the pulse amplitude.</p> <p>The slope can be selected to be the first positive, the first negative, or the first crossing (positive or negative) in the region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default, the algorithm searches forward from the Start Gate for the first falling edge, but the Direction of traversal can be reversed, so that the search will be backward from the Stop Gate.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>

Table B-2: Pulse Measurements - Timing (cont.)

Name	Definition
+Width	<p>The horizontal interval between the crossings of the rising and falling edges at the mid-reference level of the first positive pulse in the measurement region.</p> $+Width = T_{cross2} - T_{cross1}$ <p>Where Tcross1 and Tcross2 are the two consecutive horizontal crossings on the first positive pulse.</p> <p>The mid-reference level is adjustable and defaults to 50% of the pulse amplitude.</p> <p>See <i>Measurement Reference Parameters and Methods</i> on page B-56 or in the online help. Also see <i>Reference Levels Method</i> on page 3-79.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p>
-Width	<p>The horizontal interval between the crossings of the falling and rising edges at the mid-reference level of the first negative pulse in the measurement region.</p> $-Width = T_{cross2} - T_{cross1}$ <p>Where Tcross2 and Tcross1 are the two consecutive horizontal crossings on the first negative pulse.</p> <p>The mid-reference level is adjustable and defaults to 50% of the pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p>

Pulse Measurement - Area

Table B-3 describes each pulse measurement in the area category. See Table B-1 on page B-2 amplitude-category measurements; see Table B-2 on page B-8 for timing-category measurements.

Table B-3: Pulse Measurements - Area

Name	Definition
Area	<p>The area under the curve for the waveform within the measurement region. Area measured above ground is positive; area measured below ground is negative.</p> $Area = \int waveform(t) dt, \text{ over the measurement region}$ <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>For best results, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>
Cycle Area	<p>The area under the curve for the first waveform period within the measurement region. Area measured above ground is positive; area measured below ground is negative.</p> $Area = \int waveform(t) dt, \text{ over the first waveform period within the measurement region.}$ <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>For best results, optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.</p>

Return-to-Zero (RZ) Measurements - Amplitude

Table B-4 describes each RZ measurement in the amplitude category. See Table on B-5 on page B-29 for timing category measurements; see Table B-6 on page B-36 for area category measurements.

Table B-4: RZ Measurements - Amplitude

Name	Definition
<p>RZ AC RMS</p>	<p>The root mean square amplitude, minus the DC component, of the waveform that is sampled within the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.
<p>RZ Amplitude</p>	<p>The difference between the logical 1 level (High) and the logical 0 level (Low) of the RZ signal. Both High and Low levels are measured within the Eye Aperture.</p> $RZ\ Amplitude = High - Low$ <p>Where High and Low are the logical 1 and 0 levels.</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates, constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
<p>RZ Average Optical Power (dBm)</p>	<p>The true average component of an optical signal, expressed in decibels. This measurement results from the use of a hardware average power monitor circuit rather than from the calculation of digitized waveform data.</p> <p><i>Note: Average optical power measurements return valid results only on channels that contain average power monitors. In general, all optical sampling module channels contain average power monitors.</i></p> <p>To determine RZ Average Optical Power (dBm), this measurement simply converts average optical power (watts) to decibels using a log10 function referenced to 1mW. To determine average optical power in watts, see the RZ Average Optical Power (Watts) measurement below.</p> <p>For best average optical power measurement results:</p> <ul style="list-style-type: none"> ■ Use a factory-calibrated wavelength. If using the USER wavelength setting, ensure that it is properly compensated by performing the User Wavelength Gain compensation found by clicking the Optical button in the Vertical Setup dialog box. ■ Compensate the optical channel, which corrects for minor DC variances in the average power monitor as part of the compensation routine. To access, choose Compensation in the Utilities menu of the application.
<p>RZ Average Optical Power (watts)</p>	$\text{Average Optical Power (watts)} = \frac{\text{DC Signal Current (DC amps)}}{\text{Conversion Gain (amps/watts)}}$ <p>Where:</p> <ul style="list-style-type: none"> ■ DC Signal Current is the O/E-converter photo detector current in DC amps ■ Conversion Gain is the O/E-converter photo detector gain in amps/watts <p><i>Note: Average optical power measurements return valid results only on channels that contain average power monitors. In general, all optical sampling module channels contain average power monitors.</i></p> <p>To obtain accurate results, the O/E converter is calibrated at a fixed number of factory-calibrated wavelengths to determine the conversion gain of the O/E converter at each wavelength.</p> <p>For best average optical power measurement results:</p> <ul style="list-style-type: none"> ■ Use a factory-calibrated wavelength. If using the USER wavelength setting, ensure that it is properly compensated by performing the User Wavelength Gain compensation found by clicking the Optical button in the Vertical Setup dialog box. ■ Compensate the optical channel, which corrects for minor DC variances in the average power monitor as part of the compensation routine. To access, choose Compensation in the Utilities menu of the application.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
RZ Extinction Ratio	<p>The ratio of the average power levels of the logic 1 level (High) to the logic 0 level (Low) of an optical RZ signal. All level determinations are made within the RZ Eye Aperture.</p> $RZ\ ExtRatio = \frac{High}{Low}$ <p>Where High and Low are the logical 1 and 0 levels. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>For best measurement results:</p> <ul style="list-style-type: none"> ■ Always perform a Dark Level compensation before taking this measurement. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.
RZ Extinction Ratio (%)	<p>The ratio of the average power levels of the logic 0 level (Low) to the logic 1 level (High) of an optical RZ signal, expressed as a percentage. All level determinations are made within the RZ Eye Aperture.</p> $RZ\ ExtRatio\ [\%] = 100 \times \left(\frac{Low}{High} \right)$ <p>Where High and Low are the logical 1 and 0 levels.</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best measurement results:</p> <ul style="list-style-type: none"> ■ Always perform a Dark Level compensation before taking this measurement. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
<p>RZ Extinction Ratio (dB)</p>	<p>The ratio of the average power levels of the logic 1 level (High) to the logic 0 level (Low) of an optical RZ signal, expressed in decibels, dB. All level determinations are made within the RZ Eye Aperture.</p> $RZ\ ExtRatio\ [dB] = 10 \times \log\left(\frac{High}{Low}\right)$ <p>Where High and Low are the logical 1 and 0 levels. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best measurement results:</p> <ul style="list-style-type: none"> ■ Always perform a Dark Level compensation before taking this measurement. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.
<p>RZ Eye Height</p>	<p>RZ Eye Height is a measure of how noise affects the vertical opening between the High and Low levels of an RZ pulse. The RZ pulse is sampled within the Eye Aperture, where the High and Low levels are determined as the mean of the histogram of the data distribution in the upper and lower half of the pulse, respectively. The noise levels are characterized by σ_{high} and σ_{low}, the standard deviations from the mean for the High and Low levels.</p> $RZ\ Eye\ height = (High - 3 * \sigma_{high}) - (Low + 3 * \sigma_{low}),$ <p>Where High and Low are the logical 1 and 0 levels, and σ_{high} and σ_{low} are the standard deviations.</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
<p>RZ Eye Opening Factor</p>	<p>RZ Eye Opening Factor is a measure of how noise affects the vertical opening between High and Low levels of an RZ pulse. The RZ pulse is sampled within the Eye Aperture, where the High and Low levels are determined as the mean of the histogram of the data distribution in the upper and lower half of the pulse, respectively. The noise levels are characterized by σ_{high} and σ_{low}, the standard deviations from the mean for the High and Low levels.</p> $RZ\ Eye\ Opening\ Factor = \left(\frac{(High - \sigma_{high}) - (Low + \sigma_{low})}{(High - Low)} \right)$ <p>Where High and Low are the logical 1 and 0 levels, and σ_{high} and σ_{low} are the standard deviations. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.
<p>RZ Gain</p>	<p>RZ Gain is defined as the amplitude gain between two waveforms. The measurement returns the ratio between the amplitudes measured within the Eye Aperture of each of the waveforms.</p> $RZ\ Gain = \frac{Ampl2}{Ampl1}$ <p>Where Ampl1 and Ampl2 are the amplitudes of the two source waveforms.</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
<p>RZ High</p>	<p>The logical 1 level of the RZ signal. The data within the Eye Aperture is sampled, a histogram is built from the upper half of the RZ eye, and the mean of the histogram yields the High level.</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
<p>RZ Low</p>	<p>The logical 0 level of the RZ signal. The data within the Eye Aperture is sampled, a histogram is built from the lower half of the RZ eye, and the mean of the histogram yields the Low level.</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
RZ Max	<p>The maximum vertical value of the waveform that is sampled within the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.
RZ Mean	<p>The arithmetic mean of the waveform that is sampled within the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
RZ Mid	<p>The middle level between the Max and Min vertical values of the waveform that is sampled within the measurement region.</p> $RZ\ Mid = \frac{(Max + Min)}{2}$ <p>Where Max and Min are the maximum and minimum measurements.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
<p>RZ Min</p>	<p>The minimum vertical value of the waveform that is sampled within the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.
<p>RZ Peak-to-Peak</p>	<p>The difference between the Max and Min vertical values of the waveform that is sampled within the measurement region.</p> $RZ\ Peak-to-Peak = Max - Min$ <p>Where Max and Min are the maximum and minimum measurements.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
RZ Peak-to-Peak Noise	<p>The maximum range of the data distribution sampled within a fixed width vertical slice located at the center of the Eye Aperture at the High or Low levels. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>$PkPk\ noise = Highpp$ or $PkPk\ noise = Lowpp$</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width. The High or Low selection for Noise At control in the Measurement Setup dialog specifies that the measurement is to be performed on the logical 1 or 0 levels.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Perform Autoset or otherwise optimize the vertical resolution before this measurement, i.e., increase the overall vertical size of the waveform (but without producing off-screen waveform points). See <i>How to Optimize the Vertical Resolution</i> on page B-70.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
<p>RZ Q Factor</p>	<p>A figure of merit of an eye diagram, reporting the ratio between the amplitude of the RZ pulse to the total RMS noise on the High and Low levels. The RZ pulse is sampled within the Eye Aperture, where the High and Low levels are determined as the mean of the histogram of the data distribution in the upper and lower half of the pulse, respectively. The noise levels are characterized by σ_{high} and σ_{low}, the standard deviations from the mean for the High and Low levels.</p> $RZ\ Q\ Factor = \frac{(High - Low)}{(\sigma_{high} + \sigma_{low})}$ <p>Where:</p> <ul style="list-style-type: none"> ■ High and Low are the logical 1 and 0 levels. ■ σ_{high} and σ_{low} are the standard deviations. <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
<p>RZ RMS</p>	<p>The true root mean square of the waveform that is sampled within the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
RZ RMS Noise	<p>One standard deviation of the data distribution sampled within a fixed width vertical slice located at the center of the Eye Aperture at the High (logical 1) or Low (logical 0) levels.</p> $RMS\ noise = High\sigma \quad \text{or} \quad RMS\ noise = Low\sigma$ <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width. The High or Low selection for Noise At control in the Measurement Setup dialog instructs the measurement to be performed on the logical 1 or 0 levels. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
RZ Signal-to-Noise Ratio	<p>The ratio of the RZ pulse amplitude to the noise on either the High (logical 1) or Low (logical 0) level. The data within the Eye Aperture is sampled, and the mean of the histogram yields the High and Low levels. The noise is defined as one standard deviation of the distribution within a fixed width vertical slice located at the center of the Eye Aperture.</p> $S/N\ Ratio = \frac{(High - Low)}{High\sigma} \quad \text{or} \quad S/N\ Ratio = \frac{(High - Low)}{Low\sigma}$ <p>Where High and Low are the logical 1 and 0 levels. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width. The High or Low selection for Noise At control in the Measurement Setup dialog instructs the measurement to be performed on the logical 1 or 0 levels.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement, perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98.</p>

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
<p>RZ Suppression Ratio</p>	<p>The ratio of the average power level of the logic High to the Suppressed level measured between two consecutive RZ pulses. The RZ pulse is sampled within the Eye Aperture where the High is determined as the mean of the histogram of the data distribution in the upper half of the pulse. The same region is sampled to record the data distribution in the lower half of the pulse, data corresponding to the logical level 0. Similarly, data is sampled in an equivalent sized region placed at one-half bit interval offset from the Eye Aperture. The mean of the histogram of the data distribution between the peaks adjusted by subtracting the zero level histogram yields the Suppressed level.</p> $RZ\ Suppression\ Ratio = \frac{High}{(Suppress - Low)}$ <p>Where:</p> <ul style="list-style-type: none"> ■ High and Low are the logical 1 and 0 levels ■ Suppress is the mean of the histogram of the data within an Eye Aperture in the suppressed region <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). The region used for sampling the suppressed region is equal to the Eye Aperture and has no independent control. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best measurement results:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
RZ Suppression Ratio (%)	<p>The inverse ratio of the average power level of the logic High to the Suppressed level measured between two consecutive RZ pulses, with the result expressed in percentage. The RZ pulse is sampled within the Eye Aperture where the High is determined as the mean of the histogram of the data distribution in the upper half of the pulse. The same region is sampled to record the data distribution in the lower half of the pulse, data corresponding to the logical level 0. Similarly, data is sampled in an equivalent sized region placed at one-half bit interval offset from the Eye Aperture. The mean of the histogram of the data distribution between the peaks adjusted by subtracting the zero level histogram yields the Suppressed level.</p> $RZ\ Suppression\ Ratio\ [\%] = 100 \times \left(\frac{(Suppress - Low)}{High} \right)$ <p>Where:</p> <ul style="list-style-type: none"> ■ High and Low are the logical 1 and 0 levels ■ Suppress is the mean of the histogram of the data within an Eye Aperture in the suppressed region <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). The region used for sampling the suppressed region is equal to the Eye Aperture and has no independent control. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best measurement results:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.

Table B-4: RZ Measurements - Amplitude (cont.)

Name	Definition
<p>RZ Suppression Ratio (dB)</p>	<p>The ratio of the average power level of the logic High to the Suppressed level measured between two consecutive RZ pulses, with the result expressed in decibels. The RZ pulse is sampled within the Eye Aperture where the High is determined as the mean of the histogram of the data distribution in the upper half of the pulse. The same region is sampled to record the data distribution in the lower half of the pulse, data corresponding to the logical level 0. Similarly, data is sampled in an equivalent sized region placed at one-half bit interval offset from the Eye Aperture. The mean of the histogram of the data distribution between the peaks adjusted by subtracting the zero level histogram yields the Suppressed level.</p> $RZ\ Suppression\ Ratio\ [dB] = 10 \times \log\left(\frac{High}{(Suppress - Low)}\right)$ <p>Where:</p> <ul style="list-style-type: none"> ■ High and Low are the logical 1 and 0 levels ■ Suppress is the mean of the histogram of the data within an Eye Aperture in the suppressed region <p>The Eye Aperture is adjustable and defaults to 5% of the RZ pulse width. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). The region used for sampling the suppressed region is equal to the Eye Aperture and has no independent control. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best measurement results:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.

Return-to-Zero (RZ) Measurements - Timing

Table B-5 topic describes each RZ measurement in the timing category. See Table B-4 on page B-15 for amplitude category measurements; see Table B-6 on page B-36 for area category measurements.

Table B-5: RZ Measurements - Timing

Name	Definition
<p>RZ Bit Rate</p>	<p>The inverse of the time interval between two consecutive rising or falling edges (i.e. the reciprocal of the Bit Time). The crossing times are computed as the mean of the histogram of the data slice at the mid-reference level. The choice of rising or falling edge is automatic based on the first slope encountered in the measurement region.</p> $RZ\ Bit\ Rate = \frac{1}{(T_{cross3} - T_{cross1})}$ <p>Where Tcross3 and Tcross1 are the mean of the histogram of the two consecutive crossings on the same type slope at the mid-reference level. See <i>RZ Crossings</i> on page B-61.</p> <p>The mid-reference level is adjustable and defaults to 50% of the RZ maximum pulse amplitude. See <i>Mid-reference level</i> on page B-69.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>RZ Bit Time</p>	<p>The time interval between two consecutive rising or falling edges. The crossing times are computed as the mean of the histogram of the data slice at the mid-reference level. The choice of rising or falling edge is automatic based on the first slope encountered in the measurement region.</p> $RZ\ Bit\ Time = T_{cross3} - T_{cross1}$ <p>Where Tcross3 and Tcross1 are the mean of the histogram of the two consecutive crossings on the same type slope at the mid-reference level.</p> <p>The mid-reference level is adjustable and defaults to 50% of the RZ maximum pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Table B-5: RZ Measurements - Timing (cont.)

Name	Definition
<p>RZ Cross+</p>	<p>The time of a positive crossing, defined as the mean of the histogram of the data sampled at the mid-reference level.</p> $Cross+ = T_{cross}$ <p>Where T_{cross} is the mean of the histogram of a positive crossing. See <i>RZ Crossings</i> on page B-61.</p> <p>The mid-reference level is adjustable and defaults to 50% of the RZ maximum pulse amplitude. See <i>Mid-reference level</i> on page B-69.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default the algorithm searches forward from the Start Gate for the first rising edge, but the Direction of traversal can be reversed, so that the search will be backward from the Stop Gate. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>RZ Cross-</p>	<p>The time of a negative crossing, defined as the mean of the histogram of the data sampled at the mid-reference level.</p> $Cross- = T_{cross}$ <p>Where T_{cross} is the mean of the histogram of a negative crossing.</p> <p>The mid-reference level is adjustable and defaults to 50% of the RZ maximum pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default, the algorithm searches forward from the Start Gate for the first falling edge, but the Direction of traversal can be reversed, so that the search will be backward from the Stop Gate.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Table B-5: RZ Measurements - Timing (cont.)

Name	Definition
RZ Delay	<p>The time interval between the crossings of the mid-reference levels on the two sources of the measurement. The crossing times are computed as the mean of the histogram of the data slice at the mid-reference level.</p> $RZ\ Delay = T_{cross}(source1) - T_{cross}(source2)$ <p>Where T_{cross} is the mean of the histogram of a positive or negative crossing at mid-reference level. See <i>RZ Crossings</i> on page B-61.</p> <p>The mid-reference level is adjustable and defaults to 50% of the RZ maximum pulse amplitude. See <i>Mid-reference level</i> on page B-69.</p> <p>The slope can be selected to be the first positive, the first negative, or the first crossing (positive or negative) in the region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default, for each source, the algorithm searches forward from the Start Gate for the first rising or falling edge as defined by Slope, but the Direction of traversal can be reversed, so that the search will be backward from the Stop Gate. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
RZ +Duty Cycle	<p>The ratio of the RZ pulse width to the RZ bit time.</p> <p>If the first crossing is positive, then:</p> $Duty\ Cycle = \frac{(T_{cross2} - T_{cross1})}{(T_{cross3} - T_{cross1})}$ <p>If the first crossing is negative, then:</p> $Duty\ Cycle = \frac{(T_{cross3} - T_{cross2})}{(T_{cross3} - T_{cross1})}$ <p>Where T_{cross1}, T_{cross2} and T_{cross3} are the mean of the histogram of the first three consecutive crossings at the mid-reference level.</p> <p>The mid-reference level is adjustable and defaults to 50% of the RZ maximum pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Table B-5: RZ Measurements - Timing (cont.)

Name	Definition
<p>RZ Eye Width</p>	<p>The 3σ guarded delta between the rising and falling edge crossings.</p> $\text{Eye Width} = (T_{\text{cross}2} - 3 * T_{\text{cross}2 \sigma}) - (T_{\text{cross}1} + 3 * T_{\text{cross}1 \sigma})$ <p>Where $T_{\text{cross}1}$ and $T_{\text{cross}2}$ are the mean of the histogram of the two crossings. See <i>RZ Crossings</i> on page B-61.</p> <p>The mid-reference level is adjustable and defaults to 50% of the RZ maximum pulse amplitude. See <i>Mid-reference level</i> on page B-69.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>RZ Fall Time</p>	<p>RZ Fall Time characterizes the negative slope of the RZ pulse by computing the time interval between the mean crossings of the high reference level and the low reference level.</p> $\text{RZ Fall Time} = T_{\text{cross}L} - T_{\text{cross}H}$ <p>Where:</p> <ul style="list-style-type: none"> ■ $T_{\text{cross}LRZFig_RefLevels>Second}$ is the mean of the histogram of the crossing of the low reference level ■ $T_{\text{cross}H}$ is the mean of the histogram of the crossing of the high reference level. See <i>RZ Measurement Reference Levels</i> on page B-60. <p>The adjustable low reference and high reference levels default to 20% and 80% of the RZ maximum pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Table B-5: RZ Measurements - Timing (cont.)

Name	Definition
<p>RZ Phase</p>	$Phase = \frac{T_{cross1 \text{ of source2}} - T_{cross1 \text{ of source1}}}{T_{cross3 \text{ of source1}} - T_{cross1 \text{ of source1}}} \cdot 360$ <p>Where:</p> <ul style="list-style-type: none"> ■ T_{cross1} of source1 is mean of the histogram at the time of the first crossing of either polarity on source 1. See <i>RZ Crossings</i> on page B-61. ■ T_{cross3} of source1 is the mean of the histogram at time of the next crossing on source 1 of the same polarity as T_{cross1}. ■ T_{cross1} of source2 is the mean of the histogram at the time of the first crossing of either polarity on source 2 after T_{cross1} of source1. ■ All T_{crossings} are at the mid-reference levels, which are adjustable and defaults to 50% of the RZ maximum pulse amplitude. See <i>Mid-reference level</i> on page B-69. <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>RZ Pk-Pk Jitter</p>	<p>The delta between the minimum and maximum of time crossings at the reference level, with the mean of the histogram being T_{cross}.</p> $Pk-PK \text{ Jitter} = T_{crosspp}$ <p>The mid-reference level is adjustable and defaults to 50% of the RZ maximum pulse amplitude. The jitter measurement can be performed on the positive or negative slope.</p> <p>The slope can be selected to be the first positive, the first negative, or the first crossing (positive or negative) in the region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default, the algorithm searches forward from the Start Gate for the first specified edge, but the Direction of traversal can be reversed, so that the search will be backward from the Stop Gate.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Table B-5: RZ Measurements - Timing (cont.)

Name	Definition
<p>RZ Pulse Symmetry</p>	<p>RZ Pulse Symmetry measures to what extent the RZ pulse is symmetrical around the peak at the mid-reference level. The pulse peak is the center of the interval, sized to Eye Aperture, which yields the maximum mean vertical value. See RZ Eye-Aperture Parameters on page B-62.</p> $RZ\ Pulse\ Symmetry\ [\%] = 100 \times \left(\frac{(T_{cross0} - T_{cross1})}{(T_{cross2} - T_{cross1})} \right)$ <p>Where:</p> <ul style="list-style-type: none"> ■ Tcross1 and Tcross2RZFig_CrossLevels>Second are the time crossings of the RZ pulse of the mid-reference level. See <i>RZ Crossings</i> on page B-61. ■ Tcross0 is the time coordinate of the pulse peak. <p>The mid-reference level is adjustable and defaults to 50% of the RZ maximum pulse amplitude. See <i>Mid-reference level</i> on page B-69.</p> <p>If gating is enabled, the measurement region is constrained between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>RZ Rise Time</p>	<p>RZ Rise Time characterizes the positive slope of the RZ pulse by computing the time interval between the mean crossings of the low reference level and the high reference level.</p> $RZ\ Rise\ Time = T_{crossH} - T_{crossL}$ <p>Where:</p> <ul style="list-style-type: none"> ■ TcrossH is the mean of the histogram of the crossing of the high reference level ■ TcrossL is the mean of the histogram of the crossing of the low reference level. See RZ Measurement Reference Levels on page B-60. <p>The adjustable low reference and high reference levels default to 20% and 80% of the RZ maximum pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Table B-5: RZ Measurements - Timing (cont.)

Name	Definition
RZ RMS Jitter	<p>Jitter is the measure of time variance at the location where the signal crosses the mid-reference level. RMS Jitter is defined as one standard deviation (σ) of that variance. The mean of the histogram of the crossing data distribution is T_{cross}.</p> $RMS\ Jitter = T_{cross}\ \sigma$ <p>The mid-reference level is adjustable and defaults to 50% of the RZ maximum pulse amplitude. The jitter measurement can be performed on the positive or negative slope. See <i>Mid-reference level</i> on page B-69.</p> <p>The slope can be selected to be the first positive, the first negative, or the first crossing (positive or negative) in the region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). By default, the algorithm searches forward from the Start Gate for the first specified edge, but the Direction of traversal can be reversed, so that the search will be backward from the Stop Gate. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
RZ +Width	<p>The time interval between the crossings of the rising and falling edges at the mid-reference level.</p> $+Width = T_{cross2} - T_{cross1}$ <p>Where T_{cross1} and T_{cross2} are the mean of the histogram of the rising and falling crossings.</p> <p>The mid-reference level is adjustable and defaults to 50% of the RZ pulse amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Return-to-Zero (RZ) Measurements - Area

Table B-6 describes each RZ measurement in the area category. See Table B-4 on page B-15 for amplitude category measurements; see Table on B-5 on page B-29 for timing category measurements

Table B-6: RZ Measurements - Area

Name	Definition
<p>RZ Area</p>	<p>The area under the curve for the RZ waveform within the measurement region. Area measured above ground is positive; area measured below ground is negative.</p> $RZ\ Area = \int waveform(t) dt, \text{ over the measurement region.}$ <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
<p>RZ Cycle Area</p>	<p>The area under the curve for the first RZ bit period. Area measured above ground is positive; area measured below ground is negative.</p> $RZ\ Area = \int waveform(t) dt$ <p>Where the measurement region is from Start Gate (G1) to Stop Gate (G2), if measurement gates are enabled, or the first acquired RZ cycle.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Non-Return-to-Zero (NRZ) Measurements - Amplitude

Table B-7 topic describes each NRZ measurement in the amplitude category. See Table B-8 on page B-50 for timing category measurements.; see Table B-9 on page B-55 for area category measurements.

Table B-7: NRZ Measurements - Amplitude

Name	Definition
<p>NRZ AC RMS</p>	<p>The root mean square amplitude, minus the DC component, of the selected waveform within the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
<p>NRZ Amplitude</p>	<p>The difference between the logical 1 level (High) and the logical 0 level (Low) of the NRZ signal. Both High and Low levels are measured within the Eye Aperture.</p> $NRZ\ Amplitude = High - Low$ <p>Where High and Low are the logical 1 and 0 levels.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
<p>NRZ Average Optical Power (dBm)</p>	<p>The true average component of an optical signal, expressed in decibels. This measurement results from the use of a hardware average power monitor circuit rather than from the calculation of digitized waveform data.</p> <p><i>Note: Average optical power measurements return valid results only on channels that contain average power monitors. In general, all optical sampling module channels contain average power monitors.</i></p> <p>To determine NRZ Average Optical Power (dBm), this measurement simply converts average optical power (watts) to decibels using a log10 function referenced to 1mW. To determine average optical power in watts, see the NRZ Average Optical Power (Watts) measurement. See below.</p> <p>For best average optical power measurement results:</p> <ul style="list-style-type: none"> ■ Use a factory-calibrated wavelength. If using the USER wavelength setting, ensure that it is properly compensated by performing the User Wavelength Gain compensation found by clicking the Optical button in the Vertical Setup dialog box. ■ Compensate the optical channel, which corrects for minor DC variances in the average power monitor as part of the compensation routine. To access, choose Compensation in the Utilities menu of the application.
<p>NRZ Average Optical Power (watts)</p>	$\text{Average Optical Power (watts)} = \frac{\text{DC Signal Current (DC amps)}}{\text{Conversion Gain (amps/watts)}}$ <p>where:</p> <ul style="list-style-type: none"> ■ DC Signal Current is the O/E-converter photo detector current in DC amps ■ Conversion Gain is the O/E-converter photo detector gain in amps/watts <p><i>Note: Average optical power measurements return valid results only on channels that contain average power monitors. In general, all optical sampling module channels contain average power monitors.</i></p> <p>To obtain accurate results, the O/E converter is calibrated at a fixed number of factory-calibrated wavelengths to determine the conversion gain of the O/E converter at each wavelength.</p> <p>For best average optical power measurement results:</p> <ul style="list-style-type: none"> ■ Use a factory-calibrated wavelength. If using the USER wavelength setting, ensure that it is properly compensated by performing the User Wavelength Gain compensation found by clicking the Optical button in the Vertical Setup dialog box. ■ Compensate the optical channel, which corrects for minor DC variances in the average power monitor as part of the compensation routine. To access, choose Compensation in the Utilities menu of the application.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
<p>NRZ Crossing %</p>	<p>The height of eye crossing as a percentage of eye height measured in the Eye Aperture.</p> $NRZ\ Crossing\ \% = 100 \times \frac{(Eye\ Cross - Low)}{(High - Low)}$ <p>Where High and Low are the logical 1 and 0 levels, and EyeCross is the level at eye crossing. See <i>NRZ Eye-Aperture Parameters</i> on page B-65.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
<p>NRZ Crossing Level</p>	<p>The mean signal level at the eye crossing.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
<p>NRZ Extinction Ratio</p>	<p>The ratio of the average power levels of the logic 1 level (High) to the logic 0 level (Low) of an optical NRZ signal. All level determinations are made within the NRZ Eye Aperture.</p> $NRZ\ ExtRatio = 100 \times \left(\frac{Low}{High} \right)$ <p>Where High and Low are the logical 1 and 0 levels.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best measurement results:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
<p>NRZ Extinction Ratio (%)</p>	<p>The ratio of the average power levels of the logic 0 level (Low) to the logic 1 level (High) of an optical NRZ signal, expressed as a percentage. All level determinations are made within the NRZ Eye Aperture.</p> $NRZ\ ExtRatio\ [%] = 100 \times \left(\frac{Low}{High} \right)$ <p>Where High and Low are the logical 1 and 0 levels.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best measurement results:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement. See <i>To Perform Dark-Level and Gain User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
NRZ Extinction Ratio (dB)	<p>The ratio of the average power levels of the logic 1 level (High) to the logic 0 level (Low) of an optical NRZ signal, expressed in decibels (dB). All level determinations are made within the NRZ Eye Aperture.</p> $NRZ\ ExtRatio\ [dB] = 10 \times \log\left(\frac{High}{Low}\right)$ <p>Where High and Low are the logical 1 and 0 levels. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. See <i>NRZ Eye-Aperture Parameters</i> on page B-65.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best measurement results:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
NRZ Eye Height	<p>A measure of how noise affects the vertical opening between the High and Low levels of an NRZ eye. The NRZ eye is sampled within the Eye Aperture, where the High and Low levels are determined as the mean of the histogram of the data distribution in the upper and lower half of the eye, respectively. The noise levels are characterized by σ_{high} and σ_{low}, the standard deviations from the mean for the High and Low levels.</p> $NRZ\ Eye\ Height = (High - 3 * \sigma_{high}) - (Low + 3 * \sigma_{low})$ <p>Where High and Low are the logical 1 and 0 levels, and σ_{high} and σ_{low} are the standard deviations.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
<p>NRZ Gain</p>	<p>The amplitude gain between two waveforms. The measurement returns the ratio between the amplitudes measured within the Eye Aperture of each of the waveforms.</p> $NRZ\ Gain = \frac{Ampl2}{Ampl1}$ <p>Where Ampl1 and Ampl2 are the amplitudes of the two source waveforms. See <i>NRZ Amplitude</i> on page B-37.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
<p>NRZ High</p>	<p>The logical 1 of the NRZ signal. The data within the Eye Aperture is sampled, a histogram is built from the upper half of the NRZ eye, and the mean of the histogram yields the High level.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
NRZ Low	<p>The logical 0 of the NRZ signal. The data within the Eye Aperture is sampled, a histogram is built from the lower half of the NRZ eye, and the mean of the histogram yields the Low level.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
NRZ Max	<p>The maximum vertical value of the waveform that is sampled within the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.
NRZ Mean	<p>The arithmetic mean of the selected waveform within the measurement region. See <i>Defining and displaying waveforms</i> on page 3-56.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
<p>NRZ Mid</p>	<p>The middle level between the Max and Min vertical values of the selected waveform within the measurement region.</p> $NRZ\ Mid = \frac{(Max + Min)}{2}$ <p>Where Max and Min are the maximum and minimum measurements.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
<p>NRZ Min</p>	<p>The minimum vertical value of the selected waveform the measurement region.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
<p>NRZ +Overshoot</p>	<p>The ratio of the maximum value of the measured signal to its amplitude, expressed as a percentage. The waveform is scanned for the maximum value within the measurement region, while the amplitude is measured in the Eye Aperture.</p> $NRZ + Overshoot = 100 \times \frac{(Max - High)}{(High - Low)}$ <p>Where Max is the signal maximum, and High and Low are the logical 1 and 0 levels. See <i>NRZ Eye-Aperture Parameters</i> on page B-65.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
<p>NRZ - Overshoot</p>	<p>The ratio of the minimum value of the measured signal to its amplitude, expressed as a percentage. The waveform is scanned for the minimum value within the measurement region, while the amplitude is measured in the Eye Aperture.</p> $NRZ - Overshoot = 100 \times \frac{(Low - Min)}{(High - Low)}$ <p>Where Min is the signal minimum, and High and Low are the logical 1 and 0 levels.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
<p>NRZ Optical Modulation Amplitude</p>	<p>An approximation defined as the difference of the logical power 1 and 0 determined in a vertical slice through the eye crossing. The levels are determined as the means of the histograms of the vertical data slice through the High (logical 1) and Low (logical 0) levels.</p> $NRZ\ OMA\ [watts] = P1 - P0$ <p>Where:</p> <ul style="list-style-type: none"> ■ P1 and P0 are the average power levels of the logical 1 and 0, determined at the eye crossing. <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database. If a waveform database is not available, no valid measurement results will be produced. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>NRZ Peak-to-Peak</p>	<p>The difference between the Max and Min vertical values of the selected waveform within the measurement region. See <i>Defining and displaying waveforms</i> on page 3-56.</p> $NRZ\ Peak-to-Peak = Max - Min$ <p>Where Max and Min are the maximum and minimum measurements.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
NRZ Peak-to-Peak Noise	<p>The maximum range of the amplitude variance sampled within a fixed width vertical slice located at the center of the Eye Aperture at the High or Low levels. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>$PkPk\ noise = Highpp$ or $PkPk\ noise = Lowpp$</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. The High or Low selection for Noise At control in the Measurement Setup dialog instructs the measurement to be performed on the logical 1 or 0 levels. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Perform Autoset or otherwise optimize the vertical resolution before this measurement, i.e. increase the overall vertical size of the waveform (but without producing off-screen waveform points). See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
<p>NRZ Q Factor</p>	<p>NRZ Q Factor is a figure of merit of an eye diagram, reporting the ratio between the amplitude of the NRZ eye to the total RMS noise on the High and Low levels. The NRZ eye is sampled within the Eye Aperture, where the High and Low levels are determined as the mean of the histogram of the data distribution in the upper and lower half of the eye, respectively. The noise levels are characterized by σ_{high} and σ_{low}, the standard deviations from the mean for the High and Low levels.</p> $NRZ\ Q\ Factor = \frac{(High - Low)}{(\sigma_{high} + \sigma_{low})}$ <p>Where High and Low are the logical 1 and 0 levels, and σ_{high} and σ_{low} are the standard deviations. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
<p>NRZ RMS</p>	<p>The true root mean square amplitude of the selected waveform within the measurement region. See <i>Defining and displaying waveforms</i> on page 3-56.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

Table B-7: NRZ Measurements - Amplitude (cont.)

Name	Definition
NRZ RMS Noise	<p>One standard deviation of the amplitude variance sampled within a fixed width vertical slice located at the center of the Eye Aperture at the High (logical 1) or Low (logical 0) levels.</p> $RMS\ noise = High\sigma \quad or \quad RMS\ noise = Low\sigma$ <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. The High or Low selection for Noise At control in the Measurement Setup dialog instructs the measurement to be performed on the logical 1 or 0 levels. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>How to Optimize the Vertical Resolution</i> on page B-70.
NRZ Signal-to-Noise Ratio	<p>NRZ Signal-to-Noise is the ratio of the NRZ eye amplitude to the noise on either the High (logical 1) or Low (logical 0) level. The data within the Eye Aperture is sampled, and the mean of the histogram yields the High and Low levels. The noise is defined as one standard deviation of the distribution within a fixed width vertical slice located at the center of the Eye Aperture.</p> $S/N\ Ratio = \frac{(High - Low)}{High\sigma} \quad or \quad S/N\ Ratio = \frac{(High - Low)}{Low\sigma}$ <p>Where High and Low are the logical 1 and 0 levels. See <i>RZ Eye Aperture Parameters</i> on B-62.</p> <p>The Eye Aperture is adjustable and defaults to 20% of the NRZ bit time. The High or Low selection for Noise At control in the Measurement Setup dialog specifies that the measurement be performed on the logical 1 or 0 levels. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement, perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98.</p>

Non-Return-to-Zero (NRZ) Measurements - Timing

Table B-8 topic describes each NRZ measurement in the timing category. See Table B-7 on page B-37 for amplitude category measurements.; see Table B-9 on page B-55 for area category measurements.

Table B-8: NRZ Measurements - Timing

Name	Definition
<p>NRZ Bit Rate</p>	<p>The inverse of the time interval between two consecutive eye-crossing points. In other words, it is the reciprocal of the Bit Time.</p> $NRZ\ Bit\ Rate = \frac{1}{(T_{cross2} - T_{cross1})}$ <p>Where Tcross2 and Tcross1 are the mean of the histogram of the two consecutive eye crossings. See <i>NRZ Crossings</i> on page B-64.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>NRZ Bit Time</p>	<p>NRZ Bit Time is measured as the time interval between two consecutive eye-crossing points.</p> $NRZ\ Bit\ Time = T_{cross2} - T_{cross1}$ <p>Where Tcross2 and Tcross1 are the mean of the histogram of the two consecutive eye crossings.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>
<p>NRZ Crossing Time</p>	<p>The horizontal position of the eye crossing. Data is sampled on a horizontal slice at the eye crossing, and the mean of the horizontal histogram returns the crossing time.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Table B-8: NRZ Measurements - Timing (cont.)

Name	Definition
<p>NRZ Delay</p>	<p>The time interval between the crossings of the mid-reference levels on the two sources of the measurement.</p> $NRZ\ Delay = T_{cross}(source1) - T_{cross}(source2)$ <p>Where Tcross is the positive or negative crossing time at mid-reference level.</p> <p>The mid-reference level is adjustable and defaults to 50% of the NRZ eye amplitude. See <i>NRZ Crossings</i> on page B-64.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>By default, for each source, the algorithm searches forward from the Start Gate, but the Direction of traversal can be reversed, so that the search will be backward from the Stop Gate.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>
<p>NRZ Duty Cycle Distortion</p>	<p>The ratio of the time interval between the points where the rising and the falling edges cross the mid-reference level and the NRZ bit time.</p> $NRZ\ Duty\ Cycle\ Distortion = fabs\left(\frac{(T_{rise} - T_{fall})}{(T_{cross2} - T_{cross1})}\right)$ <p>Where Tcross1 and Tcross2 are the mean of the histogram of the two consecutive eye crossings, and Trise and Tfall and the time points where the rising and falling edges cross the mid-reference level. See <i>NRZ Crossings</i> on page B-64.</p> <p>The mid-reference level is adjustable and defaults to 50% of the NRZ eye amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>NRZ Eye Width</p>	<p>The 3σ guarded delta between two consecutive eye crossings.</p> $Eye\ Width = (T_{cross2} - 3 * T_{cross2}\sigma) - (T_{cross1} + 3 * T_{cross1}\sigma)$ <p>where Tcross1 and Tcross2 are the mean of the histogram of the two crossings.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Table B-8: NRZ Measurements - Timing (cont.)

Name	Definition
<p>NRZ Fall Time</p>	<p>NRZ Fall Time characterizes the negative slope of the NRZ eye by computing the time interval between the mean crossings of the high reference level and the low reference level.</p> $RZ\ Fall\ Time = T_{crossL} - T_{crossH}$ <p>Where T_{crossL} is the mean of the histogram of the crossing of the low reference level, and T_{crossH} is the mean of the histogram of the crossing of the high reference level. See <i>NRZ Measurement Reference Levels</i> on page B-63.</p> <p>The adjustable low reference and high reference levels default to 10% and 90% of the NRZ eye amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>NRZ Frequency</p>	<p>NRZ Frequency is defined as half of the inverse of the time interval between two consecutive eye crossing points (i.e. the reciprocal of the Period). It would be the frequency of a digital signal of a 0-1-0-1... stream.</p> $NRZ\ Frequency = \frac{1}{2 \times (T_{cross2} - T_{cross1})}$ <p>Where T_{cross1} and T_{cross2} are the mean of the histogram of the two crossings. See <i>NRZ Crossings</i> on page B-64.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>
<p>NRZ Period</p>	<p>NRZ Period is twice the time interval between two consecutive eye-crossing points. It would be the period of a digital signal of a 0-1-0-1... stream.</p> $NRZ\ Period = 2 * (T_{cross2} - T_{cross1})$ <p>Where T_{cross1} and T_{cross2} are the mean of the histogram of the two crossings of the eye diagram.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Table B-8: NRZ Measurements - Timing (cont.)

Name	Definition
<p>NRZ Phase</p>	$Phase = \frac{T_{cross1 \text{ of source2}} - T_{cross1 \text{ of source1}}}{T_{cross3 \text{ of source1}} - T_{cross1 \text{ of source1}}} \cdot 360$ <p>Where:</p> <ul style="list-style-type: none"> ■ T_{cross1} of source1 is the time of the first crossing of either polarity on source 1. ■ T_{cross3} of source1 is the time of next crossing on source 1 of the same polarity as T_{cross1}. ■ T_{cross1} of source2 is the time of the first crossing of either polarity on source 2 after T_{cross1} of source1. ■ All T_{crossings} are at the mid-reference level, which is adjustable and defaults to 50% of the NRZ eye amplitude. See <i>NRZ Crossings</i> on page B-64. <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>NRZ Pk-Pk Jitter</p>	<p>The delta between the minimum and maximum of time crossings, with the mean of the histogram being T_{cross}.</p> $Pk-PK \text{ Jitter} = T_{crosspp}$ <p>The Jitter At control in the Measurement Setup dialog specifies whether the jitter is to be measured at the eye cross or at the mid-reference level. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>The mid-reference level is adjustable and defaults to 50% of the eye amplitude.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Table B-8: NRZ Measurements - Timing (cont.)

Name	Definition
<p>NRZ Rise Time</p>	<p>Computes the time interval between the mean crossings of the low reference level and the high reference level to characterize the positive slope of the eye.</p> $NRZ\ Rise\ Time = T_{crossH} - H_{crossL}$ <p>Where TcrossH is the mean of the histogram of the crossing of the high reference level, and TcrossL is the mean of the histogram of the crossing of the low reference level.</p> <p>The adjustable High and Low reference levels default to 10% and 90% of the NRZ eye amplitude. See <i>NRZ Measurement Reference Levels</i> on page B-63.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p>
<p>NRZ RMS Jitter</p>	<p>Jitter is the measure of time variance on the rising and falling edges at the NRZ eye crossing or at the mid-reference level. RMS Jitter is defined as one standard deviation (σ) of that variance. The mean of the histogram of the crossing data distribution is Tcross.</p> $RMS\ Jitter = T_{cross}\ \sigma$ <p>The Jitter At control in the Measurement Setup dialog specifies if the jitter is to be measured at the eye cross or at the mid-reference level. The mid-reference level is adjustable and defaults to 50% of the eye amplitude. See <i>To Localize a Measurement</i> on page 3-83.</p> <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2).</p> <p>This measurement requires the use of a waveform database. When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p>

Non-Return-to-Zero (NRZ) Measurements - Area

Table B-9 topic describes each NRZ measurement in the area category. See Table B-7 on page B-37 for amplitude category measurements.; see Table B-8 on page B-50 for timing category measurements.

Table B-9: NRZ Measurements - Area

Name	Definition
<p>NRZ Area</p>	<p>The area under the curve for the NRZ waveform within the measurement region. Area measured above ground is positive; area measured below ground is negative.</p> $NRZ\ Area = \int waveform(t) dt, \text{ over the measurement region.}$ <p>If enabled, measurement gates constrain the measurement region to the area between the Start Gate (G1) and Stop Gate (G2). See <i>To Localize a Measurement</i> on page 3-83.</p> <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available. See <i>Use a Waveform Database</i> on page B-70.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.
<p>NRZ Cycle Area</p>	<p>The area under the curve for the first NRZ bit time within the measurement region. Area measured above ground is positive; area measured below ground is negative.</p> $NRZ\ Area = \int waveform(t) dt, \text{ over the first NRZ bit within the measurement region.}$ <p>When this measurement is turned on, it will automatically set the measurement system to use a waveform database if available.</p> <p>For best results with this measurement:</p> <ul style="list-style-type: none"> ■ Perform a Dark Level compensation before taking this measurement if the source of the measured waveform is an optical channel. See <i>To Perform Dark-Level and User Wavelength Gain Compensations</i> on page 3-98. ■ Optimize the vertical resolution before taking this measurement. See <i>To Optimize the Vertical Resolution</i> on page B-69.

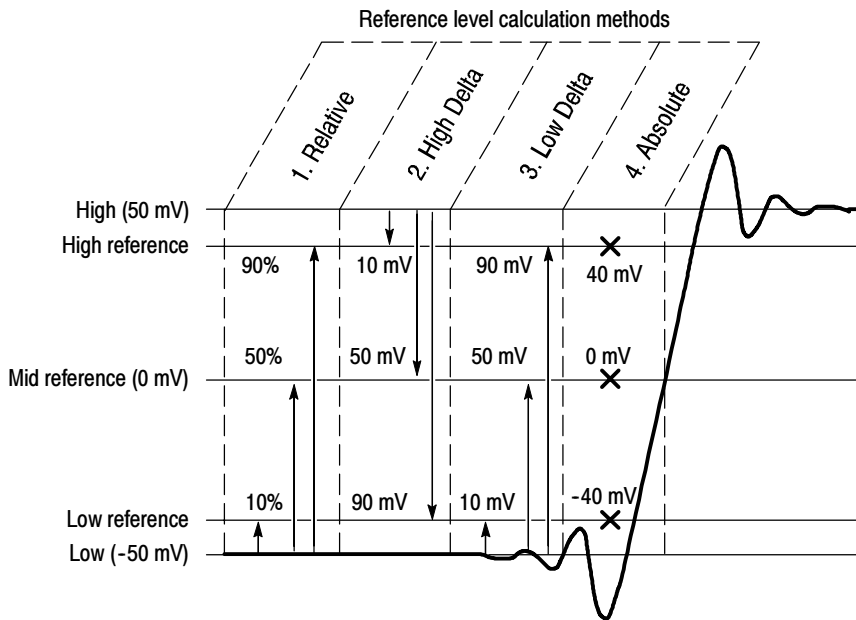
Measurement Reference Parameters and Methods

This reference topic describes the reference parameters (levels and crossings) used in taking the measurements.

All Sources

Reference-Level Calculation Methods

The methods available for calculating reference levels used in taking automatic measurement follow. The methods are shown using a pulse, but they also apply to RZ and NRZ waveforms.



1. Relative Reference is calculated as percentage of the High/Low range.
2. High Delta Reference is calculated as the absolute values from the High Level.
3. Low Delta Reference is calculated as absolute values from the Low Level.
4. Absolute Reference is set by absolute values in user units.
5. AOP (not shown) measures the Average Optical Power of the waveform and uses it as the Mid Ref level. See *Pulse Crossings and Mid-reference Level AOP* on page B-58 for more information.

Figure B- 1: Reference-level calculation methods

Pulse Sources

The automatic measurement system uses the following levels when measuring Pulse source waveforms. For the Pulse measurements, and their definitions that use the levels described here, see page B-2.

Pulse Measurement Reference Levels

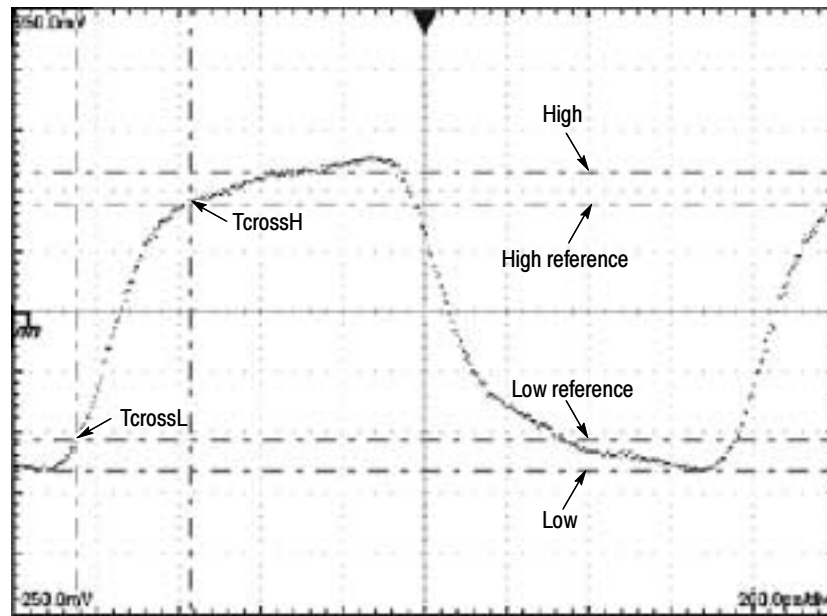


Figure B-2: Pulse-reference levels

Pulse Crossings and Mid-reference Level

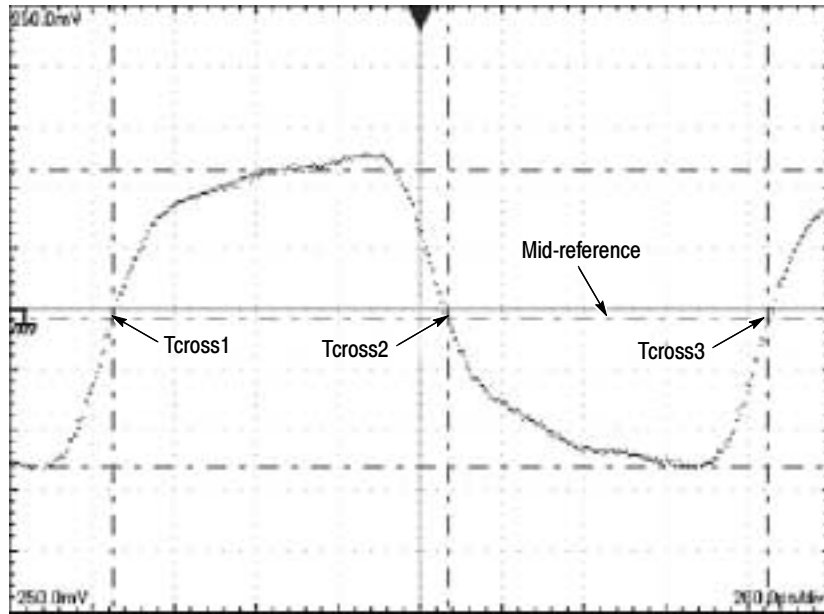


Figure B-3: Pulse crossings and mid-reference level

Pulse Crossings and Mid-reference Level (AOP)

The following measurement parameters are normally used when measuring Optical Modulation Amplitude on a pulse. Crossings at the measured Average Optical Power level determine the positions of the eye apertures for the logical 1 and logical 0 of the pulse (size set in the measurement Region control). The High, Power Logic 1, and Low, Power Logic 0 levels are determined as the mean values of the logical levels sampled within the eye aperture of the logical 1 and 0 regions of the pulse.

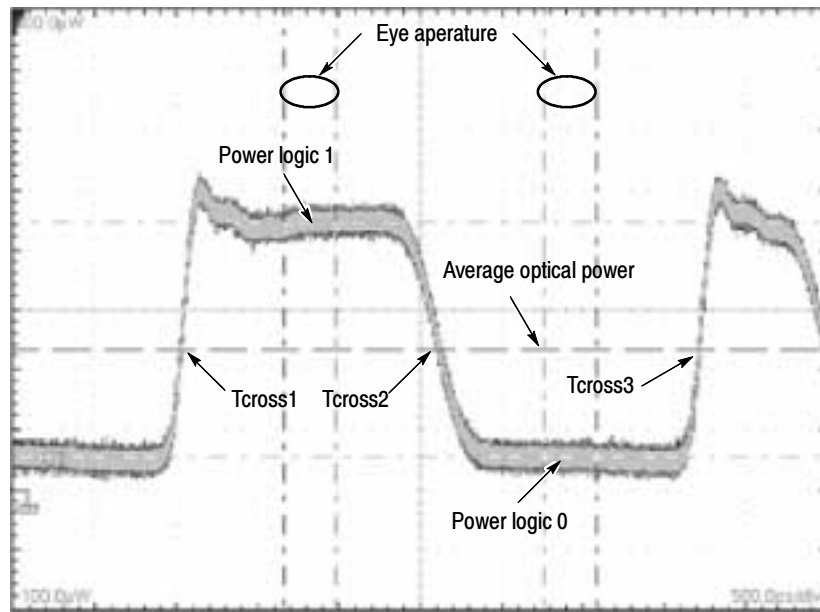


Figure B-4: AOP pulse crossings and mid-reference level

Overshoot Levels

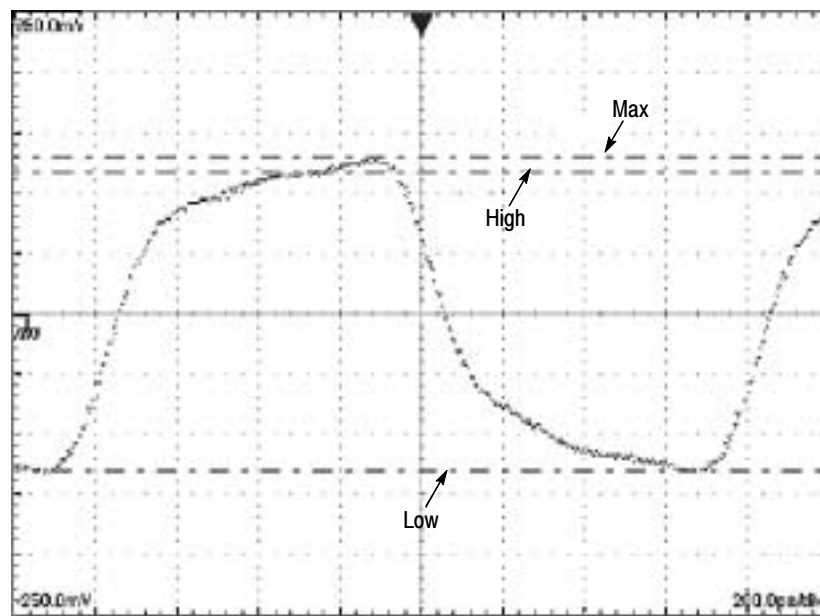


Figure B-5: Overshoot levels

RZ Sources

The automatic measurement system uses the following levels when measuring RZ source waveforms. For the RZ measurements, and their definitions that use the levels described here, see page B-15.

RZ Measurement Reference Levels

The following levels are used when deriving measurements on RZ waveforms.

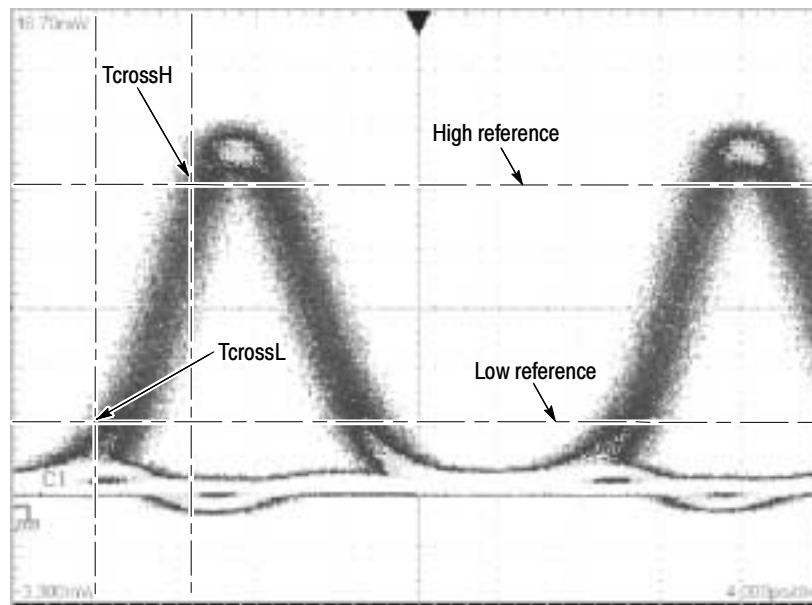


Figure B-6: RZ measurement reference levels

RZ Crossings

The following measurement parameters are used when deriving RZ measurements.

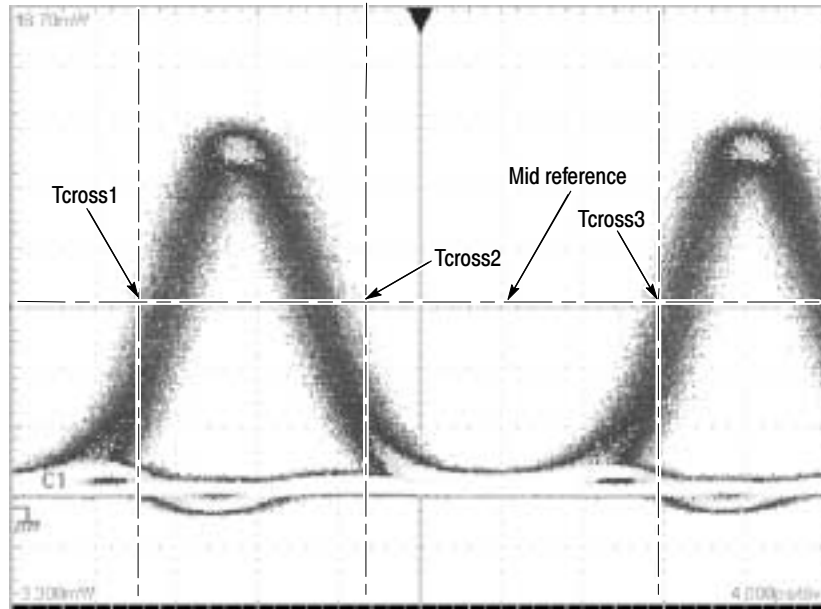


Figure B-7: RZ crossings

RZ Eye-Aperture Parameters

The following parameters are used when deriving measurements on RZ waveforms.

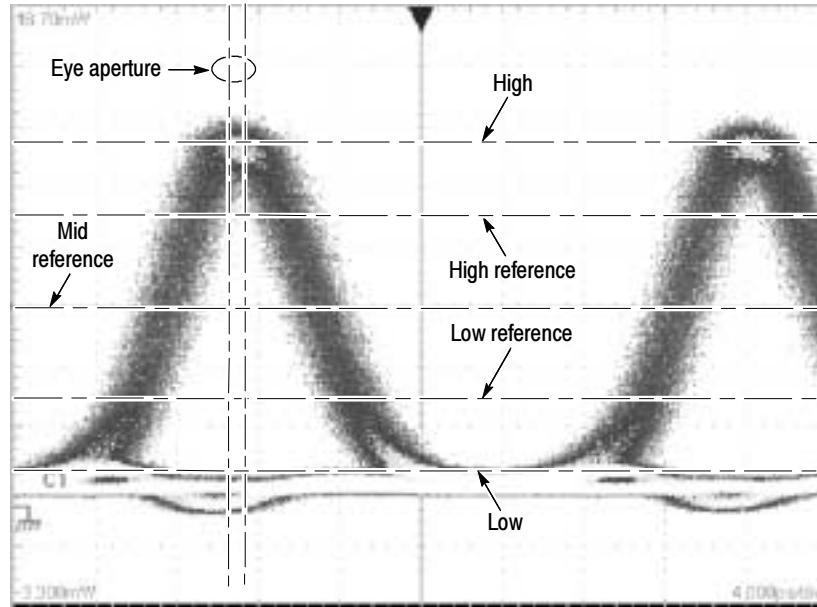


Figure B-8: RZ eye-aperture parameters

NRZ Sources

The automatic measurement system uses the following levels when measuring NRZ source waveforms. For the NRZ measurements, and their definitions that use the levels described here, see page B-37.

NRZ Measurement Reference Levels

The following levels are used when deriving measurements on NRZ waveforms.

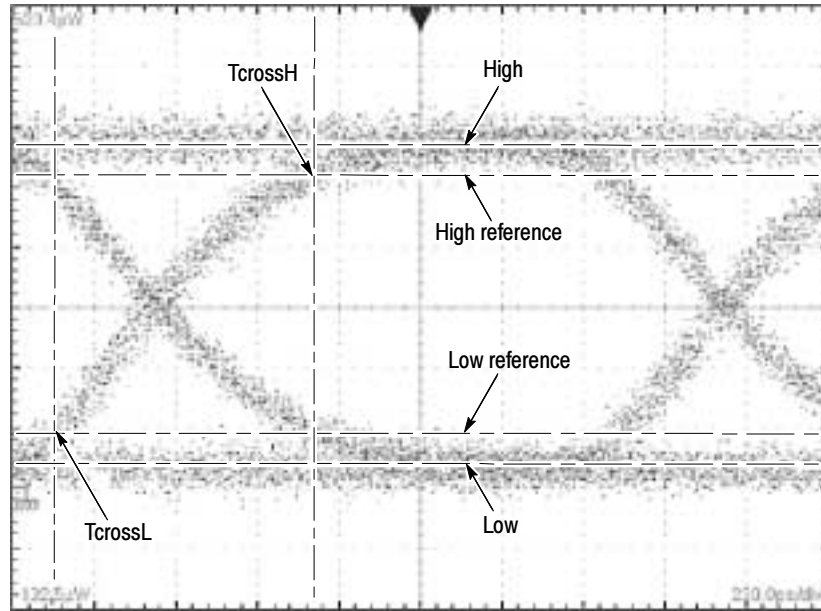


Figure B-9: NRZ measurement reference levels

NRZ Crossings

The following measurement parameters are used when deriving NRZ measurements.

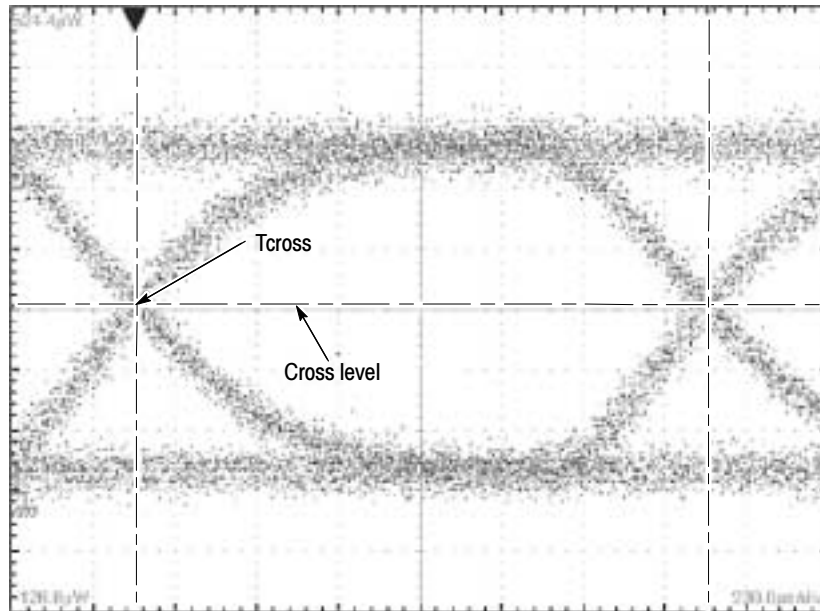


Figure B-10: NRZ crossings

NRZ Eye-Aperture Parameters

The following parameters are used when deriving measurements on NRZ waveforms.

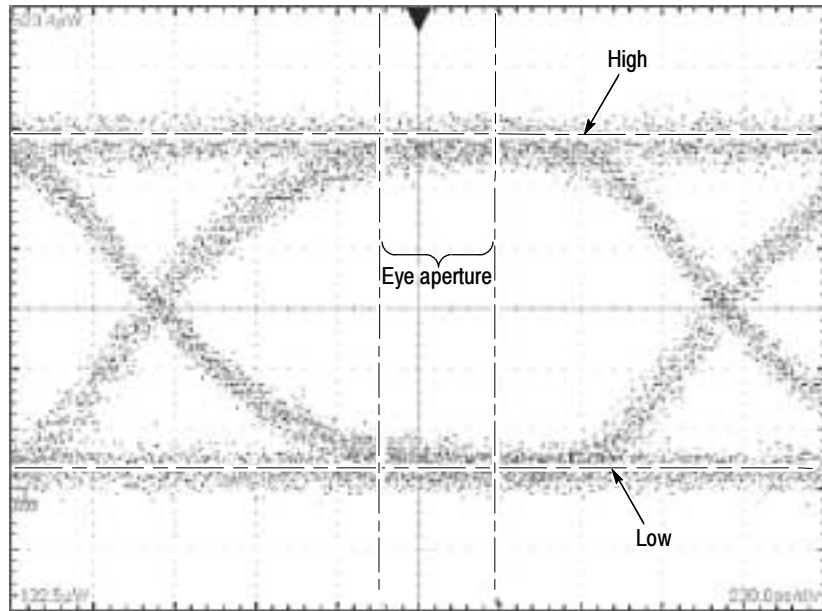


Figure B-11: NRZ eye-aperture parameters

NRZ Overshoot Levels

The following measurement parameters are used when deriving overshoot measurements on NRZ waveforms.

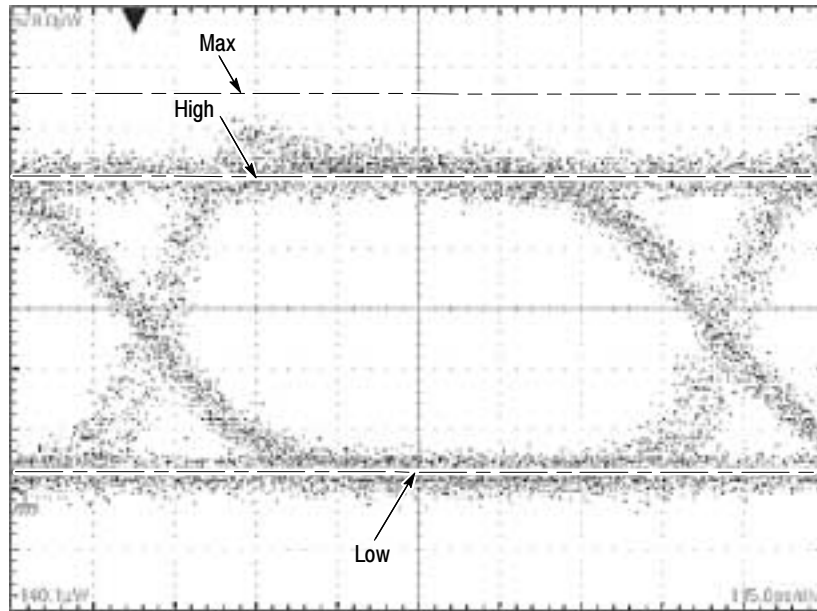


Figure B- 12: NRZ overshoot levels

NRZ Crossings (OMA)

The following measurement parameters are used when approximating Optical Modulation Amplitude (OMA) on NRZ waveforms. As shown, OMA on NRZ waveforms is determined from the means of histograms of the data from level 1 and level 0, taken on a vertical slice through the NRZ eye crossing. This method gives an approximation of Optical Modulation Amplitude of an NRZ waveform; Optical Modulations Amplitude measurements are primarily defined for Pulse signals.

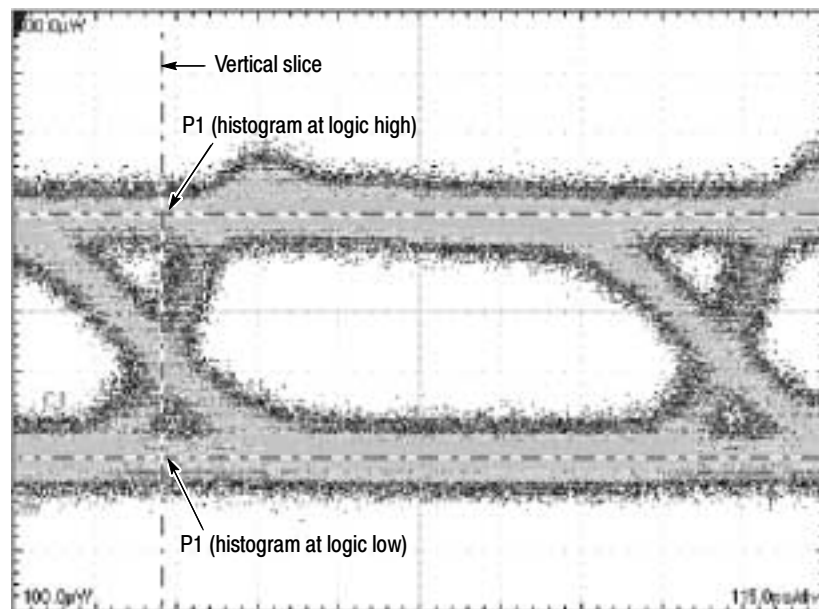
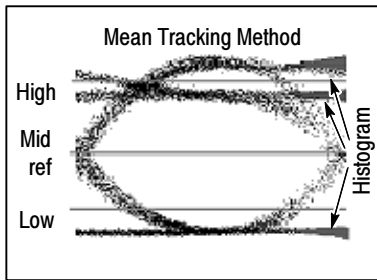


Figure B-13: NRZ Crossings (OMA)

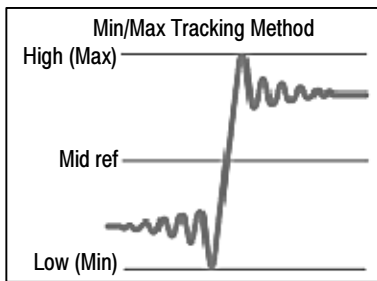
Tracking Methods

This topic describes measurements methods tracking the High and Low values used in taking automatic measurements.

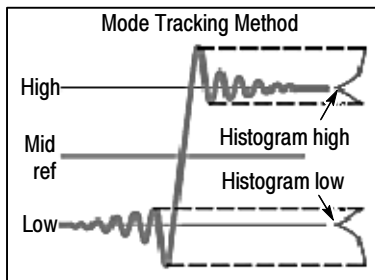
The levels that the automatic measurement system derives as the High (Top) or Low (Bottom) for a waveform influence the fidelity of amplitude and aberration measurements. For many of the automatic measurements supported, the instrument automatically determines these levels and disables all or some of the High/Low tracking method controls (for example, for RMS). If the measurement you select has High/Low methods that are appropriate to adjust (or example, RISE time), the instrument automatically enables the method controls for your adjustment. The methods available are shown below:



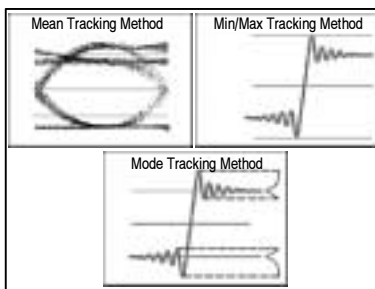
Mean (of Histogram) sets the values statistically. Using a histogram, it selects the mean or average value derived using all values either above or below the midpoint (depending on whether it is defining the high or low reference level). This setting is best for examining eye patterns and optical signals.



Min-max uses the highest and lowest values of the waveform record. This setting is best for examining waveforms that have no large, flat portions at a common value, such as sine waves and triangle waves - almost any waveform except for pulses.



Mode (of Histogram) sets the values statistically. Using a histogram, it selects the most common value either above or below the midpoint (depending on whether it is defining the high or low reference level). Since this statistical approach ignores short-term aberrations (overshoot, ringing, and so on), Mode is the best setting for examining pulses.



Auto switches between methods. Auto method first attempts to calculate the high and low values using the Mode method. Then, if the histogram does not show obvious consistent high and low levels, Auto method automatically switches to the Min/Max or Mean method.

For example, the Mode histogram operating on a triangle wave would not find consistent high and low levels, so the instrument would switch to the Min/Max mode. Consistent high and low levels would be found on a square wave, so the Auto mode would use the Mode method.

Mid-reference Level

The mid-reference level (adjustable from the Meas Setup dialog box) defaults to 50% of the pulse amplitude. If measurement gates are enabled, the measurement region is the area between the Start Gate (G1) and Stop Gate (G2). By default, the algorithm searches forward from the Start Gate for the first rising edge, but the direction can be reversed from Meas. Setup dialog box, so that the search will be backward from the Stop Gate. See *To Localize a Measurement* on page 3-83.

To Optimize the Vertical Resolution

Optimizing vertical resolution improves the result this measurement produces. Try these methods:

- Execute Autoset (push AUTOSSET on the front-panel).
- Adjust vertical scale (or increase input amplitude) to increase the overall vertical size of the waveform, while keeping the waveform on screen.

Use a Waveform Database

This measurement needs to be performed using a statistical (waveform) database. When one is specified, the instrument acquires or computes the targeted measurement source, then accumulates it into in the waveform database, and then takes the measurement on the database data. When you select the RZ or NRZ signal type, the instrument attempts to automatically allocate one of the four waveform databases it provides to your measurement source.



Appendix C: Insert Sampling Module User Manuals Here

You can insert the user manuals for the electrical and/or optical sampling modules here.

Glossary

Accuracy

The closeness of the indicated value to the true value.

Acquisition

The process of sampling signals from input channels, digitizing the samples into data points, and assembling the data points into a waveform record. The waveform record is stored in memory. The trigger marks time zero in that process.

Active cursor

The cursor that moves when you turn the general purpose knob. It is represented in the display by a solid line.

Active (or Selected) view

The view in multiple view displays that is currently targeted for adjustment by the horizontal controls. The front-panel button of the active view is always lit amber.

Aliasing

A false representation of a signal due to insufficient sampling of high frequencies or fast transitions. A condition that occurs when a sampling instrument digitizes at an effective sampling rate that is too slow to reproduce the input signal. The waveform displayed on screen may have a lower frequency than the actual input signal.

Annotations

Lines displayed on screen to indicate measurement reference levels and points that an automatic measurement is using to derive the measurement value.

Attenuation

The degree the amplitude of a signal is reduced when it passes through an attenuating device such as a probe or an external attenuator. That is, the ratio of the input measure to the output measure. For example, a 10X attenuator will attenuate, or reduce, the input voltage of a signal by a factor of 10.

Automatic measurement

An automatic measurement of a parameter and its numeric readout that the instrument takes and updates directly from a channel, math, or reference waveform in real time, without operator intervention.

Automatic trigger mode

A trigger mode that causes the instrument to automatically acquire if triggerable events are not detected within a specified time period.

Autoset

A function of the instrument that attempts to automatically produce a stable waveform of usable size. Autoset sets up the acquisition controls based on the characteristics of the selected waveform. A successful autoset will produce a coherent and stable waveform display.

Average acquisition mode

In this mode, the instrument displays and updates a waveform that is the averaged result of several waveform acquisitions. Averaging reduces the apparent noise. The instrument acquires data as in sample mode and then averages it a user-specified number of averages.

Average Optical Power (AOP)

The time averaged measurement of the optical power over a much longer time period than the bit rate of the signal.

Bandwidth

The highest frequency signal the instrument can acquire with no more than 3 dB ($\times .707$) attenuation of the original (reference) signal.

BER

An acronym for Bit Error Ratio (or Rate). The principal measure of quality of a digital transmission system. BER is defined as:

$$\text{BER} = \text{Number of Errors} / \text{Total Number of Bits}$$

BER is usually expressed as a negative exponent. For example, a BER of 10^{-7} means that 1 bit out of 10^7 bits is in error.

BER floor

A limiting of the bit-error-ratio in a digital system as a function of received power due to the presence of signal degradation mechanisms or noise.

Bit error

An incorrect bit. Also known as a coding violation.

Channel

An input that connects a signal or attaches a network or transmission line to sampling modules for acquisition of channel waveforms by the instrument.

Channel/Probe deskew

A relative time delay that is settable for a channel. Setting deskew lets you align signals to compensate for signals that may come in from cables of differing length.

Channel icon

The indicator on the left side of the display that points to the position around which the waveform contracts or expands when vertical scale is changed. This position is ground when offset is set to 0 V; otherwise, it is ground plus offset.

Channel number

The number assigned to a specific signal input channel of an installed sampling module. Assignment of channel numbers is described in *Maximum Configuration* on page 1-11.

Channel waveforms

Waveforms resulting from signals input into sampling-module channels and digitized and acquired by the instrument. See *Live Waveforms*.

Control knob

see Knob

Coupling

The association of two or more circuits or systems in such a way that power or information can be transferred from one to the other. This instrument supports direct coupling only at its inputs; the user must provide any alternate coupling (ac, frequency filtering) externally.

Cursors

Any of three styles of paired markers that you can use to make measurements between two waveform locations. The instrument displays the values (expressed in vertical or horizontal units) of the position of each cursor and the distance between the two cursors.

Delay time

See Horizontal Delay.

Digitizing

The process of converting a continuous analog signal such as a waveform to a set of discrete numbers representing the amplitude of the signal at specific points in time. Digitizing is composed of two steps: sampling and quantizing.

Display system

The part of the instrument that displays the three graticules, one each for the Main, Mag1, and Mag2 time bases, the waveforms, and other display related elements (waveform labels, cursors, test masks, measurement annotations, etc.).

Dragging

The act of changing your selection either by clicking (mouse) or touching (touchscreen) a point on the screen and pulling across the screen while holding down the key (mouse) or maintaining contact with your finger (touchscreen).

Error detection

Checking for errors in data transmission. A calculation is made on the data being sent and the results are sent along with it. The receiving station then performs the same calculation and compares its results with those sent. Each data signal conforms to specific rules of construction so that departures from this construction in the received signals can be detected. Any data detected as being in error is either deleted from the data delivered to the destination, with or without an indication that such deletion has taken place, or delivered to the destination together with an indication that it is in error.

Error rate

The ratio of the number of data units in error to the total number of data units.

Edge trigger

Triggering occurs when the instrument detects the source passing through a specified voltage level in a specified direction (the trigger slope). This instrument supports only edge triggering. All trigger sources must be external, except when using clock recovery (available as an option with optical sampling modules) or the internal clock.

Envelope acquisition mode

A mode in which the instrument acquires and displays a waveform that shows the variation extremes of several acquisitions.

Equivalent-time sampling (ET)

A sampling mode in which the instrument acquires signals over many repetitions of the event. This instrument uses a type of equivalent-time sampling called sequential equivalent-time sampling. See *Sequential equivalent-time sampling*.

Extinction Ratio

The ratio of two optical power levels of a digital signal generated by an optical source. P_1 is the optical power level generated when the light source is high, and P_2 is the power level generated when the light source is low.

$$r_e = \frac{P_1}{P_2}$$

Gated measurements

A feature that lets you limit automated measurements to a specified portion of the waveform. You define the area of interest using measurement gates.

General-purpose knob

The large front-panel knob on the upper-right corner of the front panel. You can use it to change the value of the control or element that currently has focus. It can adjust the cursors.

GPIB (General Purpose Interface Bus)

An interconnection bus and protocol that allows you to connect multiple

instruments in a network under the control of a controller. Also known as IEEE 488 bus. It transfers data with eight parallel data lines, five control lines, and three handshake lines.

Graticule

A grid on the display screen that creates the horizontal and vertical axes. You can use it to visually measure waveform parameters.

Graticule labels

Each graticule displays three labels. The upper and lower left labels indicate the amplitude level at each of the upper and lower boundaries of the graticule edges. These levels are based on the vertical scale and offset of the selected waveform. The lower right label is horizontal scale factor of the selected waveform expressed in units per division.

High

The value used as the 100% level in amplitude measurements, such as Peak and +Overshoot. See *Levels Used in Taking Amplitude, Timing, and Area Measurements* on page 3-79 for more details.

HighRef

The waveform high reference level, used in such measurements as fall time and rise time. Typically set to 90%. See *Levels Used in Amplitude, Timing, and Area Measurements* on page 3-79 for more details.

Holdoff, trigger

A specified amount of time after a trigger signal that elapses before the trigger circuit will accept another trigger signal. Trigger holdoff helps ensure a stable display.

Horizontal Acquisition Window

A common time window or range that is applied to all channels in parallel to determine the segment of an incoming signal that becomes the waveform record. Trigger and horizontal controls determine the duration of this window and its placement in the incoming signal.

Horizontal bar cursors

The two horizontal bars that you position to measure the amplitude parameters of a waveform. The instrument displays the value of both cursors with respect to ground and the amplitude value between the bars.

Horizontal delay time

The time between the trigger event and the acquisition of data. The time is set indirectly by the Horizontal reference setting and the horizontal position settings. See *Horizontal Position and the Horizontal Reference* on page 3-59.

Horizontal reference point

The point about which waveforms are expanded or contracted horizontally

when horizontal scale adjustments are made. The horizontal reference point remains anchored as the rest of the waveform grows or shrinks around it.

Icon

See Channel Icon.

Initialize

Setting the instrument to a completely known, default condition by pressing executing a Default Setup.

Internal clock

A trigger source that is synchronized to the internal clock, with a selectable repetition rate. It is most often used with TDR to synchronize the generation of TDR step pulses with subsequent acquisition.

Interpolation

The way the instrument calculates additional values to display when the acquired record length is less than 500 points. The instrument has three interpolation options: *linear*, *sin(x)/x*, or *none*.

Linear interpolation calculates record points in a straight-line fit between the actual values acquired. *Sin(x)/x* computes record points in a curve fit between the actual values acquired. It assumes all the interpolated points fall in their appropriate point in time on that curve. *None* displays only the acquired data points.

Knob

A rotary control.

Live Waveforms

Waveforms that can update as the acquisition system acquires data. Channel waveforms are live waveforms; reference waveforms are not. Math waveforms are live if they contain live waveforms in their expressions: C1 + R1 defines a live math waveform; R1 + R2 does not.

Low

The value used as the 0% level in amplitude measurements, such as Peak and +Overshoot. See *Levels Used in Taking Amplitude, Timing, and Area Measurements* on page 3-79 for more details.

LowRef

The waveform low reference level. Used in fall and rise time calculations. Typically set to 10%. See *Levels Used in Taking Amplitude, Timing, and Area Measurements* on page 3-79 for more details.

Math Waveform

A waveform defined by a combination of one or more operands (channel waveforms, reference waveforms, and automatic measurement scalars). Math waveforms may also contain math operators and functions.

Measurement

See Automatic Measurement.

Measurement statistics

The accumulation of a history of individual measurement readouts, showing the mean and standard deviation of a selected number of samples.

Measurement updating

The process of automatically adjusting the measurement parameters to reflect changes in the waveform targeted by an automatic measurement.

MidRef

The waveform middle reference level used in such measurements as Period and Duty Cycle. Typically set to 50%. See *Levels Used in Taking Amplitude, Timing, and Area Measurements* on page 3-79 for more details.

Mid2Ref

The middle reference level for a second waveform (or the second middle reference of the same waveform). Used in two waveform time measurements, such as the Delay and Phase measurements. See *Levels Used in Taking Amplitude, Timing, and Area Measurements* on page 3-79 for more details.

Non-Return to Zero (NRZ)

A waveform type for of a source to be measured.

OMA (Optical Modulation Amplitude)

The difference between the average power levels of the logic 1 level, High, and the logic 0 level, Low, of the optical pulse signal. The levels are the Means of the logical levels sampled within an Aperture of the logical 1 and 0 regions of the pulse. The logical 1 and 0 time intervals are marked by the crossings of a reference level determined as the Average Optical Power (AOP) of the signal.

Persistence

The amount of time a data point remains displayed. There are three persistence modes available in the instrument: Variable, Infinite, and Color Grading.

Pixel

A visible point on the display. The instrument display is 640 pixels wide by 480 pixels high.

Pop-up menu

A menu that displays when you right click an application element, such as a channel or its icon, a measurement or other readout. Usually provides quick access to settings related to the object clicked.

Probe

An instrument input device.

Quantizing

The process of converting an analog input that has been sampled, such as a voltage, to a digital value.

Return to Zero (RZ)

A waveform type for of a source to be measured (see waveform types).

Real-time sampling

An alternate sampling mode where the instrument samples to completely fill a waveform record from a single trigger event. This instrument does not use real time sampling; it samples sequentially. See *Sequential equivalent-time sampling* on page Glossary-9.

Record length

The specified number of samples in a waveform.

Reference memory

Memory in an instrument used to store waveforms or settings. You can use that waveform data later for processing. The instrument saves the data even when the instrument is turned off or unplugged.

Reference waveforms

Waveforms that are static, not live (see live waveforms). Reference waveforms are channel or math waveforms that you save to references or to files in the instrument file system. Once saved, they do not update.

Sample acquisition mode

The instrument creates a record point by saving the first sample during each acquisition interval. That is the default mode of the acquisition.

Sample interval

The time interval between successive samples in a time base display. The time interval between successive samples represents equivalent time, not real time.

Sampling

The process of capturing an analog input, such as a voltage, at a discrete point in time and holding it constant so that it can be quantized.

Select button

A button that changes which of the two cursors is active.

Selected waveform

The waveform which is affected by vertical position and scale adjustments. One of the channel selector buttons lights amber to indicate the currently selected waveform.

Sequential equivalent-time sampling

A type of equivalent-time sampling in which one sample is taken per acquisition, with each sample skewed incrementally with respect to an external trigger event. This instrument acquires using sequential equivalent-time sampling.

Saved waveform

A collection of sampled points that constitute a single waveform that is saved in any one of reference locations R1 - R8 or to the file system.

Slope

The direction at a point on a waveform. You can calculate the direction by computing the sign of the ratio of change in the vertical quantity (Y) to the change in the horizontal quantity. The two values are rising and falling.

Time base

The set of parameters that let you define the time and horizontal axis attributes of a waveform View. The time base determines when and how long to acquire record points.

Trigger

An event that marks time zero in the waveform record. It results in acquisition of the waveform as specified by the time base.

Trigger level

The vertical level the trigger signal must cross to generate a trigger (on edge trigger mode).

Uptime

The number of hours the instrument has been powered on.

Vertical bar cursors

The two vertical bars you position to measure the time parameter of a waveform record. The instrument displays the value of both cursors with respect to the trigger and the time value between the bars.

Vertical Acquisition Window

The range of values the acquisition system can acquire. The maximum vertical size is set by the operating range of the sampling module installed, and that of any probe installed on the sampling module. For example, an 80E00 sampling module set to its maximum 100mV/div scale yields a 10-division vertical acquisition window of 1V.

The vertical offset determines where in the operating range of the A/D converter (sampler) the signal is positioned relative to ground. Changing vertical position will simply change the space on the screen where the data is displayed.

View

Any one of the three waveform displays the instrument provides: Main, Mag1, and Mag2. Each view has its own graticule and time base. The instrument always displays the Main view; the Mag1 and Mag2 views can be added and removed from the display using the View buttons on the front panel.

Virtual keyboard

A pop-up keyboard that lets you click to type characters for the control from which it is opened, such as in the vertical scale and offset controls found in the Control bar at the bottom of the display.

Virtual keypad

A pop-up pad that lets you enter specific numeric values for the control from which it is popped up.

Waveform

The visible representation of an input signal or combination of signals. Waveforms can be channel, reference, or math waveforms.

Waveform cursors

The cursor mode that presents two cursors you position to measure both the time and amplitude parameters of a waveform record. The instrument displays the time of both cursors with respect to the trigger and the time between the cursors. The instrument also displays the value of both cursors with respect to the waveform ground and between the cursors.

Waveform database

A collection of sequentially acquired waveforms.

Waveform types

Waveform types of the source to be measured can be Pulse, NRZ, and RZ. Each waveform type has a measurement category (Amplitude, Timing, or Area) that can be selected.

WfmDB

See *Waveform database*.

Windows 98

The underlying operating system on which this instrument runs.

YT format

The conventional display format. It shows the amplitude of a waveform record (on the vertical axis) as it varies over time (on the horizontal axis).

Index

A

Accessories

- list, 1-45
- optional, 1-46
- standard, 1-45

Accuracy, Glossary-1

Acquiring Waveforms, 3-3

Acquisition, Glossary-1

- cycle, 3-29
- horizontal delay, 3-28
- horizontal delay time with, Glossary-5
- how to start and stop, 3-26
- input channels and digitizers, 3-27
- modes for starting and stopping, 3-22
- overview, 3-27
- preventing aliasing, 3-23
- record, 3-28
- record length, 3-28
- sample interval, 3-28
- sampling (see Sampling), 3-27-3-29
- set Stop mode & action, 3-25
- time base, Glossary-9
- trigger point, 3-28
- triggering, 3-39

Acquisition control

- background, 3-27
- overview, 3-21

Acquisition controls

- keys to using, 3-22
- vs. Display controls, 3-58
- why use, 3-21

Acquisition mode

- Average, Glossary-2
- Envelope, Glossary-4
- Sample, Glossary-8

Acquisition modes

- description of, 3-22
- how to set, 3-24

Acquisition settings, purpose, 3-21

Active cursor, Glossary-1

Address, Tektronix, xiii

Aliasing, 3-23, Glossary-1

AOP, average optical power, Glossary-2

Annotations, Glossary-1

Application toolbar, 3-127

Attenuation, Glossary-1

Attenuators, external, use of, 3-6

Auto, trigger mode, 3-41

Automatic measurement, Glossary-1

Automatic measurements, 3-74

- annotations, 3-74
- behavior with databases, 3-76
- categories for selection, 3-76
- database as source requirement/exclusion, 3-76
- databases as sources, 3-75
- dual waveform, 3-76
- high/low tracking, 3-77
 - methods for, 3-77
- how to localize (gates), 3-83
- how to take, 3-80
- independent characterization of, 3-75
- number available, 3-76
- reference level methods, 3-79
- sources available, 3-76
- statistics on, 3-75
- usage limitations, 3-76
- what's measured, 3-74
- why use, 3-74

Automatic Measurements Reference, B-1

Automatic measurements reference

- All Sources, B-56
- calculation method, B-56
- Mid-reference Level, B-69
- NRZ Measurement Reference Levels, B-63
- NRZ Sources, B-62
- Pulse measurement reference levels, B-57, B-60, B-62
- Pulse Sources, B-57
- RZ Measurement Reference Levels, B-60
- RZ Sources, B-60
- To Optimize the Vertical Resolution, B-69
- Tracking Methods, B-68
- Use a Waveform Database, B-70

Automatic trigger mode, Glossary-1

Autoset, 3-5, Glossary-2

- How to execute, 3-109
- how to execute, 3-11
- mask-specific, 3-142
- overview, 3-14

Average acquisition mode, Glossary-2

B

Back up, procedure, 1-17

Bandwidth, Glossary-2

Bar

- Controls, 2-7
 - Measurements, 2-7
 - Menu, 2-7
 - Readouts, 2-7
 - Status, 2-7
 - Tool, 2-7
 - Waveform, 2-7
- BER, Glossary-2
- BER floor, Glossary-2
- Bit error, Glossary-2
- Brightness/Contrast adjustment, 1-16
- Button, **SELECT**, Glossary-8

C

- CD, instrument software, 1-3
- Certifications, for instrument, A-11
- Channel, Glossary-2
- icon, Glossary-2
 - number, Glossary-3
 - waveforms, Glossary-3
- Channel icon, Glossary-2
- Channel-probe deskew, Glossary-2
- Channels
- in sampling modules, 3-27
 - maximum configuration, 1-11
 - shared horizontal window, 3-20
 - shared parameters, illustrated, 3-20
- Cleaning, instrument, how to, 3-175
- Cleaning and inspection
- exterior, 3-175
 - flat panel display, 3-176
- Cleaning optical connectors, 3-176
- Clipping, 3-6
- Clock, internal, Glossary-6
- Clock recovery, 3-39
- trigger source, 3-42
- Communication, remote, 3-139
- Compensation, 3-92-3-100
- how to perform, 3-92
 - when installing/moving sampling modules, 1-11
- Configuration
- instrument, 1-9
 - maximum channels available, 1-11
 - software installation, 1-18
- Connectors
- DIRECT**, 3-42, 3-44
 - locations and purpose, 1-13
 - PRESCALE**, 3-42, 3-44
- Contacting Tektronix, xiii

Controls

- initialize, Glossary-6
 - knob, Glossary-6
 - selected waveform, 3-7
- Controls bar, 2-7
- Coupling, Glossary-3
- CSA8000, description, 1-1
- Cursor, measurements, 3-85-3-87
- Cursor Measurements, how to set sources for, 3-90
- Cursor measurements
- how to take, 3-89
 - sources, 3-86
 - what's measured, 3-85
 - why use, 3-85
- Cursors, 3-85, Glossary-3
- constrained by the display, 3-86
 - default measurement source, 3-86
 - horizontal bars, Glossary-5
 - measure horizontally from the trigger point, 3-87
 - types, 3-86
 - units and readout names, 3-88
 - use with independent sources, 3-87
 - vertical bars, Glossary-9
 - waveform, Glossary-10
 - what time cursors measure (illustration), 3-88

D

- Dark-Level compensation, how to perform, 3-98
- Data, controlling input and output, 3-113
- Data Input and Output, 3-113
- Database, waveform, Glossary-10
- Databases, Waveform, 3-159
- Delay time, Glossary-3
- horizontal, Glossary-5
- Description
- key features, 1-1
 - product, 1-1
- Deskew, Glossary-2
- how to, 3-96
- Diagnostics
- procedure, 1-22
 - system, 1-20
- Digitizing, Glossary-3
- process, defined, 3-27-3-29
- Display
- customizable attributes of, 3-66
 - defined, 3-54
 - elements of, 3-54
 - flexible control, 3-55
 - graticule, defined, 3-54

horizontal reference, defined, 3-54
horizontal scale readout, defined, 3-54
how to customize, 3-69
how to set style of, 3-68
limit readouts, defined, 3-54
map—Main & Mag views, 2-10
map—Main view, 2-9
mode
 Infinite Persistence, 3-67
 Normal, 3-67
 Variable Persistence, 3-67
multiple views, 3-55
preview field, defined, 3-54
printing, 3-132
keys to using, 3-56
setting high color, 3-137
system, Glossary-3
time base views, defined, 3-54
touchscreen, defined, 3-55
 customizing, 3-66
 waveform, 2-7
 why use, 3-55
 zoom, 3-55
Display controls
 purpose, 3-55
 vs. Acquisition controls, 3-58
Display menu
 Dots, 3-67
 Vectors, 3-67
Display screen, overview of, 3-53
Display settings
 Horizontal position, 3-59
 horizontal reference, 3-59
Displaying waveforms, 3-53
Documentation
 online, 2-1
 online help system, 3-167
Dots, 3-67
Dots, Display menu, 3-67
Dragging, mouse or touchscreen, Glossary-3

E

Edge trigger, Glossary-4
Electrical modules, installation, 1-10
Electrical sampling modules, specifications, where to find, A-1
Envelope acquisition mode, Glossary-4
Environmental requirements, installation, 1-9
Equivalent time sampling, random, Glossary-4
Error detection, Glossary-4
Error rate, Glossary-4

ESD
 & sampling modules, 3-6
 and trigger source inputs, 3-43
Exporting waveforms, 3-128
Extinction ratio, Glossary-4

F

Fiberchannel, standards supported, 3-142
Firmware, upgrade, 1-4
Flat panel display, cleaning, 3-176
FrameScan Acquisition
 keys to using, 3-31
 usage limitations, 3-31
FrameScan acquisition
 advantages, 3-30
 cycle, 3-31
 How to catch bit error, 3-36
 how works (illustrated), 3-32
 overview, 3-30
 why use, 3-30
Envelope, usage limitations, 3-31
FrameScan Mode, How to acquire in, 3-33
Front panel, map, 2-8
Functional tests, procedure, 1-25

G

Gamma control, 1-16
Gated measurements, Glossary-4
Gated Triggering, how to set, 3-50
General purpose knob, Glossary-4
Gigabit Ethernet, 3-142
GPIB, Glossary-4
Graticule, Glossary-5
 labels, Glossary-5
 one per view, 3-57

H

Hard drive, operating system reinstallation, 1-20
Hardware and operating system, procedure, 1-42
High, Glossary-5
High frequency triggering, 3-45
High/Low tracking, 3-77
 methods for, 3-77
HighRef, measurement level, Glossary-5
Histograms
 continuous operation of, 3-154
 counting, 3-155
 editing features, 3-154

- in recalled setups, 3-155
- size, 3-155
- supported statistics, table of, 3-158
- taking, 3-154
- to take, 3-156
- usage limitations, 3-155
- valid sources of, 3-154
- why use, 3-154

Holdoff, triggering, 3-45

- usable limits, 3-46

Holdoff, trigger, Glossary-5

Bit error, to capture, 3-36

Horizontal

- Bar cursors, Glossary-5
- delay time, Glossary-5
- discussion of parameters, 3-17
- interrelation of parameters, 3-19
- position, 3-7
- scaling, 3-4
- set up procedure, 3-8
- time range (acquisition window), Glossary-5

Horizontal Reference, usage limitations, 3-31

Horizontal acquisition window, Glossary-5

- control set up, 3-10
- what determines, 3-17

Horizontal delay, defined, 3-28

Horizontal position, relative to Horizontal Ref, 3-59

Horizontal reference, relative to horizontal position, 3-59

Horizontal reference point, Glossary-5

Horizontal scale, why use, 3-4

Horizontal set up, purpose, 3-4

Horizontal settings

- with channel waveforms, 3-58
- with math waveforms, 3-58
- with reference waveforms, 3-58

I

Image, ink-saver mode, 3-134

Incoming inspection, 1-21

- perform compensation, 1-24
- perform diagnostics, 1-22
- perform hardware and operating system test, 1-42
- perform the functional tests, 1-25
- test equipment required by, 1-21

Infinite Persistence, display mode, 3-67

Initialize, Glossary-6

Ink-saver mode, 3-134

Input/Output (front panel), map, 2-11

Input/Output (rear panel), map, 2-12

Inspection and cleaning

- exterior, 3-175
- flat panel display, 3-176

Installation, 1-9

- environmental requirements, 1-9
- incoming inspection procedure, 1-21
- sampling modules, 1-10
 - compensation requirements, 1-11
- software installation, 1-18

Instrument

- accessories list, 1-45
- acquisition overview, 2-6
- cleaning, 3-175
- functional model, 2-4
- installation, 1-9
- key features, 1-1
- models, 1-1
- optional accessories list, 1-46
- options list, 1-45
- package contents, 1-7
- product description, 1-1
- standard accessories list, 1-45

Interpolation, Glossary-6

- description of modes, 3-67

Introduction, to this manual, xi

K

Keyboard, virtual, Glossary-10

Keypad, virtual, Glossary-10

Knob, Glossary-6

- general purpose, Glossary-4
- Trigger **MAIN LEVEL**, 3-40

L

Level, trigger, 3-40

Linear interpolation, 3-67, Glossary-6

Linearity, measurement errors, 3-6

Live waveforms, Glossary-6

Low, Glossary-6

LowRef, measurement level, Glossary-6

M

Mag1 and Mag2, Views, 3-59

Manuals

- part numbers, 1-45
- related, xii

Map

- acquisition process, 2-6
- documentation, 2-2
- front panel, 2-8
- input/output (front panel), 2-11
- input/output (rear panel), 2-12
- system, 2-4
- user interface, 2-7
- waveform display, 2-9

Mask testing, 3-141, 3-145

- autoset to a mask, 3-147
- clearing statistics counts, 3-151
- count statistics, 3-143
- creating a user mask (figure), 3-144
- definition of counts (statistics), 3-151
- editing description, 3-143
- flexible features of, 3-141
- stopping acquisition based on, 3-147
- supported standards, 3-142
- to create a mask, 3-152
- to edit a mask, 3-149
- usage limitations, 3-142
- why use, 3-141

Masks

- Fiberchannel standards supported, 3-142
- Gigabit Ethernet, 3-142
- SONET/SDH standards supported, 3-142

Math waveform

- defining (overview), 3-101
- how to define, 3-105
- how to use, 3-109
- operations on, 3-107
 - display considerations, 3-108
 - source considerations, 3-108
- take automatic measurements on, 3-110
- take cursor measurements on, 3-111

Math Waveforms

- how to create, 3-103
- sources for, 3-103

Math waveforms, Glossary-6

- expression syntax for, 3-104
- overview, 3-101
- source dependencies of, 3-104
- time base dependencies of, 3-104
- usage limitations, 3-102, 3-107
- why use, 3-102

Measurement

- Gated, Glossary-4
- High, Glossary-5
- Low, Glossary-6

Measurement accuracy, optimizing, 3-92-3-100**Measurement level**

- HighRef, Glossary-5
- LowRef, Glossary-6
- MidRef, Glossary-7
- MidRef2, Glossary-7

Measurement Reference Parameters and Methods, B-56**Measurements**

- automatic, 3-74
 - annotations, 3-74
 - databases as sources, 3-75
 - independent characterization of, 3-75
 - statistics on, 3-75
 - what's measured, 3-74
 - why use, 3-74
- cursor, 3-85
 - sources, 3-86
 - what's measured, 3-85
 - why use, 3-85
- cursor types, 3-86
- cursors and the display, 3-86
- how to localize (gates), 3-83
- how to set sources for cursor, 3-90
- how to take, 3-80
- how to take cursor, 3-89
- tools for taking, 3-73

Measurements (automatic), B-2, B-15, B-68

- for Pulse signals (definitions), B-2, B-8, B-14
- for RZ signals (definitions), B-15, B-29, B-36
- NRZ signals (definitions), B-37, B-50, B-55
- Reference, B-1

Tracking methods, B-68**Measurements bar, 2-7****Measuring Waveforms, 3-73****Menu, Pop-up, Glossary-7****Menu bar, 2-7****Metastability reject triggering, 3-45****MidRef, measurement level, Glossary-7****MidRef2, measurement level, Glossary-7****Mode, trigger, 3-41****Models, instrument, 1-1****Modes, sampling, 3-28-3-30****Modules, sampling, supported, 1-4****Mouse, operations equivalent with touchscreen, 3-60****N****Non-Return to Zero, Definition, Glossary-7**

- Non-Return-to-Zero (NRZ) automatic measurements, B-37
 - Amplitude-related, B-37
 - Area-related, B-55
 - Timing-related, B-50
- Normal
 - display mode, 3-67
 - trigger mode, 3-41
- NRZ measurements-amplitude, B-37
- NRZ measurements-area, B-55
- NRZ measurements-timing, B-50

O

- Offset, vertical, 3-14
- OMA, optical modulation amplitude, Glossary-7
- On/Standby button, 1-14, 1-16
- Online, documentation, 2-1
- Online Help, 2-1, 2-2
 - accessing, 3-167
 - how to use, 3-168
 - types available, 3-167
- Online help
 - displaying control descriptions, 3-168
 - displaying overviews, 3-169
 - for Windows 98, 3-174
 - full-text search, 3-173
 - keys to using, 3-167
 - set up procedures, 3-172
 - using the finder, 3-171
 - why use, 3-167
- Operating system, reinstall, 1-19
- Operation limitations
 - automatic measurements, 3-76
 - math waveforms, 3-102, 3-107
- Operational limitations
 - Histograms, 3-155
 - Mask testing, 3-142
 - preview mode, 3-55
 - save and recall of setups, 3-114
 - save and recall of waveforms, 3-120
 - vertical offset, 3-5
 - waveform databases, 3-159
- Optical modules
 - incoming inspection, 1-29
 - installation, 1-10
- Optical sampling modules, specifications, where to find, A-1
- Optional accessories list, 1-46
- Options, list, 1-45

P

- Package, shipping, contents of, 1-7
- Page setup, ink-saver, 3-134
- Peripherals, connection of, 1-13
- Persistence, waveform database, 3-159
- Persistence
 - infinite, 3-67
 - variable, 3-67
- Phone number, Tektronix, xiii
- Pixel, Glossary-7
- PNG file format, 3-136
- Pop up menu, Glossary-7
- Position
 - considerations for setting, 3-6
 - horizontal, 3-7
 - vertical, 3-6
- Power, applying & removing, 1-14, 1-16
- Preview mode, 3-55
 - usage limitations, 3-55
- Printing
 - to a file, 3-136
 - waveforms, 3-132
- Probe, used on Trigger Direct input, 3-44
- Probe-channel deskew, Glossary-2
- Probes, Definition, Glossary-7
- Procedure
 - back up user files, 1-17
 - Check the Package Contents, 1-7
 - create emergency startup disk, 1-17
 - diagnostics, 1-22
 - first-time power on, 1-14
 - functional tests, 1-25
 - hardware tests, 1-42
 - incoming inspection, 1-21
 - operating system reinstall, 1-19
 - operating system tests, 1-42
 - running QAPlus/Win, 1-43
 - To Autoreset, 3-11
 - To Clear References, 3-127
 - To Compensate the Instrument and Modules, 3-92
 - To Create a New Mask, 3-152
 - To customize the database display, 3-164
 - To Customize the Graticule & Waveforms, 3-69
 - To Define a Math Waveform, 3-105
 - To Deskew Channels, 3-96
 - To Display Waveform in a MagView, 3-64
 - To Display Waveform in the Main View, 3-62
 - To Edit a Mask, 3-149
 - To gated trigger, 3-50

To Localize a Measurement, 3-83
 To Mask Test a Waveform, 3-145
 To Perform Dark-Level and User Wavelength Gain
 Compensations, 3-98
 To Recall Your Setup, 3-118
 To Recall Your Waveform, 3-124
 To Reset the Instrument, 3-13
 To Save Your Setup, 3-115
 To Save Your Waveform, 3-121
 To Set Acquisition Modes, 3-24
 To Set Display Styles, 3-68
 To Set the Cursor Sources, 3-90
 To set up a waveform database, 3-162
 To Acquire in FrameScan mode, 3-33
 To Catch a Bit Error, 3-36
 To Set Up the Signal Input, 3-8
 To Start & Stop Acquisition, 3-26
 To Take a Histogram, 3-156
 To Take Automatic Measurements, 3-80, 3-89
 To trigger, 3-48
 To Use an Exported Waveform, 3-129
 To Use Math Waveforms, 3-109
 To use online help, 3-168
 Windows 98 reinstall, 1-19
 Procedures, in the online help, 3-172
 Product
 accessories list, 1-45
 description, 1-1
 functional model, 2-4
 installation, 1-9
 options list, 1-45
 software, 1-3
 Product support, contact information, xiii
 Programmer guide, 2-2
 Propagation delay, deskew, 3-96
 Pulse automatic measurements, Area-related, B-14
 Pulse measurements-amplitude, B-2
 Pulse measurements-area, B-14
 Pulse measurements-timing, B-8

Q

QAPLus/Win application, 1-42
 Quantizing, Glossary-8

R

Range, vertical input, 3-14
 Readout display, 2-7
 Readouts, 2-7
 Readouts bar, 2-7
 Real time sampling, Glossary-8

Recalling a setup, 3-113
 Recalling a waveform, 3-120
 Record
 acquisition, shared by all channels, 3-20
 length, defined, 3-28
 Record length, Glossary-8
 Reference levels, methods for setting, 3-79
 Reference memory, Glossary-8
 Reference waveforms, Glossary-8
 how to clear, 3-127
 Related Manuals, xii
 Release notes, software, 1-18
 Remote communication, 3-139
 Reset
 How to execute, 3-13
 of instrument, 3-13
 Return to Zero, Definition, Glossary-8
 Return-to-Zero (RZ) automatic measurements, B-36
 Amplitude-related, B-15
 Area-related, B-36
 Timing-related, B-29
 RZ measurements-amplitude, B-15
 RZ measurements-area, B-36
 RZ measurements-timing, B-29

S

Sample acquisition mode, Glossary-8
 Sample interval, Glossary-8
 defined, 3-28
 Sampling, Glossary-8
 modes, 3-28-3-30
 process, defined, 3-27-3-29
 process, illustrated, 3-28-3-29
 sequential equivalent-time, Glossary-9
 Sampling modules
 caution-avoid damage, 3-6
 installation, 1-10
 installation compartments, 1-11
 external attenuators with, 3-6
 preventing overvoltage, 3-6
 keys to using, 3-5
 selection, 3-5
 signal connection, 3-5
 specifications, where to find, A-1
 static concerns, 1-10
 supported, 1-4
 where to insert user manuals, C-1
 Save and recall of setups
 adding a comment, 3-117
 usage limitations, 3-114

- Save and recall of waveforms
 - adding a comment, 3-123
 - usage limitations, 3-120
 - Save Mode, if Windows starts in, 1-20
 - Saved waveform, saved, Glossary-9
 - Saving a setup, 3-113
 - Saving a waveform, 3-120
 - Saving and recalling setups
 - including comments, 3-114
 - virtual keyboard with, 3-114
 - why use, 3-113
 - Saving and recalling waveforms
 - including comments, 3-120
 - virtual keyboard with, 3-120
 - why use, 3-120
 - Saving images, PNG format, 3-136
 - Scale, considerations for setting, 3-6
 - Screen printouts, change display, 3-137
 - SELECT** button, Glossary-8
 - Selected cursor, Glossary-1
 - Selected waveform, Glossary-8
 - defined, 3-7
 - Service support, contact information, xiii
 - Setup
 - recalling, 3-113
 - saving, 3-113
 - Setups
 - how to recall, 3-118
 - how to save, 3-115
 - including comments with, 3-114
 - purpose of saving/recalling, 3-113
 - virtual keyboard with, 3-114
 - Shipping package, contents of, 1-7
 - Signal, connection and scaling overview, 3-4
 - Signal conditioning, background, 3-13
 - Sin(x)/x interpolation, 3-67, Glossary-6
 - Slope, Glossary-9
 - trigger, 3-40
 - Software
 - description, 1-18
 - diagnostic (QAPLus/Win), 1-42, 1-43
 - emergency startup disk, 1-17
 - installation, 1-18
 - release notes, 1-18
 - System Rebuild CD, 1-3
 - User Interface application, 1-3
 - Windows 98, 1-3
 - SONET/SDH, standards supported, 3-142
 - Sources, trigger, 3-42
 - Specifications
 - conditions for meeting, A-1
 - cooling, A-7
 - data storage, A-9
 - display, A-7
 - environmental, A-6
 - for instrument, A-1
 - for sampling modules, where to find, A-1
 - mechanical, A-10
 - ports, A-8
 - power consumption, A-7
 - signal acquisition, A-1
 - time base, A-2
 - trigger, A-3
 - specifications, A-1
 - Standard, masks supported, 3-142
 - Standard accessories, 1-45
 - Statistics, for histograms, 3-158
 - Status bar, 2-7
 - System, diagnostics, 1-20
 - System Rebuild CD, 1-3
- ## T
- TDS8000, description, 1-1
 - Technical support, contact information, xiii
 - Tektronix
 - contacting, xiii
 - toll-free number, xiii
 - Temperature compensation, 3-92-3-100
 - Test equipment, for incoming inspection, 1-21
 - Testing Waveforms, masks, histograms, and waveform databases, 3-141
 - Time base, Glossary-9
 - view, Glossary-10
 - Tool bar, 2-7
 - Touch screen, inoperable in Windows Safe mode, 1-20
 - Touchscreen, operations equivalent with mouse, 3-60
 - Tracking Methods (automatic measurement), B-68
 - Trigger, Glossary-9
 - clock recovery source, 3-42
 - DIRECT** connector, 3-42, 3-44
 - Edge, Glossary-4
 - inputs, 3-42
 - Level, Glossary-9
 - level, 3-40
 - modes, 3-41
 - PRESCALE** connector, 3-42, 3-44
 - probe used to connect, 3-44
 - slope, 3-40
 - sources, 3-42
 - vs. untriggered displays (illustrated), 3-41
 - Trigger inputs, usage limitations, 3-44
 - Trigger **MAIN LEVEL** knob, 3-40
 - Trigger point, defined, 3-28
 - Trigger source, usage limitations, 3-44

Triggering, 3-39, 3-104-3-112
 based on application, 3-43
 edge, 3-40-3-52
 high frequency, 3-45
 holdoff, 3-45
 how to set, 3-48
 keys to using, 3-40
 metastability reject, 3-45
 overview (of process), 3-40
 overview of, 3-39
 purpose, 3-39
 why use, 3-39

U

Update, software, 1-3
 Upgrade, firmware, 1-4
 URL, Tektronix, xiii
 Usable holdoff, 3-46
 User Interface
 Controls bar, 2-7
 map, 2-7
 Measurements bar, 2-7
 Menu bar, 2-7
 Readouts bar, 2-7
 readouts display, 2-7
 Status bar, 2-7
 Tool bar, 2-7
 Waveform bar, 2-7
 User Interface application, software, 1-3
 User manual
 main, 2-2
 sampling modules, 2-2
 User Wavelength compensation, how to perform, 3-98

V

Variable Persistence, display mode, 3-67
 Vectors, 3-67
Vectors, Display menu, 3-67
 Verification, incoming inspection procedure, 1-21
 Vertical
 Bar cursors, Glossary-9
 position, 3-6
 range (acquisition window), Glossary-9
 scaling, 3-4
 set up procedure, 3-8
 signal connection, 3-4
 Vertical acquisition window, Glossary-9
 control set up, 3-9
 overview, 3-14

Vertical deskew, Glossary-2
 Vertical offset
 discussion of, 3-14
 illustrated, 3-15
 usage limitations, 3-5
 Vertical position, illustrated, 3-15
 Vertical range, what determines, 3-14
 Vertical scale and offset, why use, 3-4
 Vertical set up, purpose, 3-4
 View
 graticule, 3-57
 Main & Mag, 2-10
 operations on selected, 3-57
 that magnify, 3-59
 time base, Glossary-10
 using multiple, 3-57
 Views, multiple, 3-55
 Virtual keyboard, Glossary-10
 dialog box, 3-114, 3-120
 Virtual keypad, Glossary-10

W

Waveform
 Acquiring of, 3-3
 channel, Glossary-3
 cursors, Glossary-10
 database, Glossary-10
 databases, using, 3-159
 defined, Glossary-10
 display, 2-7
 overview of, 3-53
 displayed fit to screen, 3-58
 displaying, 3-53
 exporting, 3-128
 how to display in a Mag View, 3-64
 how to display in Main View, 3-62
 how to recall, 3-124
 how to save, 3-121
 how to use an exported, 3-129
 printing, 3-132
 purpose of databases, 3-159
 recalling, 3-120
 saved, Glossary-9
 saving, 3-120
 selected, 3-7, Glossary-8
 Waveform display
 elements of, 3-54
 customizing, 3-66
 why use, 3-66
 Waveform bar, 2-7

Waveform databases

- behavior with automatic measurements, 3-76
- dimensions of, 3-160
- BIN7, 3-161
- BIN8, 3-161
- color, 3-160
- display, 3-160
- display options, 3-160
- EMPH7, 3-161
- EMPH8, 3-161
- emphasize counts, 3-161
- intensity, 3-160
- invert, 3-160
- persistence, 3-161
- special features, 3-159
- To customize display of, 3-164
- to set up, 3-162
- four database limit, 3-159
- usage limitations, 3-159
- vs. vector view (figure), 3-163
- why use, 3-159
- with intensity display (figure), 3-165

Waveform Display

- defining waveforms for, 3-56
- keys to using, 3-56

Waveform record, 3-28

- definition applied to all channels, 3-20
- illustrated, 3-29

Waveforms

- control operation vs. selected, 3-57
- creating math, 3-101
- defining and displaying, 3-56

histograms on, 3-154

including comments with, 3-120

live, Glossary-6

mask testing, 3-141

math, Glossary-6

 why use, 3-102

measuring, 3-73

operations on all views, 3-58

operations on selected, 3-56

purpose of mask testing, 3-141

purpose of saving/recalling, 3-120

purpose of taking histograms of, 3-154

Reference, Glossary-8

testing and statistical tools, 3-141

virtual keyboard with, 3-120

Web site address, Tektronix, xiii

WfmDB, Glossary-10

Window

horizontal acquisition, Glossary-5

vertical acquisition, Glossary-9

Windows, Safe mode, 1-20

Windows 98, 1-3, Glossary-10

reinstall, 1-19

Y

YT format, Glossary-10

Z

Zoom, fast access to, 3-55