



Replace Statutory Plate

Classification Campaign Bulletin **Section/Group** 19 - Labels **Country/Region** EMEA

Year 2019 **Model** Model 3 **Version** LHD

Bulletin Classification: *This campaign bulletin addresses a known non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to all vehicles in the affected VIN range listed. These instructions assume knowledge of motor vehicle and high voltage electrical component repairs, and should only be executed by trained professionals. Tesla assumes no liability for injury or property damage due to a failure to properly follow these instructions or repairs attempted by unqualified individuals.*

This Service Bulletin supersedes SB-19-19-003, dated 5-Apr-19. Each content change is marked by a vertical line in the left margin. Discard the previous version and replace it with this one.

Condition

Certain Model 3 vehicles were manufactured with incorrect information on the statutory plate near the base of the driver side B-pillar.

Correction

Replace the current statutory plate with a statutory plate containing the correct information.

Correction Description	Correction	Time
SB-19-19-003 Not Applicable	S011919003	0.00
Replace Statutory Plate	S021919003	0.10

Required Part(s):	Part Number	Description	Quantity
	1462927-00-C	LBL,BLANK MFG CERTIFICATION	1
Shop supplies:			
Alcohol wipes			

Procedure

1. Order the new statutory plate, noting the customer's VIN in the Part Request "VIN" field.
2. Upon receipt of the new statutory plate, check that the VIN on the statutory plate matches the VIN on the vehicle's dashboard VIN plate.
3. Open the driver's side door.
4. Starting from one corner, carefully peel the statutory plate off the B-Pillar. Discard the statutory plate (Figure 1).

⚠ CAUTION: Take care not to damage the body paint.



Figure 1

5. Use an alcohol wipe to remove any remaining adhesive or statutory plate shreds. Allow the alcohol to completely dry before continuing.
6. Install the updated statutory plate in the same location.

NOTE: Position the statutory plate so that it is readable when standing outside of the vehicle (Figure 2).

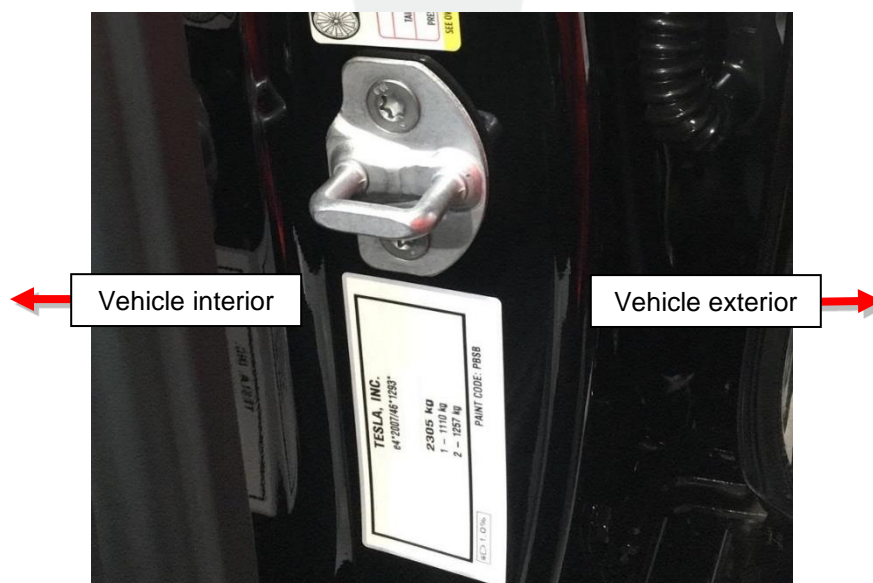


Figure 2

Affected VIN(s) Affected Model 3 vehicles in EMEA built between approximately January 3, 2019 and February 9, 2019.

NOTE: This is a simplified summary of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.

For feedback on the accuracy of this document, email ServiceBulletinFeedback@tesla.com.

