SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-D2070X/D3070X

No. 252

Subject: Wrong Part Number - Q702/705/752/755

Date: March 13, 1992

Symptom:
(**) The part numbers of Q702, Q752, Q705 and Q755 are incorrect in the Service Manual.

Solution: Correct your Service Manual as follows:

REFERENCE NUMBER	DESCRIPTION		PART NUMBER	
	INCORRECT	CORRECT	INCORRECT	CORRECT
Q702	2SC2922	2SD2012	8-729-320-82	8-729-209-15
Q705	2SD2012	2SC2922	8-729-209-15	8-729-320-82
Q752	2SC2922	2SD2012	8-729-320-82	8-729-209-15
Q755	2SD2012	2SC2922	8-729-209-15	8-729-320-82

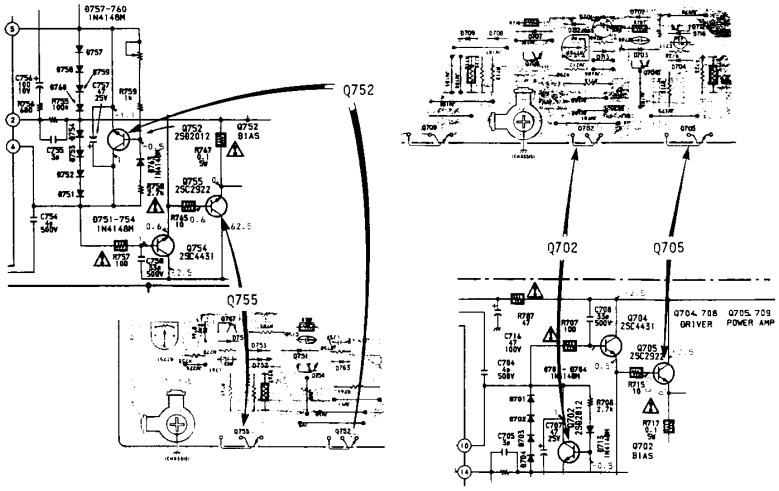

Receiver
CSA-13

Reference: FPR NO396

PRINTED IN U.S.A.
CSA-13292-7