11/24

11/24 OPTIONS DIAG
CJKDFB0

AH-F604B-MC
FICHE 01 OF 01

APR 1985
digital
Made In USA

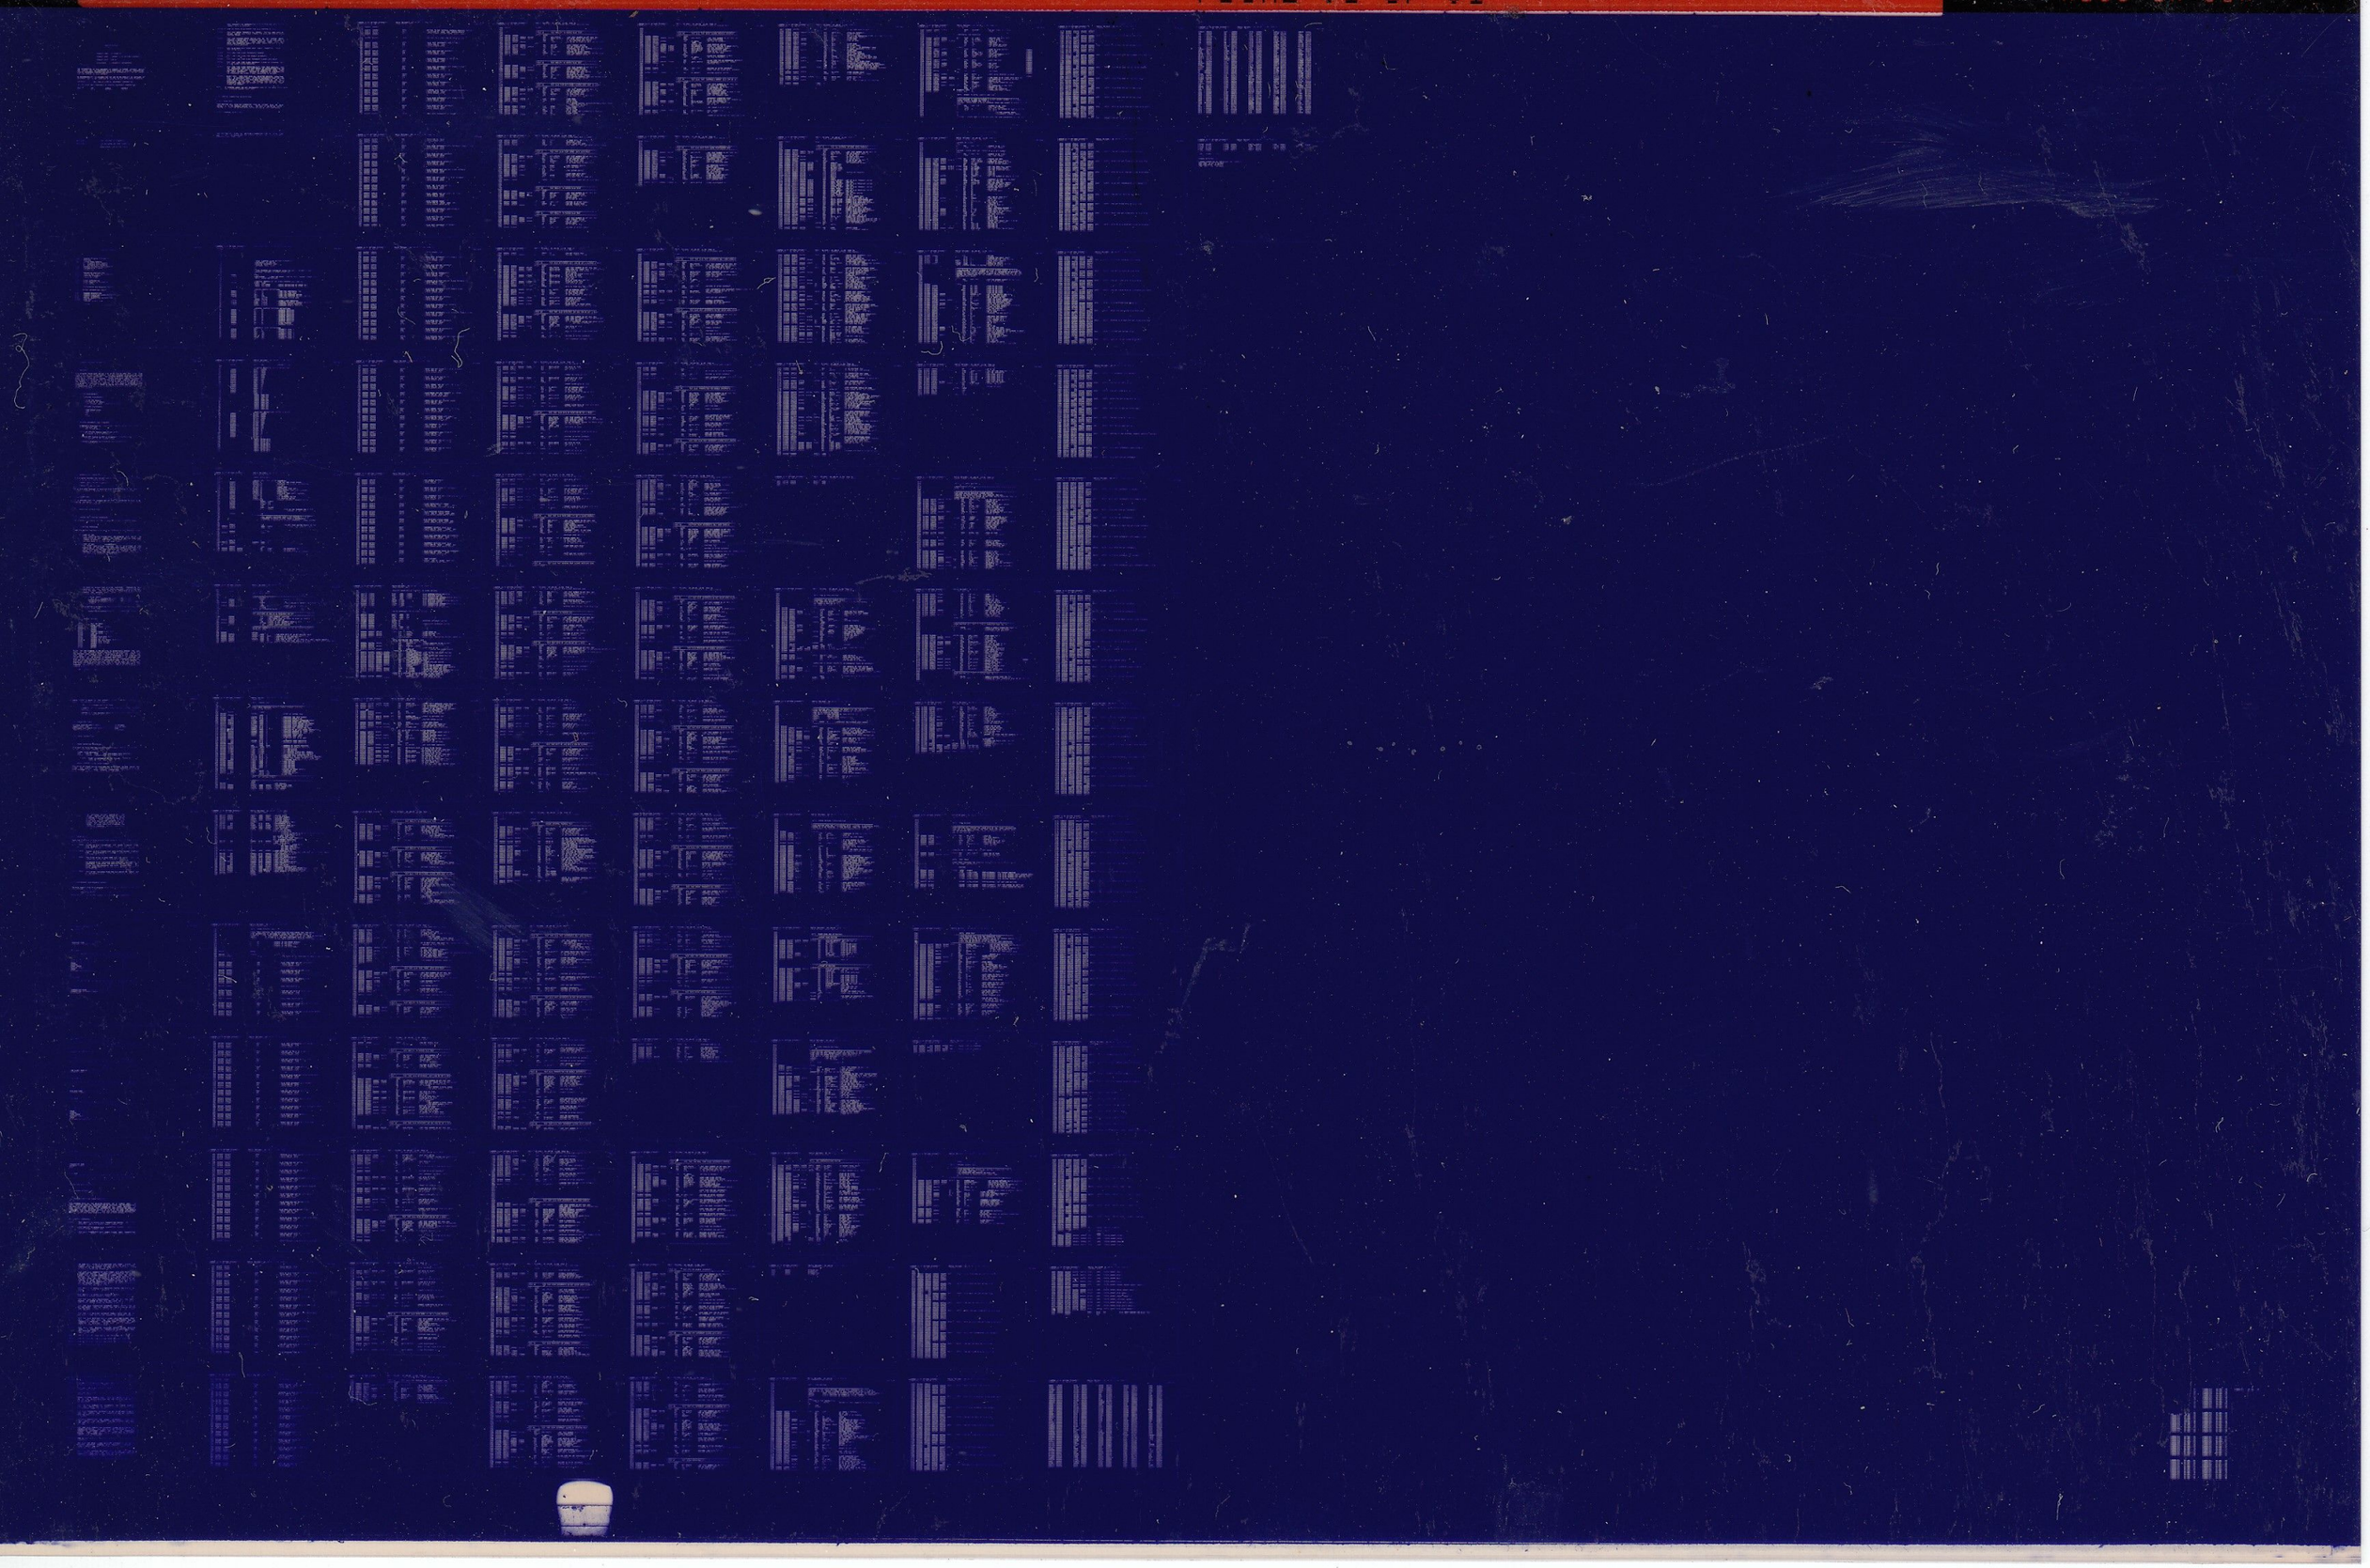

IDENTIFICATION

PRODUCT CODE: AC-F6028 MC

PRODUCT NAME: C.MKDFB0 11/24 OPTIONS DIAGNOSTIC

PRODUCT DATE: DEC 84

MAINTAINER: DIAGNOSTIC ENGINEERING

HISTORY

	FIRST RELEASE OF DIAGNOSTIC
	THIS REVISION WAS MADE SINCE THE WRONG BINARY WAS IN THE FIELD

TABLE OF CONTENTS

1.0 GENERAL PROGRAM INFORMATION

1.1 ABSTRACT

Th s program tests both serial line units (SLU's) and the line t me clock (L TC) on the M7133 module. Its main purpose is to provide scope loop ng for repair personnel. The program detects from 85 95% of all stuck-at 0, stuck-at-1 faults. Error type-outs identify a function be ng done or a function that failed and to what logical portion of the board it failed on (i.e., tried to set bit 6 on CSR of SLU1). This program is basically a rewrite of the DL11-W diagnostic and therefore is written in MACRO-11 using the SYSMAC macro package. It s compatible with all existing manufacturing and field service auto mated test systems.

1.2 SYSTEM REQUIREMENTS

A. HARDWARE REQUIREMENTS

11/24 CPU Module
Minimum 8K of memory
- Turn around jumper installed on SLU2

B. SOFTWARE ENVIRONMENTS

XXDP Stand-alone
XXDP Chain Mode
APT
ACT
SLIDE

1.3 RELATED DOCUMENTS AND STANDARDS

D agnostic Engineering Functional Specification for 11/24 on Board Options Test
BGI 79-004-00 U

KDF11 UA (M7133) Module Specification Rev. 0.
25-August-78 Bill Bernstein

Standard APT System to PDP-11 Diagnostic Interface Rev. 15
16-February-76 APT System Group

D agnostic Engineering Standards and Conventions
175-003 009 02

: 4 PREREQUISITE DIAGNOSTICS

This program assumes the correct operation of the CPU instruction set. This is to be verified by either:

CJKDBXX DCF11-AA CPU Diagnostic
or
CJKDEXX F11 Quick Test

If an end pass message is received from CJKDEXX there is no need to run this diagnostic because all devices have been fully tested.

1.5 ASSUMPTIONS

It is assumed that the console device that is connected to SLU1 is operating correctly. If the terminal is not operating correctly false indications can be expected.

2.0 OPERATING INSTRUCTIONS

2.1 LOADING AND STARTING PROCEDURES

Use standard procedure for PDP-11 absolute binary formatted tapes.

2.1.1 STARTING PROCEDURE

Load the switch register with setting (Software Switch Register Location = 176)

A START AT 200.
After checking the transmitter, the program will print its identification and report the number of devices under test (number is octal). "END PASS" is printed after a full pass has been made on all devices under test.

B START AT 204. ****NOTE****
The "ECHO" test will be executed. An "*" is printed at the beginning of the test. The echo test reads a character from the terminal, writes that character to the terminal, and reports any error flags set in the receiver buffer. A CONTROL-C (^C) halts the test and prints "STOP" at the terminal continuing restarts the ECHO test.

C. START AT 210. ****NOTE****

The terminal output test will be executed. Depressing any character at the terminal halts the test. Continuing restarts the test. The test outputs 32 characters on a line and repeats the pattern every three lines. The pattern is as follows (OCTAL code 040 > 377):

```
 (OCTAL CODE)
!" #$'()*+,-./0123456789:;<=>?   (040   > 077
@ABCDEFGHIJKLMNOPQRSTUVWXYZ[ ]   (100  -> 137)
'abcdefghijklmnopqrstuvwxyz      (140 --> 177) [LOWER CASE
 ALPHA]
```

This bottom line could be the following if the terminal does not have lower case:

```
@ABCDEFGHIJKLMNOPQRSTUVWXYZ[     [UPPER CASE ALPHA]
```

2.2 PROGRAM OPTIONS

```
BIT15       HALT ON ERROR
BIT14       SCOPE LOOP
BIT13     - INHIBIT ERROR TYPEOUT
BIT12     - UNUSED
BIT11     - UNUSED
BIT10     - INHIBIT ERROR FLAGS TEST
BIT09     - LOOP ON ERROR
BIT08       UNUSED
BIT07     - DISABLE SLU2 DATA TEST
BIT06       INHIBIT LTC TESTS
BIT05       INHIBIT ALL SLU TESTS (BOTH SLUS)
BIT04     - INHIBIT SLU1 TESTING
BIT03     - INHIBIT SLU2 TESTING
BIT02     - UNUSED
BIT01     - UNUSED
BIT00     - UNUSED
```

Built into the program is the ability to dynamically change the contents of the software switch register during execution. To do this the operator must type a "CNTL G" (typing a "G" with the "CTRL" key held down at the same time). This is processed at key times during the program (i.e. on errors, in between each test). A problem can occur since the program may be testing the SLU connected to the console device and have the SLU in maintenance mode. If this happens it should not cause an error but the "CNTL G" may be lost, so if the program does not respond to the first "CNTL G" type a few more until the response is received. When the "CNTL G" is received the program will respond with:

```
SWR = XXXXXX     NEW =
```

where XXXXXX is equal to the present switch register contents in octal. The operator can then type;

1. <CR> if no changes are to be made.
2. 6 DIGITS <CR> to represent in octal the new switch register setting.
3. CONTROL-U if the operator makes an error while inputting the new switch register setting.

2.3 EXECUTION TIMES

1ST PASS RUNTIME(WORST CASE).....15 SECONDS
LONGEST TEST TIME.....12.5 SECONDS
ADDITIONAL RUN TIME(EXTRA UNITS).....NONE
LONGEST PASS TIME.....15 SECONDS

3.0 ERROR INFORMATION

3.1 ERROR REPORTING PROCEDURES

If a routine fails and the inhibit error typeout (BIT13) of the SWR is not set, a printout results in the form:

"(SOME ASCII MESSAGE)"
TEST ERR PC RCSR [ANY APPLICABLE DATA HEADINGS]
XXXXXX XXXXXX XXXXXX [ANY APPLICABLE DATA]

NOTE: "RCSR" IS DEPENDENT ON THE FAILURE THEREFORE COULD BE TCSR, RBUF, TBUR, OR LKS

where "XXXXXX" is an octal number.

This error printout occurs provided the error that exists would not hinder the typeout. In cases where it is not possible to print an error message (i.e. fatal console transmitter failures), a halt occurs (See section 3.2 for error halt information.)

NOTE

for software switch operation, the switch register can be hanged by typing a CONTROL G at the console during error pr tnouts. After continuing from the error halt the old SWR contents is displayed and the new contents can be entered. If error halts are disabled, the CONTROL-G response occurs immediately following the typeout.

3.2 ERROR HALTS

There are 5 errors in this program that cause a halt. These errors are n tests 1, 2, 3, and 7.

TEST 1 ERROR Access to SLU1 transmitter CSR cause time-out trap. This problem will probably cause an inability of tne MICRO-ODT to run.

TEST 2 ERROR - Access to SLU1 transmitter data buffer caused time out trap. This problem will probably cause an inability of the MICRO-ODT to run.

TEST 3 ERROR - The first error is that DONE did not clear when the transmitter buffer was filled as it should.

The second error indicates that DONE did not reset in a reasonable time after the data buffer was filled, indicating that the character was never transmitted. This could cause MICRO-ODT to not run or garbled output from the MICRO-ODT.

TEST 7 ERROR This error indicates that the SLU cannot be taken out of maintenance mode. MICRO-ODT should be uneffected by this error.

4.0 PERFORMANCE AND PROGRESS REPORTS

The only report from this program other than error reports is the end pass message. It is in the form:

END PASS @XXXXX

Where XXXXX is the decimal number of end of passes completed.

5.0 DEVICE INFORMATION TABLES

SLU1 RCSR

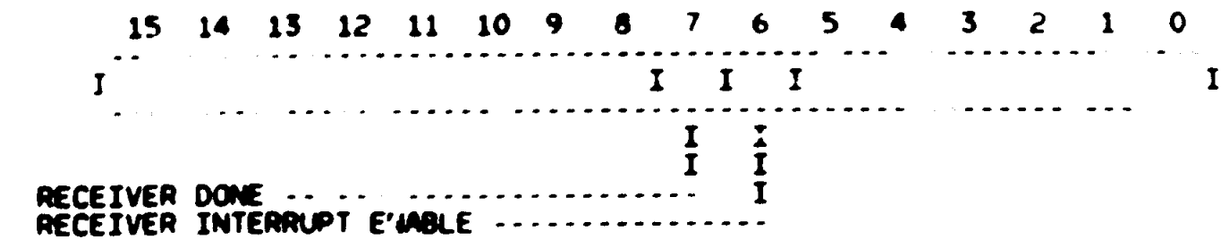

SLU1 RBUF

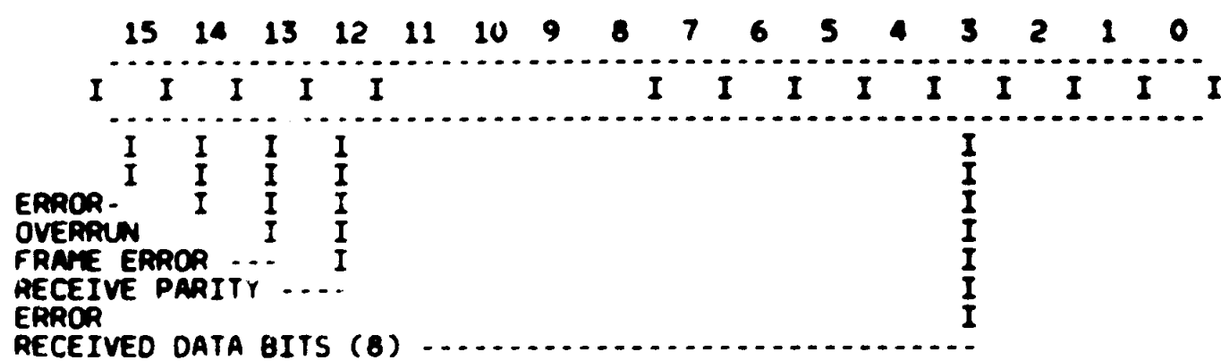

SLU1 XCSR

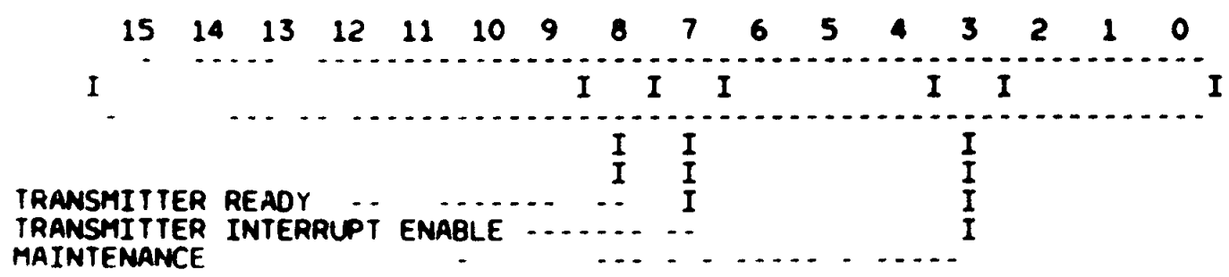

SLU1 XBUF

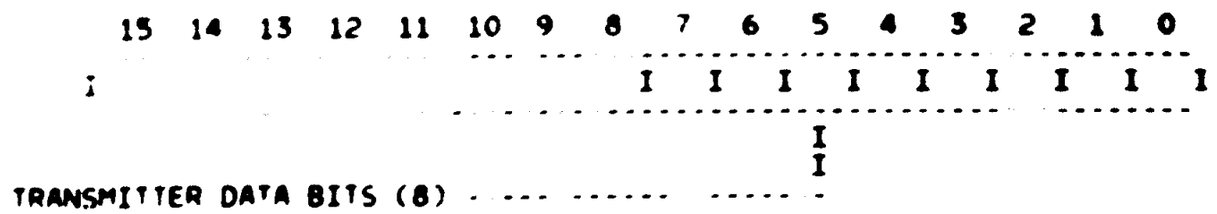

LTC CSR

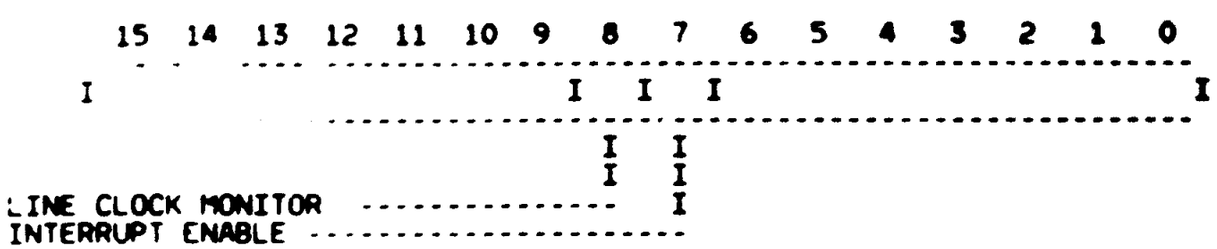

SLU2 RCSR

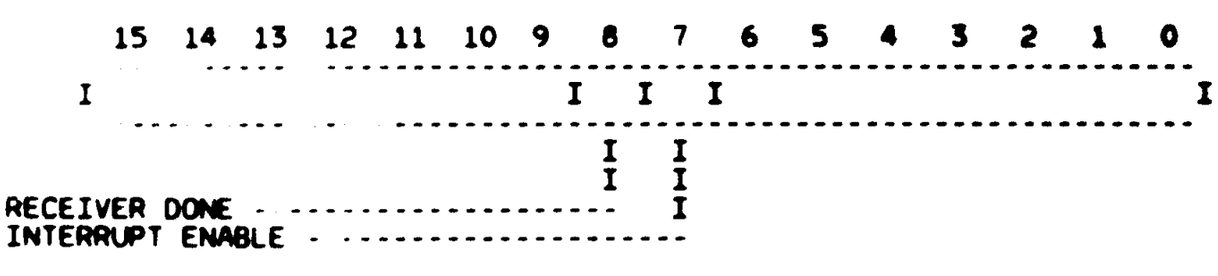

SLU2 RBUF

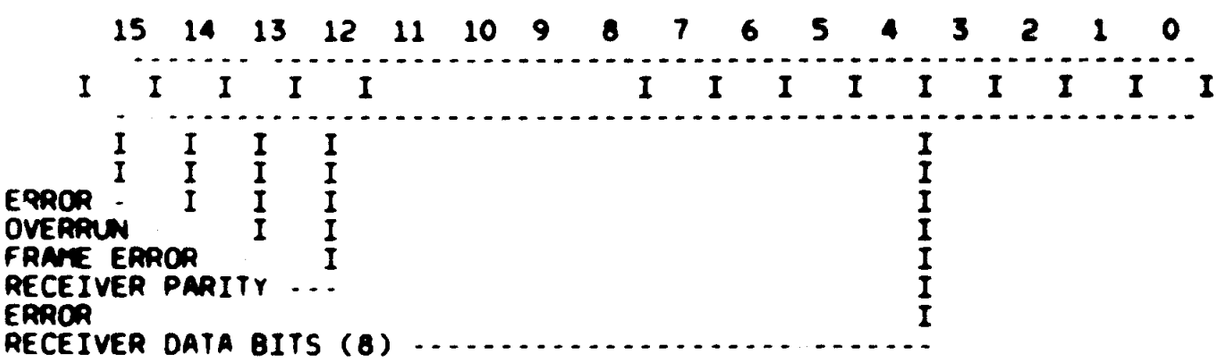

SLU2 XCSR

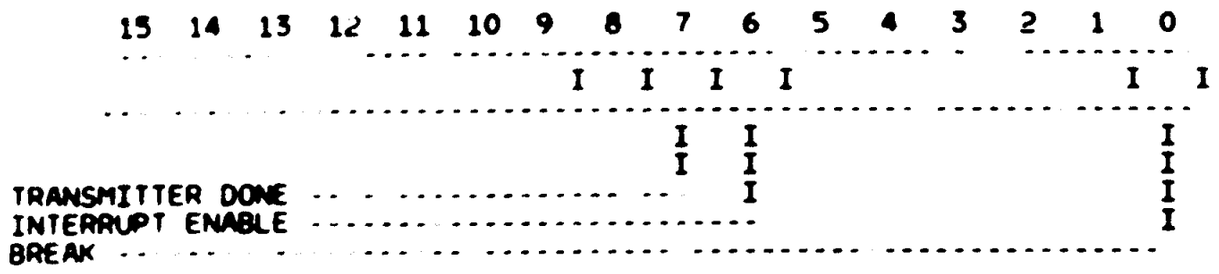

SLU2 XBUF

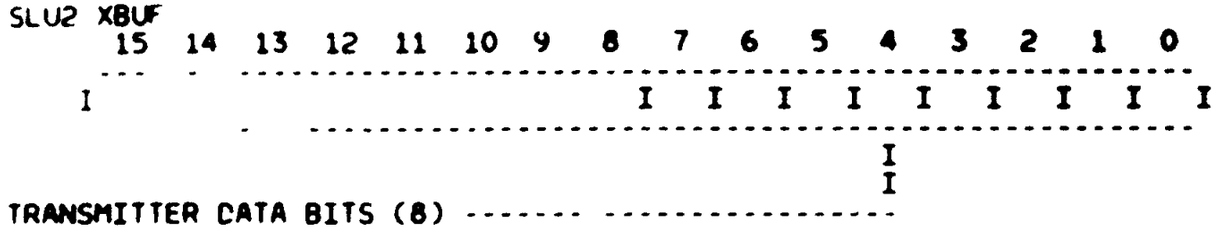

6.0 PROGRAM DESCRIPTION

6.1 PROGRAM EXECUTION CHARACTERISTICS

THIS PROGRAM TESTS ALL THE SELECTED DEVICES AS A SINGLE UNIT. IT FIRST VERIFIES THAT ALL REGISTERS CAN BE ACCESSED, THE WRITEABLE BITS ARE ABLE TO BE WRITTEN TO AND ARE UNIQUE ON ALL THREE DEVICES. IT THEN CHECKS EACH DEVICE FOR INTERRUPTS AND FOR DATA RELIABILITY. FINALLY IT SETS ALL SELECTED DEVICES UP TO GO AT THE SAME TIME ENABLES INTERRUPTS AND STARTS THEM OFF. THIS TEST CHECKS SYSTEM INTERACTION. WHEN ALL TESTS HAVE BEEN COMPLETED THE END OF PASS MESSAGE IS TYPED.

6.2 SUBTEST SUMMARIES

TEST1 TEST ABILITY TO ACCESS SLU1 TRANSMITTER CONTROL AND STATUS REGISTER. HALTS IF ACCESS CAUSES TIMEOUT TRAP.

TEST2 TEST ABILITY TO ACCESS SLU1 TRANSMITTER BUFFER. HALTS IF ACCESS CAUSES TIMEOUT TRAP.

TEST3 TEST SLU1 TRANSMITTER BIT7 (DONE) CLEARS WHEN TRANSMITTER BUFFER IS LOADED. THE BUFFER IS LOADED WHICH SHOULD CLEAR

THE DONE BIT. AFTER IT IS VERIFIED THAT "DONE" CLEARS THE PROGRAM WAITS TO RECEIVE DONE BACK AFTER THE DATA IS TRANSFERRED OUT OF THE BUFFER. IF DONE DOES NOT INITIALLY CLEAR OR FAILS TO RESET THE PROGRAM HALTS.

TEST4 TEST THAT SLU1 TRANSMITTER BIT7 (DONE) SETS WITH RESET. THE TRANSMITTER BUFFER IS LOADED WITH A CHARACTER, AS SOON AS "DONE" SETS A SECOND CHARACTER IS LOADED INTO THE BUFFER. BECAUSE THE FIRST CHARACTER IS STILL BEING SHIFTED OUT OF THE UART "DONE" WILL NOT NORMALLY SET FOR AT LEAST 1 MS (DEPENDING ON BAUD RATE). THE PROGRAM ISSUES A RESET BEFORE THE TIME IS UP AND IMMEDIATELY CHECKS FOR "DONE", IF IT IS SET THE PROGRAM ASSUMES IT WAS SET BY THE RESET INSTRUCTION. THIS ERROR DOES NOT CAUSE A HALT.

TEST5 TEST ABILITY TO ACCESS SLU1 RECEIVER CONTROL AND STATUS REGISTER. AN ERROR IS REPORTED IF ACCESS CAUSES A TIMEOUT TRAP.

TEST6 TEST ABILITY TO ACCESS SLU1 RECEIVER BUFFER. AN ERROR IS REPORTED IF ACCESS CAUSES A TIMEOUT TRAP.

TEST7 TEST THAT SLU1 BIT2 (MAINTENANCE) CAN BE SET AND RESET. BECAUSE AN ERROR ON THIS TEST MAY LEAVE THE SLU IN AN UNKNOWN STATE, ERRORS CAUSE THE PROGRAM TO HALT.

TEST10 TEST THAT SLU1 TRANSMITTER INTERRUPT ENABLE (BIT6) CAN BE SET AND RESET. THIS TEST CHECKS THAT THE BIT CAN BE WRITTEN INTO AND READ, CLEARED BY WRITING A ZERO TO IT AND CLEARED BY A "RESET".

TEST11 TEST THAT SLU1 RECEIVER INTERRUPT ENABLE (BIT6) CAN BE SET AND RESET. SAME TEST AS FOR TRANSMITTER INTERRUPT ENABLE.

TEST12 TEST THAT SLU1 RECEIVER TEST 7 (DONE) SETS AND CLEARS PROPERLY. THIS TEST PUTS THE SLU INTO MAINTENANCE MODE AND TRANSMITS A CHARACTER. RECEIVER "DONE" SHOULD SET WHEN CHARACTER IS RECEIVED. AFTER "DONE" SETS THE PROGRAM ATTEMPTS TO CLEAR IT WITH A "RESET".

TEST13 TEST SLU1 THAT READING RECEIVER BUFFER CLEAR RECEIVER "DONE". A CHARACTER IS TRANSMITTED IN MAINTENANCE MODE, WHEN RECEIVER "DONE" SETS THE RECEIVER BUFFER IS READ WHICH SHOULD CLEAR DONE.

TEST14 SAME AS TEST1 BUT DONE ONSLU2 AND ERROR DOES NOT CAUSE HALT.

TEST15 SAME AS TEST2 BUT FOR SLU2 AND ERROR DOES NOT CAUSE HALT.

TEST16 SAME AS TEST3 BUT FOR SLU2 AND ERROR DOES NOT CAUSE HALT.

TEST17-21 SAME AS TEST4-6 BUT FOR SLU2.

TEST22 TEST SLU2 BREAK BIT (BIT0) CAN BE SET, CLEARED, AND RESET.

TEST23-26 SAME AS TEST 10 13 BUT FOR SLU2.

TEST27 TEST ABILITY TO ACCESS LINE CLOCK STATUS REGISTER. ERROR REPORTED IF ACCESS CAUSES TIMEOUT TRAP.

TEST30 TEST THAT LINE CLOCK INTERRUPT ENABLE (BIT6) CAN BE SET, CLEARED, AND "RESET".

TEST31 TEST THAT BIT7 (DONE) OF LINE CLOCK STATUS REGISTER SETS AND CAN BE CLEARED.

TEST32 UNIQUE INTERNAL ADDRESS TEST. THIS TEST WRITES A BIT INTO ONE OF THE DEVICE REGISTERS AND THEN VERIFIES THAT BIT IS NOT SET IN ANY OTHER REGISTER. THE TEST IS REPEATED FOR ALL THE REGISTERS.

TEST33 TEST THAT SLU1 TRANSMITTER INTERRUPTS ONLY WHEN ENABLED. THIS TEST CHECKS THAT THE TRANSMITTER ONLY INTERRUPTS WHEN ITS INTERRUPT ENABLE BIT IS SET.

TEST34 TEST SLU1 TRANSMITTER INTERRUPTS DO NOT OCCUR WHEN DISABLED. THIS TEST CHECKS THAT THE TRANSMITTER DOES NOT INTERRUPT WHEN THE PROCESSOR PRIORITY IS 7 OR THE INTERRUPT ENABLE BIT IS CLEARED.

TEST35 TEST SLU1 TRANSMITTER FOR DOUBLE INTERRUPTS. THIS TEST FIRST CHECKS THAT THE TRANSMITTER CAN INTERRUPT THEN MAKES SURE THAT ONLY ONE INTERRUPT IS REQUESTED FOR EACH SETTING OF "DONE".

TEST36 TEST THAT SLU1 TRANSMITTER INTERRUPT CLEARS WITH LOADING OF TRANSMITTER BUFFER. THIS TEST PUTS THE PROCESSOR AT 7, SETS TRANSMITTER INTERRUPT ENABLE AND FILLS THE TRANSMITTER BUFFER. WHEN "DONE" SETS THE SLU SHOULD HAVE AN INTERRUPT PENDING. THE PROGRAM THEN FILLS THE BUFFER AGAIN WHICH SHOULD CLEAR THE INTERRUPT.

TEST37-42 SAME AS TESTS FOR SLU1 RECEIVER INTERRUPTS AS TRANSMITTER INTERRUPTS.

TEST43 TEST SLU1 THAT RESET CLEARS RECEIVER INTERRUPTS. SET UP FOR RECEIVER INTERRUPT PENDING WITH PROCESSOR AT PRIOIRYT 7, ISSUE A "RESET" AND DROP PROCESSOR PRIORITY. THE RECEIVER SHOULD NOT INTERRUPT.

TEST44 TEST SLU1 THAT OVERRUN AND ERROR (BITS 14 AND 15) CAN BE SET. THIS TEST PUTS THE SLU1 IN MAINTENANCE MODE AND TRANSMITS 3 CHARACTERS WITHOUT READING THE RECEIVER BUFFER. THIS SHOULD CAUSE BITS 14 AND 15 TO SET.

TEST45 TEST SLU1 DATA PATH USING MAINTENANCE WRAP AROUND. THIS

TEST TRANSMITS AN INCREMENTING DATA PATTERN AND VERIFIES THE CORRECT DATA IS RECEIVED.

TEST46 57 SAME AS TESTS 33-44 EXCEPT FOR SLU2 INSTEAD OF SLU1

TEST60 TEST THAT BREAK TRANSMITS ALL ZEROES. PUT ALL ONES INTO RE CEIVER BUFFER THEN ISSUE A BREAK THE RECEIVER BUFFER SHOULD CONTAIN ZEROES.

TEST61 TEST THAT FRAMING ERROR (BIT13) CAN BE SET DURING BREAK. TRANSMIT A BREAK AND A CHARACTER JUST TO LET US KNOW WHEN TO LOOK FOR THE ERROR BIT. WHEN RECEIVER "DONE" SETS BOTH BREAK AND CHARACTER SHOULD BE THERE. CHECK FOR BIT 13 IN RE CEIVER STATUS REGISTER.

TEST62 TEST SLU2 DATA PATH USING WRAP CABLE CONNECTOR. SAME AS TEST 45 ON SLU1.

TEST63 TEST LINE TIME CLOCK INTERRUPTS PROPERLY.

TEST64 TEST LINE TIME CLOCK FOR DOUBLE INTERRUPTS.

TEST65 TEST THAT LINE TIME CLOCK INTERRUPT CLEARS WITH RESET.

TEST66 TEST THAT LINE TIME CLOCK INTERRUPT CLEARS BY CLEARING BIT7 OF LINE CLOCK STATUS REGISTER.

TEST67 TEST LINE TIME CLOCK REPEATABLILITY THIS TEST VERIFIES THAT THE PROCESSOR DOES THE SAME AMOUNT OF INSTRUCTIONS FOR TWO INTERRUPTS OF THE LINE CLOCK, THUS INDICATING EQUAL TIMES FOR EACH INTERRUPT. BECAUSE OF PROBLEMS OF SYNCHRONIZING THE PROCESSOR AND CLOCK A SMALL DEVIATION IS ALLOWED.

TEST70 BLAST TEST. THIS TEST RUNS ALL SELECTED DEVICES SIMULTANE-OUSLY IN INTERRUPT MODE. AFTER 60 INTERRUPTS FROM THE LINE CLOCK OR 256 (10) BYTES HAVE BEEN TRANSFERRED BY THE SLU'S EVERYTHING IS SHUT DOWN. THE PROGRAM THEN VERIFIES THAT NO INTERRUPTS WERE LOST ON EITHER SLU AND THAT THE DATA TRANS-FERRED WAS CORRECT.

NOTE IF RUNNING UNDER THE APT ENVIRNOMENT MANY OF THE ABOVE TESTS ARE ONLY EXECUTED DURING FIRST PASS.

6.3 SPECIAL SUBROUTINE DESCRIPTIONS

6.3.1 ECHO TEST

THIS ROUTINE WILL ECHO ANY CHARACTER TYPED ON EITHER SLU1 OR SLU2. DEFAULT IS TO THE CONSOLE DEVICE SLU1. THE TEST IS HALTED BY TYPING A CONTROL-C. TEST CAN BE RESTARTED AFTER HALTING BY JUST CONTINUING.

6.3.2 TERMINAL OUTPUT TEST

C.

THIS ROUTINE WILL OUTPUT ALL WRITEABLE CHARACTERS FOR THE OCTAL CODE
040 - 377. 32 CHARACTERS ARE PRINTED ON EACH LINE. THE PATTERN IS
REPEATED EVERY THREE LINES.

SEQ 0015

7.0 LISTING

```
                                .TITLE  CJKDFB0 11/24 OPTIONS DIAGNOSTIC
                                ;*COPYRIGHT (C) DEC-84
                                ;*DIGITAL EQUIPMENT CORP.
                                ;*MAYNARD, MASS. 01754
                                ;*
                                ;*
                                ;*THIS PROGRAM WAS ASSEMBLED USING THE PDP 11 MAINDEC SYSMAC
                                ;*PACKAGE (MAINDEC 11-DZQAC-C5)DEC-84.
                                ;*
000001                          $TN=1
160000                          $SWR=160000     ;;HALT ON ERROR, LOOP ON TEST, INHIBIT ERROR TYPOUT
                                .SBTTL  BASIC DEFINITIONS

                                ;*INITIAL ADDRESS OF THE STACK POINTER *** 1100 ***
001100                          STACK=  1100
                                .EQUIV  EMT,ERROR       ;;BASIC DEFINITION OF ERROR CALL
                                .EQUIV  IOT,SCOPE       ;;BASIC DEFINITION OF SCOPE CALL

                                ;*MISCELLANEOUS DEFINITIONS
000011                          HT=     11              ;;CODE FOR HORIZONTAL TAB
000012                          LF=     12              ;;CODE FOR LINE FEED
000015                          CR=     15              ;;CODE FOR CARRIAGE RETURN
000200                          CRLF=   200             ;;CODE FOR CARRIAGE RETURN-LINE FEED
177776                          PS=     177776          ;;PROCESSOR STATUS WORD
                                .EQUIV  PS,PSW
177774                          STKLMT= 177774          ;;STACK LIMIT REGISTER
177772                          PIRQ=   177772          ;;PROGRAM INTERRUPT REQUEST REGISTER
177570                          DSWR=   177570          ;;HARDWARE SWITCH REGISTER
177570                          DDISP=  177570          ;;HARDWARE DISPLAY REGISTER

                                ;*GENERAL PURPOSE REGISTER DEFINITIONS
000000                          R0=     %0              ;;GENERAL REGISTER
000001                          R1=     %1              ;;GENERAL REGISTER
000002                          R2=     %2              ;;GENERAL REGISTER
000003                          R3=     %3              ;;GENERAL REGISTER
000004                          R4=     %4              ;;GENERAL REGISTER
000005                          R5=     %5              ;;GENERAL REGISTER
000006                          R6=     %6              ;;GENERAL REGISTER
000007                          R7=     %7              ;;GENERAL REGISTER
000006                          SP=     %6              ;;STACK POINTER
000007                          PC=     %7              ;;PROGRAM COUNTER

                                ;*PRIORITY LEVEL DEFINITIONS
000000                          PR0=    0               ;;PRIORITY LEVEL 0
000040                          PR1=    40              ;;PRIORITY LEVEL 1
000100                          PR2=    100             ;;PRIORITY LEVEL 2
000140                          PR3=    140             ;;PRIORITY LEVEL 3
000200                          PR4=    200             ;;PRIORITY LEVEL 4
000240                          PR5=    240             ;;PRIORITY LEVEL 5
000300                          PR6=    300             ;;PRIORITY LEVEL 6
```

```
                        000340          PR7=    340             ;;PRIORITY LEVEL 7

                                        ;*"SWITCH REGISTER" SWITCH DEFINITIONS
                        100000          SW15=   100000
                        040000          SW14=   40000
                        020000          SW13=   20000
                        010000          SW12=   10000
                        004000          SW11=   4000
                        002000          SW10=   2000
                        001000          SW09=   1000
                        000400          SW08=   400
                        000200          SW07=   200
                        000100          SW06=   100
                        000040          SW05=   40
                        000020          SW04=   20
                        000010          SW03=   10
                        000004          SW02=   4
                        000002          SW01=   2
                        000001          SW00=   1
                                        .EQUIV  SW09,SW9
                                        .EQUIV  SW08,SW8
                                        .EQUIV  SW07,SW7
                                        .EQUIV  SW06,SW6
                                        .EQUIV  SW05,SW5
                                        .EQUIV  SW04,SW4
                                        .EQUIV  SW03,SW3
                                        .EQUIV  SW02,SW2
                                        .EQUIV  SW01,SW1
                                        .EQUIV  SW00,SW0

                                        ;*DATA BIT DEFINITIONS (BIT00 TO BIT15)
                        100000          BIT15=  100000
                        040000          BIT14=  40000
                        020000          BIT13=  20000
                        010000          BIT12=  10000
                        004000          BIT11=  4000
                        002000          BIT10=  2000
                        001000          BIT09=  1000
                        000400          BIT08=  400
                        000200          BIT07=  200
                        000100          BIT06=  100
                        000040          BIT05=  40
                        000020          BIT04=  20
                        000010          BIT03=  10
                        000004          BIT02=  4
                        000002          BIT01=  2
                        000001          BIT00=  1
                                        .EQUIV  BIT09,BIT9
                                        .EQUIV  BIT08,BIT8
                                        .EQUIV  BIT07,BIT7
                                        .EQUIV  BIT06,BIT6
                                        .EQUIV  BIT05,BIT5
                                        .EQUIV  BIT04,BIT4
                                        .EQUIV  BIT03,BIT3
                                        .EQUIV  BIT02,BIT2
                                        .EQUIV  BIT01,BIT1
```

```
                                .EQUIV  BIT00,BIT0

                                ;*BASIC "CPU" TRAP VECTOR ADDRESSES
000004                          ERRVEC= 4               ;;TIME OUT AND OTHER ERRORS
000010                          RESVEC= 10              ;;RESERVED AND ILLEGAL INSTRUCTIONS
000014                          TBITVEC=14              ;;"T" BIT
000014                          TRTVEC= 14              ;;TRACE TRAP
000014                          BPTVEC= 14              ;;BREAKPOINT TRAP (BPT)
000020                          IOTVEC= 20              ;;INPUT/OUTPUT TRAP (IOT) **SCOPE**
000024                          PWRVEC= 24              ;;POWER FAIL
000030                          EMTVEC= 30              ;;EMULATOR TRAP (EMT) **ERROR**
000034                          TRAPVEC=34              ;;"TRAP" TRAP
000060                          TKVEC=  60              ;;TTY KEYBOARD VECTOR
000064                          TPVEC=  64              ;;TTY PRINTER VECTOR
000240                          PIRQVEC=240             ;;PROGRAM INTERRUPT REQUEST VECTOR
176500                                  ABASE=  176500
000300                                  AVECT1= 300
000400                                  AUSWR=  400
000001                                  $TN=    1
161000                                  $SWR=   161000
000003                                  BPT=    000003          ;THIS IS THE COMMAND FOR A TRAP
                                                                ;   THROUGH 14 (BPT TRAP)

000000                                  .=0
                                ;;*****************************************************************
                                        ;*ALL UNUSED LOCATIONS FROM 4-776 CONTAIN A ".+2,BPT"
                                        ;*SEQUENCE TO CATCH ILLEGAL TRAPS & INTERRUPPTS
                                        ;*LOCATION 0 CONTAINS 0 TO CATCH IMPPOPERLY LOADED VECTORS

000014                                  .=14                    ;THE BPT TRAP VECTOR POINTS TO THE
000014  015070                          .WORD   CATCH           ;   ILLEGAL TRAP HANDLER "CATCH"
000016  000340                          .WORD   340

000042                                  .=      42
000042  000000                          .WORD   0


000174                                  .=      174
000174  000000                DISPREG:  .WORD   0
000176  000000                SWREG:    .WORD   0

000200                                  .=200
000200  000137  003036                  JMP     START           ;DO INTERFACE TEST
000204  000137  020106                  JMP     ECHO            ;DO ECHO TEST
000210  000137  020364                  JMP     OUTTST          ;DO OUTPUT TEST TO TERMINAL
```

```
                        .=      500
                .SBTTL  ACT11 HOOKS

                ;;******************************************************************
                ;HOOKS REQUIRED BY ACT11
000500                  $SVPC=.                 ;SAVE PC
000046                  .=46
000046  015022          $ENDAD                  ;;1)SET LOC.46 TO ADDRESS OF $ENDAD IN .$EOP
000052                  .=52
000052  000000          .WORD   0               ;;2)SET LOC.52 TO ZERO
000500                  .=$SVPC                 ;; RESTORE PC
                .SBTTL  APT PARAMETER BLOCK

                ;;******************************************************************
                ;SET LOCATIONS 24 AND 44 AS REQUIRED FOR APT
                ;;******************************************************************
000500                  .$X=.   ;;SAVE CURRENT LOCATION
000024                  .=24    ;;SET POWER FAIL TO POINT TO START OF PROGRAM
000024  000200          200     ;;FOR APT START UP
000044                  .=44    ;;POINT TO APT INDIRECT ADDRESS PNTR.
000044  000500          $APTHDR ;;POINT TO APT HEADER BLOCK
000500                  .=.$X   ;;RESET LOCATION COUNTER
                ;;******************************************************************
                ;SETUP APT PARAMETER BLOCK AS DEFINED IN THE APT-PDP11 DIAGNOSTIC
                ;INTERFACE SPEC.

000500          $APTHD:
000500  000000  $HIBTS: .WORD   0       ;;TWO HIGH BITS OF 18 BIT MAILBOX ADDR.
000502  001100  $MBADR: .WORD   $MAIL    ;;ADDRESS OF APT MAILBOX (BITS 0 15)
000504  000050  $TSTM:  .WORD   50       ;;RUN TIM OF LONGEST TEST
000506  000060  $PASTM: .WORD   60       ;;RUN TIME IN SECS. OF 1ST PASS ON 1 UNIT (QUICK VERIFY)
000510  000055  $UNITM: .WORD   55       ;;ADDITIONAL RUN TIME (SECS) OF A PASS FOR EACH ADDITIONAL UNIT
000512  000030          .WORD   $ETEND-$MAIL/2 ;;LENGTH MAILBOX-ETABLE(WORDS)
```

```
                                .SBTTL  COMMON TAGS

                                ;;*****************************************************************
                                ;*THIS TABLE CONTAINS VARIOUS COMMON STORAGE LOCATIONS
                                ;*USED IN THE PROGRAM.

                                        .=1000
001000                  $CMTAG:                         ;;START OF COMMON TAGS
001000  000000                         .WORD   0
001002  000                    $TSTNM: .BYTE   0        ;;CONTAINS THE TEST NUMBER
001003  000                    $ERFLG: .BYTE   0        ;;CONTAINS ERROR FLAG
001004  000000                 $ICNT:  .WORD   0        ;;CONTAINS SUBTEST ITERATION COUNT
001006  000000                 $LPADR: .WORD   0        ;;CONTAINS SCOPE LOOP ADDRESS
001010  000000                 $LPERR: .WORD   0        ;;CONTAINS SCOPE RETURN FOR ERRORS
001012  000000                 $ERTTL: .WORD   0        ;;CONTAINS TOTAL ERRORS DETECTED
001014  000                    $ITEMB: .BYTE   0        ;;CONTAINS ITEM CONTROL BYTE
001015  001                    $ERMAX: .BYTE   1        ;;CONTAINS MAX. ERRORS PER TEST
001016  000000                 $ERRPC: .WORD   0        ;;CONTAINS PC OF LAST ERROR INSTRUCTION
001020  000000                 $GDADR: .WORD   0        ;;CONTAINS ADDRESS OF 'GOOD' DATA
001022  000000                 $BDADR: .WORD   0        ;;CONTAINS ADDRESS OF 'BAD' DATA
001024  000000                 $GDDAT: .WORD   0        ;;CONTAINS 'GOOD' DATA
001026  000000                 $BDDAT: .WORD   0        ;;CONTAINS 'BAD' DATA
001030  000000                         .WORD   0        ;;RESERVED--NOT TO BE USED
001032  000000                         .WORD   0
001034  000                    $AUTOB: .BYTE   0        ;;AUTOMATIC MODE INDICATOR
001035  000                    $INTAG: .BYTE   0        ;;INTERRUPT MODE INDICATOR
001036  000000                         .WORD   0
001040  177570                 SWR:    .WORD   DSWR     ;;ADDRESS OF SWITCH REGISTER
001042  177570                 DISPLAY: .WORD  DDISP    ;;ADDRESS OF DISPLAY REGISTER
001044  177560                 $TKS:   177560           ;;TTY KBD STATUS
001046  177562                 $TKB:   177562           ;;TTY KBD BUFFER
001050  177564                 $TPS:   177564           ;;TTY PRINTER STATUS REG. ADDRESS
001052  177566                 $TPB:   177566           ;;TTY PRINTER BUFFER REG. ADDRESS
001054  000                    $NULL:  .BYTE   0        ;;CONTAINS NULL CHARACTER FOR FILLS
001055  002                    $FILLS: .BYTE   2        ;;CONTAINS # OF FILLER CHARACTERS REQUIRED
001056  012                    $FILLC: .BYTE   12       ;;INSERT FILL CHARS. AFTER A "LINE FEED"
001057  000                    $TPFLG: .BYTE   0        ;;"TERMINAL AVAILABLE" FLAG (BIT<07>=0=YES)
001060  000000                 $TMP0:  .WORD   0        ;;USER DEFINED
001062  000000                 $TMP1:  .WORD   0        ;;USER DEFINED
001064  000000                 $TMP2:  .WORD   0        ;;USER DEFINED
001066  000000                 $TMP3:  .WORD   0        ;;USER DEFINED
001070  000000                 $TMP4:  .WORD   0        ;;USER DEFINED
001072  000000                 $ESCAPE:0                ;;ESCAPE ON ERROR ADDRESS
001074  077                    $QUES:  .ASCII  /?/      ;;QUESTION MARK
001075  015                    $CRLF:  .ASCII  <15>     ;;CARRIAGE RETURN
001076  000012                 $LF:    .ASCIZ  <12>     ;;LINE FEED
                                ;;*****************************************************************
                                .SBTTL  APT MAILBOX-ETABLE

                                ;;*****************************************************************
                                .EVEN
001100                  $MAIL:                          ;;APT MAILBOX
001100  000000                 $MSGTY: .WORD   AMSGTY   ;;MESSAGE TYPE CODE
001102  000000                 $FATAL: .WORD   AFATAL   ;;FATAL ERROR NUMBER
001104  000000                 $TESTN: .WORD   ATESTN   ;;TEST NUMBER
001106  000000                 $PASS:  .WORD   APASS    ;;PASS COUNT
```

```
  252  001110  000000                $DEVCT: .WORD   ADEVCT  ;;DEVICE COUNT
  253  001112  000000                $UNIT:  .WORD   AUNIT   ;;I/O UNIT NUMBER
  254  001114  000000                $MSGAD: .WORD   AMSGAD  ;;MESSAGE ADDRESS
  255  001116  000000                $MSGLG: .WORD   AMSGLG  ;;MESSAGE LENGTH
  256  001120                        $ETABLE:                ;;APT ENVIRONMENT TABLE
  257  001120      000               $ENV:   .BYTE   AENV    ;;ENVIRONMENT BYTE
  258  001121      000               $ENVM:  .BYTE   AENVM   ;;ENVIRONMENT MODE BITS
  259  001122  000000                $SWREG: .WORD   ASWREG  ;;APT SWITCH REGISTER
  260  001124  000400                $USWR:  .WORD   AUSWR   ;;USER SWITCHES
  261  001126  000000                $CPUOP: .WORD   ACPUOP  ;;CPU TYPE,OPTIONS
  262                                ;*                      BITS 15-11=CPU TYPE
  263                                ;*                              11/04=01,11/05=02,11/20=03,11/40=04,11/45=05
  264                                ;*                              11/70=06,PDQ=07,Q=10
  265                                ;*                      BIT 10=REAL TIME CLOCK
  266                                ;*                      BIT  9=FLOATING POINT PROCESSOR
  267                                ;*                      BIT  8=MEMORY MANAGEMENT
  268  001130      000               $MAMS1: .BYTE   AMAMS1  ;;HIGH ADDRESS,M.S. BYTE
  269  001131      000               $MTYP1. .BYTE   AMTYP1  ;;MEM. TYPE,BLK#1
  270                                ;*                      MEM.TYPE BYTE   --  (HIGH BYTE)
  271                                ;*                              900 NSEC CORE=001
  272                                ;*                              [illegible] NSEC BIPOLAR=002
  273                                ;*                              500 NSEC MOS=003
  274  001132  000000                $MADR1: .WORD   AMADR1  ;;HIGH ADDRESS,BLK#1
  275                                ;*                        MEM.LAST ADDR.=3 BYTES,THIS WORD AND LOW OF "TYPE" ABOVE
  276  001134      000               $MAMS2: .BYTE   AMAMS2  ;;HIGH ADDRESS,M.S. BYTE
  277  001135      000               $MTYP2: .BYTE   AMTYP2  ;;MEM.TYPE,BLK#2
  278  001136  000000                $MADR2: .WORD   AMADR2  ;;MEM.LAST ADDRESS,BLK#2
  279  001140      000               $MAMS3: .BYTE   AMAMS3  ;;HIGH ADDRESS,M.S.BYTE
  280  001141      000               $MTYP3: .BYTE   AMTYP3  ;;MEM.TYPE,BLK#3
  281  001142  000000                $MADR3: .WORD   AMADR3  ;;MEM.LAST ADDRESS,BLK#3
  282  001144      000               $MAMS4: .BYTE   AMAMS4  ;;HIGH ADDRESS,M.S.BYTE
  283  001145      000               $MTYP4: .BYTE   AMTYP4  ;;MEM.TYPE,BLK#4
  284  001146  000000                $MADR4: .WORD   AMADR4  ;;MEM.LAST ADDRESS,BLK#4
  285  001150  000300                $VECT1: .WORD   AVECT1  ;;INTERRUPT VECTOR#1,BUS PRIORITY#1
  286  001152  000000                $VECT2: .WORD   AVECT2  ;;INTERRUPT VECTOR#2BUS PRIORITY#2
  287  001154  176500                $BASE:  .WORD   ABASE   ;;BASE ADDRESS OF EQUIPMENT UNDER TEST
  288  001156  000000                $DEVM:  .WORD   ADEVM   ;;DEVICE MAP
  289  001160                        $ETEND:
  290                                .MEXIT
```

```
                                .SBTTL  ERROR POINTER TABLE

                                ;*THIS TABLE CONTAINS THE INFORMATION FOR EACH ERROR THAT CAN OCCUR.
                                ;*THE INFORMATION IS OBTAINED BY USING THE INDEX NUMBER FOUND IN
                                ;*LOCATION $ITEMB. THIS NUMBER INDICATES WHICH ITEM IN THE TABLE IS PERTINENT
                                ;*NOTE1:        IF $ITEMB IS 0 THE ONLY PERTINENT DATA IS ($ERRPC).
                                ;*NOTE2:        EACH ITEM IN THE TABLE CONTAINS 4 POINTERS EXPLAINED AS FOLLOWS

                                ;*      EM              ;;POINTS TO THE ERROR MESSAGE
                                ;*      DH              ;;POINTS TO THE DATA HEADER
                                ;*      DT              ;;POINTS TO THE DATA
                                ;*      DF              ;;POINTS TO THE DATA FORMAT


001160                          $ERRTB:

001160                          .$ERRTB:
001160  000020                          .BLKW   20              ;THIS BLOCK OF 16 LOCATIONS IS HERE TO PACIFY SYSMAC


001220  020510                          EM5                     ;SLU1 TCSR DONE NOT SET WITH RESET
001222  027431                          DH5                     ;"TEST# ERR PC  TCSR"
001224  030212                          DT5                     ;$TESTN,$ERRPC,CTCSR
001226  000000                          0

001230  020552                          EM6                     ;SLU1 RCSR DID NOT RETURN SSYNC
001232  027456                          DH6                     ;"TEST# ERR PC  RCSR"
001234  030222                          DT6                     ;$TESTN,$ERRPC,CRCSR
001236  000000                          0

001240  020611                          EM7                     ;SLU1 RBUF DID NOT RETURN SSYNC
001242  027503                          DH7                     ;"TEST# ERR PC  RBUF"
001244  030232                          DT7                     ;$TESTN,$ERRPC,CRBUF
001246  000000                          0

001250  000004                          .BLKW   4               ;MORE PACIFICATION


001260  020650                          EM11                    ;"CAN NOT SET BIT2 OF SLU1 TCSR"
001262  027431                          DH5                     ;"TEST# ERR PC  TCSR"
001264  030212                          DT5                     ;$TESTN,$ERRPC,CTCSR
001266  000000                          0

001270  000004                          .BLKW   4               ;STILL MORE PACIFICATION


001300  020706                          EM13                    ;"RESET DID NOT CLEAR BIT2 OF SLU1 TCSR'
001302  027431                          DH5                     ;"TEST# ERR PC  TCSR"
001304  030212                          DT5                     ;$TESTN,$ERRPC,CTCSR
001306  000000                          0

001310  020754                          EM14                    ;"BIT6 OF SLU1 TCSR NOT CLEAR AFTER RESET2
001312  027431                          DH5                     ;"TEST# ERR PC  TCSR'
001314  030212                          DT5                     ;$TESTN,$ERRPC,CTCSR
001316  000000                          0
```

```
347
348  001320  021024          EM15    ;"SLU1 XMIT INTERRUPTED WITH PRIORI
349  001322  027431          DH5     ;"TEST# ERR PC  TCSR
350  001324  030212          DT5     ;$TESTN,$ERRPC,CTCSR
351  001326  000000          0
352
353  001330  021072          EM16    ;"CAN NOT SET BIT6 OF SLU1 TCSR
354  001332  027431          DH5     ;"TEST# ERR PC  TCSR"
355  001334  030212          DT5     ,$TESTN,$ERRPC,CTCSR
356  001336  000000          0
357
358  001340  021130          EM17    ;"CAN NOT CLEAR BIT6 OF SLU1 TCSR"
359  001342  027431          DH5     ;"TEST# ERR PC  TCSR"
360  001344  030212          DT5     ;$TESTN,$ERRPC,CTCSR
361  001346  000000          0
362
363  001350  021170          EM20    ;"RESET DID NOT CLEAR BIT6 OF SLU1 TCSR"
364  001352  027431          DH5     ;"TEST# ERR PC  TCSR"
365  001354  030212          DT5     ;$TESTN,$ERRPC,CTCSR
366  001356  000000          0
367
368  001360  021236          EM21    ;"BIT6 OF SLU1 RCSR NOT CLEAR AFTER RESET"
369  001362  027456          DH6     ;"TEST# ERR PC  RCSR"
370  001364  030222          DT6     ;$TESTN,$ERRPC,CRCSR
371  001366  000000          0
372
373  001370  021306          EM22    ;"SLU1 RCVR INTERRUPT WITH PRIORITY 7
374  001372  027456          DH6     ;"TEST# ERR PC  RCSR"
375  001374  030222          DT6     ;$TESTN,$ERRPC,CRCSR
376  001376  000000          0
377
378  001400  021352          EM23    ;"CAN NOT SET BIT6 OF SLU1 RCSR'
379  001402  027456          DH6     ;"TEST# ERR PC  RCSR"
380  001404  030222          DT6     ;$TESTN,$ERRPC,CRCSR
381  001406  000000          0
382
383  001410  021410          EM24    ;"CAN NOT CLEAR BIT6 OF SLU1 RCSR
384  001412  027456          DH6     ;"TEST# ERR PC  RCSR"
385  001414  030222          DT6     ;$TESTN,$ERRPC,CRCSR
386  001416  000000          0
387
388  001420  021450          EM25    ;"CAN NOT CLEAR BIT6 OF SLU1 RCSR WITH RESE'2
389  001422  027456          DH6     ;"TEST# ERR PC  RCSR"
390  001424  030222          DT6     ;$TESTN,$ERRPC,CRCSR
391  001426  000000          0
392
393  001430  021523          EM26    ;"SLU1 RECEIVER DONE NEVER SET'
394  001432  027456          DH6     ;"TEST# ERR PC  RCSR"
395  001434  030222          DT6     ;$TESTN,$ERRPC,CRCSR
396  001436  000000          0
397
398  001440  021560          EM27    ;"RESET DID NOT CLEAR SLU1 RCVR DONE
399  001442  027456          DH6     ;"TEST# ERR PC  RCSR"
400  001444  030222          DT6     ;$TESTN,$ERRPC,CRCSR
401  001446  000000          0
402
```

```
403  001450  021623          EM30    ;"READING SLU1 RBUF DID NOT CLEAR RCVR DONE
404  001452  027456          DH6     ;"TEST# ERR PC  RCSR"
405  001454  030222          DT6     ;$TESTN,$ERRPC,CRCSR
406  001456  000000          0
407
408  001460  021675          EM31    ;SLU2 TCSR DID NOT RETURN SSYNC
409  001462  027431          DH5     ;"TEST# ERR PC  TCSR"
410  001464  030242          DT31    ;$TESTN,$ERRPC,TCSR
411  001466  000000          0
412
413  001470  021734          EM32    ;SLU2 TBUF DID NOT RETURN SSYNC
414  001472  027530          DH32    ;"TEST# ERR PC  TBUF"
415  001474  030252          DT32    ;$TESTN,$ERRPC,TBUF
416  001476  000000          0
417
418  001500  021773          EM33    ;"SLU2 TCSR DONE NOT CLEARED WITH TBUF FULL
419  001502  027431          DH5     ;"TEST# ERR PC  TCSR"
420  001504  030242          DT31    ;$TESTN,$ERRPC,TCSR
421  001506  000000          0
422
423  001510  022045          EM34    ;"SLU2 TCSR DONE NOT SET AFTER TRANSMIT
424  001512  027431          DH5     ;"TEST# ERR PC  TCSR"
425  001514  030242          DT31    ;$TESTN,$ERRPC,TCSR
426  001516  000000          0
427
428  001520  022113          EM35    ;"SLU2 TCSR DONE NOT SET WITH RESET"
429  001522  027431          DH5     ;"TEST#  ERR PC  TCSR"
430  001524  030242          DT31    ;$TESTN,ERRPC,TCSR
431  001526  000000          0
432
433  001530  022155          EM36    ;"SLU2 RCSR DID NOT RETURN SSYNC"
434  001532  027456          DH6     ;"TEST#  ERR PC  RCSR"
435  001534  030262          DT36    ;$TESTN,ERRPC,RCSR
436  001536  000000          0
437
438  001540  022214          EM37    ;SLU2 RBUF DID NOT RETURN SSYNC"
439  001542  027503          DH7     ;"TEST#  ERR PC  RBUF"
440  001544  030272          DT37    ;$TESTN,ERRPC,RBUF
441  001546  000000          0
442
443  001550  022253          EM40    ;"BIT0 OF SLU2 TCSR NOT CLEAR AFTER RESET"
444  001552  027431          DH5     ;"TEST# ERR PC  TCSR
445  001554  030242          DT31    ;$TESTN,$ERRPC,TCSR
446  001556  000000          0
447
448  001560  022323          EM41    ;"CAN NOT SET BIT0 OF SLU2 TCSR"
449  001562  027431          DH5     ;"TEST# ERR PC  TCSR
450  001564  030242          DT31    ;$TESTN,$ERRPC,TCSR
451  001566  000000          0
452
453  001570  022361          EM42    ;"CAN NOT CLEAR BIT0 OF SLU2 TCSR"
454  001572  027431          DH5     ;"TEST# ERR PC  TCSR
455  001574  030242          DT31    ;$TESTN,$ERRPC,TCSR
456  001576  000000          0
457
458  001600  022421          EM43    ;"RESET DID NOT CLEAR BIT0 OF SLU2 TCSR"
```

M2


```
459  001602  027431          DH5             ;"TEST# ERR PC  TCSR
460  001604  030242          DT31            ;$TESTN,$ERRPC,TCSR
461  001606  000000          0
462
463  001610  022467          EM44            ;"BIT6 OF SLU2 TCSR NOT CLEAR AFTER RESET2
464  001612  027431          DH5             ;"TEST# ERR PC  TCSR
465  001614  030242          DT31            ;$TESTN,$ERRPC,TCSR
466  001616  000000          0
467
468  001620  022537          EM45            ;"SLU2 XMIT INTERRUPTED WITH PRIORITY 7"
469  001622  027431          DH5             ;"TEST# ERR PC  TCSR
470  001624  030242          DT31            ;$TESTN,$ERRPC,TCSR
471  001626  000000          0
472
473  001630  022605          EM46            ;"CAN NOT SET BIT6 OF SLU2 TCSR'
474  001632  027431          DH5             ;"TEST# ERR PC  TCSR
475  001634  030242          DT31            ;$TESTN,$ERRPC,TCSR
476  001636  000000          0
477
478  001640  022643          EM47            ;"CAN NOT CLEAR BIT6 OF SLU2 TCSR
479  001642  027431          DH5             ;"TEST# ERR PC  TCSR
480  001644  030242          DT31            ;$TESTN,$ERRPC,TCSR
481  001646  000000          0
482
483  001650  022703          EM50            ;"RESET DID NOT CLEAR BIT6 OF SLU2 TCSR"
484  001652  027431          DH5             ;"TEST# ERR PC  TCSR
485  001654  030242          DT31            ;$TESTN,$ERRPC,TCSR
486  001656  000000          0
487
488  001660  022751          EM51            ;"BIT6 OF SLU2 RCSR NOT CLEAR AFTER RESET"
489  001662  027456          DH6             ;"TEST#  ERR PC  RCSR"
490  001664  030262          DT36            ;$TESTN,ERRPC,RCSR
491  001666  000000          0
492
493  001670  023021          EM52            ;"SLU2 RCVR INTERRUPT WITH PRIORITY 7'
494  001672  027456          DH6             ;"TEST#  ERR PC  RCSR'
495  001674  030262          DT36            ;$TESTN,ERRPC,RCSR
496  001676  000000          0
497
498  001700  023065          EM53            ;"CAN NOT SET BIT6 OF SLU2 RCSR'
499  001702  027456          DH6             ;"TEST#  ERR PC  RCSR"
500  001704  030262          DT36            ;$TESTN,ERRPC,RCSR
501  001706  000000          0
502
503  001710  023123          EM54            ;"CAN NOT CLEAR BIT6 OF SLU2 RCSR'
504  001712  027456          DH6             ;"TEST#  ERR PC  RCSR"
505  001714  030262          DT36            ;$TESTN,ERRPC,RCSR
506  001716  000000          0
507
508  001720  023163          EM55            ;"CAN NOT CLEAR BIT6 OF SLU2 RCSR WITH RESET2
509  001722  027456          DH6             ;"TEST#  ERR PC  RCSR"
510  001724  030262          DT36            ;$TESTN,ERRPC,RCSR
511  001726  000000          0
512
513  001730  023236          EM56            ;"SLU2 RECEIVER DONE NEVER SET
514  001732  027456          DH6             ;"TEST#  ERR PC  RCSR
```

```
515  001734  030262          DT36                    ;$TESTN,ERRPC,RCSR
516  001736  000000          0
517
518  001740  023273          EM57                    ;"RESET DID NOT CLEAR SLU2 RCVR DONE
519  001742  027456          DH6                     ;"TEST#  ERR PC  RCSR"
520  001744  030262          DT36                    ;$TESTN,ERRPC,RCSR
521  001746  000000          0
522
523  001750  023336          EM60                    ;"READING SLU2 RBUF DID NOT CLEAR RCVR DONE
524  001752  027456          DH6                     ;"TEST#  ERR PC  RCSR"
525  001754  030262          DT36                    ;$TESTN,ERRPC,RCSR
526  001756  000000          0
527
528  001760  023410          EM61                    ;LKS DID NOT RETURN SSYNC
529  001762  027555          DH61                    ;"TEST#  ERR PC  LKS"
530  001764  030302          DT61                    ;$TESTN,ERRPC,LKS
531  001766  000000          0
532
533  001770  023441          EM62                    ;"BIT6 OF LKS NOT CLEAR AFTER RESET
534  001772  027555          DH61                    ;"TEST# ERR PC  LKS"
535  001774  030302          DT61                    ;$TESTN,$ERRPC,LKS
536  001776  000000          0
537
538  002000  023503          EM63                    ;"LKS INTERRUPT WITH PRIORITY 7
539  002002  027555          DH61                    ;"TEST# ERR PC  LKS"
540  002004  030302          DT61                    ;$TESTN,$ERRPC,LKS
541  002006  000000          0
542
543  002010  023541          EM64                    ;"CAN NOT SET BIT6 OF LKS
544  002012  027555          DH61                    ;"TEST# ERR PC  LKS"
545  002014  030302          DT61                    ;$TESTN,$ERRPC,LKS
546  002016  000000          0
547
548  002020  023571          EM65                    ;"CAN NOT CLEAR BIT6 OF LKS
549  002022  027555          DH61                    ;"TEST# ERR PC  LKS"
550  002024  030302          DT61                    ;$TESTN,$ERRPC,LKS
551  002026  000000          0
552
553  002030  023623          EM66                    ;"RESET DID NOT CLEAR BIT6 OF LKS"
554  002032  027555          DH61                    ;"TEST# ERR PC  LKS"
555  002034  030302          DT61                    ;$TESTN,$ERRPC,LKS
556  002036  000000          0
557
558  002040  023663          EM67                    ;"BIT7 OF LKS NOT SET AFTER RESET2
559  002042  027555          DH61                    ;"TEST# ERR PC  LKS"
560  002044  030302          DT61                    ;$TESTN,$ERRPC,LKS
561  002046  000000          0
562
563  002050  023723          EM70                    ;"CAN NOT CLEAR BIT7 OF LKS"
564  002052  027555          DH61                    ;"TEST# ERR PC  LKS"
565  002054  030302          DT61                    ;$TESTN,$ERRPC,LKS
566  002056  000000          0
567
568  002060  023755          EM71                    ;"BIT7 OF LKS DOES NOT SET"
569  002062  027555          DH61                    ;"TEST# ERR PC  LKS"
570  002064  030302          DT61                    ;$TESTN,$ERRPC,LKS
```

```
571  002066  000000                    0
572
573  002070  024006                    EM72                ;WRITING TO ONE INTERNAL ADDRESS MODIFIED ANOTHER
574  002072  027601                    DM72                ;"TEST# ERR PC  GOOD  BAD  GDDATA BDDATA
575  002074  030312                    DT72                ;$TESTN,$ERRPC,$GDADR,$BDADR,$GDDAT,$BDDAT
576  002076  000000                    0
577
578  002100  000004                    .BLKW   4           ;THE LAST IN A LONG LINE OF PACIFICATION
579
580
581  002110  024067                    EM74                ;"SLU1 XMIT INTERRUPTS WHEN DISABLED
582  002112  027431                    DM5                 ;"TEST# ERR PC  TCSR"
583  002114  030212                    DT5                 ;$TESTN,$ERRPC,CTCSR
584  002116  000000                    0
585
586  002120  024132                    EM75                ;"SLU1 XMIT DID NOT INTERRUPT
587  002122  027431                    DM5                 ;"TEST# ERR PC  TCSR"
588  002124  030212                    DT5                 ;$TESTN,$ERRPC,CTCSR
589  002126  000000                    0
590
591  002130  024166                    EM76                ;"SLU1 XMIT INTERRUPT AT PRIORITY 7
592  002132  027431                    DM5                 ;"TEST# ERR PC  TCSR"
593  002134  030212                    DT5                 ;$TESTN,$ERRPC,CTCSR
594  002136  000000                    0
595
596  002140  024230                    EM77                ;"SLU1 XMIT INTERRUPTS WITH ENABLE CLEAR
597  002142  027431                    DM5                 ;"TEST# ERR PC  TCSR"
598  002144  030212                    DT5                 ;$TESTN,$ERRPC,CTCSR
599  002146  000000                    0
600
601  002150  024277                    EM100               ;"SLU1 XMIT DID NOT INTERRUPT
602  002152  027431                    DM5                 ;"TEST# ERR PC  TCSR"
603  002154  030212                    DT5                 ;$TESTN,$ERRPC,CTCSR
604  002156  000000                    0
605
606  002160  024333                    EM101               ;"SLU1 XMIT RE-INTERRUPTED
607  002162  027431                    DM5                 ;"TEST# ERR PC  TCSR"
608  002164  030212                    DT5                 ;$TESTN,$ERRPC,CTCSR
609  002166  000000                    0
610
611  002170  024364                    EM102               ;"LOADING SLU1 TBUF DID NOT CLEAR INTERRUPT
612  002172  027431                    DM5                 ;"TEST# ERR PC  TCSR'
613  002174  030212                    DT5                 ;$TESTN,$ERRPC,CTCSR
614  002176  000000                    0
615
616  002200  024436                    EM103               ;"SLU1 RCVR INTERRUPTS WITH ENABLE CLEAR'
617  002202  027456                    DM6                 ;"TEST# ERR PC  RCSR"
618  002204  030222                    DT6                 ;$TESTN,$ERRPC,CRCSR
619  002206  000000                    0
620
621  002210  024505                    EM104               ;"SLU1 RCVR DID NOT INTERRUPT
622  002212  027456                    DM6                 ;"TEST# ERR PC  RCSR"
623  002214  030222                    DT6                 ;$TESTN,$ERRPC,CRCSR
624  002216  000000                    0
625
626  002220  024541                    EM105               ;"SLU1 RCVR INTERRUPTS AT PRIORITY 7
```

```
627  002222  027456                  DH6                     ;"TEST# ERR PC  RCSR
628  002224  030222                  DT6                     ;$TESTN,$ERRPC,CRCSR
629  002226  000000                  0
630
631  002230  024604                  EM106                   ;"SLU1 RCVR INTERRUPTS WITH INTERRUPT ENABLE CLEAR
632  002232  027456                  DH6                     ;"TEST# ERR PC  RCSR
633  002234  030222                  DT6                     ;$TESTN,$ERRPC,CRCSR
634  002236  000000                  0
635
636  002240  024665                  EM107                   ;"SLU1 RCVR DID NOT INTERRUPT
637  002242  027456                  DH6                     ;"TEST# ERR PC  RCSR"
638  002244  030222                  DT6                     ;$TESTN,$ERRPC,CRCSR
639  002246  000000                  0
640
641  002250  024721                  EM110                   ;"SLU1 RECEIVER RE-INTERRUPTED"
642  002252  027456                  DH6                     ;"TEST# ERR PC  RCSR"
643  002254  030222                  DT6                     ;$TESTN,$ERRPC,CRCSR
644  002256  000000                  0
645
646  002260  024756                  EM111                   ;"SLU1 READING RBUF DID NOT CLEAR INTERRUPT
647  002262  027456                  DH6                     ;"TEST# ERR PC  RCSR"
648  002264  030222                  DT6                     ;$TESTN,$ERRPC,CRCSR
649  002266  000000                  0
650
651  002270  025030                  EM112                   ;"RESET DID NOT CLEAR SLU1 RCVR INTERRUPT
652  002272  027456                  DH6                     ;"TEST# ERR PC  RCSR"
653  002274  030222                  DT6                     ;$TESTN,$ERRPC,CRCSR
654  002276  000000                  0
655
656  002300  025100                  EM113                   ;"SLU1 'OR' FLAG DID NOT SET'
657  002302  027456                  DH6                     ;"TEST# ERR PC  RCSR"
658  002304  030222                  DT6                     ;$TESTN,$ERRPC,CRCSR
659  002306  000000                  0
660
661  002310  025133                  EM114                   ;"SLU1 'ERROR' NOT SET WITH  OR  FLAG
662  002312  027456                  DH6                     ;"TEST# ERR PC  RCSR"
663  002314  030222                  DT6                     ;$TESTN,$ERRPC,CRCSR
664  002316  000000                  0
665
666  002320  025177                  EM115                   ;"DATA COMPARE ERROR"
667  002322  027657                  DH115                   ;"TEST# ERR PC  CRCSR  GOOD  BAD'
668  002324  030330                  DT115                   ;$TESTN,$ERRPC,CRCSR,GD,BD
669  002326  000000                  0
670
671  002330  025222                  EM116                   ;"SLU2 XMIT INTERRUPTS WHEN DISABLED
672  002332  027431                  DH5                     ;"TEST# ERR PC  TCSR"
673  002334  030242                  DT31                    ;$TESTN,$ERRPC,TCSR
674  002336  000000                  0
675
676  002340  025265                  EM117                   ;"SLU2 XMIT DID NOT INTERRUPT"
677  002342  027431                  DH5                     ;"TEST# ERR PC  TCSR"
678  002344  030242                  DT31                    ;$TESTN,$ERRPC,TCSR
679  002346  000000                  0
680
681  002350  025321                  EM120                   ;"SLU2 XMIT INTERRUPT AT PRIORITY "
682  002352  027431                  DH5                     ;"TEST# ERR PC  TCSR'
```

```
683  002354  030242                DT31                    ;$TESTN,$ERRPC,TCSR
684  002356  000000                0
685
686  002360  025363                EM121                   ;"SLU2 XMIT INTERRUPTS WITH ENABLE CLEAR
687  002362  027431                DH5                     ;"TEST# ERR PC  TCSR"
688  002364  030242                DT31                    ;$TESTN,$ERRPC,TCSR
689  002366  000000                0
690
691  002370  025432                EM122                   ;"SLU2 XMIT DID NOT INTERRUPT
692  002372  027431                DH5                     ;"TEST# ERR PC  TCSR"
693  002374  030242                DT31                    ;$TESTN,$ERRPC,TCSR
694  002376  000000                0
695
696  002400  025466                EM123                   ;"SLU2 XMIT RE-INTERRUPTED"
697  002402  027431                DH5                     ;"TEST# ERR PC  TCSR"
698  002404  030242                DT31                    ;$TESTN,$ERRPC,TCSR
699  002406  000000                0
700
701  002410  025517                EM124                   ;"LOADING SLU2 TBUF DID NOT CLEAR INTERRUP
702  002412  027431                DH5                     ;"TEST# ERR PC  TCSR"
703  002414  030242                DT31                    ;$TESTN,$ERRPC,TCSR
704  002416  000000                0
705
706  002420  025571                EM125                   ;"SLU2 RCVR INTERRUPTS WITH ENABLE CLEAR"
707  002422  027456                DH6                     ;"TEST# ERR PC  RCSR"
708  002424  030262                DT36                    ;$TESTN,$ERRPC,RCSR
709  002426  000000                0
710
711  002430  025640                EM126                   ;"SLU2 RCVR DID NOT INTERRUPT
712  002432  027456                DH6                     ;"TEST# ERR PC  RCSR"
713  002434  030262                DT36                    ;$TESTN,$ERRPC,RCSR
714  002436  000000                0
715
716  002440  025674                EM127                   ;"SLU2 RCVR INTERRUPTS AT PRIORITY 7
717  002442  027456                DH6                     ;"TEST# ERR PC  RCSR"
718  002444  030262                DT36                    ;$TESTN,$ERRPC,RCSR
719  002446  000000                C
720
721  002450  025737                EM130                   ;"SLU2 RCVR INTERRUPTS WITH INTERRUPT ENABLE CLEAR
722  002452  027456                DH6                     ;"TEST# ERR PC  RCSR"
723  002454  030262                DT36                    ;$TESTN,$ERRPC,RCSR
724  002456  000000                0
725
726  002460  026020                EM131                   ;"SLU2 RCVR DID NOT INTERRUPT
727  002462  027456                DH6                     ;"TEST# ERR PC  RCSR"
728  002464  030262                DT36                    ;$TESTN,$ERRPC,RCSR
729  002466  000000                0
730
731  002470  026054                EM132                   ;"SLU2 RECEIVER RE-INTERRUPTED
732  002472  027456                DH6                     ;"TEST# ERR PC  RCSR"
733  002474  030262                DT36                    ;$TESTN,$ERRPC,RCSR
734  002476  000000                0
735
736  002500  026111                EM133                   ;"SLU2 READING RBUF DID NOT CLEAR INTERRUPT
737  002502  027456                DH6                     ;"TEST# ERR PC  RCSR"
738  002504  030262                DT36                    ;$TESTN,$ERRPC,RCSR
```

```
739  002506  000000                    0
740
741  002510  026163                    EM134           ;"RESET DID NOT CLEAR SLU2 RCVR INTERRUPT
742  002512  027456                    DH6             ;"TEST# ERR PC  RCSR'
743  002514  030262                    DT36            ;$TESTN,$ERRPC,RCSR
744  002516  000000                    0
745
746  002520  026233                    EM135           ;"SLU2  OR' FLAG DID NOT SET"
747  002522  027456                    DH6             ;"TEST# ERR PC  RCSR"
748  002524  030262                    DT36            ;$TESTN,$ERRPC,RCSR
749  002526  000000                    0
750
751  002530  026266                    EM136           ;"SLU2 'ERROR' NOT SET WITH 'OR  FLAG'
752  002532  027456                    DH6             ;"TEST# ERR PC  RCSR"
753  002534  030262                    DT36            ;$TESTN,$ERRPC,RCSR
754  002536  000000                    0
755
756  002540  026332                    EM137           ;"SLU2 BREAK DID NOT TRANSMIT ALL ZEROES"
757  002542  027723                    DH137           ;"TEST# ERR PC  RCSR  DATA"
758  002544  030344                    DT137           ;$TESTN,$ERRPC,RCSR,$BDDAT
759  002546  000000                    0
760
761  002550  026401                    EM140           ;"BREAK DID NOT SET FRAMING ERROR'
762  002552  027456                    DH6             ;"TEST# ERR PC  RCSR"
763  002554  030222                    DT6             ;$TESTN,$ERRPC,RCSR
764  002556  000000                    0
765
766  002560  026441                    EM141           ;"SLU2 'ERROR' NOT SET WITH 'FR' FLAG
767  002562  027456                    DH6             ;"TEST# ERR PC  RCSR"
768  002564  030262                    DT36            ;$TESTN,$ERRPC,RCSR
769  002566  000000                    0
770
771  002570  026505                    EM142           ;"DATA COMPARE ERROR WITH CABLE
772  002572  027760                    DH142           ;"TEST# ERR PC  RCSR    GOOD    BAD"
773  002574  030356                    DT142           ;$TESTN,$ERRPC,RCSR,GD,BD
774  002576  000000                    0
775
776  002600  026543                    EM143           ;"RTC INTERRUPT AT PRIORITY 7"
777  002602  027555                    DH61            ;"TEST# ERR PC  LKS"
778  002604  030302                    DT61            ;$TESTN,$ERRPC,LKS
779  002606  000000                    0
780
781  002610  026577                    EM144           ;"RTC INTERRUPTS WHEN DISABLED'
782  002612  027555                    DH61            ;"TEST# ERR PC  LKS"
783  002614  030302                    DT61            ;$TESTN,$ERRPC,LKS
784  002616  000000                    0
785
786  002620  026634                    EM145           ;"RTC INTERRUPT DID NOT OCCUR'
787  002622  027555                    DH61            ;"TEST# ERR PC  LKS"
788  002624  030302                    DT61            ;$TESTN,$ERRPC,LKS
789  002626  000000                    0
790
791  002630  026670                    EM146           ;"RTC INTERRUPT DID NOT OCCUR'
792  002632  027555                    DH61            ;"TEST# ERR PC  LKS'
793  002634  030302                    DT61            ;$TESTN,$ERRPC,LKS
794  002636  000000                    0
```

```
795
796  002640  026724          EM147           ;"RTC DOUBLE INTERRUPT"
797  002642  027555          DH61            ;"TEST# ERR PC  LKS"
798  002644  030302          DT61            ;$TESTN,$ERRPC,LKS
799  002646  000000          0
800
801  002650  026751          EM150           ;"RESET DID NOT CLEAR RTC INTERRUPT
802  002652  027555          DH61            ;"TEST# ERR PC  LKS"
803  002654  030302          DT61            ;$TESTN,$ERRPC,LKS
804  002656  000000          0
805
806  002660  027013          EM151           ;"RTC INTERRUPT DID NOT CLEAR WITH BIT7 OF LKS"
807  002662  027555          DH61            ;"TEST# ERR PC  LKS"
808  002664  030302          DT61            ;$TESTN,$ERRPC,LKS
809  002666  000000          0
810
811  002670  027070          EM152           ;"CLOCK REPEATABILITY ERROR"
812  002672  030014          DH152           ;"TEST# ERR PC  LKS    CNT1    CNT2"
813  002674  030370          DT152           ;"$TESTN,$ERRPC,LKS,FIRST,SECND
814  002676  000000          0
815
816  002700  027122          EM153           ;"SLU1 RECEIVER STATUS ERROR"
817  002702  027657          DH115           ;"TEST#  ERR PC  CRCSR  GOOD  BAD"
818  002704  030330          DT115           ;$TESTN,$ERRPC,CRCSR,$GDDTA,$BDDAT
819  002706  000000          0
820
821  002710  027155          EM154           ;SLU2 RECEIVER STATUS ERROR
822  002712  027760          DH142           ;"TESTN  ERR PC  RCSR  GOOD  BAD"
823  002714  030356          DT142           ;$TESTN,$ERRPC,RCSR,$GDDAT,$BDDAT
824  002716  000000          0
825
826  002720  027210          EM15[illegible]  ;"INCORRECT RECEIVE COUNT SLU1
827  002722  030061          DH15[illegible]  ;"TEST# ERR PC  RCSR    TRANS   RCV"
828  002724  030404          DT155           ;$TESTN,$ERRPC,CRCSR,XMTCT1,RCVCT1
829  002726  000000          0
830
831  002730  027245          EM156           ;"SLU1 DATA COMPARE ERROR IN EXERCISER"
832  002732  027657          DH115           ;"TEST# ERR PC  CRCSR   GOOD    BAD"
833  002734  030330          DT115           ;$TESTN,$ERRPC,CRCSR,GD,BD
834  002736  000000          0
835
836  002740  027312          EM157           ;"INCORRECT RECEIVE COUNT SLU2
837  002742  030061          DH155           ;"TEST# ERR PC  RCSR    TRANS   RCV"
838  002744  030420          DT157           ;$TESTN,$ERRPC,RCSR,XMTCT2,RCVCT2
839  002746  000000          0
840
841  002750  027347          EM160           ;"SLU2 DATA COMPARE ERROR IN EXERCISER"
842  002752  027760          DH142           ;"TEST# ERR PC  RCSR    GOOD    BAD"
843  002754  030356          DT142           ;$TESTN,$ERRPC,RCSR,GD,BD
844  002756  000000          0
845
846  002760  027414          EM161           ;"TRAP CATCHER"
847  002762  030125          DH161           ;"TEST#   ERR PC  OLDPC  TRAP ADR"
848  002764  030434          DT161           ;$TESTN,$ERRPC,OLDPC,BDVECT
849  002766  000000          0
850
```

```
                                        ;REGISTER ADDRESSES OF INTERNAL ON BOARD OPTIONS
                                        
002770  176500                  RCSR:   .WORD   176500          ;SLU2 COMMAND/STATUS REGISTER
002772  176502                  RBUF:   .WORD   176502          ;SLU2 RECEIVER BUFFER
002774  176504                  TCSR:   .WORD   176504          ;SLU2 TRANSMITTER COMMAND/STATUS REGISTER
002776  176506                  TBUF:   .WORD   176506          ;SLU2 TRANSMITTER BUFFER
003000  177560                  CRCSR:  177560                  ;SLU1 RECEIVER COMMAND/STATUS REGISTER
003002  177562                  CRBUF:  177562                  ;SLU1 RECEIVER BUFFER
003004  177564                  CTCSR:  177564                  ;SLU1 TRANSMITTER COMMAND/STATUS REGISTER
003006  177566                  CTBUF:  177566                  ;SLU1 TRANSMITTER BUFFER
003010  177546                  LKS:    .WORD   177546          ;LTC COMMAND/STATUS REGISTER
                                        
                                        ;VECTOR ADDRESSES FOR ON BOARD OPTIONS
                                        
003012  000300                  RVECT:  .WORD   300
003014  000302                  RPSW:   .WORD   302
003016  000304                  TVECT:  .WORD   304
003020  000306                  TPSW:   .WORD   306
003022  000060                  CRVECT: 60                      ;RECEIVER INTERRUPT VECTOR
003024  000062                  CRPSW:  62
003026  000064                  CTVECT: 64                      ;TRANSMITTER INTERRUPT VECTOR
003030  000066                  CTPSW:  66
003032  000100                  RTCVT:  .WORD   100
003034  000102                  RTCPSW: .WORD   102
                                        
003036  005037  001102          START:  CLR     $FATAL          ;CLEAR ERROR NO.
003042  005037  001100                  CLR     $MSGTYP         ;CLEAR MESSAGE TYPE
003046  005037  001104                  CLR     $TESTN          ;CLEAR TEST NO.
003052  005037  001156                  CLR     $DEVM           ;CLEAR FLAGS INDICATING DEVICES UNDER TEST
003056                          1$:
                                        .SBTTL  INITIALIZE THE COMMON TAGS
                                        ;;CLEAR THE COMMON TAGS ($CMTAG) AREA
003056  012706  001000                  MOV     #$CMTAG,R6      ;;FIRST LOCATION TO BE CLEARED
003062  005026                          CLR     (R6)+           ;;CLEAR MEMORY LOCATION
003064  022706  001040                  CMP     #SWR,R6 ;;DONE?
003070  001374                          BNE     .-6             ;;LOOP BACK IF NO
003072  012706  001000                  MOV     #1000,SP                ;;SETUP THE STACK POINTER
                                        ;;INITIALIZE A FEW VECTORS
003076  012737  015614  000020          MOV     #$SCOPE,@#IOTVEC ;;IOT VECTOR FOR SCOPE ROUTINE
003104  012737  000340  000022          MOV     #340,@#IOTVEC+2 ;;LEVEL 7
003112  012737  015120  000030          MOV     #$ERROR,@#EMTVEC ;;EMT VECTOR FOR ERROR ROUTINE
003120  012737  000340  000032          MOV     #340,@#EMTVEC+2 ;;LEVEL 7
003126  012737  020026  000034          MOV     #$TRAP,@#TRAPVEC ;;TRAP VECTOR FOR TRAP CALLS
003134  012737  000340  000036          MOV     #340,@#TRAPVEC+2;LEVEL 7
003142  012737  015436  000024          MOV     #$PWRDN,@#PWRVEC ;;POWER FAILURE VECTOR
003150  012737  000340  000026          MOV     #340,@#PWRVEC+2 ;;LEVEL 7
003156  013737  014770  014762          MOV     $ENDCT,$EOPCT   ;;SETUP END-OF-PROGRAM COUNTER
003164  005037  001072                  CLR     $ESCAPE         ;;CLEAR THE ESCAPE ON ERROR ADDRESS
003170  112737  000001  001015          MOVB    #1,$ERMAX       ;;ALLOW ONE ERROR PER TEST
003176  012737  003176  001006          MOV     #.,$LPADR       ;;INITIALIZE THE LOOP ADDRESS FOR SCOPE
003204  012737  003204  001010          MOV     #.,$LPERR       ;;SETUP THE ERROR LOOP ADDRESS
                                        ;;SIZE FOR A HARDWARE SWITCH REGISTER. IF NOT FOUND OR IT IS
                                        ;;EQUAL TO A "-1", SETUP FOR A SOFTWARE SWITCH REGISTER.
003212  013746  000004                  MOV     @#ERRVEC,-(SP)  ;;SAVE ERROR VECTOR
003216  012737  003252  000004          MOV     #64$,@#ERRVEC   ;;SET UP ERROR VECTOR
```

```
 907  003224  012737  177570  001040          MOV     #DSWR,SWR       ;;SETUP FOR A HARDWARE SWICH REGISTER
 908  003232  012737  177570  001042          MOV     #DDISP,DISPLAY  ;;AND A HARDWARE DISPLAY REGISTER
 909  003240  022777  177777  175572          CMP     #-1,@SWR        ;;TRY TO REFERENCE HARDWARE SWR
 910  003246  001012                          BNE     66$             ;;BRANCH IF NO TIMEOUT TRAP OCCURRED
 911                                                                  ;;AND  THE HARDWARE SWR IS NOT = -1
 912  003250  000403                          BR      65$             ;;BRANCH IF NO TIMEOUT
 913  003252  012716  003260          64$:    MOV     #65$,(SP)       ;;SET UP FOR TRAP RETURN
 914  003256  000002                          RTI
 915  003260  012737  000176  001040  65$:    MOV     #SWREG,SWR      ;;POINT TO SOFTWARE SWR
 916  003266  012737  000174  001042          MOV     #DISPREG,DISPLAY
 917  003274  012637  000004          66$:    MOV     (SP)+,@#ERRVEC  ;;RESTORE ERROR VECTOR
 918
 919  003300  005037  001106                  CLR     $PASS           ;;CLEAR PASS COUNT
 920  003304  132737  000200  001121          BITB    #APTSIZE,$ENVM  ;;TEST USER SIZE UNDER APT
 921  003312  001405                          BEQ     67$             ;;YES,USE NON-APT SWITCH
 922  003314  012737  001122  001040          MOV     #$SWREG,SWR     ;;NO,USE APT SWITCH REGISTER
 923  003322                          67$:
 924                                  .SBTTL  GET VALUE FOR SOFTWARE SWITCH REGISTER
 925  003322  005737  000042                  TST     @#42            ;;ARE WE RUNNING UNDER XXDP/ACT?
 926  003326  001012                          BNE     68$             ;;BRANCH IF YES
 927  003330  123727  001120  000001          CMPB    $ENV,#1         ;;ARE WE RUNNING UNDER APT?
 928  003336  001406                          BEQ     68$             ;;BRANCH IF YES
 929  003340  023727  001040  000176          CMP     SWR,#SWREG      ;;SOFTWARE SWITCH REG SELECTED?
 930  003346  001005                          BNE     69$             ;;BRANCH IF NO
 931  003350  104406                          GTSWR                   ;;GET SOFT-SWR SETTINGS
 932  003352  000403                          BR      69$
 933  003354  112737  000001  001034  68$:    MOVB    #1,$AUTOB       ;;SET AUTO-MODE INDICATOR
 934  003362                          69$:
 935  003362  032777  000060  175450          BIT     #BIT4!BIT5,@SWR ;IS SLU1 TO BE TESTED
 936  003370  001003                          BNE     2$              ;IF EITHER BIT IS SET THEN DON'T TEST IT
 937  003372  052737  000001  001156          BIS     #BIT0,$DEVM     ;SET DEVICE FLAG TO TEST SLU1
 938  003400  032777  000050  175432  2$:     BIT     #BIT3!BIT5,@SWR ;IS SLU2 TO BE TESTED
 939  003406  001003                          BNE     3$              ;IF EITHER BIT IS SET THEN DON'T TEST IT
 940  003410  052737  000002  001156          BIS     #BIT1,$DEVM     ;SET DEVICE FLAG TO TEST SLU2
 941  003416  032777  000100  175414  3$:     BIT     #BIT6,@SWR      ;IS LTC TO BE TESTED
 942  003424  001003                          BNE     4$              ;IF BIT IS SET THEN DON'T TEST IT.
 943  003426  052737  000004  001156          BIS     #BIT2,$DEVM     ;SET DEVICE FLAG TO TEST LTC
 944  003434  032737  000001  001156  4$:     BIT     #BIT0,$DEVM     ;IS SLU1 UNDER TEST
 945  003442  001002                          BNE     TST1            ;IF YES TEST XMIT REG. BEFORE TYPING TITLE
 946  003444  000137  003700                  JMP     ID              ;IF NO SKIP TESTS AND TYPE IT NOW
```

```
 947
 948
 949                                    ;;**********************************************************************
 950                                    ;*TEST 1         TEST ABILITY TO ACCESS SLU1 TCSR
 951                                    ;;**********************************************************************
 952  003450  000004               TST1:   SCOPE
 953  003452  012737  000001 001104        MOV     #1,$TESTN       ;;SET TEST NUMBER IN APT MAIL BOX
 954  003460  013703  000004               MOV     @#4,R3          ;SAVE TIMEOUT VECTOR
 955  003464  012737  003500 000004        MOV     #1$,@#4         ;SET UP TIMEOUT VECTOR
 956  003472  005777  177306               TST     @CTCSR          ;REFERENCE THE XMIT COMMAND/STATUS REG.
 957  003476  000405                       BR      2$              ; GO TO END OF TEST
 958  003500  022626               1$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER TIMEOUT
 959  003502  004737  016004               JSR     PC,$ATY4                ;;ONLY REPORT A FATAL ERROR
 960  003506  000001                       1                               ;;THE ERROR NUMBER (FROM APT LIST)
 961  003510  000000                       HALT
 962  003512  010337  000004       2$:     MOV     R3,@#4          ;RESTORE TIMEOUT VECTOR
 963
 964
 965
 966                                    ;;**********************************************************************
 967                                    ;*TEST 2         TEST ABILITY TO ACCESS SLU1 TBUF
 968                                    ;;**********************************************************************
 969  003516  000004               TST2:   SCOPE
 970  003520  012737  000002 001104        MOV     #2,$TESTN       ;;SET TEST NUMBER IN APT MAIL BOX
 971  003526  013703  000004               MOV     @#4,R3          ;SAVE TIMEOUT VECTOR
 972  003532  012737  003546 000004        MOV     #1$,@#4         ;SET UP TIMEOUT VECTOR
 973  003540  005777  177242               TST     @CTBUF          ;REFERENCE THE XMIT BUFFER
 974  003544  000405                       BR      2$              ;GO TO END OF  TEST
 975  003546  022626               1$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER TIMEOUT
 976  003550  004737  016004               JSR     PC,$ATY4                ;;ONLY REPORT A FATAL ERROR
 977  003554  000002                       2                               ;;THE ERROR NUMBER (FROM APT LIST)
 978  003556  000000                       HALT
 979  003560  010337  000004       2$:     MOV     R3,@#4          ;RESTORE TIMEOUT VECTOR
 980
 981
 982                                    ;;**********************************************************************
 983                                    ;*TEST 3         TEST SLU1 TCSR BIT7(DONE) CLEARS WHEN XBUF IS LOADED
 984                                    ;;**********************************************************************
 985  003564  000004               TST3:   SCOPE
 986  003566  012737  000003 001104        MOV     #3,$TESTN       ;;SET TEST NUMBER IN APT MAIL BOX
 987  003574  032737  000001 001120        BIT     #1,@#$ENV       ;ARE WE RUNNING UNDER APT
 988  003602  001405                       BEQ     70$             ;IF NO THEN DO TEST
 989  003604  005737  001106               TST     @#$PASS         ;IS THIS FIRST PASS
 990  003610  001402                       BEQ     70$             ;IF YES THEN DO THIS SERIES OF TESTS
 991  003612  000137  004726               JMP     SLU2RT          ;IF NO THEN SKIP THIS SERIES OF TESTS
 992  003616  005077  177164       70$:    CLR     @CTBUF          ;LOAD XBUF
 993  003622  105777  177156               TSTB    @CTCSR          ;CHECK DONE
 994  003626  100011                       BPL     1$              ;BR IF CLEAR
 995                                                                ;FILL SECOND BUFFER, BECAUSE REFRESH COULD CAUSE
 996                                                                ;   FIRST TEST TO FAIL
 997  003630  005077  177152               CLR     @CTBUF          ;FILL DOUBLE BUFFER
 998  003634  105777  177144               TSTB    @CTCSR          ;CHECK DONE
 999  003640  100004                       BPL     1$              ;BR IF CLEAR
1000  003642  004737  016004               JSR     PC,$ATY4                ;;ONLY REPORT A FATAL ERROR
1001  003646  000003                       3                               ;;THE ERROR NUMBER (FROM APT LIST)
1002  003650  000000                       HALT                    ;TCSR "DONE" NOT CLEARED WITH TBUF FULL
```

```
1003  003652  005000                    1$:     CLR     R0              ;CLEAR TIMER
1004  003654  105777  177124            2$:     TSTB    @CTCSR          ;CHECK FOR XMIT DONE
1005  003660  100407                            BMI     ID              ;IF DONE SETS, BR TO END OF TEST
1006  003662  005200                            INC     R0              ;INCREMENT TIMER
1007  003664  001373                            BNE     2$              ;BR IF TIMER NOT DONE
1008  003666  004737  016004                    JSR     PC,$ATY4                ;;ONLY REPORT A FATAL ERROR
1009  003672  000004                            4                       ;;THE ERROR NUMBER (FROM APT LIST)
1010  003674  000000                            HALT
1011  003676  000416                            BR      TST4            ;BR TO NEXT TEST, AND SKIP THE TYPEOUT THAT FOLLOWS
1012                                                                    ;  BECAUSE OF THIS FAILURE
1013
1014  003700  023737  000042  000046    ID:     CMP     @#42,@#46       ;UNDER ACT11?
1015  003706  001412                            BEQ     6$              ;IF YES, SKIP IDENT. TYPEOUT
1016  003710  005737  001106                    TST     $PASS           ;IS THIS THE FIRST PASS?
1017  003714  001007                            BNE     6$              ;IF NOT BR TO NEXT TEST & SKIP THE IDENTIFICATION TYPEOU
1018  003716  005737  001110                    TST     $DEVCT          ;IS THIS THE FIRST SUBPASS?
1019  003722  001004                            BNE     6$              ;IF NOT, BRTO NEXT TEST
1020  003724  104401                            TYPE                    ;TYPE PROGRAM INDENTIFICATION
1021  003726  030176                            M1
1022  003730  104401                            TYPE                    ;TYPE NUMBER OF DEVICES UNDER TEST
1023  003732  030210                            M2
1024  003734                            6$:
1025
1026                                    ;;**********************************************************************
1027                                    ;*TEST 4         TEST THAT SLU1 TCSR "DONE" SETS WITH RESET
1028                                    ;;**********************************************************************
1029  003734  000004                    TST4:   SCOPE
1030  003736  012737  000004  001104            MOV     #4,$TESTN       ;;SET TEST NUMBER IN APT MAIL BOX
1031  003744  032737  000001  001156            BIT     #BIT0,@#$DEVM   ;DO THESE TESTS FOR THIS DEVICE?
1032  003752  001002                            BNE     99$             ;F YES CONTINUE WITH TESTS
1033  003754  000137  004726                    JMP     SLU2RT          ;IF NO GO TO START OF NEXT SET OF TESTS.
1034  003760                            99$:
1035  003760  005077  177022                    CLR     @CTBUF          ;LOAD TRANSMIT BUFFER
1036  003764  105777  177014            1$:     TSTB    @CTCSR          ;WAIT FOR DONE
1037  003770  100375                            BPL     1$
1038  003772  005077  177010                    CLR     @CTBUF          ;LOAD SECOND BUFFER
1039  003776  000240                            NOP
1040  004000  000005                            RESET                   ;CLEAR DONE WITH RESET
1041  004002  105777  176776                    TSTB    @CTCSR          ;CHECK FOR DONE SET
1042  004006  100401                            BMI     TST5            ;BR TO NEXT TEST IF DONE SET
1043
1044  004010  104005                            ERROR   5               ;TCSR "DONE" DOES NOT SET WITH RESET
1045
1046
1047
1048                                    ;;**********************************************************************
1049                                    ;*TEST 5         TEST ABILITY TO ACCESS SLU1 RCSR
1050                                    ;;**********************************************************************
1051  004012  000004                    TST5:   SCOPE
1052  004014  012737  000005  001104            MOV     #5,$TESTN       ;;SET TEST NUMBER IN APT MAIL BOX
1053  004022  013703  000004                    MOV     @#4,R3          ;SAVE TIMEOUT VECTOR
1054  004026  012737  004042  000004            MOV     #1$,@#4         ;SET UP TIMEOUT VECTOR
1055  004034  005777  176740                    TST     @CRCSR          ;ACCESS RCSR
1056  004040  000402                            BR      2$              ;BR TO END OF TEST
1057
1058  004042  022626                    1$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER TIMEOUT
```

```
1059  004044  104006                          ERROR   6               ;CAN NOT ACCESS RCSR
1060  004046  010337  000004          2$:     MOV     R3,@#4          ;RESTORE TIMEOUT VECTOR
1061
1062
1063                                  ;;*******************************************************************
1064                                  ;*TEST 6         TEST ABILITY TO ACCESS SLU1 RBUF
1065                                  ;;*******************************************************************
1066  004052  000004                  TST6:   SCOPE
1067  004054  012737  000006  001104          MOV     #6,$TESTN       ;;SET TEST NUMBER IN APT MAIL BOX
1068  004062  013703  000004                  MOV     @#4,R3          ;SAVE TIMEOUT VECTOR
1069  004066  012737  004102  000004          MOV     #1$,@#4         ;SET UP TIMEOUT VECTOR
1070  004074  005777  176702                  TST     @#RBUF          ;ACCESS RBUF
1071  004100  000402                          BR      2$              ;BR TO END OF TEST
1072
1073  004102  022626                  1$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER TIMEOUT
1074  004104  104007                          ERROR   7               ;CAN NOT ACCESS RBUF
1075  004106  010337  000004          2$:     MOV     R3,@#4          ;RESTORE TIMEOUT VECTOR
1076
1077
1078
1079                                  ;;*******************************************************************
1080                                  ;*TEST 7         TEST THAT SLU1 BIT2(MAINT. BIT) CAN BE SET & RESET
1081                                  ;;*******************************************************************
1082  004112  000004                  TST7:   SCOPE
1083  004114  012737  000007  001104          MOV     #7,$TESTN       ;;SET TEST NUMBER IN APT MAIL BOX
1084  004122  042777  000004  176654          BIC     #BIT2,@#TCSR    ;MAKE SURE BIT UNDER TEST IS INITIALIZED
1085  004130  032777  000004  176646          BIT     #BIT2,@#TCSR    ;TEST FOR BIT2 OF TCSR CLEAR
1086  004136  001404                          BEQ     1$              ;BR IF CLEAR
1087  004140  004737  016004                  JSR     PC,$ATY4                ;;ONLY REPORT A FATAL ERROR
1088  004144  000010                          10                      ;;THE ERROR NUMBER (FROM APT LIST)
1089  004146  000000                          HALT
1090  004150  052777  000004  176626  1$:     BIS     #BIT2,@#TCSR    ;SET BIT2 OF TCSR
1091  004156  032777  000004  176620          BIT     #BIT2,@#TCSR    ;TEST FOR BIT2 SET
1092  004164  001001                          BNE     2$              ;BR IF SET
1093  004166  104011                          ERROR   11              ;BIT2 OF TCSR WILL NOT SET
1094  004170  042777  000004  176606  2$:     BIC     #BIT2,@#TCSR    ;CLEAR BIT2 OF TCSR
1095  004176  032777  000004  176600          BIT     #BIT2,@#TCSR    ;TEST BIT2 CLEAR
1096  004204  001404                          BEQ     3$              ;BR IF CLEAR
1097  004206  004737  016004                  JSR     PC,$ATY4                ;;ONLY REPORT A FATAL ERROR
1098  004212  000012                          12                      ;;THE ERROR NUMBER (FROM APT LIST)
1099  004214  000000                          HALT                    ;BIT0 OF TCSR WILL NOT CLEAR
1100  004216  052777  000004  176560  3$:     BIS     #BIT2,@#TCSR    ;SET BIT2 OF TCSR
1101  004224  000005                          RESET                   ;CLEAR BIT2 WITH RESET
1102  004226  032777  000004  176550          BIT     #BIT2,@#TCSR    ;TEST FOR BIT2 CLEAR
1103  004234  001404                          BEQ     TST10           ;IF CLEAR, GO TO NEXT TEST
1104  004236  042777  000004  176540          BIC     #BIT2,@#TCSR    ;CLEAR BIT2, TO PRINT ERROR
1105  004244  104013                          ERROR   13
1106                                                                  ;RESET DID NOT CLEAR BIT2 OF TCSR
1107
1108
1109                                  ;;*******************************************************************
1110                                  ;*TEST 10        TEST THAT SLU1 BIT6(XMIT INT EN) CAN BE SET & RESET
1111                                  ;;*******************************************************************
1112  004246  000004                  TST10:  SCOPE
1113  004250  012737  000010  001104          MOV     #10,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1114  004256  042777  000100  176520          BIC     #BIT6,@#TCSR    ;MAKE SURE BIT UNDER TEST IS INITIALIZED
```

```
1115  004264  017703  176536          MOV     @CTVECT,R3      ;SAVE XMIT VECTOR
1116  004270  012777  004320  176530  MOV     #1$,@CTVECT     ;SET UP INTERRUPT VECTOR FOR ERROR REPORT
1117  004276  004737  015056          JSR     PC,WRPSW                ;SET PSW TO PRIORITY=7
1118  004302  000340                  .WORD   340
1119  004304  032777  000100  176472  BIT     #BIT6,@CTCSR    ;TEST BIT6 OF TCSR
1120  004312  001404                  BEQ     2$              ;BR IF ZERO
1121  004314  104014                  ERROR   14
1122                                                          ;BIT6 IN TCSR NOT CLEAR AFTER RESET
1123  004316  000402                  BR      2$
1124
1125  004320  022626          1$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1126  004322  104015                  ERROR   15
1127                                                          ;XMIT INTERRUPT OCCURRED  PRIO=7
1128
1129  004324  052777  000100  176452  2$:     BIS     #BIT6,@CTCSR    ;SET BIT6 OF TCSR
1130  004332  032777  000100  176444  BIT     #BIT6,@CTCSR    ;TEST BIT6 OF TCSR
1131  004340  001001                  BNE     3$              ;BR, IF SET
1132
1133  004342  104016                  ERROR   16
1134                                                          ;CANNOT SET BIT6 OF TCSR
1135
1136  004344  042777  000100  176432  3$:     BIC     #BIT6,@CTCSR    ;CLEAR BIT6 OF TCSR
1137  004352  032777  000100  176424  BIT     #BIT6,@CTCSR    ;TEST BIT6 OF TCSR
1138  004360  001401                  BEQ     4$              ;BR IF CLEAR
1139  004362  104017                  ERROR   17
1140                                                          ;CANNOT CLEAR BIT6 OF TCSR
1141
1142  004364                  4$:
1143  004364  052777  000100  176412  BIS     #BIT6,@CTCSR    ;SET BIT6 OF TCSR
1144  004372  000005                  RESET                   ;CLEAR BIT6 WITH RESET
1145  004374  032777  000100  176402  BIT     #BIT6,@CTCSR    ;TEST BIT6 OF TCSR
1146  004402  001401                  BEQ     5$              ;BR IF CLEAR
1147
1148  004404  104020                  ERROR   20
1149                                                          ;CANNOT CLEAR BIT6 OF TCSR WITH RESET
1150  004406  010377  176414          5$:     MOV     R3,@CTVECT      ;RESTORE XMIT VECTOR
1151
1152
1153                                  ;;**********************************************************************
1154                                  ;*TEST 11        TEST THAT SLU1 BIT6 OF RCSR CAN BE SET & RESET
1155                                  ;;**********************************************************************
1156  004412  000004                  TST11:  SCOPE
1157  004414  012737  000011  001104          MOV     #11,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1158  004422  042777  000100  176350          BIC     #BIT6,@CRCSR    ;MAKE SURE BIT UNDER TEST IS INITIALIZED
1159  004430  017703  176366                  MOV     @CRVECT,R3      ;SAVE RECEIVE VECTOR
1160  004434  012777  004464  176360          MOV     #1$,@CRVECT     ;SET UP INTERRUPT VECTOR FOR ERROR REPORT
1161  004442  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY=7
1162  004446  000340                          .WORD   340
1163  004450  032777  000100  176322          BIT     #BIT6,@CRCSR    ;TEST BIT6 OF RCSR
1164  004456  001404                          BEQ     2$
1165  004460  104021                          ERROR   21
1166                                                          ;BIT6 OF RCSR NOT CLEAR AFTER RESET
1167  004462  000402                          BR      2$
1168
1169  004464  022626                  1$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1170  004466  104022                          ERROR   22
```

```
1171                                                        ;RCVR INTERRUPT WITH PRIORITY
1172
1173  004470  052777  000100  176302  2$:     BIS     #BIT6,@RCRCSR   ;SET BIT6 OF RCSR
1174  004476  032777  000100  176274          BIT     #BIT6,@RCRCSR   ;TEST BIT6 OF RCSR
1175  004504  001001                          BNE     3$              ;BR, IF SET
1176
1177  004506  104023                          ERROR   23
1178                                                        ;CANNOT SET BIT6 OF RCSR
1179
1180  004510  042777  000100  176262  3$:     BIC     #BIT6,@RCRCSR   ;CLEAR BIT6 OF RCSR
1181  004516  032777  000100  176254          BIT     #BIT6,@RCRCSR   ;TEST BIT6 OF RCSR
1182  004524  001401                          BEQ     4$              ;BR, IF CLEAR
1183
1184  004526  104024                          ERROR   24
1185                                                        ;CANNOT CLEAR BIT6 OF RCSR
1186
1187  004530                          4$:
1188  004530  052777  000100  176242          BIS     #BIT6,@RCRCSR   ;SET BIT6 OF RCSR
1189  004536  000005                          RESET                   ;CLEAR BIT6OF RCSR WITH RESET
1190  004540  032777  000100  176232          BIT     #BIT6,@RCRCSR   ;TEST BIT6 OF RCSR
1191  004546  001401                          BEQ     5$              ;BR, IF CLEAR
1192
1193  004550  104025                          ERROR   25
1194                                                        ;CANNOT CLEAR BIT6 OF RCSR WITH RESET
1195  004552  010377  176244          5$:     MOV     R3,@CRVECT      ;RESTORE RECEIVE VECTOR
1196
1197
1198
1199                          ;;**************************************************************
1200                          ;*TEST 12        TEST THAT SLU1 RCVR DONE (7) SET & CLEAR PROPERLY
1201                          ;;**************************************************************
1202  004556  000004          TST12:  SCOPE
1203  004560  012737  000012  001104          MOV     #12,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1204  004566  052777  000004  176210          BIS     #BIT2,@CTCSR    ;TURN ON INTERNAL MAINTENENCE WRAP AROUND
1205  004574  005000                          CLR     R0              ;CLEAR TIMER
1206  004576  005077  176204                  CLR     @CTBUF          ;LOAD TRANSMIT BUFFER
1207  004602  105777  176172          CWDONE: TSTB    @CRCSR          ;CHECK FOR RECEIVER DONE
1208  004606  100406                          BMI     1$              ;BR, IF DONE
1209  004610  005200                          INC     R0              ;INCREMENT TIMER, IF NOT DONE
1210  004612  001373                          BNE     CWDONE          ;CONTINUE WAIT IF TIME REMAINS
1211  004614  042777  000004  176162          BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1212  004622  104026                          ERROR   26
1213                                                        ;RECEIVER DONE NEVER SET
1214
1215  004624  000005          1$:     RESET                   ;CLEAR DONE WITH RESET
1216  004626  105777  176146                  TSTB    @CRCSR          ;CHECK FOR DONE CLEAR
1217  004632  001404                          BEQ     2$
1218
1219  004634  042777  000004  176142          BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1220  004642  104027                          ERROR   27
1221                                                        ;RESET DID NOT CLEAR RCVR DONE
1222
1223  004644  042777  000004  176126  2$:     BIC     #BIT2,@RCRCSR   ;CLEAR MAINTENANCE BIT
1224
1225
1226                          ;;**************************************************************
```

```
1227                                    ;*TEST 13       TEST SLU1 THAT READING RBUF CLEARS RECEIVER DONE
1228                                    ;;*****************************************************************
1229  004652  000004                    TST13:  SCOPE
1230  004654  012737  000013  001104            MOV     #13.$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1231  004662  000005                            RESET                   ;CLEAR EVERYTHING
1232  004664  052777  000004  176112            BIS     #BIT2,@CTCSR    ;SET MAINTENANCE WRAP
1233  004672  005077  176110                    CLR     @CTBUF          ;LOAD TRANSMITTER
1234  004676  105777  176076            1$:     TSTB    @CRCSR          ;WAIT FOR RECEIVER DONE
1235  004702  100375                            BPL     1$
1236  004704  017700  176072                    MOV     @CRBUF,R0       ;READ RECEIVE BUFFER
1237  004710  042777  000004  176066            BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1238  004716  105777  176056                    TSTB    @CRCSR          ;CHECK FOR RECEIVE DONE CLEAR
1239  004722  001401                            BEQ     TST14           ;BR. IF CLEAR TO NEXT TEST
1240  004724  104030                            ERROR   30
1241                                                                    ;READING RBUF DID NOT CLEAR RCVR DONE
```

```
1242  004726                          SLU2RT:
1243
1244                                  ;;*****************************************************************
1245                                  ;*TEST 14       TEST ABILITY TO ACCESS SLU2 TCSR
1246                                  ;;*****************************************************************
1247  004726  000004                  TST14:  SCOPE
1248  004730  012737  000014  001104          MOV     #14,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1249  004736  032737  000002  001156          BIT     #BIT1,@#DEVM    ;DO THESE TESTS FOR THIS DEVICE?
1250  004744  001002                          BNE     99$             ;F YES CONTINUE WITH TESTS
1251  004746  000137  006152                  JMP     LTCRT           ;IF NO GO TO START OF NEXT SET OF TESTS.
1252  004752                          99$:
1253  004752  013703  000004                  MOV     @#4,R3          ;SAVE TIMEOUT VECTOR
1254  004756  012737  004772  000004          MOV     #1$,@#4         ;SET UP TIMEOUT VECTOR
1255  004764  005777  176004                  TST     @TCSR           ;REFERENCE THE XMIT COMMAND/STATUS REG.
1256  004770  000402                          BR      2$              ; GO TO END OF TEST
1257  004772  022626                  1$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER TIMEOUT
1258  004774  104031                          ERROR   31              ;XMIT CSR ADDRESS DOES NOT RETURN SSYNC
1259  004776  010337  000004          2$:     MOV     R3,@#4          ;RESTORE TIMEOUT VECTOR
1260
1261
1262
1263                                  ;;*****************************************************************
1264                                  ;*TEST 15       TEST ABILITY TO ACCESS SLU2 TBUF
1265                                  ;;*****************************************************************
1266  005002  000004                  TST15:  SCOPE
1267  005004  012737  000015  001104          MOV     #15,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1268  005012  013703  000004                  MOV     @#4,R3          ;SAVE TIMEOUT VECTOR
1269  005016  012737  005032  000004          MOV     #1$,@#4         ;SET UP TIMEOUT VECTOR
1270  005024  005777  175746                  TST     @TBUF           ;REFERENCE THE XMIT BUFFER
1271  005030  000402                          BR      2$              ;GO TO END OF  TEST
1272  005032  022626                  1$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER TIMEOUT
1273  005034  104032                          ERROR   32              ;XMIT BUFFER ADDRESS DOES NOT REUTRN SSYNC
1274  005036  010337  000004          2$:     MOV     R3,@#4          ;RESTORE TIMEOUT VECTOR
1275
1276
1277                                  ;;*****************************************************************
1278                                  ;*TEST 16       TEST SLU2 TCSR BIT7(DONE) CLEARS WHEN XBUF IS LOADED
1279                                  ;;*****************************************************************
1280  005042  000004                  TST16:  SCOPE
1281  005044  012737  000016  001104          MOV     #16,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1282  005052  032737  000001  001120          BIT     #1, @#ENV       ;ARE WE RUNNING UNDER APT
1283  005060  001403                          BEQ     70$             ;IF NO THEN DO TEST
1284  005062  005737  001106                  TST     @#PASS          ;IS THIS FIRST PASS
1285  005066  001022                          BNE     TST17           ;IF NO THEN SKIP TO NEXT TEST
1286  005070                          70$:
1287  005070  005077  175702                  CLR     @TBUF           ;LOAD XBUF
1288  005074  105777  175674                  TSTB    @TCSR           ;CHECK DONE
1289  005100  100006                          BPL     1$              ;BR IF CLEAR
1290                                                                  ;FILL SECOND BUFFER, BECAUSE REFRESH COULD CAUSE
1291                                                                  ;   FIRST TEST TO FAIL
1292  005102  005077  175670                  CLR     @TBUF           ;FILL DOUBLE BUFFER
1293  005106  105777  175662                  TSTB    @TCSR           ;CHECK DONE
1294  005112  100001                          BPL     1$              ;BR IF CLEAR
1295  005114  104033                          ERROR   33              ;TCSR "DONE" NOT CLEARED WITH TBUF FULL
1296  005116  005000                  1$:     CLR     R0              ;CLEAR TIMER
1297  005120  105777  175650          2$:     TSTB    @TCSR           ;CHECK FOR XMIT DONE
```

```
1298  005124  100403                          BMI     TST17           ;IF DONE SETS, BR TO NEXT TEST
1299  005126  005200                          INC     R0              ;INCREMENT TIMER
1300  005130  001373                          BNE     2$              ;BR IF TIMER NOT DONE
1301  005132  104034                          ERROR   34              ;XMIT DONE BIT DOES NOT RESET AFTER TRANSMIT
1302
1303
1304                                    ;;*******************************************************************
1305                                    ;*TEST 17        TEST THAT SLU2 TCSR "DONE" SETS WITH RESET
1306                                    ;;*******************************************************************
1307  005134  000004                    TST17:  SCOPE
1308  005136  012737  000017  001104            MOV     #17,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
1309  005144  032737  000001  001120            BIT     #1, @#ENV       ;ARE WE RUNNING UNDER APT
1310  005152  001403                          BEQ     70$             ;IF NO THEN DO TEST
1311  005154  005737  001106                  TST     @#PASS          ;IS THIS FIRST PASS
1312  005160  001015                          BNE     TST20           ;IF NO THEN SKIP TO NEXT TEST
1313  005162                            70$:
1314  005162  005077  175610                  CLR     @TBUF           ;LOAD TRANSMIT BUFFER
1315  005166  105777  175602            1$:   TSTB    @TCSR           ;WAIT FOR DONE
1316  005172  100375                          BPL     1$
1317  005174  005077  175576                  CLR     @TBUF           ;LOAD SECOND BUFFER
1318  005200  000240                          NOP
1319  005202  000005                          RESET                   ;CLEAR DONE WITH RESET
1320  005204  105777  175564                  TSTB    @TCSR           ;CHECK FOR DONE SET
1321  005210  100401                          BMI     TST20           ;BR TO NEXT TEST IF DONE SET
1322
1323  005212  104035                          ERROR   35              ;TCSR "DONE" DOES NOT SET WITH RESET
1324
1325
1326
1327                                    ;;*******************************************************************
1328                                    ;*TEST 20        TEST ABILITY TO ACCESS SLU2 RCSR
1329                                    ;;*******************************************************************
1330  005214  000004                    TST20:  SCOPE
1331  005216  012737  000020  001104            MOV     #20,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
1332  005224  013703  000004                    MOV     @#4,R3          ;SAVE TIMEOUT VECTOR
1333  005230  012737  005244  000004            MOV     #1$,@#4         ;SET UP TIMEOUT VECTOR
1334  005236  005777  175526                    TST     @RCSR           ;ACCESS RCSR
1335  005242  000402                          BR      2$              ;BR TO END OF TEST
1336
1337  005244  022626                    1$:   CMP     (SP)+,(SP)+     ;RESTORE SP AFTER TIMEOUT
1338  005246  104036                          ERROR   36              ;CAN NOT ACCESS RCSR
1339  005250  010337  000004            2$:   MOV     R3,@#4          ;RESTORE TIMEOUT VECTOR
1340
1341
1342
1343                                    ;;*******************************************************************
1344                                    ;*TEST 21        TEST ABILITY TO ACCESS SLU2 RBUF
1345                                    ;;*******************************************************************
1346  005254  000004                    TST21:  SCOPE
1347  005256  012737  000021  001104            MOV     #21,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
1348  005264  013703  000004                    MOV     @#4,R3          ;SAVE TIMEOUT VECTOR
1349  005270  012737  005304  000004            MOV     #1$,@#4         ;SET UP TIMEOUT VECTOR
1350  005276  005777  175470                    TST     @RBUF           ;ACCESS RBUF
1351  005302  000402                          BR      2$              ;BR TO END OF TEST
1352
1353  005304  022626                    1$:   CMP     (SP)+,(SP)+     ;RESTORE SP AFTER TIMEOUT
```

```
1354  005306  104037                        ERROR   37              ;CAN NOT ACCESS RBUF
1355  005310  010337  000004          2$:    MOV     R3,@#4          ;RESTORE TIMEOUT VECTOR
1356
1357
1358
1359                                  ;;*****************************************************************
1360                                  ;*TEST 22       TEST SLU2 BIT0(BREAK BIT) CAN BE SET & CLEARED & RESET
1361                                  ;;*****************************************************************
1362  005314  000004                TST22:  SCOPE
1363  005316  012737  000022  001104        MOV     #22,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
1364  005324  042777  000001  175442        BIC     #BIT0,@TCSR     ;MAKE SURE BIT UNDER TEST IS INITIALIZED
1365  005332  032777  000001  175434        BIT     #BIT0,@TCSR     ;CHECK BIT0 OF TCSR CLEAR
1366  005340  001401                        BEQ     1$              ;BR IF CLEAR
1367  005342  104040                        ERROR   40              ;BIT0 WAS NOT CLEAR AFTER RESET
1368  005344  052777  000001  175422  1$:   BIS     #BIT0,@TCSR     ;SET BIT0 IN TCSR
1369  005352  032777  000001  175414        BIT     #BIT0,@TCSR     ;TEST BIT0 OF TCSR
1370  005360  001001                        BNE     2$              ;BR IF SET
1371  005362  104041                        ERROR   41              ;BIT0 OF TCSR WILL NOT SET
1372  005364  042777  000001  175402  2$:   BIC     #BIT0,@TCSR     ;CLEAR BIT0 OF TCSR
1373  005372  032777  000001  175374        BIT     #BIT0,@TCSR     ;TEST BIT0 OF TCSR
1374  005400  001401                        BEQ     3$
1375  005402  104042                        ERROR   42              ;BIT0 OF TCSR WILL NOT CLEAR
1376  005404                          3$:
1377  005404  032737  000001  001120        BIT     #1, @#ENV       ;ARE WE RUNNING UNDER APT
1378  005412  001403                        BEQ     70$             ;IF NO THEN DO TEST
1379  005414  005737  001106                TST     @#PASS          ;IS THIS FIRST PASS
1380  005420  001014                        BNE     TST23           ;IF NO THEN SKIP TO NEXT TEST
1381  005422                          70$:
1382  005422  052777  000001  175344        BIS     #BIT0,@TCSR     ;SET BIT0 IN TCSR
1383  005430  000005                        RESET                   ;CLEAR BIT0 WITH RESET
1384  005432  032777  000001  175334        BIT     #BIT0,@TCSR     ;TEST BIT0 CLEAR
1385  005440  001404                        BEQ     TST23           ;BR IF CLEAR
1386  005442  042777  000001  175324        BIC     #BIT0,@TCSR     ;CLEAR BIT0, TO PRINT ERROR
1387  005450  104043                        ERROR   43              ;RESET DID NOT CLEAR BIT0 OF TCSR
1388
1389
1390                                  ;;*****************************************************************
1391                                  ;*TEST 23       TEST THAT SLU2 BIT6(XMIT INT EN) CAN BE SET & RESET
1392                                  ;;*****************************************************************
1393  005452  000004                TST23:  SCOPE
1394  005454  012737  000023  001104        MOV     #23,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
1395  005462  042777  000100  175304        BIC     #BIT6,@TCSR     ;MAKE SURE BIT UNDER TEST IS INITIALIZED
1396  005470  017703  175322                MOV     @TVECT,R3       ;SAVE XMIT VECTOR
1397  005474  012777  005524  175314        MOV     #1$,@TVECT      ;SET UP INTERRUPT VECTOR FOR ERROR REPORT
1398  005502  004737  015056                JSR     PC,WRPSW                ;SET PSW TO PRIORITY=7
1399  005506  000340                                .WORD   340
1400  005510  032777  000100  175256        BIT     #BIT6,@TCSR     ;TEST BIT6 OF TCSR
1401  005516  001404                        BEQ     2$              ;BR IF ZERO
1402  005520  104044                        ERROR   44
1403                                                                ;BIT6 IN TCSR NOT CLEAR AFTER RESET
1404  005522  000402                        BR      2$
1405
1406  005524  022626                  1$:   CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1407  005526  104045                        ERROR   45
1408                                                                ;XMIT INTERRUPT OCCURRED  PRIO=7
1409
```

```
1410  005530  052777  000100  175236  2$:     BIS     @#BIT6,@TCSR      ;SET BIT6 OF TCSR
1411  005536  032777  000100  175230          BIT     @#BIT6,@TCSR      ;TEST BIT6 OF TCSR
1412  005544  001001                          BNE     3$                ;BR, IF SET
1413
1414  005546  104046                          ERROR   46
1415                                                                    ;CANNOT SET BIT6 OF TCSR
1416
1417  005550  042777  000100  175216  3$:     BIC     @#BIT6,@TCSR      ;CLEAR BIT6 OF TCSR
1418  005556  032777  000100  175210          BIT     @#BIT6,@TCSR      ;TEST BIT6 OF TCSR
1419  005564  001401                          BEQ     4$                ;BR IF CLEAR
1420  005566  104047                          ERROR   47
1421                                                                    ;CANNOT CLEAR BIT6 OF TCSR
1422
1423  005570  032737  000001  001120  4$:     BIT     #1,@#$ENV         ;ARE WE RUNNING UNDER APT
1424  005576  001403                          BEQ     70$               ;IF NO THEN DO TEST
1425  005600  005737  001106                  TST     @#$PASS           ;IS THIS FIRST PASS
1426  005604  001011                          BNE     5$                ;IF NO THEN SKIP TO END OF TEST
1427  005606                          70$:
1428  005606  052777  000100  175160          BIS     @#BIT6,@TCSR      ;SET BIT6 OF TCSR
1429  005614  000005                          RESET                     ;CLEAR BIT6 WITH RESET
1430  005616  032777  000100  175150          BIT     @#BIT6,@TCSR      ;TEST BIT6 OF TCSR
1431  005624  001401                          BEQ     5$                ;BR IF CLEAR
1432
1433  005626  104050                          ERROR   50
1434                                                                    ;CANNOT CLEAR BIT6 OF TCSR WITH RESET
1435  005630  010377  175162          5$:     MOV     R3,@TVECT         ;RESTORE XMIT VECTOR
1436
1437
1438                                  ;;**********************************************************************
1439                                  ;*TEST 24        TEST THAT SLU2 BIT6 OF RCSR CAN BE SET & RESET
1440                                  ;;**********************************************************************
1441  005634  000004                  TST24:  SCOPE
1442  005636  012737  000024  001104          MOV     #24,@#$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1443  005644  042777  000100  175116          BIC     @#BIT6,@RCSR      ;MAKE SURE BIT UNDER TEST IS INITIALIZED
1444  005652  017703  175134                  MOV     @RVECT,R3         ;SAVE RECEIVE VECTOR
1445  005656  012777  005706  175126          MOV     #1$,@RVECT        ;SET UP INTERRUPT VECTOR FOR ERROR REPORT
1446  005664  004737  015056                  JSR     PC,@#RPSW         ;SET PSW TO PRIORITY=7
1447  005670  000340                          .WORD   340
1448  005672  032777  000100  175070          BIT     @#BIT6,@RCSR      ;TEST BIT6 OF RCSR
1449  005700  001404                          BEQ     2$
1450  005702  104051                          ERROR   51
1451                                                                    ;BIT6 OF RCSR NOT CLEAR AFTER RESET
1452  005704  000402                          BR      2$
1453
1454  005706  022626                  1$:     CMP     (SP)+,(SP)+       ;RESTORE SP AFTER INTERRUPT
1455  005710  104052                          ERROR   52
1456                                                                    ;RCVR INTERRUPT WITH PRIORITY=7
1457
1458  005712  052777  000100  175050  2$:     BIS     @#BIT6,@RCSR      ;SET BIT6 OF RCSR
1459  005720  032777  000100  175042          BIT     @#BIT6,@RCSR      ;TEST BIT6 OF RCSR
1460  005726  001001                          BNE     3$                ;BR, IF SET
1461
1462  005730  104053                          ERROR   53
1463                                                                    ;CANNOT SET BIT6 OF RCSR
1464
1465  005732  042777  000100  175030  3$:     BIC     @#BIT6,@RCSR      ;CLEAR BIT6 OF RCSR
```

```
1466  005740  032777  000100  175022          BIT     #BIT6,@RCSR     ;TEST BIT6 OF RCSR
1467  005746  001401                          BEQ     4$              ;BR, IF CLEAR
1468
1469  005750  104054                          ERROR   54
1470                                                                  ;CANNOT CLEAR BIT6 OF RCSR
1471
1472  005752  032737  000001  001120  4$:     BIT     #1,@#$ENV       ;ARE WE RUNNING UNDER APT
1473  005760  001403                          BEQ     70$             ;IF NO THEN DO TEST
1474  005762  005737  001106                  TST     @#$PASS         ;IS THIS FIRST PASS
1475  005766  001011                          BNE     5$              ;IF NO THEN SKIP TO END OF TEST
1476  005770                          70$:
1477  005770  052777  000100  174772          BIS     #BIT6,@RCSR     ;SET BIT6 OF RCSR
1478  005776  000005                          RESET                   ;CLEAR BIT6OF RCSR WITH RESET
1479  006000  032777  000100  174762          BIT     #BIT6,@RCSR     ;TEST BIT6 OF RCSR
1480  006006  001401                          BEQ     5$              ;BR, IF CLEAR
1481
1482  006010  104055                          ERROR   55
1483                                                                  ;CANNOT CLEAR BIT6 OF RCSR WITH RESET
1484  006012  010377  174774          5$:     MOV     R3,@RVECT       ;RESTORE RECEIVE VECTOR
1485
1486
1487
1488                                  ;;**********************************************************************
1489                                  ;*TEST 25        TEST THAT SLU2 RCVR DONE (7) SET & CLEAR PROPERLY
1490                                  ;;**********************************************************************
1491  006016  000004                  TST25:  SCOPE
1492  006020  012737  000025  001104          MOV     #25,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
1493  006026  005077  174740                  CLR     @RBUF           ;INITIALIZE REGISTER BEFORE TESTING
1494  006032  005000                          CLR     R0              ;CLEAR TIMER
1495  006034  005077  174736                  CLR     @TBUF           ;LOAD TRANSMIT BUFFER
1496  006040  105777  174724          WDONE:  TSTB    @RCSR           ;CHECK FOR RECEIVER DONE
1497  006044  100403                          BMI     1$              ;BR, IF DONE
1498  006046  005200                          INC     R0              ;INCREMENT TIMER, IF NOT DONE
1499  006050  001373                          BNE     WDONE           ;CONTINUE WAIT IF TIME REMAINS
1500  006052  104056                          ERROR   56
1501                                                                  ;RECEIVER DONE NEVER SET
1502
1503  006054  032737  000001  001120  1$:     BIT #1,@#$ENV   ;ARE WE RUNNING UNDER APT
1504  006062  001403                          BEQ     70$             ;IF NO THEN DO TEST
1505  006064  005737  001106                  TST     @#$PASS         ;IS THIS FIRST PASS
1506  006070  001005                          BNE     2$              ;IF NO THEN SKIP TO END OF TEST
1507  006072                          70$:
1508  006072  000005                          RESET                   ;CLEAR DONE WITH RESET
1509  006074  105777  174670                  TSTB    @RCSR           ;CHECK FOR DONE CLEAR
1510  006100  001401                          BEQ     2$
1511
1512  006102  104057                          ERROR   57
1513                                                                  ;RESET DID NOT CLEAR RCVR DONE
1514  006104  005777  174662          2$:     TST     @RBUF           ;CLEAR RECEIVER BUFFER
1515
1516
1517
1518                                  ;;**********************************************************************
1519                                  ;*TEST 26        TEST SLU2 THAT READING RBUF CLEARS RECEIVER DONE
1520                                  ;;**********************************************************************
1521  006110  000004                  TST26:  SCOPE
```

```
1522  006112  012737  000026  001104          MOV     #26,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1523  006120  005077  174646                  CLR     @RBUF           ;INITIALIZE REGISTER BEFORE TESTING
1524  006124  005077  174646                  CLR     @TBUF           ;LOAD TRANSMITTER
1525  006130  105777  174634          1$:     TSTB    @RCSR           ;WAIT FOR RECEIVER DONE
1526  006134  100375                          BPL     1$
1527  006136  017700  174630                  MOV     @RBUF,R0        ;READ RECEIVE BUFFER
1528  006142  105777  174622                  TSTB    @RCSR           ;CHECK FOR RECEIVE DONE CLEAR
1529  006146  001401                          BEQ     TST27           ;BR, IF CLEAR TO NEXT TEST
1530  006150  104060                          ERROR   60
1531                                                                  ;READING RBUF DID NOT CLEAR RCVR DONE
1532  006152                          LTCRT:
1533
1534                                  ;;**********************************************************************
1535                                  ;*TEST 27        TEST ABILITY TO ACCESS LKS
1536                                  ;;**********************************************************************
1537  006152  000004                  TST27:  SCOPE
1538  006154  012737  000027  001104          MOV     #27,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1539  006162  032737  000004  001156          BIT     #BIT2,@#$DEVM   ;DO THESE TESTS FOR THIS DEVICE?
1540  006170  001002                          BNE     99$             ;F YES CONTINUE WITH TESTS
1541  006172  000137  006524                  JMP     UNIQUE          ;IF NO GO TO START OF NEXT SET OF TESTS.
1542  006176                          99$:
1543  006176  013703  000004                  MOV     @#4,R3          ;SAVE TIMEOUT VECTOR
1544  006202  012737  006216  000004          MOV     #1$,@#4         ;SET UP TIMEOUT VECTOR
1545  006210  005777  174574                  TST     @LKS            ;ACCESS LKS
1546  006214  000402                          BR      2$              ;NO TIMEOUT -  BR TO END OF TEST
1547
1548  006216  022626                  1$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER TIMEOUT
1549  006220  104061                          ERROR   61              ;CAN NOT ACCESS LKS
1550
1551  006222  010337  000004          2$:     MOV     R3,@#4          ;RESTORE TIMEOUT VECTOR
1552
1553                                  ;;**********************************************************************
1554                                  ;*TEST 30        TEST THAT BIT6 OF LKS CAN BE SET & RESET
1555                                  ;;**********************************************************************
1556  006226  000004                  TST30:  SCOPE
1557  006230  012737  000030  001104          MOV     #30,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1558  006236  042777  000100  174544          BIC     #BIT6,@LKS      ;MAKE SURE BIT UNDER TEST IS INITIALIZED BEFORE TESTING
1559  006244  017703  174562                  MOV     @RTCVT,R3       ;SAVE LINE CLOCK VECTOR
1560  006250  012777  006300  174554          MOV     #1$,@RTCVT      ;SET UP INTERRUPT VECTOR FOR ERROR REPORT
1561  006256  004737  015056                  JSR     PC,$RPSW        ;SET PSW TO PRIORITY 7
1562  006262  000340                                  .WORD   340
1563  006264  032777  000100  174516          BIT     #BIT6,@LKS      ;TEST BIT6 OF LKS
1564  006272  001404                          BEQ     2$
1565  006274  104062                          ERROR   62
1566                                                                  ;BIT6 OF LKS NOT CLEAR AFTER RESET
1567  006276  000402                          BR      2$
1568
1569  006300  022626                  1$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1570  006302  104063                          ERROR   63
1571                                                                  ;LKS INTERRUPT WITH PRIORITY=7
1572
1573  006304  052777  000100  174476  2$:     BIS     #BIT6,@LKS      ;SET BIT6 OF LKS
1574  006312  032777  000100  174470          BIT     #BIT6,@LKS      ;TEST BIT6 OF LKS
1575  006320  001001                          BNE     3$              ;BR IF SET
1576
1577  006322  104064                          ERROR   64
```

```
                                                        ;CANNOT SET BIT6 OF LK
                
006324 042777 000100 174456 3$:     BIC    #BIT6,@LKS      ;CLEAR BIT6 OF LKS
006332 032777 000100 174450         BIT    #BIT6,@LKS      ;TEST BIT6 OF LK
006340 001401                       BEQ    4$
006342 104065                       ERROR  65
                                                        ;CANNOT CLEAR BIT6 OF LKS
006344 032737 000001 001120 4$:     BIT    #1,@#ENV        ;ARE WE RUNNING UNDER APT
006352 001403                       BEQ    70$             ;IF NO THEN DO TEST
006354 005737 001106                TST    @#PASS          ;IS THIS FIRST PASS
006360 001011                       BNE    5$              ;IF NO THEN SKIP TO END OF TEST
006362                         70$:
006362 052777 000100 174420         BIS    #BIT6,@LKS      ;SET BIT6 OF LKS
006370 000005                       RESET                  ;CLEAR BIT6 OF LKS WITH RESET
006372 032777 000100 174410         BIT    #BIT6,@LKS      ;TEST BIT6 OF LKS
006400 001401                       BEQ    5$              ;BR IF CLEAR
                
006402 104066                       ERROR  66
                                                        ;CANNOT CLEAR BIT6 OF LKS WITH RESET
006404 010377 174422           5$:  MOV    R3,@RTCVT       ;RESTORE LINE CLOCK VECTOR
                
                
                
                                    ;;*****************************************************************
                                    ;*TEST 31       TEST THAT BIT7 OF LKS SETS & CAN BE CLEARED
                                    ;;*****************************************************************
006410 000004                  TST31: SCOPE
006412 012737 000031 001104         MOV    #31,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
006420 032737 000001 001120         BIT    #1, @#ENV       ;ARE WE RUNNING UNDER APT
006426 001403                       BEQ    70$             ;IF NO THEN DO TEST
006430 005737 001106                TST    @#PASS          ;IS THIS FIRST PASS
006434 001033                       BNE    TST32           ;IF NO THEN SKIP TO NEXT TEST
006436                         70$:
006436 000005                       RESET                  ;CLEAR EVERYTHING & SET BIT7 OF LKS
006440 105777 174344           1$:  TSTB   @LKS            ;TEST FOR BIT7 OF LKS
006444 100401                       BMI    2$              ;BR IF SET
                
006446 104067                       ERROR  67              ;BIT7 OF LKS DID NOT SET WITH RESET
                
006450 042777 000200 174332 2$:     BIC    #BIT7,@LKS      ;CLEAR BIT7 OF LKS
006456 032777 000200 174324         BIT    #BIT7,@LKS      ;TEST BIT7 OF LKS
006464 001410                       BEQ    3$
006466 042777 000200 174314         BIC    #BIT7,@LKS      ;TRY ONE MORE TIME BECAUSE THE CLOCK
006474 032777 000200 174306         BIT    #BIT7,@LKS      ;  MAY HAVE SET IMMEDIATELY AFTER THE FIRST CLEAR
006502 001401                       BEQ    3$
                
006504 104070                       ERROR  70              ;CAN NOT CLEAR BIT7 OF LKS
                
006506 005000                  3$:  CLR    R0              ;CLEAR TIMER
006510 105777 174274           CONT: TSTB   @LKS            ;TEST FOR BIT7 OF LKS
006514 100403                       BMI    TST32           ;BR, IF SET
006516 005200                       INC    R0              ;INCREMENT TIMER
006520 001373                       BNE    CONT            ;CONTINUE UNTIL TIME EXPIRES
                
006522 104071                       ERROR  71              ;BIT7 OF LKS DOES NOT SET
```

```
1634
1635  006524                                  UNIQUE:
1636
1637                                          ;;*****************************************************************
1638                                          ;*TEST 32       UNIQUE INTERNAL ADDRESS TEST
1639                                          ;;*****************************************************************
1640  006524  000004                         TST32:  SCOPE
1641  006526  012737  000032  001104                 MOV     #32,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1642  006534  032737  000001  001120                 BIT     #1,@#$ENV       ;ARE WE RUNNING UNDER APT
1643  006542  001403                                 BEQ     70$             ;IF NO THEN DO TEST
1644  006544  005737  001106                         TST     @#$PASS         ;IS THIS FIRST PASS
1645  006550  001053                                 BNE     TST33           ;IF NO THEN SKIP TO NEXT TEST
1646  006552                                  70$:
1647  006552  012737  000340  177776                 MOV     #340,PS         ;WE WILL BE PLAYING WITH BIT6
1648                                                                          ;SO LOCK OUT EXTRANEOUS INTERRUPTS
1649  006560  012700  002770                         MOV     #RCSR,R0        ;GET LOCATION OF FIRST REGISTER ADDRESS
1650  006564  012703  002770          1$:    MOV     #RCSR,R3        ;MAKE R3 POINT TO LOCATION OF FIRST
1651                                                                          ;REGISTER ADDRESS
1652  006570  012701  000011                         MOV     #11,R1          ;SET LOOP COUNTER TO CLEAR ALL REG.
1653  006574  005033                  2$:    CLR     @(R3)+          ;CLEAR A REGISTER
1654  006576  077102                         SOB     R1,2$           ;LOOP UNTIL ALL REGISTERS CLEARED
1655  006600  012770  000100  000000         MOV     #BIT6,@(R0)     ;SET TEST BIT IN DEVICE REGISTERS
1656  006606  012701  002770                 MOV     #RCSR,R1        ;GET LOCATION OF FIRST REGISTER ADDRESS
1657  006612  012702  000011                 MOV     #11,R2          ;SET UP TEST LOOP COUNTER
1658  006616  032731  000100          3$:    BIT     #BIT6,@(R1)+    ;IS TEST BIT SET IN THIS REGISTER
1659  006622  001006                         BNE     5$              ;IF YES GO SEE IF THERE IS AN ERROR
1660  006624  077204                  4$:    SOB     R2,3$           ;LOOP UNTIL ALL REGISTER CHECKED
1661  006626  020027  003010                 CMP     R0,#LKS         ;ARE WE DONE TESTING
1662  006632  001422                         BEQ     7$              ;IF YES GO TO NEXT TEST
1663  006634  005030                         CLR     @(R0)+          ;CLEAR REGISTER JUST TESTED AND POINT
1664                                                                          ;TO NEXT ONE
1665  006636  000752                         BR      1$              ;CONTINUE TESTING
1666  006640  021041                  5$:    CMP     (R0),-(R1)      ;DID WE COMPARE THE REGISTER TO ITSELF?
1667  006642  001413                         BEQ     6$              ;IF YES GET OVER ERROR CALL
1668  006644  011037  001020                 MOV     (R0),$GDADR     ;IF NO SET UP ERROR INFORMATION
1669  006650  011137  001022                 MOV     (R1),$BDADR
1670  006654  017037  000000  001024         MOV     @(R0),$GDDAT
1671  006662  017137  000000  001026         MOV     @(R1),$BDDAT
1672  006670  104072                         ERROR   72              ;WRITE TO 1 INTERNAL ADDRESS MODIFIED
1673                                                                          ;ANOTHER SO ADDRESS NOT UNIQUE
1674  006672  062701  000002          6$:    ADD     #2,R1           ;RESTORE POINTER
1675  006676  000752                         BR      4$              ;GET BACK IN TEST LOOP
1676  006700                           7$:
1677
```

```
1678  006700                                SLU1IT:
1679
1680                                        ;;**********************************************************************
1681                                        ;*TEST 33       TEST THAT SLU1 XMIT INTERRUPTS ONLY WHEN ENABLED
1682                                        ;;**********************************************************************
1683  006700  000004               TST33:  SCOPE
1684  006702  012737  000033  001104       MOV     #33,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1685  006710  032737  000001  001120       BIT     #1,@#ENV        ;IF NOT UNDER APT
1686  006716  001405                       BEQ     70$             ;  THEN RUN THIS SERIES OF TESTS
1687  006720  005737  001106              TST     @#PASS          ;  ELSE IF FIRST PASS
1688  006724  001402                       BEQ     70$             ;         THEN RUN THESE TESTS
1689  006726  000137  010600              JMP     SLU2IT          ;         ELSE DO NOT RUN THESE TESTS
1690  006732                        70$:
1691  006732  032737  000001  001156       BIT     #BIT0,@#DEVM    ;DO THESE TESTS FOR THIS DEVICE?
1692  006740  001002                       BNE     99$             ;F YES CONTINUE WITH TESTS
1693  006742  000137  010600              JMP     SLU2IT          ;IF NO GO TO START OF NEXT SET OF TESTS.
1694  006746                        99$:
1695  006746  000005                       RESET                   ;CLEAR THE WORLD
1696  006750  042777  000100  174026       BIC     #BIT6,@CTCSR    ;CLEAR TRANSMIT INTERRUPT ENABLE
1697  006756  017703  174044              MOV     @CTVECT,R3      ;SAVE XMIT VECTOR
1698  006762  012777  007006  174036       MOV     #2$,@CTVECT     ;POINT XMIT VECTOR TO ERROR REPORT
1699  006770  105777  174010        1$:   TSTB    @CTCSR          ;WAIT FOR DONE
1700  006774  100375                       BPL     1$
1701  006776  004737  015056              JSR     PC,WRPSW        ;SET PSW TO PRIORITY 3
1702  007002  000140                                .WORD   140
1703  007004  000402                       BR      3$
1704
1705  007006  022626                 2$:   CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1706  007010  104074                       ERROR   74
1707                                                                ;XMIT INTERRUPTS WITH INTERRUPT ENABLE CLEAR
1708  007012  012777  007032  174006  3$:   MOV     #4$,@CTVECT     ;SET XMIT VECTOR TO END OF TEST
1709  007020  052777  000100  173756       BIS     #BIT6,@CTCSR    ;ENABLE INTERRUPTS
1710  007026  000240                       NOP
1711
1712  007030  104075                       ERROR   75              ;XMIT DID NOT INTERRUPT
1713
1714  007032  042777  000100  173744  4$:   BIC     #BIT6,@CTCSR    ;DISABLE INTERRUPTS
1715  007040  022626                       CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1716  007042  010377  173760              MOV     R3,@CTVECT      ;RESTORE XMIT VECTOR
1717
1718
1719                                        ;;**********************************************************************
1720                                        ;*TEST 34       TEST SLU1 XMIT INTERRUPTS DO NOT OCCUR WHEN DISABLED
1721                                        ;;**********************************************************************
1722  007046  000004               TST34:  SCOPE
1723  007050  012737  000034  001104       MOV     #34,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1724  007056  042777  000100  173720       BIC     #BIT6,@CTCSR    ;DISABLE INTERRUPTS
1725  007064  004737  015056              JSR     PC,WRPSW        ;SET PSW TO PRIORITY 7
1726  007070  000340                                .WORD   340
1727  007072  017703  173730              MOV     @CTVECT,R3      ;SAVE XMIT VECTOR
1728  007076  012777  007124  173722       MOV     #2$,@CTVECT     ;POINT XMIT VECTOR TO ERROR REPORT
1729  007104  105777  173674        1$:   TSTB    @CTCSR          ;WAIT FOR DONE
1730  007110  100375                       BPL     1$
1731  007112  052777  000100  173664       BIS     #BIT6,@CTCSR    ;ENABLE INTERRUPT
1732  007120  000240                       NOP
1733  007122  000402                       BR      3$              ;CONTINUE TEST
```

```
1734
1735  007124  022626                  2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1736  007126  104076                          ERROR   76
1737                                          ;XMIT INTERRUPTS AT PRIORITY=7
1738  007130  042777  000100  173646  5$:     BIC     #BIT6,@CTCSR    ;CLEAR INTERRUPT ENABLE
1739  007136  012777  007156  173662          MOV     #4$,@CTVECT     ;POINT XMIT VECTOR TO ERROR REPORT
1740  007144  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 3
1741  007150  000140                          .WORD   140
1742  007152  000240                          NOP
1743  007154  000402                          BR      5$              ;BR TO END OF TEST-NO INTERRUPT
1744
1745  007156  022626                  4$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1746  007160  104077                          ERROR   77
1747                                          ;XMIT INTERRUPT OCCURES WITH BIT6 CLEAR
1748  007162  010377  173640          5$:     MOV     R3,@CTVECT      ;RESTORE XMIT VECTOR
1749
1750
1751                                  ;;**********************************************************************
1752                                  ;*TEST 35        TEST SLU1 TRANSMITTER FOR DOUBLE INTERRUPTS
1753                                  ;;**********************************************************************
1754  007166  000004                  TST35:  SCOPE
1755  007170  012737  000035  001104          MOV     #35,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1756  007176  042777  000100  173600          BIC     #BIT6,@CTCSR    ;CLEAR INTERRUPT ENABLE
1757  007204  017703  173616                  MOV     @CTVECT,R3      ;SAVE XMIT VECTOR
1758  007210  017704  173614                  MOV     @CTPSW,R4       ;SAVE XMIT PSW VECTOR
1759  007214  012777  007256  173604          MOV     #2$,@CTVECT     ;SET UP XMIT VECTOR
1760  007222  012777  000340  173600          MOV     #340,@CTPSW     ;SET PIO 7 AFTER INTERRUPT
1761  007230  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 3
1762  007234  000140                          .WORD   140
1763  007236  105777  173542          1$:     TSTB    @CTCSR          ;WAIT FOR DONE
1764  007242  100375                          BPL     1$
1765  007244  052777  000100  173532          BIS     #BIT6,@CTCSR    ;ENABLE INTERRUPTS
1766  007252  000240                          NOP
1767
1768  007254  104100                          ERROR   100
1769                                          ;XMIT INTERRUPT DID NOT OCCUR
1770  007256  022626                  2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1771  007260  012777  007306  173540          MOV     #4$,@CTVECT     ;POINT XMIT VECTOR TO ERROR
1772  007266  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 3
1773  007272  000140                          .WORD   140
1774  007274  000240                          NOP                     ;GIVE TIME FOR ANY INTERRUPTS
1775  007276  042777  000100  173500          BIC     #BIT6,@CTCSR    ;DISABLE INTERRUPTS
1776  007304  000402                          BR      5$              ;BR TO END OF TEST
1777
1778  007306  022626                  4$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1779  007310  104101                          ERROR   101
1780                                          ;XMIT RE-INTERRUPTED
1781  007312  010377  173510          5$:     MOV     R3,@CTVECT      ;RESTORE XMIT VECTOR
1782  007316  010477  173506                  MOV     R4,@CTPSW       ;RESTORE XMIT PSW VECTOR
1783
1784                                  ;;**********************************************************************
1785                                  ;*TEST 36        TEST THAT SLU1 XMIT INTERRUPT CLEARS WITH LOADING TBUF
1786                                  ;;**********************************************************************
1787  007322  000004                  TST36:  SCOPE
1788  007324  012737  000036  001104          MOV     #36,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1789  007332  042777  000100  173444          BIC     #BIT6,@CTCSR    ;DISABLE INTERRUPTS
```

```
1790  007340  004737  015056            JSR     PC,@RPSW        ;SET PSW TO PRIORITY 7
1791  007344  000340                    .WORD   340
1792  007346  017703  173454            MOV     @CTVECT,R3      ;SAVE XMIT VECTOR
1793  007352  012777  007424  173446    MOV     #2$,@CTVECT     ;POINT XMIT VECTOR TO ERROR
1794  007360  052777  000100  173416    BIS     #BIT6,@CTCSR    ;ENABLE INTERRUPTS
1795  007366  005077  173414            CLR     @CTBUF          ;LOAD TBUF
1796  007372  105777  173406    1$:     TSTB    @CTCSR          ;WAIT FOR DONE (INTERRUPT)
1797  007376  100375                    BPL     1$
1798  007400  005077  173402            CLR     @CTBUF          ;FILL SECOND BUFFER TO RESET INT
1799  007404  004737  015056            JSR     PC,@RPSW        ;ALLOW INTERRUPTS
1800  007410  000140                    .WORD   140
1801  007412  000240                    NOP                     ;GIVE TIME FOR ANY INTERRUPTS
1802  007414  042777  000100  173362    BIC     #BIT6,@CTCSR    ;DISABLE INTERRUPTS
1803  007422  000402                    BR      3$              ;BR TO END OF TEST
1804
1805  007424  022626            2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1806  007426  104102                    ERROR   102
1807                                                            ;LOADING TBUF DID NOT CLEAR INTERRUPT.
1808  007430  010377  173372    3$:     MOV     R3,@CTVECT      ;RESTORE XMIT VECTOR
1809
1810
1811
1812
1813
1814
1815
1816
1817                            ;;**********************************************************************
1818                            ;*TEST 37        TEST THAT SLU1 RCVR INTERRUPTS ONLY WHEN ENABLED
1819                            ;;**********************************************************************
1820  007434  000004    TST37:  SCOPE
1821  007436  012737  000037  001104    MOV     #37,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
1822  007444  000005                    RESET                   ;MAKE SURE NO INTERRUPTS ARE PENDING FROM
1823                                                            ;ANOTHER TEST
1824  007446  042777  000100  173330    BIC     #BIT6,@CTCSR    ;DISABLE TRANSMIT INTERRUPTS
1825  007454  042777  000100  173316    BIC     #BIT6,@CRCSR    ;DISABLE RECEIVER INTERRUPTS
1826  007462  052777  000004  173314    BIS     #BIT2,@CTCSR    ;SET MAINTENANCE WRAP
1827  007470  017703  173326            MOV     @CRVECT,R3      ;SAVE RECEIVE VECTOR
1828  007474  012777  007532  173320    MOV     #2$,@CRVECT     ;POINT RCV VECTOR TO ERROR REPORT
1829  007502  004737  015056            JSR     PC,@RPSW        ;SET PSW TO PRIORITY 3
1830  007506  000140                    .WORD   140
1831  007510  005077  173272            CLR     @CTBUF          ;SEND A CHARACTER
1832  007514  105777  173260    1$:     TSTB    @CRCSR          ;WAIT FOR RECEIVER DONE
1833  007520  100375                    BPL     1$
1834  007522  042777  000004  173254    BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1835  007530  000405                    BR      3$              ;CONTINUE TEST
1836
1837  007532  042777  000004  173244    BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1838  007540  022626            2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1839  007542  104103                    ERROR   103
1840                                                            ;RECEIVER INTERRUPTS WITH INT. ENABLE CLEAR
1841
1842  007544  012777  007572  173250    MOV     #4$,@CRVECT     ;POINT RCV VECTOR TO END OF TEST
1843  007552  052777  000100  173220    BIS     #BIT6,@CRCSR    ;ENABLE RCV INTERRUPTS
1844  007560  000240                    NOP                     ;GIVE ANY INTERRUPTS TIME
1845  007562  042777  000004  173214    BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
```

```
1846  007570  104104                          ERROR   104
1847                                                    ;RCVR DID NOT INTERRUPT
1848
1849  007572  042777  000100  173200  4$:     BIC     #BIT6,@CRCSR    ;DISABLE INTERRUPTS
1850  007600  042777  000004  173176          BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1851  007606  022626                          CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1852  007610  010377  173206                  MOV     R3,@CRVECT      ;RESTORE RECEIVE VECTOR
1853
1854
1855                                  ;;**********************************************************
1856                                  ;*TEST 40        TEST THAT RCVR INTERRUPTS DO NOT OCCUR WHEN DISABLED
1857                                  ;;**********************************************************
1858  007614  000004                  TST40:  SCOPE
1859  007616  012737  000040  001104          MOV     #40,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1860  007624  000005                          RESET                   ;CLEAR EVERYTHING
1861  007626  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 7
1862  007632  000340                          .WORD   340
1863  007634  017703  173162                  MOV     @CRVECT,R3      ;SAVE RECEIVE VECTOR
1864  007640  012777  007700  173154          MOV     #2$,@CRVECT     ;POINT RCVR VECTOR TO ERROR REPORT
1865  007646  052777  000004  173130          BIS     #BIT2,@CTCSR    ;SET MAINTENANCE WRAP
1866  007654  005077  173126                  CLR     @CTBUF          ;SEND A CHARACTER
1867  007660  105777  173114          1$:     TSTB    @CRCSR          ;WAIT FOR RECEIVER DONE
1868  007664  100375                          BPL     1$
1869  007666  052777  000100  173104          BIS     #BIT6,@CRCSR    ;ENABLE INTERRUPTS
1870  007674  000240                          NOP                     ;GIVE TIME FOR INTERRUPT
1871  007676  000405                          BR      3$              ;CONTINUE TEST
1872  007700  042777  000004  173076  2$:     BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1873  007706  022626                          CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1874  007710  104105                          ERROR   105
1875                                                    ;RCVR INTERRUPTS AT PRIORITY 7
1876
1877  007712  042777  000100  173060  3$:     BIC     #BIT6,@CRCSR    ;CLEAR INTERRUPT ENABLE
1878  007720  012777  007746  173074          MOV     #4$,@CRVECT     ;POINT RCVR VECTOR TO ERROR REPORT
1879  007726  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 3
1880  007732  000140                          .WORD   140
1881  007734  000240                          NOP                     ;GIVE TIME FOR ANY INTERRUPT
1882  007736  042777  000004  173040          BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1883  007744  000405                          BR      5$              ;BR TO END OF TEST, IF NO INTERRUPT
1884
1885  007746  042777  000004  173050  4$:     BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1886  007754  022626                          CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1887  007756  104106                          ERROR   106
1888                                                    ;RCVR INTERRUPT REQUEST PASSED WITH BIT6 CLEAR
1889  007760  010377  173036          5$:     MOV     R3,@CRVECT      ;RESTORE RECEIVE VECTOR
1890
1891
1892                                  ;;**********************************************************
1893                                  ;*TEST 41        TEST SLU1 RECEIVER FOR DOUBLE INTERRUPTS
1894                                  ;;**********************************************************
1895  007764  000004                  TST41:  SCOPE
1896  007766  012737  000041  001104          MOV     #41,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1897  007774  000005                          RESET                   ;CLEAR EVERYTHING
1898  007776  017703  173020                  MOV     @CRVECT,R3      ;SAVE RECEIVE VECTOR
1899  010002  017704  173016                  MOV     @CRPSW,R4       ;SAVE RECEIVE PSW VECTOR
1900  010006  012777  010070  173006          MOV     #2$,@CRVECT     ;POINT RCV VECTOR TO CONTINUE TEST
1901  010014  012777  000340  173002          MOV     #340,@CRPSW     ;SET PRIORITY TO 7 AFTER INTERRUPT
```

```
1902  010022  004737  015056          JSR     PC,@WRPSW       ;SET PSW TO PRIORITY 3
1903  010026  000140                  .WORD   140
1904  010030  052777  000004  172746  BIS     #BIT2,@CTCSR    ;SET MAINTENANCE WRAP
1905  010036  005077  172744          CLR     @CTBUF          ;SEND A CHARACTER
1906  010042  105777  172732  1$:     TSTB    @CRCSR          ;WAIT FOR RCVR DONE
1907  010046  100375                  BPL     1$
1908  010050  042777  000004  172726  BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1909  010056  052777  000100  172714  BIS     #BIT6,@CRCSR    ;ENABLE RCV INTERRUPTS
1910  010064  000240                  NOP                     ;GIVE SOME TIME
1911
1912  010066  104107                  ERROR   107
1913                                                          ;RCVR INTERRUPT DID NOT OCCUR
1914
1915  010070  022626          2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1916  010072  012777  010124  172722  MOV     #3$,@CRVECT     ;POINT RCV VECTOR TO ERROR REPORT
1917  010100  004737  015056          JSR     PC,@WRPSW       ;PESET PSW TO PRIORITY 3
1918  010104  000140                  .WORD   140
1919  010106  000240                  NOP                     ;GIVE SOME TIME
1920  010110  042777  000100  172662  BIC     #BIT6,@CRCSR    ;CLEAR INTERRUPT ENABLE
1921  010116  010477  172702          MOV     R4,@CRPSW       ;RESTORE RECEIVE PSW VECTOR
1922  010122  000402                  BR      4$              ;BR TO END OF TEST
1923
1924  010124  022626          3$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1925  010126  104110                  ERROR   110
1926                                                          ;RECEIVER RE-INTERRUPTED
1927  010130  010377  172666  4$:     MOV     R3,@CRVECT      ;RESTORE RECEIVE VECTOR
1928
1929
1930                          ;;*****************************************************************
1931                          ;*TEST 42        TEST THAT RCVR INTERRUPT CLEARS BY READING RBUF
1932                          ;;*****************************************************************
1933  010134  000004  TST42:  SCOPE
1934  010136  012737  000042  001104  MOV     #42,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
1935  010144  000005                  RESET                   ;CLEAR EVERYTHING
1936  010146  004737  015056          JSR     PC,@WRPSW       ;SET PSW PRIORITY TO 7
1937  010152  000340                  .WORD   340
1938  010154  017703  172642          MOV     @CRVECT,R3      ;SAVE RECEIVE VECTOR
1939  010160  012777  010246  172634  MOV     #2$,@CRVECT     ;POINT RCV VECTOR TO ERROR REPORT
1940  010166  052777  000100  172604  BIS     #BIT6,@CRCSR    ;SET RCVR INTERRUPT ENABLE
1941  010174  052777  000004  172602  BIS     #BIT2,@CTCSR    ;SET MAINTENANCE WRAP
1942  010202  005077  172600          CLR     @CTBUF          ;SEND A CHARACTER
1943  010206  105777  172566  1$:     TSTB    @CRCSR          ;WAIT FOR DONE (INTERRUPT)
1944  010212  100375                  BPL     1$
1945  010214  042777  000004  172562  BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
1946  010222  005777  172554          TST     @CRBUF          ;READ RBUF TO CLEAR PENDING INTERRPUT
1947  010226  004737  015056          JSR     PC,@WRPSW       ;SET PSW TO PRIORITY 3
1948  010232  000140                  .WORD   140
1949  010234  000240                  NOP                     ;ALLOW TIME FOR ANY ERRONEOUS INTERRUPT
1950  010236  042777  000100  172534  BIC     #BIT6,@CRCSR    ;NO INTERRUPT CLEAR INT. ENABLE
1951  010244  000402                  BR      3$
1952
1953  010246  022626          2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
1954  010250  104111                  ERROR   111             ;READING RBUF DID NOT CLEAR INTERRUPT
1955
1956  010252  010377  172544  3$:     MOV     R3,@CRVECT      ;RESTORE RECEIVE VECTOR
1957
```

```
                                ;;*****************************************************************
                                ;*TEST 43        TEST SLU1 THAT RESET CLEARS RECEIVE INTERRUPT
                                ;;*****************************************************************
010256  000004          TST43:  SCOPE
010260  012737  000043  001104          MOV     #43,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
010266  000005                        RESET                   ;CLEAR EVERYTHING
010270  004737  015056                JSR     PC,@#RPSW       ;SET PSW TO PRIORITY 7
010274  000340                                .WORD   340
010276  017703  172520                MOV     @#RCVECT,R3     ;SAVE RECEIVE VECTOR
010302  012777  010362  172512        MOV     #2$,@#RCVECT    ;POINT RCV VECTOR TO ERROR REPORT
010310  052777  000100  172462        BIS     #BIT6,@#RCSR    ;SET RCV INTERRUPT ENABLE
010316  052777  000004  172460        BIS     #BIT2,@#TCSR    ;SET MAINTENANCE WRAP
010324  012777  000377  172454        MOV     #377,@#TBUF     ;SEND AN ALL 1'S CHARACTER
010332  105777  172442          1$:   TSTB    @#RCSR          ;WAIT FOR RCV DONE
010336  100375                        BPL     1$
010340  000005                        RESET                   ;CLEAR RCV INTERRUPT & RBUF
010342  004737  015056                JSR     PC,@#RPSW       ;SET PSW TO PRIORITY 3
010346  000140                                .WORD   140
010350  000240                        NOP                     ;ALLOW TIME FOR AN ERRONEOUS INTERRUPT
010352  042777  000100  172420        BIC     #BIT6,@#RCSR    ;NO INTERRUPT-CLEAR INT. ENABLE
010360  000402                        BR      3$              ;CONTINUE TEST

010362  022626                  2$:   CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
010364  104112                        ERROR   112             ;RESET DID NOT CLEAR RCVR INTERRUPT

010366  010377  172430          3$:   MOV     R3,@#RCVECT     ;RESTORE RECEIVE VECTOR

                                ;;*****************************************************************
                                ;*TEST 44        TEST SLU1 THAT "OVERRUN & ERROR" BITS CAN BE SET
                                ;;*****************************************************************
010372  000004          TST44:  SCOPE
010374  012737  000044  001104          MOV     #44,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
010402  032777  002000  170430        BIT     #BIT10,@#SWR    ;IS THIS TEST ENABLED
010410  001032                        BNE     TST45           ;IF DISABLED, BR TO NEXT TEST
010412  000005                        RESET                   ;CLEAR EVERYTHING
010414  052777  000004  172362        BIS     #BIT2,@#TCSR    ;SET MAINTENANCE WRAP
010422  012700  000003                MOV     #3,R0           ;SET CHARACTER COUNT TO SEND 3 CHAR.
010426  005077  172354          1$:   CLR     @#TBUF          ;LOAD TRANSMIT BUFFER
010432  105777  172346          2$:   TSTB    @#TCSR          ;WAIT FOR TRANSMIT DONE
010436  100375                        BPL     2$
010440  005300                        DEC     R0              ;DECREMENT CHARACTER COUNT
010442  001371                        BNE     1$              ;BR IF ALL CHARACTERS NOT TRANSMITTED
010444  042777  000004  172332        BIC     #BIT2,@#TCSR    ;CLEAR MAINTENANCE BIT
010452  032777  040000  172322        BIT     #BIT14,@#RCRBUF ;TEST FOR "OR" ERROR FLAG
010460  001001                        BNE     3$              ;BR, IF SET
010462  104113                        ERROR   113
                                                            ;"OR" ERROR FLAG DID NOT SET

010464  032777  100000  172310  3$:   BIT     #BIT15,@#RCRBUF ;TEST "ERROR" FLAG
010472  001001                        BNE     4$              ;BR, IF SET
010474  104114                        ERROR   114
                                                            ;"ERROR" FLAG DID NOT SET WITH "OR" FLAG
```

```
2014  010476                                  4$:
2015
2016
2017                                          ;;*****************************************************************
2018                                          ;*TEST 45       TEST SLU1 DATA PATH USING MAINTENANCE WRAP
2019                                          ;;*****************************************************************
2020  010476  000004                          TST45:  SCOPE
2021  010500  012737  000045  001104                  MOV     #45,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2022  010506  000005                                  RESET                   ;CLEAR EVERYTHING
2023  010510  005001                                  CLR     R1              ;CLEAR REGISTER FOR TEST DATA
2024  010512  052777  000004  172264                  BIS     #BIT2,@CTCSR    ;SET MAINTENANCE WRAP
2025  010520  105201                          1$:     INCB    R1              ;INCREMENT THE TEST DATA
2026  010522  010177  172260                          MOV     R1,@CTBUF       ;XMIT A CHARACTER
2027  010526  105777  172246                  2$:     TSTB    @CRCSR          ;WAIT FOR RECEIVER DONE
2028  010532  100375                                  BPL     2$
2029  010534  017702  172242                          MOV     @CRBUF,R2       ;GET RECEIVED CHARACTER
2030  010540  020102                                  CMP     R1,R2           ;COMPARE DATA
2031  010542  001003                                  BNE     3$              ;BR, IF NON-COMPARE
2032  010544  105701                                  TSTB    R1              ;TEST XMIT DATA FOR ZERO
2033  010546  001411                                  BEQ     4$              ;BR, IF FINISHED
2034  010550  000763                                  BR      1$              ;CONTINUE IF NOT
2035  010552  010137  001024                  3$:     MOV     R1,$GDDAT       ;STORE THE EXPECTED DATA
2036  010556  010237  001026                          MOV     R2,$BDDAT       ;STORE RECEIVED DATA
2037  010562  042777  000004  172214                  BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
2038  010570  104115                                  ERROR   115             ;DATA COMPARE DATA
2039
2040  010572  042777  000004  172204  4$:     BIC     #BIT2,@CTCSR    ;CLEAR MAINTENANCE BIT
2041
2042
```

```
                                SLU2IT:

                                ;;*****************************************************************
                                ;*TEST 46        TEST THAT SLU2 XMIT INTERRUPTS ONLY WHEN ENABLED
                                ;;*****************************************************************
010600  000004                  TST46:  SCOPE
010602  012737  000046  001104          MOV     #46,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
010610  032737  000002  001156          BIT     #BIT1,@#DEVM    ;DO THESE TESTS FOR THIS DEVICE?
010616  001002                          BNE     99$             ;F YES CONTINUE WITH TESTS
010620  000137  012544                  JMP     LTCIT           ;IF NO GO TO START OF NEXT SET OF TESTS.
010624                          99$:
010624  042777  000100  172142          BIC     #BIT6,@TCSR     ;CLEAR TRANSMIT INTERRUPT ENABLE
010632  017703  172160                  MOV     @TVECT,R3       ;SAVE XMIT VECTOR
010636  012777  010662  172152          MOV     #2$,@TVECT      ;POINT XMIT VECTOR TO ERROR REPORT
010644  105777  172124          1$:     TSTB    @TCSR           ;WAIT FOR DONE
010650  100375                          BPL     1$
010652  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 3
010656  000140                                  .WORD   140
010660  000402                          BR      3$

010662  022626                  2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
010664  104116                          ERROR   116
                                                                ;XMIT INTERRUPTS WITH INTERRUPT ENABLE CLEAR
010666  012777  010706  172122  3$:     MOV     #4$,@TVECT      ;SET XMIT VECTOR TO END OF TEST
010674  052777  000100  172072          BIS     #BIT6,@TCSR     ;ENABLE INTERRUPTS
010702  000240                          NOP

010704  104117                          ERROR   117             ;XMIT DID NOT INTERRUPT

010706  042777  000100  172060  4$:     BIC     #BIT6,@TCSR     ;DISABLE INTERRUPTS
010714  022626                          CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
010716  010377  172074                  MOV     R3,@TVECT       ;RESTORE XMIT VECTOR


                                ;;*****************************************************************
                                ;*TEST 47        TEST SLU2 XMIT INTERRUPTS DO NOT OCCUR WHEN DISABLED
                                ;;*****************************************************************
010722  000004                  TST47:  SCOPE
010724  012737  000047  001104          MOV     #47,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
010732  042777  000100  172034          BIC     #BIT6,@TCSR     ;DISABLE INTERRUPTS
010740  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 7
010744  000340                                  .WORD   340
010746  017703  172044                  MOV     @TVECT,R3       ;SAVE XMIT VECTOR
010752  012777  011000  172036          MOV     #2$,@TVECT      ;POINT XMIT VECTOR TO ERROR REPORT
010760  105777  172010          1$:     TSTB    @TCSR           ;WAIT FOR DONE
010764  100375                          BPL     1$
010766  052777  000100  172000          BIS     #BIT6,@TCSR     ;ENABLE INTERRUPT
010774  000240                          NOP
010776  000402                          BR      3$              ;CONTINUE TEST

011000  022626                  2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
011002  104120                          ERROR   120
                                                                ;XMIT INTERRUPTS AT PRIORITY=7
011004  042777  000100  171762  3$:     BIC     #BIT6,@TCSR     ;CLEAR INTERRUPT ENABLE
011012  012777  011032  171776          MOV     #4$,@TVECT      ;POINT XMIT VECTOR TO ERROR REPORT
011020  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 3
```

```
 2099  011024  000140                          .WORD   140
 2100  011026  000240                  NOP
 2101  011030  000402                  BR      5$              ;BR TO END OF TEST-NO INTERRUPT
 2102
 2103  011032  022626          4$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
 2104  011034  104121                  ERROR   121
 2105                                                          ;XMIT INTERRUPT OCCURES WITH BIT6 CLEAR
 2106  011036  010377  171754         5$:     MOV     R3,@TVECT       ;RESTORE XMIT VECTOR
 2107
 2108
 2109
 2110
 2111                                  ;;*****************************************************************
 2112                                  ;*TEST 50        TEST SLU2 TRANSMITTER FOR DOUBLE INTERRUPTS
 2113                                  ;;*****************************************************************
 2114  011042  000004                  TST50:  SCOPE
 2115  011044  012737  000050  001104          MOV     #50,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
 2116  011052  042777  000100  171714          BIC     #BIT6,@TCSR     ;CLEAR INTERRUPT ENABLE
 2117  011060  017703  171732                  MOV     @TVECT,R3       ;SAVE XMIT VECTOR
 2118  011064  017704  171730                  MOV     @TPSW,R4        ;SAVE XMIT PSW VECTOR
 2119  011070  012777  011132  171720          MOV     #2$,@TVECT      ;SET UP XMIT VECTOR
 2120  011076  012777  000340  171714          MOV     #340,@TPSW      ;SET PIO 7 AFTER INTERRUPT
 2121  011104  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 3
 2122  011110  000140                          .WORD   14C
 2123  011112  105777  171656         1$:     TSTB    @TCSR           ;WAIT FOR DONE
 2124  011116  100375                  BPL     1$
 2125  011120  052777  000100  171646          BIS     #BIT6,@TCSR     ;ENABLE INTERRUPTS
 2126  011126  000240                  NOP
 2127
 2128  011130  104122                  ERROR   122
 2129                                                          ;XMIT INTERRUPT DID NOT OCCUR
 2130  011132  022626          2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
 2131  011134  012777  011162  171654          MOV     #4$,@TVECT      ;POINT XMIT VECTOR TO ERROR
 2132  011142  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 3
 2133  011146  000140                          .WORD   140
 2134  011150  000240                  NOP                     ;GIVE TIME FOR ANY INTERRUPTS
 2135  011152  042777  000100  171614          BIC     #BIT6,@TCSR     ;DISABLE INTERRUPTS
 2136  011160  000402                  BR      5$              ;BR TO END OF TEST
 2137
 2138  011162  022626          4$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
 2139  011164  104123                  ERROR   123
 2140                                                          ;XMIT RE-INTERRUPTED
 2141  011166  010377  171624         5$:     MOV     R3,@TVECT       ;RESTORE XMIT VECTOR
 2142  011172  010477  171622                  MOV     R4,@TPSW        ;RESTORE XMIT PSW VECTOR
 2143
 2144                                  ;;*****************************************************************
 2145                                  ;*TEST 51        TEST THAT SLU2 XMIT INTERRUPT CLEARS WITH LOADING TBUF
 2146                                  ;;*****************************************************************
 2147  011176  000004                  TST51:  SCOPE
 2148  011200  012737  000051  001104          MOV     #51,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
 2149  011206  032737  000001  001120          BIT     #1, @#$ENV      ;ARE WE RUNNING UNDER APT
 2150  011214  001403                  BEQ     70$             ;IF NO THEN DO TEST
 2151  011216  005737  001106                  TST     @#$PASS         ;IS THIS FIRST PASS
 2152  011222  001046                  BNE     TST52           ;IF NO THEN SKIP TO NEXT TEST
 2153  011224                          70$:
 2154  011224  042777  000100  171542          BIC     #BIT6,@TCSR     ;DISABLE INTERRUPTS
```

```
2155  011232  004737  015056            JSR     PC,@#WRPSW      ;SET PSW TO PRIORITY 7
2156  011236  000340                    .WORD   340
2157  011240  017703  171552            MOV     @#TVECT,R3      ;SAVE XMIT VECTOR
2158  011244  012777  011316  171544    MOV     #2$,@#TVECT     ;POINT XMIT VECTOR TO ERROR
2159  011252  052777  000100  171514    BIS     #BIT6,@#TCSR    ;ENABLE INTERRUPTS
2160  011260  005077  171512            CLR     @#TBUF          ;LOAD TBUF
2161  011264  105777  171504    1$:     TSTB    @#TCSR          ;WAIT FOR DONE (INTERRUPT)
2162  011270  100375                    BPL     1$
2163  011272  005077  171500            CLR     @#TBUF          ;FILL SECOND BUFFER TO RESET INT.
2164  011276  004737  015056            JSR     PC,@#WRPSW      ;ALLOW INTERRUPTS
2165  011302  000140                    .WORD   140
2166  011304  000240                    NOP                     ;GIVE TIME FOR ANY INTERRUPTS
2167  011306  042777  000100  171460    BIC     #BIT6,@#TCSR    ;DISABLE INTERRUPTS
2168  011314  000402                    BR      3$              ;BR TO END OF TEST
2169
2170  011316  022626            2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2171  011320  104124                    ERROR   124
2172                                                            ;LOADING TBUF DID NOT CLEAR INTERRUPT.
2173  011322  005001            3$:     CLR     R1              ;INITIALIZE LOOP COUNTER
2174  011324  005201            4$:     INC     R1              ;INCREMENT LOOP COUNTER
2175  011326  001376                    BNE     4$              ;UNTIL LOOP COUNTER EQUALS 0
2176  011330  005777  171436            TST     @#RBUF          ;CLEAR RECEIVER BUFFER
2177  011334  010377  171456            MOV     R3,@#TVECT      ;RESTORE XMIT VECTOR
2178
2179
2180
2181
2182                                    ;;*******************************************************************
2183                                    ;*TEST 52        TEST THAT RCVR INTERRUPTS ONLY WHEN ENABLED
2184                                    ;;*******************************************************************
2185  011340  000004            TST52:  SCOPE
2186  011342  012737  000052  001104    MOV     #52,@#TESTN     ;;SET TEST NUMBER IN APT MAIL BOX
2187  011350  042777  000100  171416    BIC     #BIT6,@#TCSR    ;DISABLE TRANSMIT INTERRUPTS
2188  011356  042777  000100  171404    BIC     #BIT6,@#RCSR    ;DISABLE RECEIVER INTERRUPTS
2189  011364  017703  171422            MOV     @#RVECT,R3      ;SAVE RECEIVE VECTOR
2190  011370  012777  011420  171414    MOV     #2$,@#RVECT     ;POINT RCV VECTOR TO ERROR REPORT
2191  011376  004737  015056            JSR     PC,@#WRPSW      ;SET PSW TO PRIORITY 3
2192  011402  000140                    .WORD   140
2193  011404  005077  171366            CLR     @#TBUF          ;SEND A CHARACTER
2194  011410  105777  171354    1$:     TSTB    @#RCSR          ;WAIT FOR RECEIVER DONE
2195  011414  100375                    BPL     1$
2196  011416  000402                    BR      3$              ;CONTINUE TEST
2197
2198  011420  022626            2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2199  011422  104125                    ERROR   125
2200                                                            ;RECEIVER INTERRPUTS WITH INT. ENABLE CLEAR
2201
2202  011424  012777  011444  171360    MOV     #4$,@#RVECT     ;POINT RCV VECTOR TO END OF TEST
2203  011432  052777  000100  171330    BIS     #BIT6,@#RCSR    ;ENABLE RCV INTERRUPTS
2204  011440  000240                    NOP                     ;GIVE ANY INTERRUPTS TIME
2205  011442  104126                    ERROR   126
2206                                                            ;RCVR DID NOT INTERRUPT
2207
2208  011444  042777  000100  171316    BIC     #BIT6,@#RCSR    ;DISABLE INTERRUPTS
2209  011452  022626                    CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2210  011454  010377  171332            MOV     R3,@#RVECT      ;RESTORE RECEIVE VECTOR
```

```
                                ;;*****************************************************************
                                ;*TEST 53        TEST THAT RCVR INTERRUPTS DO NOT OCCUR WHEN DISABLED
                                ;;*****************************************************************
011460  000004          TST53:  SCOPE
011462  012737  000053  001104          MOV     #53,@TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
011470  004737  015056                  JSR     PC,@RPSW        ;SET PSW TO PRIORITY 7
011474  000340                          .WORD   340
011476  017703  171310                  MOV     @RVECT,R3       ;SAVE RECEIVE VECTOR
011502  012777  011534  171302          MOV     #2$,@RVECT      ;POINT RCVR VECTOR TO ERROR REPORT
011510  005077  171262                  CLR     @TBUF           ;SEND A CHARACTER
011514  105777  171250          1$:     TSTB    @RCSR           ;WAIT FOR RECEIVER DONE
011520  100375                          BPL     1$
011522  052777  000100  171240          BIS     #BIT6,@RCSR     ;ENABLE INTERRUPTS
011530  000240                          NOP                     ;GIVE TIME FOR INTERRUPT
011532  000402                          BR      3$              ;CONTINUE TEST
011534  022626                  2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
011536  104127                          ERROR   127
                                                                ;RCVR INTERRUPTS AT PRIORITY 7
011540  042777  000100  171222  3$:     BIC     #BIT6,@RCSR     ;CLEAR INTERRUPT ENABLE
011546  012777  011566  171236          MOV     #4$,@RVECT      ;POINT RCVR VECTOR TO ERROR REPORT
011554  004737  015056                  JSR     PC,@RPSW        ;SET PSW TO PRIORITY 3
011560  000140                          .WORD   140
011562  000240                          NOP                     ;GIVE TIME FOR ANY INTERRUPT
011564  000402                          BR      5$              ;BR TO END OF TEST, IF NO INTERRUPT
011566  022626                  4$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
011570  104130                          ERROR   130
                                                                ;RCVR INTERRUPT REQUEST PASSED WITH BIT6 CLEAR
011572  010377  171214          5$:     MOV     R3,@RVECT       ;RESTORE RECEIVE VECTOR

                                ;;*****************************************************************
                                ;*TEST 54        TEST SLU2 RECEIVER FOR DOUBLE INTERRUPTS
                                ;;*****************************************************************
011576  000004          TST54:  SCOPE
011600  012737  000054  001104          MOV     #54,@TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
011606  017703  171200                  MOV     @RVECT,R3       ;SAVE RECEIVE VECTOR
011612  017704  171176                  MOV     @RPSW,R4        ;SAVE RECEIVE PSW VECTOR
011616  012777  011664  171166          MOV     #2$,@RVECT      ;POINT RCV VECTOR TO CONTINUE TEST
011624  012777  000340  171162          MOV     #340,@RPSW      ;SET PRIORITY TO 7 AFTER INTERRUPT
011632  004737  015056                  JSR     PC,@RPSW        ;SET PSW TO PRIORITY 3
011636  000140                          .WORD   140
011640  005077  171132                  CLR     @TBUF           ;SEND A CHARACTER
011644  105777  171120          1$:     TSTB    @RCSR           ;WAIT FOR RCVR DONE
011650  100375                          BPL     1$
011652  052777  000100  171110          BIS     #BIT6,@RCSR     ;ENABLE RCV INTERRUPTS
011660  000240                          NOP                     ;GIVE SOME TIME

011662  104131                          ERROR   131
                                                                ;RCVR INTERRUPT DID NOT OCCUR

011664  022626                  2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
011666  012777  011720  171116          MOV     #3$,@RVECT      ;POINT RCV VECTOR TO ERROR REPORT
```

```
2267  011674  004737  015056          JSR     PC,@WRPSW       ;RESET PSW TO PRIORITY 3
2268  011700  000140                  .WORD   140
2269  011702  000240                  NOP                     ;GIVE SOME TIME
2270  011704  042777  000100  171056  BIC     #BIT6,@RCSR     ;CLEAR INTERRUPT ENABLE
2271  011712  010477  171076          MOV     R4,@RPSW        ;RESTORE RECEIVE PSW VECTOR
2272  011716  000402                  BR      4$              ;BR TO END OF TEST
2273
2274  011720  022626          3$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2275  011722  104132                  ERROR   132
2276                                                          ;RECEIVER RE INTERRUPTED
2277  011724  010377  171062  4$:     MOV     R3,@RVECT       ;RESTORE RECEIVE VECTOR
2278
2279
2280                          ;;**********************************************************************
2281                          ;*TEST 55        TEST THAT RCVR INTERRUPT CLEARS BY READING RBUF
2282                          ;;**********************************************************************
2283  011730  000004          TST55:  SCOPE
2284  011732  012737  000055  001104  MOV     #55,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2285  011740  004737  015056          JSR     PC,@WRPSW       ;SET PSW PRIORITY TO 7
2286  011744  000340                  .WORD   340
2287  011746  017703  171040          MOV     @RVECT,R3       ;SAVE RECEIVE VECTOR
2288  011752  012777  012024  171032  MOV     #2$,@RVECT      ;POINT RCV VECTOR TO ERROR REPORT
2289  011760  052777  000100  171002  BIS     #BIT6,@RCSR     ;SET RCVR INTERRUPT ENABLE
2290  011766  005077  171004          CLR     @TBUF           ;SEND A CHARACTER
2291  011772  105777  170772  1$:     TSTB    @RCSR           ;WAIT FOR DONE (INTERRUPT)
2292  011776  100375                  BPL     1$
2293  012000  005777  170766          TST     @RBUF           ;READ RBUF TO CLEAR PENDING INTERRPUT
2294  012004  004737  015056          JSR     PC,@WRPSW       ;SET PSW TO PRIORITY 3
2295  012010  000140                  .WORD   140
2296  012012  000240                  NOP                     ;ALLOW TIME FOR ANY ERRONEOUS INTERRUPT
2297  012014  042777  000100  170746  BIC     #BIT6,@RCSR     ;NO INTERRUPT-CLEAR INT. ENABLE
2298  012022  000402                  BR      3$
2299
2300  012024  022626          2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2301  012026  104133                  ERROR   133             ;READING RBUF DID NOT CLEAR INTERRUPT
2302
2303  012030  010377  170756  3$:     MOV     R3,@RVECT       ;RESTORE RECEIVE VECTOR
2304
2305
2306
2307                          ;;**********************************************************************
2308                          ;*TEST 56        TEST SLU2 THAT RESET CLEARS RECEIVE INTERRUPT
2309                          ;;**********************************************************************
2310  012034  000004          TST56:  SCOPE
2311  012036  012737  000056  001104  MOV     #56,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2312  012044  032737  000001  001120  BIT     #1,@#ENV        ;ARE WE RUNNING UNDER APT
2313  012052  001403                  BEQ     70$             ;IF NO THEN DO TEST
2314  012054  005737  001106          TST     @#PASS          ;IS THIS FIRST PASS
2315  012060  001037                  BNE     TST57           ;IF NO THEN SKIP TO NEXT TEST
2316  012062                  70$:
2317  012062  000005                  RESET                   ;CLEAR EVERYTHING
2318  012064  004737  015056          JSR     PC,@WRPSW       ;SET PSW TO PRIORITY 7
2319  012070  000340                  .WORD   340
2320  012072  017703  170714          MOV     @RVECT,R3       ;SAVE RECEIVE VECTOR
2321  012076  012777  012150  170706  MOV     #2$,@RVECT      ;POINT RCV VECTOR TO ERROR REPORT
2322  012104  052777  000100  170656  BIS     #BIT6,@RCSR     ;SET RCV INTERRUPT ENABLE
```

```
2323  012112  012777  000377  170656          MOV     #377,@TBUF      ;SEND AN ALL 1'S CHARACTER
2324  012120  105777  170644          1$:     TSTB    @RCSR           ;WAIT FOR RCV DONE
2325  012124  100375                          BPL     1$
2326  012126  000005                          RESET                   ;CLEAR RCV INTERRUPT & RBUF
2327  012130  004737  015056                  JSR     PC,WRPSW        ;SET PSW TO PRIORITY 3
2328  012134  000140                          .WORD   140
2329  012136  000240                          NOP                     ;ALLOW TIME FOR AN ERRONEOUS INTERRUPT
2330  012140  042777  000100  170622          BIC     #BIT6,@RCSR     ;NO INTERRUPT-CLEAR INT. ENABLE
2331  012146  000402                          BR      3$              ;CONTINUE TEST
2332
2333
2334  012150  022626                  2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2335  012152  104134                          ERROR   134             ;RESET DID NOT CLEAR RCVR INTERRUPT
2336
2337  012154  010377  170632          3$:     MOV     R3,@RVECT       ;RESTORE RECEIVE VECTOR
2338
2339
2340                                  ;;*******************************************************************
2341                                  ;*TEST 57        TEST SLU2 THAT "OVERRUN & ERROR" BITS CAN BE SET
2342                                  ;;*******************************************************************
2343  012160  000004                  TST57:  SCOPE
2344  012162  012737  000057  001104          MOV     #57,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2345  012170  032777  002000  166642          BIT     #BIT10,@SWR     ;IS THIS TEST DISABLED
2346  012176  001023                          BNE     TST60           ;IF NOT ENABLED, BR TO NEXT TEST
2347  012200  012700  000003                  MOV     #3,R0           ;SET CHARACTER COUNT TO SEND 3 CHAR.
2348  012204  005077  170566          1$:     CLR     @TBUF           ;LOAD TRANSMIT BUFFER
2349  012210  105777  170560          2$:     TSTB    @TCSR           ;WAIT FOR TRANSMIT DONE
2350  012214  100375                          BPL     2$
2351  012216  005300                          DEC     R0              ;DECREMENT CHARACTER COUNT
2352  012220  001371                          BNE     1$              ;BR IF ALL CHARACTERS NOT TRANSMITTED
2353  012222  032777  040000  170542          BIT     #BIT14,@RBUF    ;TEST FOR "OR" ERROR FLAG
2354  012230  001001                          BNE     3$              ;BR, IF SET
2355  012232  104135                          ERROR   135
2356                                                                  ;"OR" ERROR FLAG DID NOT SET
2357
2358  012234  032777  100000  170530  3$:     BIT     #BIT15,@RBUF    ;TEST "ERROR" FLAG
2359  012242  001001                          BNE     4$              ;BR, IF SET
2360  012244  104136                          ERROR   136
2361                                                                  ;"ERROR" FLAG DID NOT SET WITH "OR" FLAG
2362  012246                          4$:
2363
2364
2365                                  ;;*******************************************************************
2366                                  ;*TEST 60        TEST THAT BREAK TRANSMITS ALL ZEROES
2367                                  ;;*******************************************************************
2368  012246  000004                  TST60:  SCOPE
2369  012250  012737  000060  001104          MOV     #60,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2370  012256  012777  177777  170512          MOV     #-1,@TBUF       ;TRANSMIT ALL ONES TO RCVR
2371  012264  105777  170500          1$:     TSTB    @RCSR           ;WAIT FOR RCVR DONE
2372  012270  100375                          BPL     1$
2373  012272  005777  170474                  TST     @RBUF           ;CLEAR DONE (LEAVING ALL ONES IN RBUF)
2374  012276  052777  000001  170470          BIS     #BIT0,@TCSR     ;TRANSMIT BREAK
2375  012304  005000                          CLR     R0              ;CLEAR A TIMER
2376  012306  105777  170456          2$:     TSTB    @RCSR           ;WAIT FOR RCVR DONE
2377  012312  100406                          BMI     CONT41          ;BR IF DONE
2378  012314  005200                          INC     R0              ;IF NOT, INCREMENT TIMER
```

```
2379  012316  001373                          BNE     2$              ;BR IF TIME REMAINS
2380
2381  012320  042777  000001  170446          BIC     #BIT0,@TCSR       ;CLEAR BREAK BITS
2382  012326  104137                          ERROR   137             ;BREAK DID NOT TRANSMIT ANYTHING
2383
2384  012330  105777  170436          CONT41: TSTB    @RBUF           ;CHECK RECEIVE BUFFER FOR ZERO
2385  012334  001404                          BEQ     3$              ;BR, IF ZERO
2386  012336  042777  000001  170430          BIC     #BIT0,@TCSR       ;CLEAR BREAK BITS
2387
2388  012344  104137                          ERROR   137             ;BREAK DID NOT TRANSMIT ALL ZEROES
2389
2390  012346  042777  000001  170420  3$:     BIC     #BIT0,@TCSR       ;CLEAR BREAK BITS
2391
2392
2393                                  ;;**********************************************************************
2394                                  ;*TEST 61        TEST THAT "FR" ERROR CAN BE SET DURING BREAK
2395                                  ;;**********************************************************************
2396  012354  000004                  TST61:  SCOPE
2397  012356  012737  000061  001104          MOV     #61,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2398  012364  032777  002000  166446          BIT     #BIT10,@SWR     ;IS THIS TEST DISABLED
2399  012372  001025                          BNE     TST62           ;BR TO NEXT TEST, IF DISABLED
2400  012374  052777  000001  170372          BIS     #BIT0,@TCSR     ;SEND BREAK
2401  012402  005077  170370                  CLR     @TBUF           ;TRANSMIT A CHARACTER TO TIME BREAK
2402  012406  105777  170356          1$:     TSTB    @RCSR           ;WAIT FOR RCVR DONE
2403  012412  100375                          BPL     1$
2404  012414  042777  000001  170352          BIC     #BIT0,@TCSR       ;CLEAR BREAK BITS
2405  012422  032777  020000  170342          BIT     #BIT13,@RBUF    ;CHECK FOR FRAMING ERROR FLAG
2406  012430  001001                          BNE     2$              ;BR, IF SET
2407
2408  012432  104140                          ERROR   140
2409                                                                  ;BREAK DID NOT SET FRAMING ERROR
2410  012434  032777  100000  170330  2$:     BIT     #BIT15,@RBUF    ;TEST "ERROR"FLAG
2411  012442  001001                          BNE     3$              ;BR, IF SET
2412
2413  012444  104141                          ERROR   141
2414                                                                  ;"ERROR" FLAG DID NOT SET WITH "OR" FLAG
2415  012446                          3$:
2416                                  ;;**********************************************************************
2417                                  ;*TEST 62        TEST DATA PATHS USING WRAP CABLE
2418                                  ;;**********************************************************************
2419  012446  000004                  TST62:  SCOPE
2420  012450  012737  000062  001104          MOV     #62,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2421  012456  032777  000200  166354          BIT     #BIT7,@SWR      ;IS THIS TEST ENABLED
2422  012464  001027                          BNE     TST63           ;BR, IF NOT
2423  012466  005001                          CLR     R1              ;CLEAR REGISTER FOR TEST DATA
2424                                                                  ;TRANSMIT A BINARY COUNT PATTERN   UP
2425                                                                  ;TO THE BIT POSITION INDICATED BY THE
2426                                                                  ;CONTENTS OF LOCATION "$USWR"
2427  012470  105201                  1$:     INCB    R1              ;INCREMENT THE TEST DATA
2428  012472  010177  170300                  MOV     R1,@TBUF        ;XMIT A CHARACTER
2429  012476  005000                          CLR     R0              ;CLEAR A TIMER
2430  012500  105777  170264          2$:     TSTB    @RCSR           ;WAIT FOR RECEIVER DONE
2431  012504  100403                          BMI     3$              ;BR IF DONE
2432  012506  005200                          INC     R0              ;INCREMENT TIMER IF NOT
2433  012510  001373                          BNE     2$              ;BR IF TIME REMAINS
2434
```

```
2435  012512  104056                    ERROR   56              ;RECEIVER DONE NOT SET
2436
2437  012514  017702  170252    3$:     MOV     @RBUF,R2        ;GET RECEIVED CHARACTER
2438  012520  020102                    CMP     R1,R2           ;COMPARE DATA
2439  012522  001003                    BNE     4$              ;BR. IF NON-COMPARE
2440  012524  105701                    TSTB    R1              ;TEST XMIT DATA FOR ZERO
2441  012526  001406                    BEQ     TST63           ;BR. IF FINISHED
2442  012530  000757                    BR      1$              ;CONTINUE IF NOT
2443  012532  010137  001024    4$:     MOV     R1,$GDDAT       ;STORE EXPECTED DATA
2444  012536  010237  001026            MOV     R2,$BDDAT       ;STORE RECEIVED DATA
2445
2446  012542  104142                    ERROR   142             ;DATA COMPARE ERROR WITH WRAP CABLE
2447
2448
```

```
2449  012544                                  LTCIT:
2450
2451                                          ;;*****************************************************************
2452                                          ;*TEST 63       TEST THAT THE REAL TIME CLOCK INTERRUPTS PROPERLY
2453                                          ;;*****************************************************************
2454  012544  000004                          TST63:  SCOPE
2455  012546  012737  000063  001104                 MOV     #63,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2456  012554  032737  000004  001156                 BIT     #BIT2,@#DEVM    ;DO THESE TESTS FOR THIS DEVICE?
2457  012562  001002                                 BNE     99$             ;F YES CONTINUE WITH TESTS
2458  012564  000137  013600                         JMP     BLAST           ;IF NO GO TO START OF NEXT SET OF TESTS.
2459  012570                                  99$:
2460  012570  004737  015056                         JSR     PC,WRPSW        ;SET PSW TO PRIORITY 7
2461  012574  00034C                                 .WORD   340
2462  012576  017703  170230                         MOV     @RTCVT,R3       ;SAVE LINE CLOCK VECTOR
2463  012602  017704  170226                         MOV     @RTCPSW,R4      ;SAVE LINE CLOCK PSW VECTOR
2464  012606  012777  012650  170216                 MOV     #2$,@RTCVT      ;SET RTC INTERRUPT VECTOR TO ERROR REPORT
2465  012614  012777  000340  170212                 MOV     #340,@RTCPSW    ;KEEP PRIORITY AT 7
2466  012622  042777  000200  170160                 BIC     #BIT7,@LKS      ;CLEAR CLOCK DONE FLAG
2467  012630  052777  000100  170152                 BIS     #BIT6,@LKS      ;SET INTERRUPT ENABLE
2468  012636  105777  170146          1$:     TSTB    @LKS                    ;WAIT FOR RTC DONE(INTERRUPT REQUEST)
2469  012642  100375                                 BPL     1$
2470  012644  000240                                 NOP                     ;GIVE TIME FOR ANY INTERRUPTS
2471  012646  000402                                 BR      3$              ;BR, IF NO INTERRUPT OCCURS
2472
2473  012650  022626                  2$:     CMP     (SP)+,(SP)+             ;RESTORE SP AFTER INTERRUPT
2474  012652  104143                          ERROR   143                     ;RTC INTERRUPTS AT PRIORITY 7
2475
2476  012654  005077  170130          3$:     CLR     @LKS    ;DISABLE RTC INTERRUPTS & CLEAR DONE
2477  012660  012777  012706  170144                 MOV     #4$,@RTCVT      ;SET RTC INTERRUPT VECTOR FOR ERROR
2478  012666  004737  015056                         JSR     PC,WRPSW        ;CHANGE PSW TO PRIORITY 5
2479  012672  000240                                 .WORD   240
2480  012674  105777  170110          20$:    TSTB    @LKS                    ;WAIT FOR DONE (INTERRUPT REQUEST)
2481  012700  100375                                 BPL     20$
2482  012702  000240                                 NOP                     ;GIVE TIME FOR ANY INTERRUPT
2483  012704  000402                                 BR      5$              ;IF NO INTERRUPT - BR TO CONTINUE TEST
2484
2485  012706  022626                  4$:     CMP     (SP)+,(SP)+             ;RESTORE SP AFTER INTERRUPT
2486  012710  104144                          ERROR   144                     ;RTC INTERRUPTS WITH INTERRUPTS DISABLED
2487
2488  012712  012777  012746  170112  5$:     MOV     #7$,@RTCVT      ;POINT RTC VECTOR TO END OF TEST
2489  012720  042777  000200  170062          BIC     #BIT7,@LKS      ;CLEAR CLOCK DONE FLAG
2490  012726  052777  000100  170054          BIS     #BIT6,@LKS      ;ALLOW INTERRUPTS
2491  012734  105777  170050          6$:     TSTB    @LKS            ;WAIT FOR RTC DONE
2492  012740  100375                          BPL     6$
2493  012742  000240                          NOP                     ;GIVE TIME FOR INTERRUPT
2494
2495  012744  104145                          ERROR   145             ;RTC INTERRUPT DID NOT OCCUR
2496
2497  012746  022626                  7$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2498  012750  042777  000100  170032          BIC     #BIT6,@LKS      ;DISABLE INTERRUPTS
2499  012756  010377  170050                  MOV     R3,@RTCVT       ;RESTORE LINE CLOCK VECTOR
2500  012762  010477  170046                  MOV     R4,@RTCPSW      ;RESTORE LINE CLOCK PSW VECTOR
2501
2502
2503
2504                                          ;;*****************************************************************
```

```
2505                                        ;*TEST 64       TEST RTC FOR DOUBLE INTERRUPTS
2506                                        ;;**************************************************************
2507  012766  000004                  TST64:  SCOPE
2508  012770  012737  000064  001104          MOV     #64,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2509  012776  032737  000001  001120          BIT     #1, @#$ENV      ;ARE WE RUNNING UNDER APT
2510  013004  001403                          BEQ     70$             ;IF NO THEN DO TEST
2511  013006  005737  001106                  TST     @#$PASS         ;IS THIS FIRST PASS
2512  013012  001052                          BNE     TST65           ;IF NO THEN SKIP TO NEXT TEST
2513  013014                              70$:
2514  013014  017703  170012                  MOV     @RTCVT,R3       ;SAVE LINE CLOCK VECTOR
2515  013020  017704  170010                  MOV     @RTCPSW,R4      ;SAVE LINE CLOCK PSW VECTOR
2516  013024  012777  013274  170000          MOV     #2$,@RTCVT      ;SET UP RTC INTERRUPT VECTOR
2517  013032  012777  000340  167774          MOV     #340,@RTCPSW    ;DISALLOW INTERRUPTS AFTER THE INTERRUPT
2518  013040  004737  015056                  JSR     PC,@RPSW        ;SET PRIORITY TO 5
2519  013044  000240                                  .WORD   240
2520  013046  042777  000200  167734          BIC     #BIT7,@LKS      ;CLEAR CLOCK DONE FLAG
2521  013054  052777  000100  167726          BIS     #BIT6,@LKS      ;ENABLE CLOCK INTERRUPTS
2522  013062  105777  167722              1$: TSTB    @LKS            ;WAIT FOR DONE
2523  013066  100375                          BPL     1$
2524  013070  000240                          NOP                     ;GIVE TIME FOR ANY INTERRUPT
2525
2526  013072  104146                          ERROR   146             ;RTC INTERRUPT DID NOT OCCUR
2527
2528  013074  022626                      2$: CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2529  013076  012777  013116  167726          MOV     #3$,@RTCVT      ;POINT RTC VECTOR TO ERROR REPORT
2530  013104  004737  015056                  JSR     PC,@RPSW        ;SET PSW TO PRIORITY 5
2531  013110  000240                                  .WORD   240
2532  013112  000240                          NOP                     ;GIVE SOME TIME FOR AN INTERRUPT
2533  013114  000402                          BR      4$              ;NO INTERRUPT - BR TO END OF TEST
2534
2535  013116  022626                      3$: CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2536  013120  104147                          ERROR   147             ;INTERRUPT SEQUENCE DID NOT CLEAR
2537                                                                  ;INTERRUPT REQUEST
2538
2539  013122  042777  000100  167660      4$: BIC     #BIT6,@LKS      ;DISABLE CLOCK INTERRUPTS
2540  013130  010377  167676                  MOV     R3,@RTCVT       ;RESTORE LINE CLOCK VECTOR
2541  013134  010477  167674                  MOV     R4,@RTCPSW      ;RESTORE LINE CLOCK PSW VECTOR
2542
2543
2544                                        ;;**************************************************************
2545                                        ;*TEST 65       TEST THAT RTC INTERRUPT CLEARS WITH RESET
2546                                        ;;**************************************************************
2547  013140  000004                  TST65:  SCOPE
2548  013142  012737  000065  001104          MOV     #65,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2549  013150  032737  000001  001120          BIT     #1, @#$ENV      ;ARE WE RUNNING UNDER APT
2550  013156  001403                          BEQ     70$             ;IF NO THEN DO TEST
2551  013160  005737  001106                  TST     @#$PASS         ;IS THIS FIRST PASS
2552  013164  001036                          BNE     TST66           ;IF NO THEN SKIP TO NEXT TEST
2553  013166                              70$:
2554  013166  004737  015056                  JSR     PC,@RPSW        ;SET PRIORITY TO 7
2555  013172  000340                                  .WORD   340
2556  013174  017703  167632                  MOV     @RTCVT,R3       ;SAVE LINE CLOCK VECTOR
2557  013200  012777  013252  167624          MOV     #2$,@RTCVT      ;POINT RTC VECTOR TO ERROR REPORT
2558  013206  042777  000200  167574          BIC     #BIT7,@LKS      ;CLEAR CLOCK DONE FLAG
2559  013214  052777  000100  167566          BIS     #BIT6,@LKS      ;ENABLE CLOCK INTERRUPTS
2560  013222  105777  167562              1$: TSTB    @LKS            ;WAIT FOR DONE (INTERRUPT REQUEST)
```

```
2561  013226  100375                        BPL     1$
2562  013230  000005                        RESET                   ;CLEAR PENDING INTERRUPT WITH RESET
2563  013232  004737  015056                JSR     PC,@RPSW        ;SET PRIORITY TO 5
2564  013236  000240                        .WORD   240
2565  013240  000240                        NOP                     ;GIVE TIME FOR ANY INTERRUPT
2566  013242  042777  000100  167540        BIC     #BIT6,@LKS      ;DISALLOW INTERRUPTS
2567  013250  000402                        BR      3$              ;BR TO END OF TEST
2568
2569  013252  022626                2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2570  013254  104150                        ERROR   150             ;RESET DID NOT CLEAR INTERRUPT
2571
2572  013256  010377  167550        3$:     MOV     R3,@RTCVT       ;RESTORE LINE CLOCK VECTOR
2573
2574
2575                                ;;*******************************************************************
2576                                ;*TEST 66        TEST THAT RTC INTERRUPT CLEARS BY CLEARING BIT7 OF LKS
2577                                ;;*******************************************************************
2578  013262  000004                TST66:  SCOPE
2579  013264  012737  000066  001104        MOV     #66,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2580  013272  032737  000001  001120        BIT     #1, @#$ENV      ;ARE WE RUNNING UNDER APT
2581  013300  001403                        BEQ     70$             ;IF NO THEN DO TEST
2582  013302  005737  001106                TST     @#$PASS         ;IS THIS FIRST PASS
2583  013306  001043                        BNE     TST67           ;IF NO THEN SKIP TO NEXT TEST
2584  013310                        70$:
2585  013310  004737  015056                JSR     PC,@RPSW        ;SET PRIORITY TO 7
2586  013314  000340                        .WORD   340
2587  013316  017703  167510                MOV     @RTCVT,R3       ;SAVE LINE CLOCK VECTOR
2588  013322  012777  013400  167502        MOV     #2$,@RTCVT      ;POINT RTC VECTOR TO ERROR REPORT
2589  013330  042777  000200  167452        BIC     #BIT7,@LKS      ;CLEAR CLOCK DONE FLAG
2590  013336  052777  000100  167444        BIS     #BIT6,@LKS      ;ENABLE CLOCK INTERRUPTS
2591  013344  105777  167440        1$:     TSTB    @LKS            ;WAIT FOR DONE (INTERRUPT REQUEST)
2592  013350  100375                        BPL     1$
2593  013352  042777  000200  167430        BIC     #BIT7,@LKS      ;CLEAR DONE & INTERRUPT
2594  013360  004737  015056                JSR     PC,@RPSW        ;ALLOW INTERRUPTS
2595  013364  000240                        .WORD   240
2596  013366  000240                        NOP                     ;GIVE TIME FOR ANY INTERRUPT
2597  013370  042777  000100  167412        BIC     #BIT6,@LKS      ;DISALLOW INTERRUPTS
2598  013376  000402                        BR      3$              ;BR TO END OF TEST
2599
2600
2601  013400  022626                2$:     CMP     (SP)+,(SP)+     ;RESTORE SP AFTER INTERRUPT
2602  013402  104151                        ERROR   151             ;CLEARING BIT7 OF LKS DID NOT CLEAR INTERRUPT
2603
2604  013404  010377  167422        3$:     MOV     R3,@RTCVT       ;RESTORE LINE CLOCK VECTOR
2605  013410  004737  015056                JSR     PC,@RPSW        ;RESTORE PRIORITY TO 7
2606  013414  000340                        .WORD   340
2607
2608
2609                                ;;*******************************************************************
2610                                ;*TEST 67        TEST CLOCK REPEATABILITY
2611                                ;;*******************************************************************
2612  013416  000004                TST67:  SCOPE
2613  013420  012737  000067  001104        MOV     #67,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
2614  013426  032737  000001  001120        BIT     #1, @#$ENV      ;ARE WE RUNNING UNDER APT
2615  013434  001403                        BEQ     70$             ;IF NO THEN DO TEST
2616  013436  005737  001106                TST     @#$PASS         ;IS THIS FIRST PASS
```

```
2617  013442  001056                          BNE     TST70           ;IF NO THEN SKIP TO NEXT TEST
2618  013444                          70$:
2619  013444  042777  000100  167336          BIC     #BIT6,@LKS      ;DISALLOW INTERRUPTS
2620  013452  005000                          CLR     R0              ;CLEAR A TIMER
2621  013454  012701  177777                  MOV     #-1,R1          ;SET A FLAG INDICATING FIRST PASS THR' THI' .00P
2622  013460  005002                  1$:     CLR     R2              ;CLEAR CLOCK COUNTER
2623  013462  005077  167322                  CLR     @LKS            ;CLEAR DONE
2624  013466  105777  167316          2$:     TSTB    @LKS            ;SYNC ON DONE
2625  013472  100375                          BPL     2$
2626  013474  005077  167310                  CLR     @LKS            ;CLEAR DONE
2627  013500  105777  167304          3$:     TSTB    @LKS            ;IS CLOCK DONE?
2628  013504  100003                          BPL     4$              ;BR IF NOT , TO INCREMENT TIMER
2629  013506  005202                          INC     R2              ;IF DONE, INCREMENT CLOCK COUNT
2630  013510  005077  167274                  CLR     @LKS            ;CLEAR DONE
2631  013514  005200                  4$:     INC     R0              ;INCREMENT TIMER
2632  013516  001370                          BNE     3$              ;BR IF TIME REMAINS
2633  013520  005201                          INC     R1              ;INCREMENT LOOP PASS FLAG
2634  013522  001003                          BNE     CMPARE          ;BR IF TWO PASSES HAVE BEEN MADE
2635  013524  010237  013574                  MOV     R2,FIRST        ;IF NOT, STORE FIRST CLOCK COUNT
2636  013530  000753                          BR      1$              ;DO LOOP AGAIN
2637  013532  013701  013574          CMPARE: MOV     FIRST,R1        ;RECALL FIRST CLOCK COUNT
2638  013536  160201                          SUB     R2,R1           ;CALCULATE DIFFERENCE OF TWO COUNTS
2639  013540  100001                          BPL     TOLER           ;IF POSITIVE,SKIP NEGATION OF DIFFERENCE
2640  013542  005401                          NEG     R1              ;MAKE DIFFERENCE A POSITIVE NUMBER
2641  013544  020127  000002          TOLER:  CMP     R1,#2           ;COMPARE DIFFERENCE WITH DESIRED TOLERANCE
2642  013550  003403                          BLE     5$              ;BR, IF LOWER/EQUAL TO TOLERANCE
2643
2644  013552  010237  013576                  MOV     R2,SECND        ;STORE SECOND COUNT
2645  013556  104152                          ERROR   152             ;CLOCK REPEATABILITY ERROR
2646
2647  013560  032777  000040  165252  5$:     BIT     #BIT5,@SWR      ;CLOCK TESTS ONLY?
2648  013566  001404                          BEQ     TST70           ;BR IF NOT
2649  013570  000137  014740                  JMP     $EOP            ;ELSE, JUMP TO END OF PASS ROUTINE
2650
2651  013574  000000                  FIRST:  0
2652  013576  000000                  SECND:  0
```

```
        013600                                  BLAST:

                                                ;;*******************************************************************
                                                ;*TEST 70        TEST ALL INTERNAL OPTIONS SIMULTANEOUSLY
                                                ;;*******************************************************************
        013600  000004                          TST70:  SCOPE
        013602  012737  000070  001104                  MOV     #70,$TESTN      ;;SET TEST NUMBER IN APT MAIL BOX
        013610  032737  000001  001120                  BIT     #BIT0,@#$ENV    ;ARE WE RUNNING UNDER APT
        013616  001405                                  BEQ     70$             ;IF NO DO TEST
        013620  005737  001106                          TST     @#$PASS         ;IS THIS FIRST PASS
        013624  001402                                  BEQ     70$             ;IF YES DO TEST
        013626  000137  014740                          JMP     $EOP            ;IF NO DO NOT DO TEST
        013632  000005                          70$:    RESET                   ;CLEAR EVERY BODY
        013634  012737  000340  177776                  MOV     #340,PS         ;SET PROCESSOR PRIORITY TO 7
        013642  017737  167150  001060                  MOV     @TVECT,$TMP0
        013650  017737  167136  001062                  MOV     @RVECT,$TMP1
        013656  017737  167144  001064                  MOV     @CTVECT,$TMP2
        013664  017737  167132  001066                  MOV     @CRVECT,$TMP3
        013672  017737  167134  001070                  MOV     @RTCVT,$TMP4
        013700  005037  014726                          CLR     XMTCT1          ;INITIALIZE COUNTERS
        013704  005037  014730                          CLR     XMTCT2
        013710  005037  014732                          CLR     RECCT1
        013714  005037  014734                          CLR     RECCT2
        013720  005037  014736                          CLR     COUNT
        013724  012777  014154  167074                  MOV     #XMIT1,@CTVECT  ;SET UP SLU1 TRANSMIT VECTOR
        013732  012777  000340  167070                  MOV     #340, @CTPSW    ;AND PSW
        013740  012777  014210  167054                  MOV     #REC1, @CRVECT  ;SET UP SLU1 RECEIVER VECTOR
        013746  012777  000340  167050                  MOV     #340, @CRPSW    ;AND PSW
        013754  012777  014270  167034                  MOV     #XMIT2, @TVECT  ;SET UP SLU2 TRANSMIT VECTOR
        013762  012777  000340  167030                  MOV     #340, @TPSW     ;AND PSW
        013770  012777  014324  167014                  MOV     #REC2, @RVECT   ;SET UP SLU2 RECEIVER VECTOR
        013776  012777  000340  167010                  MOV     #340, @RPSW     ;AND PSW
        014004  012777  014144  167020                  MOV     #TICKER, @RTCVT ;SET UP RTC VECTOR
        014012  012777  000340  167014                  MOV     #340, @RTCPSW   ;AND PSW
        014020  032737  000001  001156                  BIT     #BIT0, $DEVM    ;IS SLU1 UNDER TEST
        014026  001413                                  BEQ     1$              ;IF NO DON'T TURN IT ON
        014030  052777  000004  166746                  BIS     #BIT2, @CTCSR   ;ENABLE SLU1 MAINTENANCE WRAP
        014036  052777  000100  166740                  BIS     #BIT6, @CTCSR   ;ENABLE SLU1 XMIT INTERRUPT
        014044  052777  000100  166726                  BIS     #BIT6, @CRCSR   ;ENABLE SLU1 RECEIVER INTERRUPT
        014052  012702  030450                          MOV     #BUF1, R2       ;SET UP RECEIVER BUFFER
        014056  032737  000002  001156          1$:     BIT     #BIT1, $DEVM    ;IS SLU2 UNDER TEST
        014064  001410                                  BEQ     2$              ;IF NO DON'T SET IT UP
        014066  052777  000100  166700                  BIS     #BIT6, @TCSR    ;ENABLE SLU2 XMIT INTERRUPT
        014074  052777  000100  166666                  BIS     #BIT6, @RCSR    ;ENABLE SLU2 RECEIVER INTERRUPT
        014102  012703  031050                          MOV     #BUF2, R3       ;SET UP RECEIVER BUFFER
        014106  032737  000004  001156          2$:     BIT     #BIT2, $DEVM    ;IS LTC UNDER TEST
        014114  001403                                  BEQ     3$              ;IF NO DON'T SET IT UP
        014116  052777  000100  166664                  BIS     #BIT6, @LKS     ;ENABLE RTC INTERRUPTS
        014124  012700  177777                  3$:     MOV     #-1, R0         ;INITIALIZE DATA FOR SLU1(1ST CHR. 0)
        014130  012701  177777                          MOV     #-1, R1         ;INITIALIZE DATA FOR SLU2(1ST CHR. 0)
        014134  005037  177776                          CLR     PS              ;DROP PROCESSOR PRIORITY TO ZERO
        014140  000001                          WAITIO: WAIT                    ;WAIT FOR INTERRUPT
        014142  000776                                  BR      WAITIO

        014144  005237  014736                  TICKER: INC     COUNT           ;UPDATE COUNT
        014150  000137  014400                          JMP     IOHAND          ;GO TO INTERRUPT HANDLER
```

```
2709  014154  005237  014726          XMIT1:  INC     XMTCT1          ;UPDATE XMIT INTERRUPT COUNT
2710  014160  005200                          INC     R0              ;UPDATE XMIT DATA
2711  014162  010077  166620                  MOV     R0, @CTBUF      ;SEND NEXT CHARACTER
2712  014166  023727  014726  000400          CMP     XMTCT1,#400     ;IF 256 CHARACTERS HAVE NOT BEEN
2713  014174  002403                          BLT     1$              ;TRANSFERRED CONTINUE
2714  014176  042777  000100  166600          BIC     #BIT6, @CTCSR   ;IF YES TURN OFF TRANSMITTER INTERRUPTS FOR
2715  014204  000137  014400          1$:     JMP     IOHAND          ;GO TO INTERRUPT HANDLER
2716
2717  014210  005237  014732          REC1:   INC     RECCT1          ;UPDATE RECEIVER INTERUPT COUNT
2718  014214  005777  166562                  TST     @CRBUF          ;BIT 15 SET IF ANY ERRORS OCCURRED
2719  014220  100017                          BPL     3$              ;IF BIT IS CLEAR NO ERROR
2720  014222  017737  166554  001026          MOV     @CRBUF, $BDDAT  ;GET ERROR INFORMATION
2721  014230  000005                          RESET                   ;CLEAR THE WORLD STOP ALL
2722                                                                  ;INTERRUPTS
2723  014232  020227  030450                  CMP     R2, #BUF1       ;WAS MORE THAN 1 WORD TRANSFERRED
2724  014236  003004                          BGT     1$              ;IF YES GET LAST GOOD DATA
2725  014240  012737  177777  001024          MOV     #-1, $GDDAT     ;MAKE GOOD DATA = -1
2726  014246  000403                          BR      2$              ;GO TO ERROR REPORT
2727  014250  116237  177777  001024  1$:     MOVB    -1(R2), $GDDAT  ;GET LAST GOOD DATA
2728  014256  104153                  2$:     ERROR   153             ;RECEIVER STATUS ERROR
2729  014260  117722  166516          3$:     MOVB    @CRBUF, (R2)+   ;GET DATA AND STORE IT
2730  014264  000137  014400                  JMP     IOHAND          ;GO TO INTERRUPT HANDLER
2731
2732  014270  005237  014730          XMIT2:  INC     XMTCT2          ;UPDATE XMIT INTERRUPT COUNT
2733  014274  005201                          INC     R1              ;UPDATE XMIT DATA
2734  014276  010177  166474                  MOV     R1, @TBUF       ;SEND NEXT CHARACTER
2735  014302  023727  014730  000400          CMP     XMTCT2, #400    ;IF 256 CHARACTERS HAVE NOT
2736  014310  002403                          BLT     1$              ;BEEN TRANSFERRED CONTINUE
2737  014312  042777  000100  166454          BIC     #BIT6, @TCSR    ;ELSE NO MORE XMIT INTERRUPTS
2738  014320  000137  014400          1$:     JMP     IOHAND          ;GO TO INTERRUPT HANDLER
2739
2740  014324  005237  014734          REC2:   INC     RECCT2          ;UPDATE RECEIVER INTERRUPT COUNT
2741  014330  005777  166436                  TST     @RBUF           ;BIT 15 SETS IF ANY ERRORS OCCURRED
2742  014334  100017                          BPL     3$              ;IF BIT IS CLEAR NO ERRORS
2743  014336  017737  166430  001026          MOV     @RBUF, $BDDAT   ;GET ERROR INFORMATION
2744  014344  000005                          RESET                   ;CLEAR THE WORLD - STOP ALL
2745                                                                  ;INTERRUPTS
2746  014346  020327  031050                  CMP     R3, #BUF2       ;WAS MORE THAN 1 WORD TRANSFERRED
2747  014352  003004                          BGT     1$              ;IF YES GET LAST GOOD DATA
2748  014354  012737  177777  001024          MOV     #-1, $GDDAT     ;IF NO MAKE GOOD DATA -1
2749  014362  000403                          BR      2$              ;AND GET TO ERROR REPORT
2750  014364  116337  177777  001024  1$:     MOVB    -1(R3), $GDDAT  ;GET LAST GOOD DATA RECEIVED
2751  014372  104154                  2$:     ERROR   154             ;RECEIVER STATUS ERROR
2752  014374  117723  166372          3$:     MOVB    @RBUF, (R3)+    ;GET DATA AND STORE IT
2753
2754  014400  032737  000004  001156  IOHAND: BIT     #BIT2, $DEVM    ;IS RTC UNDER TEST
2755  014406  001416                          BEQ     1$              ;IF NO CHECK OTHER DEVICES
2756  014410  023727  014736  000074          CMP     COUNT, #74      ;HAS 1 SEC ELAPSED
2757  014416  002427                          BLT     3$              ;IF NO CONTINUE TEST
2758  014420  042777  000100  166356          BIC     #BIT6, @CTCSR   ;IF YES STOP TRANSMISSIONS
2759  014426  042777  000100  166340          BIC     #BIT6, @TCSR    ;
2760  014434  042777  000100  166346          BIC     #BIT6,  @LKS    ;TURN OFF LINE CLOCK
2761  014442  000416                          BR      WAITER
2762  014444  032737  000001  001156  1$:     BIT     #BIT0, $DEVM    ;IS SLU1 UNDER TEST
2763  014452  001405                          BEQ     2$              ;IF NO CHECK FOR SLU2
2764  014454  032777  000100  166322          BIT     #BIT6, @CTCSR   ;IS TRANSMITTER SHUTDOWN
```

```
2765  014462  001405                          BEQ     3$              ;IF NO CONTINUE TEST
2766  014464  000405                          BR      WAITER          ;IF YES GO WAIT FOR POSSIBLE
2767
2768  014466  032777  000100  166300  2$:     BIT     #BIT6, @TCSR    ;IS TRANSMITTER SHUT DOWN
2769  014474  001001                          BNE     WAITER          ;IF YES GO WAIT FOR POSSIBLE
2770                                                                  ;LAST CHARACTER
2771  014476  000002                  3$:     RTI                     ;RETURN FROM INTERRUPT TO AWAIT NEXT
2772
2773  014500  005037  177776          WAITER: CLR     PS              ;MAKE PROCESSOR PRIORITY 0
2774  014504  012705  140000                  MOV     #-40000, R5     ;SET UP LOOP COUNTER
2775  014510  062705  000001          1$:     ADD     #1, R5          ;DO LOOP UNTIL R5 = 0
2776  014514  001375                          BNE     1$
2777  014516  000005                          RESET                   ;STOP EVERYONE SHOULD BE DONE
2778  014520  012706  001000                  MOV     #1000,SP        ;RESET STACK AFTER LAST INTERRUPT
2779
2780  014524  032737  000001  001156  CHECK1: BIT     #BIT0, $DEVM    ;SLU1 UNDER TEST
2781  014532  001424                          BEQ     CHECK2          ;IF NO GO CHECK SLU2 DATA
2782  014534  023737  014726  014732          CMP     XMTCT1,RECCT1   ;# OF XMIT INTERRUPTS = REC INTERRUPTS
2783  014542  001401                          BEQ     1$              ;IF YES GET OVER ERROR AND CHECK DATA
2784  014544  104155                          ERROR   155             ;INTERRUPT COMPARISON ERROR
2785  014546  012702  030450          1$:     MOV     #BUF1, R2       ;POINT TO FIRST DATA
2786  014552  005000                          CLR     R0              ;INITIALIZE TO FIRST DATA XMIT
2787  014554  013704  014726                  MOV     XMTCT1, R4      ;GET # OF BYTES TRANSFERRED
2788  014560  122200                  2$:     CMPB    (R2)+, R0       ;IS RECEIVED DATA = EXPECTED
2789  014562  001406                          BEQ     3$              ;IF YES CONTINUE
2790  014564  114237  001026                  MOVB    -(R2), $BDDAT   ;IF NO GET ERROR INFORMATION
2791  014570  010037  001024                  MOV     R0, $GDDAT
2792  014574  104156                          ERROR   156             ;SLU1 DATA COMPARISON ERROR
2793  014576  005202                          INC     R2              ;IF CONTINUE ON ERROR RESET POINTER
2794  014600  005200                  3$:     INC     R0              ;UPDATE TO NEXT GOOD DATA
2795  014602  077412                          SOB     R4,2$           ;LOOP UNTIL ALL DATA CHECKED
2796  014604  032737  000002  001156  CHECK2: BIT     #BIT1, $DEVM    ;SLU2 UNDER TEST
2797  014612  001424                          BEQ     FINIE           ;IF NO WE'RE DONE
2798  014614  023737  014730  014734          CMP     XMTCT2, RECCT2  ;#OF XMIT INTERRUPTS = REC INTERRUPTS
2799  014622  001401                          BEQ     1$              ;IF YES CHECK DATA
2800  014624  104157                          ERROR   157             ;INTERRUPT COMPARISON ERROR
2801  014626  012703  031050          1$:     MOV     #BUF2, R3       ;INITIALIZE TO FIRST RECEIVED DATA
2802  014632  005001                          CLR     R1              ;INITIALIZE TO FIRST XMIT DATA
2803  014634  013704  014730                  MOV     XMTCT2, R4      ;GET # OF BYTES TRANSFERRED
2804  014640  122301                  2$:     CMPB    (R3)+, R1       ;IS RECEIVED DATA = EXPECTED DATA
2805  014642  001406                          BEQ     3$              ;IF YES CONTINUE TESTING
2806  014644  114337  001026                  MOVB    -(R3), $BDDAT   ;IF NO GET ERROR INFORMATION
2807  014650  010137  001024                  MOV     R1, $GDDAT
2808  014654  104160                          ERROR   160             ;SLU2 DATA COMPARISON ERROR
2809  014656  005203                          INC     R3              ;IF COONTINUE ON ERROR RESET POINTER
2810  014660  005201                  3$:     INC     R1              ;UPDATE TO NEXT GOOD DATA
2811  014662  077412                          SOB     R4,2$           ;LOOP UNTIL ALL DATA CHECKED
2812  014664  013777  001060  166124  FINIE:  MOV     $TMP0, @TVECT   ;RESTORE VECTORS
2813  014672  013777  001062  166112          MOV     $TMP1, @RVECT
2814  014700  013777  001064  166120          MOV     $TMP2, @CTVECT
2815  014706  013777  001066  166106          MOV     $TMP3, @CRVECT
2816  014714  013777  001070  166110          MOV     $TMP4, @RTCVT
2817  014722  000137  014740                  JMP     $EOP            ;FINISHED TESTING GO TO END OF PASS
2818
2819  014726  000000                  XMTCT1: .WORD   0
2820  014730  000000                  XMTCT2: .WORD   0
```

```
2821  014732  000000          RECCT1: .WORD   0
2822  014734  000000          RECCT2: .WORD   0
2823  014736  000000          COUNT:  .WORD   0
2824
```

```
2825
2826                                    .SBTTL  END OF PASS ROUTINE
2827
2828                                    ;;*****************************************************************
2829                                    ;*INCREMENT THE PASS NUMBER ($PASS)
2830                                    ;*TYPE "END PASS #XXXXX" (WHERE XXXXX IS A DECIMAL NUMBER)
2831                                    ;*IF THERES A MONITOR GO TO IT
2832                                    ;*IF THERE ISN'T JUMP TO TST1
2833
2834  014740                            $EOP:
2835  014740  000004                           SCOPE
2836  014742  005037  001002                   CLR     $TSTNM          ;;ZERO THE TEST NUMBER
2837  014746  005237  001106                   INC     $PASS           ;;INCREMENT THE PASS NUMBER
2838  014752  042737  100000  001106          BIC     #100000,$PASS   ;;DON'T ALLOW A NEG. NUMBER
2839  014760  005327                   $EOPCT: DEC     (PC)+           ;;LOOP?
2840  014762  000001                           .WORD   1
2841  014764  003022                           BGT     $DOAGN          ;;YES
2842  014766  012737                           MOV     (PC)+,@(PC)+    ;;RESTORE COUNTER
2843  014770  000001                   $ENDCT: .WORD   1
2844  014772  014762                           $EOPCT
2845  014774  104401  015041                   TYPE    ,$ENDMG         ;;TYPE "END PASS #"
2846  015000  013746  001106                   MOV     $PASS,-(SP)     ;;SAVE $PASS FOR TYPEOUT
2847  015004  104405                           TYPDS                   ;;GO TYPE--DECIMAL ASCII WITH SIGN
2848  015006  104401  015036                   TYPE    ,$ENULL         ;;TYPE A NULL CHARACTER
2849  015012  013700  000042           $GET42: MOV     @#42,R0         ;;GET MONITOR ADDRESS
2850  015016  001405                           BEQ     $DOAGN          ;;BRANCH IF NO MONITOR
2851  015020  000005                           RESET                   ;;CLEAR THE WORLD
2852  015022  004710                   $ENDAD: JSR     PC,(R0)         ;;GO TO MONITOR
2853  015024  000240                           NOP                     ;;SAVE ROOM
2854  015026  000240                           NOP                     ;;FOR
2855  015030  000240                           NOP                     ;;ACT11
2856  015032                            $DOAGN:
2857  015032  000137                           JMP     @(PC)+          ;;RETURN
2858  015034  003450                   $RTNAD: .WORD   TST1
2859  015036     377     377     000   $ENULL: .BYTE   -1,-1,0         ;;NULL CHARACTER STRING
2860  015041     015  042412  042116   $ENDMG: .ASCIZ  <15><12>/END PASS #/
2861  015046  050040  051501  020123
2862  015054  000043
2863
2864  015056  011646                   WRPSW:  MOV(SP),-(SP)           ;COPY RETUN PC
2865  015060  013616                           MOV     @(SP)+,(SP)     ;MOVE NEW PSW TO STACK
2866  015062  062746  000002                   ADD     #2,-(SP)        ;ADJUST JSR RETURN
2867  015066  000002                           RTI                     ;POP RETURN PC & NEW PSW
2868
2869                                    ;SUBROUTINE TO REPORT UNEXPECTED OR ERRONEOUS TRAPS OR INTERRUPTS
2870
2871  015070  012600                   CATCH:  MOV     (SP)+,R0        ;GET ADDRESS OF TRAP VECTOR + 4
2872  015072  162700  000004                   SUB     #4,R0           ;ADJUST TO POINT TO TRAP ADDRESS
2873  015076  010037  015116                   MOV     R0,BDVECT       ;STORE TRAP OR INTERRUPT ADDRESS
2874  015102  016637  000002  015114          MOV     2(SP),OLDPC     ;GET PC WHERE TRAP OR INTERRUPT OCCURRED
2875  015110  104161                           ERROR   161             ;REPORT ERROR
2876
2877  015112  000000                           HALT                    ;PROGRAM MUST BE RESTARTED AT THIS POINT
2878  015114  000000                   OLDPC:  .WORD   0
2879  015116  000000                   BDVECT: .WORD   0
2880
```

```
2881
2882                                    ;;*****************************************************************
2883                                    ;*THIS ROUTINE WILL INCREMENT THE ERROR FLAG AND THE ERROR COUNT,
2884                                    ;*SAVE THE ERROR ITEM NUMBER AND ADDRESS OF THE ERROR CALL
2885                                    ;*AND GO TO $ERRTYP ON ERROR
2886                                    ;*THE SWITCH OPTIONS PROVIDED BY THIS ROUTINE ARE:
2887                                    ;*SW15=1        HALT ON ERROR
2888                                    ;*SW13=1        INHIBIT ERROR TYPEOUTS
2889                                    ;*SW09=1        LOOP IN ERROR
2890                                    ;*CALL
2891                                    ;*      ERROR   N       ;;ERROR=EMT AND N=ERROR ITEM NUMBER
2892                                    ;;*****************************************************************
2893
2894  015120                            $ERROR:
2895  015120  105237  001003           7$:     INCB    $ERFLG          ;SET THE ERROR FLAG
2896  015124  001775                           BEQ     7$              ;DON'T LET FLAG GO TO ZERO
2897  015126  013777  001002  163706           MOV     $TSTNM,@DISPLAY ;DISPLAY TEST NUMBER AND ERROR FLAG
2898  015134  005237  001012                   INC     $ERTTL          ;INCREMENT ERROR COUNT
2899  015140  011637  001016                   MOV     (SP),$ERRPC     ;GET ADDRESS OF ERROR INSTRUCTION
2900  015144  162737  000002  001016           SUB     #2,$ERRPC
2901  015152  117737  163640  001014           MOVB    @$ERRPC,$ITEMB  ;STRIP AND SAVE THE ERROR ITEM CODE
2902  015160  032777  020000  163652           BIT     #BIT13,@SWR     ;SKIP TYPEOUT IF SET
2903  015166  001004                           BNE     20$             ;SKIP TYPEOUTS
2904  015170  004737  015302                   JSR     PC,$ERRTYP      ;GO TO USER ERROR ROUTINE
2905  015174  104401  001075                   TYPE    ,$CRLF
2906  015200                            20$:
2907  015200  122737  000001  001120           CMPB    #APTENV,$ENV    ;RUNNING IN APT MODE
2908  015206  001007                           BNE     2$              ;NO, SKIP APT ERROR REPORT
2909  015210  113737  001014  015222           MOVB    $ITEMB,21$      ;SET ITEM NUMBER AS ERROR NUMBER
2910  015216  004737  016004                   JSR     PC,$ATY4        ;REPORT FATAL ERROR TO APT
2911  015222     000                    21$:    .BYTE   0
2912  015223     000                            .BYTE   0
2913  015224  000777                    22$:    BR      22$             ;APT ERROR LOOP
2914  015226  005777  163606           2$:     TST     @SWR            ;HALT ON ERROR
2915  015232  100001                           BPL     3$              ;SKIP IF CONTINUE
2916  015234  000000                           HALT                    ;HALT ON ERROR!
2917  015236  104407                    3$:     CKSWR                   ;TEST FOR CHANGE IN SOFT SWR
2918  015240  032777  001000  163572           BIT     #BIT09,@SWR     ;LOOP ON ERROR SWITCH SET?
2919  015246  001402                           BEQ     4$              ;BR IF NO
2920  015250  013716  001010                   MOV     $LPERR,(SP)     ;FUDGE RETURN FOR LOOPING
2921  015254  005737  001072           4$:     TST     $ESCAPE         ;CHECK FOR AN ESCAPE ADDRESS
2922  015260  001402                           BEQ     5$              ;BR IF NONE
2923  015262  013716  001072                   MOV     $ESCAPE,(SP)    ;FUDGE RETURN ADDRESS FOR ESCAPE
2924  015266                            5$:
2925  015266  022737  015022  000042           CMP     #$ENDAD,@#42    ;ACT-11 AUTO-ACCEPT?
2926  015274  001001                           BNE     6$              ;BR IF NO
2927  015276  000000                           HALT                    ;YES
2928  015300                            6$:
2929  015300  000002                           RTI                     ;RETURN
2930
```

```
2931
2932                                    .SBTTL  ERROR MESSAGE TYPEOUT ROUTINE
2933
2934                                    ;;*****************************************************************
2935                                    ;*THIS ROUTINE USES THE "ITEM CONTROL BYTE" ($ITEMB) TO DETERMINE WHICH
2936                                    ;*ERROR IS TO BE REPORTED. IT THEN OBTAINS, FROM THE "ERROR TABLE" ($ERRTB),
2937                                    ;*AND REPORTS THE APPROPRIATE INFORMATION CONCERNING THE ERROR.
2938
2939  015302                            $ERRTYP:
2940  015302  104401  001075                    TYPE    ,$CRLF          ;;"CARRIAGE RETURN" & "LINE FEED'
2941  015306  010046                            MOV     R0,-(SP)        ;;SAVE R0
2942  015310  005000                            CLR     R0              ;;PICKUP THE ITEM INDEX
2943  015312  153700  001014                    BISB    @#$ITEMB,R0
2944  015316  001004                            BNE     1$              ;;IF ITEM NUMBER IS ZERO, JUST
2945                                                                    ;;TYPE THE PC OF THE ERROR
2946  015320  013746  001016                    MOV     $ERRPC,-(SP)    ;;SAVE $ERRPC FOR TYPEOUT
2947                                                                    ;;ERROR ADDRESS
2948  015324  104402                            TYPOC                   ;;GO TYPE--OCTAL ASCII(ALL DIGITS)
2949  015326  000426                            BR      6$              ;;GET OUT
2950  015330  005300                    1$:     DEC     R0              ;;ADJUST THE INDEX SO THAT IT WILL
2951  015332  006300                            ASL     R0              ;;      WORK FOR THE ERROR TABLE
2952  015334  006300                            ASL     R0
2953  015336  006300                            ASL     R0
2954  015340  062700  001160                    ADD     #$ERRTB,R0      ;;FORM TABLE POINTER
2955  015344  012037  015354                    MOV     (R0)+,2$        ;;PICKUP "ERROR MESSAGE" POINTER
2956  015350  001404                            BEQ     3$              ;;SKIP TYPEOUT IF NO POINTER
2957  015352  104401                            TYPE                    ;;TYPE THE "ERROR MESSAGE"
2958  015354  000000                    2$:     .WORD   0               ;;"ERROR MESSAGE" POINTER GOES HERE
2959  015356  104401  001075                    TYPE    ,$CRLF          ;;"CARRIAGE RETURN" & "LINE FEED'
2960  015362  012037  015372            3$:     MOV     (R0)+,4$        ;;PICKUP "DATA HEADER" POINTER
2961  015366  001404                            BEQ     5$              ;;SKIP TYPEOUT IF 0
2962  015370  104401                            TYPE                    ;;TYPE THE "DATA HEADER"
2963  015372  000000                    4$:     .WORD   0               ;;"DATA HEADER" POINTER GOES HERE
2964  015374  104401  001075                    TYPE    ,$CRLF          ;;"CARRIAGE RETURN" & "LINE FEED"
2965  015400  011000                    5$:     MOV     (R0),R0         ;;PICKUP "DATA TABLE" POINTER
2966  015402  001004                            BNE     7$              ;;GO TYPE THE DATA
2967  015404  012600                    6$:     MOV     (SP)+,R0        ;;RESTORE R0
2968  015406  104401  001075                    TYPE    ,$CRLF          ;;"CARRIAGE RETURN" & "LINE FEED"
2969  015412  000207                            RTS     PC              ;;RETURN
2970  015414                            7$:
2971  015414  113046                            MOV     @(R0)+,-(SP)    ;;SAVE @(R0)+ FOR TYPEOUT
2972  015416  104402                            TYPOC                   ;;GO TYPE--OCTAL ASCII(ALL DIGITS)
2973  015420  005710                            TST     (R0)            ;;IS THERE ANOTHER NUMBER?
2974  015422  001770                            BEQ     6$              ;;BR IF NO
2975  015424  104401  015432                    TYPE    ,8$             ;;TYPE TWO(2) SPACES
2976  015430  000771                            BR      7$              ;;LOOP
2977  015432  020040      000           8$:     .ASCIZ  /  /            ;;TWO(2) SPACES
2978          015436                            .EVEN
2979
```

```
2980
2981                                    .SBTTL  POWER DOWN AND UP ROUTINES
2982                                    ;;*****************************************************************
2983                                            ;*POWER DOWN ROUTINE
2984                                    ;;*****************************************************************
2985  015436  012737  015576  000024  $PWRDN: MOV     #$ILLUP,@#PWRVEC ;SET FOR FAST UP
2986  015444  012737  000340  000026          MOV     #340,@#PWRVEC+2 ;PRIO:7
2987  015452  010046                         MOV     R0,-(SP)        ;PUSH R0 ON STACK
2988  015454  010146                         MOV     R1,-(SP)        ;PUSH R1 ON STACK
2989  015456  010246                         MOV     R2,-(SP)        ;PUSH R2 ON STACK
2990  015460  010346                         MOV     R3,-(SP)        ;PUSH R3 ON STACK
2991  015462  010446                         MOV     R4,-(SP)        ;PUSH R4 ON STACK
2992  015464  010546                         MOV     R5,-(SP)        ;PUSH R5 ON STACK
2993  015466  017746  163346                 MOV     @SWR,-(SP)      ;PUSH @SWR ON STACK
2994  015472  010637  015602                 MOV     SP,$SAVR6       ;SAVE SP
2995  015476  012737  015510  000024         MOV     #$PWRUP,@#PWRVEC ;SET UP VECTOR
2996  015504  000000                         HALT
2997  015506  000776                         BR      .-2             ;HANG UP
2998
2999
3000                                    ;;*****************************************************************
3001                                            ;*POWER UP ROUTINE
3002                                    ;;*****************************************************************
3003  015510  012737  015576  000024  $PWRUP: MOV     #$ILLUP,@#PWRVEC ;SET FOR FAST DOWN
3004  015516  013706  015602                 MOV     $SAVR6,SP       ;GET SP
3005  015522  012677  163312                 MOV     (SP)+,@SWR      ;POP STACK INTO @SWR
3006  015526  012605                         MOV     (SP)+,R5
3007  015530  012604                         MOV     (SP)+,R4        ;POP STACK INTO R4
3008  015532  012603                         MOV     (SP)+,R3        ;POP STACK INTO R3
3009  015534  012602                         MOV     (SP)+,R2        ;POP STACK INTO R2
3010  015536  012601                         MOV     (SP)+,R1        ;POP STACK INTO R1
3011  015540  012600                         MOV     (SP)+,R0        ;POP STACK INTO R0
3012  015542  012737  015436  000024         MOV     #$PWRDN,@#PWRVEC ;SET UP THE POWER DOWN VECTOR
3013  015550  012737  000340  000026         MOV     #340,@#PWRVEC+2 ;PRIO:7
3014  015556  005037  015602                 CLR     $SAVR6          ;WAIT LOOP FOR THE TTY
3015  015562  005237  015602          1$:    INC     $SAVR6          ;WAIT FOR THE INC
3016  015566  001375                         BNE     1$              ;OF WORD
3017  015570  104401                         TYPE                    ;REPORT THE POWER FAILURE
3018  015572  015604          $PWRMG: .WORD   $POWER                  ;POWER FAIL MESSAGE POINTER
3019  015574  000002                         RTI
3020  015576  000000          $ILLUP: HALT                            ;THE POWER UP SEQUENCE WAS STARTED
3021  015600  000776                         BR      .-2             ; BEFORE THE POWER DOWN WAS COMPLETE
3022  015602  000000          $SAVR6: 0                               ;PUT THE SP HERE
3023  015604  005015  047520  042527  $POWER: .ASCIZ  <15><12>"POWER"
3024  015612  000122
3025
```

```
3026
3027                                    .SBTTL  SCOPE HANDLER ROUTINE
3028
3029                                    ;;**********************************************************************
3030                                    ;*THIS ROUTINE CONTROLS THE LOOPING OF SUBTESTS. IT WILL INCREMENT
3031                                    ;*AND LOAD THE TEST NUMBER($TSTNM) INTO THE DISPLAY REG.(DISPLAY<7:0>
3032                                    ;*AND LOAD THE ERROR FLAG ($ERFLG) INTO DISPLAY<15:08>
3033                                    ;*THE SWITCH OPTIONS PROVIDED BY THIS ROUTINE ARE:
3034                                    ;*SW14=1        LOOP ON TEST
3035                                    ;*SW09=1        LOOP ON ERROR
3036                                    ;*CALL
3037                                    ;*      SCOPE           ;;SCOPE=IOT
3038
3039  015614                            $SCOPE:
3040  015614  104407                           CKSWR                   ;;TEST  FOR CHANGE IN SOFT-SWR
3041  015616  032777  040000  163214    1$:     BIT     #BIT14,@SWR     ;;LOOP ON PRESENT TEST?
3042  015624  001052                            BNE     $OVER           ;;YES IF SW14=1
3043                                    ;*****START OF CODE FOR THE XOR TESTER*****
3044  015626  000416                    $XTSTR: BR      6$              ;;IF RUNNING ON THE "XOR" TESTER CHANGE
3045                                                                    ;;THIS INSTRUCTION TO A "NOP" (NOP=240)
3046  015630  013746  000004                   MOV     @#ERRVEC,-(SP)  ;;SAVE THE CONTENTS OF THE ERROR VECTOR
3047  015634  012737  015654  000004          MOV     #5$,@#ERRVEC    ;;SET FOR TIMEOUT
3048  015642  005737  177060                   TST     @#177060        ;;TIME OUT ON XOR?
3049  015646  012637  000004                   MOV     (SP)+,@#ERRVEC  ;;RESTORE THE ERROR VECTOR
3050  015652  000421                           BR      $SVLAD          ;;GO TO THE NEXT TEST
3051  015654  022626                    5$:     CMP     (SP)+,(SP)+     ;;CLEAR THE STACK AFTER A TIME OUT
3052  015656  012637  000004                   MOV     (SP)+,@#ERRVEC  ;;RESTORE THE ERROR VECTOR
3053  015662  000407                           BR      7$              ;;LOOP ON THE PRESENT TEST
3054  015664                            6$:;*****END OF CODE FOR THE XOR TESTER*****
3055  015664  105737  001003            2$:     TSTB    $ERFLG          ;;HAS AN ERROR OCCURRED?
3056  015670  001412                           BEQ     $SVLAD          ;;BR IF NO
3057  015672  032777  001000  163140          BIT     #BIT09,@SWR     ;;LOOP ON ERROR?
3058  015700  001404                           BEQ     4$              ;;BR IF NO
3059  015702  013737  001010  001006    7$:     MOV     $LPERR,$LPADR   ;;SET LOOP ADDRESS TO LAST SCOPE
3060  015710  000420                           BR      $OVER
3061  015712  105037  001003            4$:     CLRB    $ERFLG          ;;ZERO THE ERROR FLAG
3062  015716  105237  001002            $SVLAD: INCB    $TSTNM          ;;COUNT TEST NUMBERS
3063  015722  113737  001002  001104          MOVB    $TSTNM,$TESTN   ;;SET TEST NUMBER IN APT MAILBOX
3064  015730  011637  001006                   MOV     (SP),$LPADR     ;;SAVE SCOPE LOOP ADDRESS
3065  015734  011637  001010                   MOV     (SP),$LPERR     ;;SAVE ERROR LOOP ADDRESS
3066  015740  005037  001072                   CLR     $ESCAPE         ;;CLEAR THE ESCAPE FROM ERROR ADDRESS
3067  015744  112737  000001  001015          MOVB    #1,$ERMAX       ;;ONLY ALLOW ONE(1) ERROR ON NEXT TEST
3068  015752  013777  001002  163062  $OVER:  MOV     $TSTNM,@DISPLAY ;;DISPLAY TEST NUMBER
3069  015760  013716  001006                   MOV     $LPADR,(SP)     ;;FUDGE RETURN ADDRESS
3070  015764  000002                           RTI                     ;;FIXES PS
3071
```

```
3072
3073                                    ;;*****************************************************************
3074                                    .SBTTL  APT COMMUNICATIONS ROUTINE
3075                                    ;;*****************************************************************
3076
3077  015766  112737  000001  016232  $ATY1:  MOVB    #1,$FFLG        ;TO REPORT FATAL ERROR
3078  015774  112737  000001  016230  $ATY3:  MOVB    #1,$MFLG        ;TO TYPE A MESSAGE
3079  016002  000403                  BR      $ATYC
3080  016004  112737  000001  016232  $ATY4:  MOVB    #1,$FFLG        ;TO ONLY REPORT FATAL ERROR
3081  016012                          $ATYC:
3082  016012  010046                          MOV     R0,-(SP)        ;PUSH R0 ON STACK
3083  016014  010146                          MOV     R1,-(SP)        ;PUSH R1 ON STACK
3084  016016  105737  016230                 TSTB    $MFLG           ;SHOULD TYPE A MESSAGE?
3085  016022  001450                          BEQ     5$              ;IF NOT: BR
3086  016024  122737  000001  001120         CMPB    #APTENV,$ENV    ;OPERATING UNDER APT?
3087  016032  001031                          BNE     3$              ;IF NOT: BR
3088  016034  132737  000100  001121         BITB    #APTSPOOL,$ENVM ;SHOULD SPOOL MESSAGE?
3089  016042  001425                          BEQ     3$              ;IF NOT: BR
3090  016044  017600  000004                 MOV     @4(SP),R0       ;GET MESSAGE ADDRESS
3091  016050  062766  000002  000004         ADD     #2,4(SP)        ;BUMP RETURN ADDRESS
3092  016056  005737  001100          1$:    TST     $MSGTYPE                ;SEE IF DONE W/ LAST XMISSION?
3093  016062  001375                          BNE     1$              ;IF NOT: WAIT
3094  016064  010037  001114                 MOV     R0,$MSGAD       ;PUT ADDRESS IN MAILBOX
3095  016070  105720                  2$:    TSTB    (R0)+           ;FIND END OF MESSAGE
3096  016072  001376                          BNE     2$
3097  016074  163700  001114                 SUB     $MSGAD,R0       ;SUB START OF MESSAGE
3098  016100  006200                          ASR     R0              ;GET MESSAGE LENGTH IN WORDS
3099  016102  010037  001116                 MOV     R0,$MSGLGT      ;PUT LENGTH IN MAILBOX
3100  016106  012737  000004  001100         MOV     #4,$MSGTYPE     ;TELL APT TO TAKE MESSAGE
3101  016114  000413                          BR      5$
3102  016116  017637  000004  016142  3$:    MOV     @4(SP),4$       ;PUT MSG ADDR IN JSR LINKAGE
3103  016124  062766  000002  000004         ADD     #2,4(SP)        ;BUMP RETURN ADDRESS
3104  016132  013746  177776                 MOV     177776,-(SP)    ;PUSH 177776 ON STACK
3105  016136  004737  016234                 JSR     PC,$TYPE        ;CALL TYPE MACRO
3106  016142  000000                  4$:    .WORD   0
3107  016144                          5$:
3108  016144  105737  016232          10$:   TSTB    $FFLG           ;SHOULD REPORT FATAL ERROR?
3109  016150  001413                          BEQ     12$             ;IF NOT, BR
3110  016152  005737  001120                 TST     $ENV            ;RUNNING UNDER APT?
3111  016156  001410                          BEQ     12$             ;IF NOT: BR
3112  016160  005737  001100          11$:   TST     $MSGTYPE        ;FINISHED LAST MESSAGE?
3113  016164  001375                          BNE     11$             ;IF NOT: WAIT
3114  016166  017637  000004  001102         MOV     @4(SP),$FATAL   ;GET ERROR #
3115  016174  005237  001100                 INC     $MSGTYPE        ;TELL APT TO TAKE ERROR
3116  016200  062766  000002  000004  12$:    ADD     #2,4(SP)        ;BUMP RETURN ADDRESS
3117  016206  105037  016232                 CLRB    $FFLG           ;CLEAR FATAL FLAG
3118  016212  105037  016231                 CLRB    $LFLG           ;CLEAR LOG FLAG
3119  016216  105037  016230                 CLRB    $MFLG           ;CLEAR MESSAGE FLAG
3120  016222  012601                          MOV     (SP)+,R1        ;POP STACK INTO R1
3121  016224  012600                          MOV     (SP)+,R0        ;POP STACK INTO R1
3122  016226  000207                          RTS     PC              ;RETURN
3123  016230     000                  $MFLG:  .BYTE   0
3124  016231     000                  $LFLG:  .BYTE   0               ;LOG FLAG
3125  016232     000                  $FFLG:  .BYTE   0               ;FATAL FLAG
3126
3127          016234                          .EVEN
```

F-16


```
3128          000200          APTSIZE=200
3129          000001          APTENV=001
3130          000100          APTSPOOL=100
3131          000040          APTCSUP=040
3132
```

```
                                .SBTTL  TYPE ROUTINE

                                ;;**********************************************************************
                                ;*ROUTINE TO TYPE ASCIZ MESSAGE. MESSAGE MUST TERMINATE WITH A 0 BYTE.
                                ;*THE ROUTINE WILL INSERT A NUMBER OF NULL CHARACTERS AFTER A LINE FEED.
                                ;*NOTE1:         $NULL CONTAINS THE CHARACTER TO BE USED AS THE FILLER CHARACTER.
                                ;*NOTE2:         $FILLS CONTAINS THE NUMBER OF FILLER CHARACTERS REQUIRED.
                                ;*NOTE3:         $FILLC CONTAINS THE CHARACTER TO FILL AFTER.
                                ;*
                                ;*CALL:
                                ;*1) USING A TRAP INSTRUCTION
                                ;*      TYPE    ,MESADR         ;;MESADR IS FIRST ADDRESS OF AN ASCIZ STRING
                                ;*OR
                                ;*      TYPE
                                ;*      MESADR
                                ;*

016234  105737  001057          $TYPE:  TSTB    $TPFLG          ;;IS THERE A TERMINAL?
016240  100002                          BPL     1$              ;;BR IF YES
016242  000000                          HALT                    ;;HALT HERE IF NO TERMINAL
016244  000430                          BR      3$              ;;LEAVE
016246  010046                  1$:     MOV     R0,-(SP)        ;;SAVE R0
016250  017600  000002                  MOV     @2(SP),R0       ;;GET ADDRESS OF ASCIZ STRING
016254  122737  000001  001120          CMPB    #APTENV,$ENV    ;;RUNNING IN APT MODE
016262  001011                          BNE     62$             ;;NO,GO CHECK FOR APT CONSOLE
016264  132737  000100  001121          BITB    #APTSPOOL,$ENVM ;;SPOOL MESSAGE TO APT
016272  001405                          BEQ     62$             ;;NO,GO CHECK FOR CONSOLE
016274  010037  016304                  MOV     R0,61$          ;;SETUP MESSAGE ADDRESS FOR APT
016300  004737  015774                  JSR     PC,$ATY3        ;;SPOOL MESSAGE TO APT
016304  000000                  61$:    .WORD   0               ;;MESSAGE ADDRESS
016306  132737  000040  001121  62$:    BITB    #APTCSUP,$ENVM  ;;APT CONSOLE SUPPRESSED
016314  001003                          BNE     60$             ;;YES,SKIP TYPE OUT
016316  112046                  2$:     MOVB    (R0)+,-(SP)     ;;PUSH CHARACTER TO BE TYPED ONTO STACK
016320  001005                          BNE     4$              ;;BR IF IT ISN'T THE TERMINATOR
016322  005726                          TST     (SP)+           ;;IF TERMINATOR POP IT OFF THE STACK
016324  012600                  60$:    MOV     (SP)+,R0        ;;RESTORE R0
016326  062716  000002          3$:     ADD     #2,(SP)         ;;ADJUST RETURN PC
016332  000002                          RTI                     ;;RETURN
016334  122716  000011          4$:     CMPB    #HT,(SP)        ;;BRANCH IF <HT>
016340  001430                          BEQ     8$
016342  122716  000200                  CMPB    #CRLF,(SP)      ;;BRANCH IF NOT <CRLF>
016346  001006                          BNE     5$
016350  005726                          TST     (SP)+           ;;POP  <CR><LF> EQUIV
016352  104401                          TYPE                    ;;TYPE A CR AND LF
016354  001075                          $CRLF
016356  105037  016564                  CLRB    $CHARCNT        ;;CLEAR CHARACTER COUNT
016362  000755                          BR      2$              ;;GET NEXT CHARACTER
016364  004737  016446          5$:     JSR     PC,$TYPEC       ;;GO TYPE THIS CHARACTER
016370  123726  001056          6$:     CMPB    $FILLC,(SP)+    ;;IS IT TIME FOR FILLER CHARS.?
016374  001350                          BNE     2$              ;;IF NO GO GET NEXT CHAR.
016376  013746  001054                  MOV     $NULL,-(SP)     ;;GET # OF FILLER CHARS. NEEDED
                                                                ;;AND THE NULL CHAR.
016402  105366  000001          7$:     DECB    1(SP)           ;;DOES A NULL NEED TO BE TYPED?
016406  002770                          BLT     6$              ;;BR IF NO--GO POP THE NULL OFF OF STACK
016410  004737  016446                  JSR     PC,$TYPEC       ;;GO TYPE A NULL
```

```
3189  016414  105337  016564                  DECB    $CHARCNT        ;;DO NOT COUNT AS A COUNT
3190  016420  000770                          BR      7$              ;;LOOP
3191
3192                                  ;HORIZONTAL TAB PROCESSOR
3193
3194  016422  112716  000040          8$:     MOVB    #' ,(SP)        ;;REPLACE TAB WITH SPACE
3195  016426  004737  016446          9$:     JSR     PC,$TYPEC       ;;TYPE A SPACE
3196  016432  132737  000007  016564          BITB    #7,$CHARCNT     ;;BRANCH IF NOT AT
3197  016440  001372                          BNE     9$              ;;TAB STOP
3198  016442  005726                          TST     (SP)+           ;;POP SPACE OFF STACK
3199  016444  000724                          BR      2$              ;;GET NEXT CHARACTER
3200  016446                        $TYPEC:
3201  016446  105777  162372                  TSTB    @#TKS           ;;CHAR IN KYBD BUFFER?          ;MJD001
3202  016452  100022                          BPL     10$             ;;BR IF NOT                     ;MJD001
3203  016454  017746  162366                  MOV     @#TKB,-(SP)     ;;GET CHAR                      ;MJD001
3204  016460  042716  177600                  BIC     #177600,(SP)    ;;STRIP EXTRANEOUS BITS         ;MJD001
3205  016464  122716  000023                  CMPB    #^XOFF,(SP)     ;;WAS CHAR XOFF                 ;MJD001
3206  016470  001012                          BNE     102$            ;;BR IF NOT                     ;MJD001
3207  016472                        101$:                                                             ;MJD001
3208  016472  105777  162346                  TSTB    @#TKS           ;;WAIT FOR CHAR                 ;MJD001
3209  016476  100375                          BPL     101$                                            ;MJD001
3210  016500  117716  162342                  MOVB    @#TKB,(SP)      ;;GET CHAR                      ;MJD001
3211  016504  042716  177600                  BIC     #177600,(SP)    ;;STRIP IT                      ;MJD001
3212  016510  122716  000021                  CMPB    #^XON,(SP)      ;;WAS IT XON?                   ;MJD001
3213  016514  001366                          BNE     101$            ;;BR IF NOT                     ;MJD001
3214  016516                        102$:                                                             ;MJD001
3215  016516  005726                          TST     (SP)+           ;;FIX STACK                     ;MJD001
3216  016520                        10$:                                                              ;MJD001
3217  016520  105777  162324                  TSTB    @#TPS           ;;WAIT UNTIL PRINTER IS READY
3218  016524  100375                          BPL     10$                                             ;MJD001
3219  016526  116677  000002  162316          MOVB    2(SP),@#TPB     ;;LOAD CHAR TO BE TYPED INTO DATA REG.
3220  016534  122766  000015  000002          CMPB    #CR,2(SP)       ;;IS CHARACTER A CARRIAGE RETURN?
3221  016542  001003                          BNE     1$              ;;BRANCH IF NO
3222  016544  105037  016564                  CLRB    $CHARCNT        ;;YES--CLEAR CHARACTER COUNT
3223  016550  000406                          BR      $TYPEX          ;;EXIT
3224  016552  122766  000012  000002  1$:     CMPB    #LF,2(SP)       ;;IS CHARACTER A LINE FEED?
3225  016560  001402                          BEQ     $TYPEX          ;;BRANCH IF YES
3226  016562  105227                          INCB    (PC)+           ;;COUNT THE CHARACTER
3227  016564  000000                $CHARCNT:.WORD  0               ;;CHARACTER COUNT STORAGE
3228  016566  000207                $TYPEX: RTS     PC
3229
3230                                  .SBTTL  BINARY TO OCTAL (ASCII) AND TYPE
3231
3232                                  ;;**********************************************************
3233                                  ;*THIS ROUTINE IS USED TO CHANGE A 16-BIT BINARY NUMBER TO A 6-DIGIT
3234                                  ;*OCTAL (ASCII) NUMBER AND TYPE IT.
3235                                  ;*$TYPOS---ENTER HERE TO SETUP SUPPRESS ZEROS AND NUMBER OF DIGITS TO TYPE
3236                                  ;*CALL:
3237                                  ;*      MOV     NUM,-(SP)       ;;NUMBER TO BE TYPED
3238                                  ;*      TYPOS                   ;;CALL FOR TYPEOUT
3239                                  ;*      .BYTE   N               ;;N=1 TO 6 FOR NUMBER OF DIGITS TO TYPE
3240                                  ;*      .BYTE   M               ;;M=1 OR 0
3241                                  ;*                                      ;;1=TYPE LEADING ZEROS
3242                                  ;*                                      ;;0=SUPPRESS LEADING ZEROS
3243                                  ;*
3244                                  ;*$TYPON----ENTER HERE TO TYPE OUT WITH THE SAME PARAMETERS AS THE LAST
```

```
                                        ;*$TYPOS OR $TYPOC
                                        ;*CALL:
                                        ;*      MOV     NUM, (SP)       ;;NUMBER TO BE TYPED
                                        ;*      TYPON                   ;;CALL FOR TYPEOUT
                                        ;*
                                        ;*$TYPOC --ENTER HERE FOR TYPEOUT OF A 16 BIT NUMBER
                                        ;*CALL:
                                        ;*      MOV     NUM, (SP)       ;;NUMBER TO BE TYPED
                                        ;*      TYPOC                   ;;CALL FOR TYPEOUT

016570  017646  000000          $TYPOS: MOV     @(SP),-(SP)     ;;PICKUP THE MODE
016574  116637  000001  017013          MOVB    1(SP),$OFILL    ;;LOAD ZERO FILL SWITCH
016602  112637  017015                  MOVB    (SP)+,$OMODE+1  ;;NUMBER OF DIGITS TO TYPE
016606  062716  000002                  ADD     #2,(SP)         ;;ADJUST RETURN ADDRESS
016612  000406                          BR      $TYPON
016614  112737  000001  017013  $TYPOC: MOVB    #1,$OFILL       ;;SET THE ZERO FILL SWITCH
016622  112737  000006  017015          MOVB    #6,$OMODE+1     ;;SET FOR SIX(6) DIGITS
016630  112737  000005  017012  $TYPON: MOVB    #5,$OCNT        ;;SET THE ITERATION COUNT
016636  010346                          MOV     R3,-(SP)        ;;SAVE R3
016640  010446                          MOV     R4,-(SP)        ;;SAVE R4
016642  010546                          MOV     R5,-(SP)        ;;SAVE R5
016644  113704  017015                  MOVB    $OMODE+1,R4     ;;GET THE NUMBER OF DIGITS TO TYPE
016650  005404                          NEG     R4
016652  062704  000006                  ADD     #6,R4           ;;SUBTRACT IT FOR MAX. ALLOWED
016656  110437  017014                  MOVB    R4,$OMODE       ;;SAVE IT FOR USE
016662  113704  017013                  MOVB    $OFILL,R4       ;;GET THE ZERO FILL SWITCH
016666  016605  000012                  MOV     12(SP),R5       ;;PICKUP THE INPUT NUMBER
016672  005003                          CLR     R3              ;;CLEAR THE OUTPUT WORD
016674  006105                  1$:     ROL     R5              ;;ROTATE MSB INTO "C"
016676  000404                          BR      3$              ;;GO DO MSB
016700  006105                  2$:     ROL     R5              ;;FORM THIS DIGIT
016702  006105                          ROL     R5
016704  006105                          ROL     R5
016706  010503                          MOV     R5,R3
016710  006103                  3$:     ROL     R3              ;;GET LSB OF THIS DIGIT
016712  105337  017014                  DECB    $OMODE          ;;TYPE THIS DIGIT?
016716  100016                          BPL     7$              ;;BR IF NO
016720  042703  177770                  BIC     #177770,R3      ;;GET RID OF JUNK
016724  001002                          BNE     4$              ;;TEST FOR 0
016726  005704                          TST     R4              ;;SUPPRESS THIS 0?
016730  001403                          BEQ     5$              ;;BR IF YES
016732  005204                  4$:     INC     R4              ;;DON'T SUPPRESS ANYMORE 0'S
016734  052703  000060                  BIS     #'0,R3          ;;MAKE THIS DIGIT ASCII
016740  052703  000040          5$:     BIS     #' ,R3          ;;MAKE ASCII IF NOT ALREADY
016744  110337  017010                  MOVB    R3,8$           ;;SAVE FOR TYPING
016750  104401  017010                  TYPE    ,8$             ;;GO TYPE THIS DIGIT
016754  105337  017012          7$:     DECB    $OCNT           ;;COUNT BY 1
016760  003347                          BGT     2$              ;;BR IF MORE TO DO
016762  002402                          BLT     6$              ;;BR IF DONE
016764  005204                          INC     R4              ;;INSURE LAST DIGIT ISN'T A BLANK
016766  000744                          BR      2$              ;;GO DO THE LAST DIGIT
016770  012605                  6$:     MOV     (SP)+,R5        ;;RESTORE R5
016772  012604                          MOV     (SP)+,R4        ;;RESTORE R4
016774  012603                          MOV     (SP)+,R3        ;;RESTORE R3
016776  016666  000002  000004          MOV     2(SP),4(SP)     ;;SET THE STACK FOR RETURNING
017004  012616                          MOV     (SP)+,(SP)
```

```
 3301  017006  000002                        RTI                     ;;RETURN
 3302  017010     000        8$:             .BYTE   0               ;;STORAGE FOR ASCII DIGIT
 3303  017011     000                        .BYTE   0               ;;TERMINATOR FOR TYPE ROUTINE
 3304  017012     000        $OCNT:          .BYTE   0               ;;OCTAL DIGIT COUNTER
 3305  017013     000        $OFILL:         .BYTE   0               ;;ZERO FILL SWITCH
 3306  017014  000000        $OMODE:         .WORD   0               ;;NUMBER OF DIGITS TO TYPE
 3307                                        .SBTTL  CONVERT BINARY TO DECIMAL AND TYPE ROUTINE
 3308
 3309                                        ;;*************************************************************
 3310                                        ;*THIS ROUTINE IS USED TO CHANGE A 16-BIT BINARY NUMBER TO A 5-DIGIT
 3311                                        ;*SIGNED DECIMAL (ASCII) NUMBER AND TYPE IT. DEPENDING ON WHETHER THE
 3312                                        ;*NUMBER IS POSITIVE OR NEGATIVE A SPACE OR A MINUS SIGN WILL BE TYPED
 3313                                        ;*BEFORE THE FIRST DIGIT OF THE NUMBER. LEADING ZEROS WILL ALWAYS BE
 3314                                        ;*REPLACED WITH SPACES.
 3315                                        ;*CALL:
 3316                                        ;*      MOV     NUM,-(SP)       ;;PUT THE BINARY NUMBER ON THE STACK
 3317                                        ;*      TYPDS                   ;;GO TO THE ROUTINE
 3318
 3319  017016                                $TYPDS:
 3320  017016  010046                            MOV     R0,-(SP)        ;;PUSH R0 ON STACK
 3321  017020  010146                            MOV     R1,-(SP)        ;;PUSH R1 ON STACK
 3322  017022  010246                            MOV     R2,-(SP)        ;;PUSH R2 ON STACK
 3323  017024  010346                            MOV     R3,-(SP)        ;;PUSH R3 ON STACK
 3324  017026  010546                            MOV     R5,-(SP)        ;;PUSH R5 ON STACK
 3325  017030  012746  020200                    MOV     #20200,-(SP)    ;;SET BLANK SWITCH AND SIGN
 3326  017034  016605  000020                    MOV     20(SP),R5       ;;GET THE INPUT NUMBER
 3327  017040  100004                            BPL     1$              ;;BR IF INPUT IS POS.
 3328  017042  005405                            NEG     R5              ;;MAKE THE BINARY NUMBER POS.
 3329  017044  112766  000055  000001            MOVB    #'-,1(SP)       ;;MAKE THE ASCII NUMBER NEG.
 3330  017052  005000                1$:         CLR     R0              ;;ZERO THE CONSTANTS INDEX
 3331  017054  012703  017232                    MOV     #$DBLK,R3       ;;SETUP THE OUTPUT POINTER
 3332  017060  112723  000040                    MOVB    #' ,(R3)+       ;;SET THE FIRST CHARACTER TO A BLANK
 3333  017064  005002                2$:         CLR     R2              ;;CLEAR THE BCD NUMBER
 3334  017066  016001  017222                    MOV     $DTBL(R0),R1    ;;GET THE CONSTANT
 3335  017072  160105                3$:         SUB     R1,R5           ;;FORM THIS BCD DIGIT
 3336  017074  002402                            BLT     4$              ;;BR IF DONE
 3337  017076  005202                            INC     R2              ;;INCREASE THE BCD DIGIT BY 1
 3338  017100  000774                            BR      3$
 3339  017102  060105                4$:         ADD     R1,R5           ;;ADD BACK THE CONSTANT
 3340  017104  005702                            TST     R2              ;;CHECK IF BCD DIGIT=0
 3341  017106  001002                            BNE     5$              ;;FALL THROUGH IF 0
 3342  017110  105726                            TSTB    (SP)            ;;STILL DOING LEADING 0'S?
 3343  017112  100407                            BMI     7$              ;;BR IF YES
 3344  017114  106316                5$:         ASLB    (SP)            ;;MSD?
 3345  017116  103003                            BCC     6$              ;;BR IF NO
 3346  017120  116663  000001  177777            MOVB    1(SP),-1(R3)    ;;YES--SET THE SIGN
 3347  017126  052702  000060        6$:         BIS     #'0,R2          ;;MAKE THE BCD DIGIT ASCII
 3348  017132  052702  000040        7$:         BIS     #' ,R2          ;;MAKE IT A SPACE IF NOT ALREADY A DIGIT
 3349  017136  110223                            MOVB    R2,(R3)+        ;;PUT THIS CHARACTER IN THE OUTPUT BUFFER
 3350  017140  005720                            TST     (R0)+           ;;JUST INCREMENTING
 3351  017142  020027  000010                    CMP     R0,#10          ;;CHECK THE TABLE INDEX
 3352  017146  002746                            BLT     2$              ;;GO DO THE NEXT DIGIT
 3353  017150  003002                            BGT     8$              ;;GO TO EXIT
 3354  017152  010502                            MOV     R5,R2           ;;GET THE LSD
 3355  017154  000764                            BR      6$              ;;GO CHANGE TO ASCII
 3356  017156  105726                8$:         TSTB    (SP)+           ;;WAS THE LSD THE FIRST NON ZERO?
```

```
3357  017160  100003                          BPL     9$                  ;;BR IF NO
3358  017162  116663  177777  177776          MOVB    -1(SP),-2(R3)       ;;YES--SET THE SIGN FOR TYPING
3359  017170  105013                  9$:     CLRB    (R3)                ;;SET THE TERMINATOR
3360  017172  012605                          MOV     (SP)+,R5            ;;POP STACK INTO R5
3361  017174  012603                          MOV     (SP)+,R3            ;;POP STACK INTO R3
3362  017176  012602                          MOV     (SP)+,R2            ;;POP STACK INTO R2
3363  017200  012601                          MOV     (SP)+,R1            ;;POP STACK INTO R1
3364  017202  012600                          MOV     (SP)+,R0            ;;POP STACK INTO R0
3365  017204  104401  017232                  TYPE    ,$DBLK              ;;NOW TYPE THE NUMBER
3366  017210  016666  000002  000004          MOV     2(SP),4(SP)         ;;ADJUST THE STACK
3367  017216  012616                          MOV     (SP)+,(SP)
3368  017220  000002                          RTI                         ;;RETURN TO USER
3369  017222  023420                  $DTBL:  10000.
3370  017224  001750                          1000.
3371  017226  000144                          100.
3372  017230  000012                          10.
3373  017232  000004                  $DBLK:  .BLKW   4
3374
```

```
3375
3376                                    .SBTTL  TTY INPUT ROUTINE
3377
3378                                    ;;*****************************************************************
3379                                    .ENABL  LSB
3380
3381                                    ;;*****************************************************************
3382                                    ;*SOFTWARE SWITCH REGISTER CHANGE ROUTINE.
3383                                    ;*ROUTINE IS ENTERED FROM THE TRAP HANDLER, AND WILL
3384                                    ;*SERVICE THE TEST FOR CHANGE IN SOFTWARE SWITCH REGISTER TRAP CALL
3385                                    ;*WHEN OPERATING IN TTY FLAG MODE.
3386  017242  022737  000176  001040  $CKSWR: CMP     #SWREG,SWR      ;;IS THE SOFT-SWR SELECTED?
3387  017250  001074                          BNE     15$             ;;BRANCH IF NO
3388  017252  105777  161566                  TSTB    @#TKS           ;;CHAR THERE?
3389  017256  100071                          BPL     15$             ;;IF NO, DON'T WAIT AROUND
3390  017260  117746  161562                  MOVB    @#TKB,-(SP)     ;;SAVE THE CHAR
3391  017264  042716  177600                  BIC     #^C177,(SP)     ;;STRIP-OFF THE ASCII
3392  017270  022726  000007                  CMP     #7,(SP)+        ;;IS IT A CONTROL G?
3393  017274  001062                          BNE     15$             ;;NO, RETURN TO USER
3394  017276  123727  001034  000001          CMPB    $AUTOB,#1       ;;ARE WE RUNNING IN AUTO-MODE?
3395  017304  001456                          BEQ     15$             ;;BRANCH IF YES
3396
3397  017306  104401  017777                  TYPE    ,$CNTLG         ;;ECHO THE CONTROL-G (^G)
3398  017312  104401  020004  $GTSWR: TYPE    ,$MSWR          ;;TYPE CURRENT CONTENTS
3399  017316  013746  000176                  MOV     SWREG,-(SP)     ;;SAVE SWREG FOR TYPEOUT
3400  017322  104402                          TYPOC                   ;;GO TYPE--OCTAL ASCII(ALL DIGITS)
3401  017324  104401  020015                  TYPE    ,$MNEW          ;;PROMPT FOR NEW SWR
3402  017330  005046                  19$:    CLR     -(SP)           ;;CLEAR COUNTER
3403  017332  005046                          CLR     -(SP)           ;;THE NEW SWR
3404  017334  105777  161504          7$:     TSTB    @#TKS           ;;CHAR THERE?
3405  017340  100375                          BPL     7$              ;;IF NOT TRY AGAIN
3406
3407  017342  117746  161500                  MOVB    @#TKB,-(SP)     ;;PICK UP CHAR
3408  017346  042716  177600                  BIC     #^C177,(SP)     ;;MAKE IT 7-BIT ASCII
3409
3410
3411
3412  017352  021627  000025          9$:     CMP     (SP),#25        ;;IS IT A CONTROL-U?
3413  017356  001005                          BNE     10$             ;;BRANCH IF NOT
3414  017360  104401  017772                  TYPE    ,$CNTLU         ;;YES, ECHO CONTROL-U (^U)
3415  017364  062706  000006          20$:    ADD     #6,SP           ;;IGNORE PREVIOUS INPUT
3416  017370  000757                          BR      19$             ;;LET'S TRY IT AGAIN
3417
3418
3419  017372  021627  000015          10$:    CMP     (SP),#15        ;;IS IT A <CR>?
3420  017376  001022                          BNE     16$             ;;BRANCH IF NO
3421  017400  005766  000004                  TST     4(SP)           ;;YES, IS IT THE FIRST CHAR?
3422  017404  001403                          BEQ     11$             ;;BRANCH IF YES
3423  017406  016677  000002  161424          MOV     2(SP),@#SWR     ;;SAVE NEW SWR
3424  017414  062706  000006          11$:    ADD     #6,SP           ;;CLEAR UP STACK
3425  017420  104401  001075          14$:    TYPE    ,$CRLF          ;;ECHO <CR> AND <LF>
3426  017424  123727  001035  000001          CMPB    $INTAG,#1       ;;RE-ENABLE TTY KBD INTERRUPTS?
3427  017432  001003                          BNE     15$             ;;BRANCH IF NOT
3428  017434  012777  000100  161402          MOV     #100,@#TKS      ;;RE-ENABLE TTY KBD INTERRUPTS
3429  017442  000002                  15$:    RTI                     ;;RETURN
3430  017444  004737  016446          16$:    JSR     PC,$TYPEC       ;;ECHO CHAR
```

```
3431  017450  021627  000060            CMP     (SP),#60        ;;CHAR < 0?
3432  017454  002420                    BLT     18$             ;;BRANCH IF YES
3433  017456  021627  000067            CMP     (SP),#67        ;;CHAR > 7?
3434  017462  003015                    BGT     18$             ;;BRANCH IF YES
3435  017464  042726  000060            BIC     #60,(SP)+       ;;STRIP-OFF ASCII
3436  017470  005766  000002            TST     2(SP)           ;;IS THIS THE FIRST CHAR
3437  017474  001403                    BEQ     17$             ;;BRANCH IF YES
3438  017476  006316                    ASL     (SP)            ;;NO. SHIFT PRESENT
3439  017500  006316                    ASL     (SP)            ;;    CHAR OVER TO MAKE
3440  017502  006316                    ASL     (SP)            ;;    ROOM FOR NEW ONE.
3441  017504  005266  000002    17$:    INC     2(SP)           ;;KEEP COUNT OF CHAR
3442  017510  056616  177776            BIS     -2(SP),(SP)     ;;SET IN NEW CHAR
3443  017514  000707                    BR      7$              ;;GET THE NEXT ONE
3444  017516  104401  001074    18$:    TYPE    ,$QUES          ;;TYPE ?<CR><LF>
3445  017522  000720                    BR      20$             ;;SIMULATE CONTROL U
3446                          .DSABL  LSB
3447
3448
3449                          ;;*****************************************************************
3450                          ;*THIS ROUTINE WILL INPUT A SINGLE CHARACTER FROM THE TTY
3451                          ;*CALL:
3452                          ;*      RDCHR                   ;;INPUT A SINGLE CHARACTER FROM THE TTY
3453                          ;*      RETURN HERE             ;;CHARACTER IS ON THE STACK
3454                          ;*                              ;;WITH PARITY BIT STRIPPED OFF
3455                          ;
3456
3457  017524  011646          $RDCHR: MOV     (SP),-(SP)      ;;PUSH DOWN THE PC
3458  017526  016666  000004  000002    MOV     4(SP),2(SP)     ;;SAVE THE PS
3459  017534  105777  161304    1$:     TSTB    @#TKS           ;;WAIT FOR
3460  017540  100375                    BPL     1$              ;;A CHARACTER
3461  017542  117766  161300  000004    MOVB    @#TKB,4(SP)     ;;READ THE TTY
3462  017550  042766  177600  000004    BIC     #^C<177>,4(SP)  ;;GET RID OF JUNK IF ANY
3463  017556  026627  000004  000023    CMP     4(SP),#23       ;;IS IT A CONTROL S?
3464  017564  001013                    BNE     3$              ;;BRANCH IF NO
3465  017566  105777  161252    2$:     TSTB    @#TKS           ;;WAIT FOR A CHARACTER
3466  017572  100375                    BPL     2$              ;;LOOP UNTIL ITS THERE
3467  017574  117746  161246            MOVB    @#TKB,-(SP)     ;;GET CHARACTER
3468  017600  042716  177600            BIC     #^C177,(SP)     ;;MAKE IT 7-BIT ASCII
3469  017604  022627  000021            CMP     (SP)+,#21       ;;IS IT A CONTROL-Q?
3470  017610  001366                    BNE     2$              ;;IF NOT DISCARD IT
3471  017612  000750                    BR      1$              ;;YES, RESUME
3472  017614  026627  000004  000021  3$:     CMP     4(SP),#$XON     ;;IS IT A RANDOM XON?                   ;RAN001
3473  017622  001744                    BEQ     1$              ;;BRANCH IF YES                         ;RAN001
3474  017624  026627  000004  000140            CMP     4(SP),#140      ;;IS IT UPPER CASE?
3475  017632  002407                    BLT     4$              ;;BRANCH IF YES
3476  017634  026627  000004  000175            CMP     4(SP),#175      ;;IS IT A SPECIAL CHAR?
3477  017642  003003                    BGT     4$              ;;BRANCH IF YES
3478  017644  042766  000040  000004            BIC     #40,4(SP)       ;;MAKE IT UPPER CASE
3479  017652  000002                  4$:     RTI                     ;;GO BACK TO USER
3480                          ;;*****************************************************************
3481                          ;*THIS ROUTINE WILL INPUT A STRING FROM THE TTY
3482                          ;*CALL:
3483                          ;*      RDLIN                   ;;INPUT A STRING FROM THE TTY
3484                          ;*      RETURN HERE             ;;ADDRESS OF FIRST CHARACTER WILL BE ON THE STACK
3485                          ;*                              ;;TERMINATOR WILL BE A BYTE OF ALL 0'S
3486
```

```
 3487  017654  010346                  $RDLIN: MOV     R3,-(SP)        ;;SAVE R3
 3488  017656  012703  017762          1$:     MOV     #$TTYIN,R3      ;;GET ADDRESS
 3489  017662  022703  017772          2$:     CMP     #$TTYIN+8.,R3   ;;BUFFER FULL?
 3490  017666  101405                          BLOS    4$              ;;BR IF YES
 3491  017670  104410                          RDCHR                   ;;GO READ ONE CHARACTER FROM THE TTY
 3492  017672  112513                          MOVB    (SP)+,(R3)      ;;GET CHARACTER
 3493  017674  122713  000177          10$:    CMPB    #177,(R3)       ;;IS IT A RUBOUT
 3494  017700  001003                          BNE     3$              ;;SKIP IF NOT
 3495  017702  104401  001074          4$:     TYPE    ,$QUES          ;;TYPE A '?'
 3496  017706  000763                          BR      1$              ;;CLEAR THE BUFFER AND LOOP
 3497  017710  111337  017760          3$:     MOVB    (R3),9$         ;;ECHO THE CHARACTER
 3498  017714  104401  017760                  TYPE    ,9$
 3499  017720  122723  000015                  CMPB    #15,(R3)+       ;;CHECK FOR RETURN
 3500  017724  001356                          BNE     2$              ;;LOOP IF NOT RETURN
 3501  017726  105063  177777                  CLRB    -1(R3)          ;;CLEAR RETURN (THE 15)
 3502  017732  104401  001076                  TYPE    ,$LF            ;;TYPE A LINE FEED
 3503  017736  012603                          MOV     (SP)+,R3        ;;RESTORE R3
 3504  017740  011646                          MOV     (SP),-(SP)      ;;ADJUST THE STACK AND PUT ADDRESS OF THE
 3505  017742  016666  000004  000002          MOV     4(SP),2(SP)     ;;      FIRST ASCII CHARACTER ON IT
 3506  017750  012766  017762  000004          MOV     #$TTYIN,4(SP)
 3507  017756  000002                          RTI                     ;;RETURN
 3508  017760     000                  9$:     .BYTE   0               ;;STORAGE FOR ASCII CHAR. TO TYPE
 3509  017761     000                          .BYTE   0               ;;TERMINATOR
 3510  017762  000010                  $TTYIN: .BLKB   8.              ;;RESERVE 8 BYTES FOR TTY INPUT
 3511  017772  052536  005015     000  $CNTLU: .ASCIZ  /↑U/<15><12>    ;;CONTROL "U"
 3512  017777     136  006507  000012  $CNTLG: .ASCIZ  /↑G/<15><12>    ;;CONTROL "G"
 3513  020004  005015  053523  020122  $MSWR:  .ASCIZ  <15><12>/SWR = /
 3514  020012  020075     000
 3515  020015     040  047040  053505  $MNEW:  .ASCIZ  /  NEW = /
 3516  020022  036440  000040
 3517
```

```
                                        .SBTTL  TRAP DECODER

                                        ;;**********************************************************************
                                        ;*THIS ROUTINE WILL PICKUP THE LOWER BYTE OF THE "TRAP" INSTRUCTION
                                        ;*AND USE IT TO INDEX THROUGH THE TRAP TABLE FOR THE STARTING ADDRESS
                                        ;*OF THE DESIRED ROUTINE. THEN USING THE ADDRESS OBTAINED IT WILL
                                        ;*GO TO THAT ROUTINE.

020026  010046                  $TRAP:  MOV     R0,-(SP)        ;;SAVE R0
020030  016600  000002                  MOV     2(SP),R0        ;;GET TRAP ADDRESS
020034  005740                          TST     -(R0)           ;;BACKUP BY 2
020036  111000                          MOVB    (R0),R0         ;;GET RIGHT BYTE OF TRAP
020040  006300                          ASL     R0              ;;POSITION FOR INDEXING
020042  016000  020062                  MOV     $TRPAD(R0),R0   ;;INDEX TO TABLE
020046  000200                          RTS     R0              ;;GO TO ROUTINE


                                        ;;THIS IS USE TO HANDLE THE "GETPRI" MACRO

020050  011646                  $TRAP2: MOV     (SP),-(SP)      ;;MOVE THE PC DOWN
020052  016666  000004  000002          MOV     4(SP),2(SP)     ;;MOVE THE PSW DOWN
020060  000002                          RTI                     ;;RESTORE THE PSW

                                        .SBTTL  TRAP TABLE

                                        ;*THIS TABLE CONTAINS THE STARTING ADDRESSES OF THE ROUTINES CALLED
                                        ;*BY THE "TRAP" INSTRUCTION.

                                        ;       ROUTINE
                                        ;       -------
020062  020050                  $TRPAD: .WORD   $TRAP2
020064  016234                          $TYPE   ;;CALL=TYPE     TRAP+1(104401)  TTY TYPEOUT ROUTINE
020066  016614                          $TYPOC  ;;CALL=TYPOC    TRAP+2(104402)  TYPE OCTAL NUMBER (WITH LEADING ZEROS)
020070  016570                          $TYPOS  ;;CALL=TYPOS    TRAP+3(104403)  TYPE OCTAL NUMBER (NO LEADING ZEROS)
020072  016630                          $TYPON  ;;CALL=TYPON    TRAP+4(104404)  TYPE OCTAL NUMBER (AS PER LAST CALL)
020074  017016                          $TYPDS  ;;CALL=TYPDS    TRAP+5(104405)  TYPE DECIMAL NUMBER (WITH SIGN)

020076  017312                          $GTSWR  ;;CALL=GTSWR    TRAP+6(104406)  GET SOFT-SWR SETTING

020100  017242                          $CKSWR  ;;CALL=CKSWR    TRAP+7(104407)  TEST FOR CHANGE IN SOFT-SWR
020102  017524                          $RDCHR  ;;CALL=RDCHR    TRAP+10(104410) TTY TYPEIN CHARACTER ROUTINE
020104  017654                          $RDLIN  ;;CALL=RDLIN    TRAP+11(104411) TTY TYPEIN STRING ROUTINE
```

```
                        .SBTTL  ECHO TEST
                ;;**************************************************************
                ;*THIS ROUTINE WILL ECHO ANY CHARACTER TYPED
                ;*ON EITHER SLU1 OR SLU2. DEFAULT IS TO THE CONSOLE DEVICE SLU1.
                ;*THE TEST IS HALTED BY TYPING A CONTROL-C
                ;*TEST CAN BE RESTARTED AFTER HALTING BY JUST CONTINUING
                ;;**************************************************************
020106 012737 000176 001040 ECHO:   MOV     #SWREG,SWR              ;SET UP FOR SOFTWARE SWITCH REGISTER
020114 012737 000174 001042         MOV     #DISPREG,DISPLAY        ;AND DISPLAY REGISTER
020122 032777 000020 160710         BIT     #BIT4, @SWR             ;CHECK IF BIT4 SET IN SWITCH REG
020130 001403                       BEQ     1$                      ;IF NOT THEN SELECT SLU1
020132 012703 002770                MOV     #RCSR, R3               ;IF BIT4 SET THEN SELECT SLU2
020136 000402                       BR      2$
020140 012703 003000        1$:     MOV     #CRCSR, R3              ;SELECT SLU1 (THIS IS DEFAULT DEVICE)
020144 000005               2$:     RESET                   ;CLEAR EVERYTHING
020146 112773 000052 000006         MOVB    #'*,@6(R3)      ;TRANSMIT PROMPT "*"
020154 105773 000000        3$:     TSTB    @(R3)           ;WAIT FOR INPUT
020160 100375                       BPL     3$
020162 117373 000002 000006         MOVB    @2(R3),@6(R3)   ;ECHO INPUT
020170 017300 000002                MOV     @2(R3),R0       ;STORE INPUT
020174 100023                       BPL     6$              ;BR IF "ERROR"NOT SET
020176 052701 010000                BIS     #BIT12,R1       ;SET PARITY ERROR TEST MASK
020202 030100                       BIT     R1,R0           ;CHECK  FOR PARITY ERROR FLAG
020204 001403                       BEQ     4$              ;BR IF NOT SET
020206 004737 020270                JSR     PC,MSG          ;REPORT PARITY ERROR
020212 020316                       MPAR
020214 006301                4$:    ASL     R1              ;SHIFT MASK TO TEST "FR" FLAG
020216 030100                       BIT     R1,R0           ;TEST FOR FRAMING ERROR FLAG
020220 001403                       BEQ     5$              ;BR IF NOT SET
020222 004737 020270                JSR     PC,MSG          ;REPSORT FRAMING ERROR
020226 020327                       MFR
020230 006301                5$:    ASL     R1              ;SHIFT MASK TO TEST "OR" FLAG
020232 030100                       BIT     R1,R0           ;TEST FOR OVERFLOW ERROR
020234 001403                       BEQ     6$              ;BR IF NOT SET
020236 004737 020270                JSR     PC,MSG          ;REPORT OVERFLOW ERROR
020242 020341                       MOR
020244 042700 000200        6$:     BIC     #BIT7,R0        ;CLEAR ANY PARITY BIT
020250 022700 000003                CMP     #3,R0           ;WAS INPUT CONTROL-C
020254 001337                       BNE     3$              ;BR IF IS NOT
020256 004737 020270                JSR     PC,MSG          ;REPORT PROGRAM STOP
020262 020354                       MSTOP
020264 000000                       HALT                    ;END OF TEST HALT
020266 000707                       BR      ECHO            ;AFTER END OF TEST HALT
                                                            ;   PRESS CONTINUE TO RESTART ECHO TEST

020270 013600                MSG:   MOV     @(SP)+,R0       ;PICK UP MESSAGE POINTER
020272 062746 000002                ADD     #2,-(SP)        ;ADJUST RETURN PC
020276 105773 000004         WAIT:  TSTB    @4(R3)          ;WAIT FOR XMIT DONE
020302 100375                       BPL     WAIT
020304 112073 000006                MOVB    (R0)+,@6(R3)    ;SEND CHARACTER
020310 105710                       TSTB    (R0)            ;IS THIS END OF MESSAGE?
020312 001371                       BNE     WAIT            ;BR IF NOT
020314 000207                       RTS     PC              ;RETURN

020316 005015 040520 044522 MPAR:   .ASCIZ  <CR><LF>/PARITY/
020324 054524    000
```

```
  3619  020327      015  043012  040522  MFR:    .ASCIZ  <CR><LF>/FRAMING/
  3620  020334  044515  043516     000
  3621  020341      015  047412  042526  MOR:    .ASCIZ  <CR><LF>/OVERFLOW/
  3622  020346  043122  047514  000127
  3623  020354  005015  052123  050117  MSTOP:  .ASCIZ  <CR><LF>/STOP/
  3624  020362      000
```

```
3625
3626
3627            020364                          .EVEN
3628
3629                                            .SBTTL  TERMINAL OUTPUT TEST
3630
3631                                            ;;*****************************************************************
3632                                            ;*THIS ROUTINE WILL OUTPUT ALL WRITABLE CHARACTERS FOR THE
3633                                            ;*THE OCTAL CODE 040 --> 377
3634                                            ;*32 CHARACTERS ARE PRINTED ON EACH LINE
3635                                            ;*THE PATTERN IS REPEATED EVERY THREE LINES
3636                                            ;*
3637                                            ;;*****************************************************************
3638
3639  020364  012737  000176  001040  OUTTST: MOV     #SWREG,SWR              ;SET UP FOR SOFTWARE SWITCH REGISTER
3640  020372  012737  000174  001042          MOV     #DISPREG,DISPLAY        ;AND DISPLAY REGISTER
3641  020400  032777  000020  160432          BIT     #BIT4, @SWR             ;CHECK IF BIT4 SET IN SWITCH REG
3642  020406  001403                          BEQ     1$                      ;IF NOT THEN SELECT SLU1
3643  020410  012703  002770                  MOV     #RCSR, R3               ;IF BIT4 SET THEN SELECT SLU2
3644  020414  000402                          BR      2$
3645  020416  012703  003000          1$:     MOV     #CRCSR, R3              ;SELECT SLU1 (THIS IS DEFAULT DEVICE)
3646  020422  000005                  2$:     RESET                   ;CLEAR THE WORLD
3647  020424  012701  000040          3$:     MOV     #40,R1          ;LOAD FIRST WRITABLE CHARACTER
3648  020430  012700  000040          4$:     MOV     #40,R0          ;LOAD CHAR COUNT PER LINE
3649  020434  105773  000004          5$:     TSTB    @4(R3)          ;WAIT FOR DONE
3650  020440  100375                          BPL     5$
3651  020442  010173  000006                  MOV     R1,@6(R3)       ;TRANSMIT A CHARACTER
3652  020446  105201                          INCB    R1              ;INCREMENT CHARACTER CODE
3653  020450  005300                          DEC     R0              ;DECREMENT CHAR COUNT
3654  020452  001370                          BNE     5$              ;BR IF LINE NOT COMPLETE
3655  020454  004737  020270                  JSR     PC,MSG          ;SSUE CR,LINE FEED
3656
3657  020460  001075                          $CRLF
3658  020462  105773  000000                  TSTB    @(R3)           ;ANY CHARACTER RECEIVED?
3659  020466  100404                          BMI     6$              ;BR IF YES
3660  020470  032701  000200                  BIT     #BIT7,R1        ;FINISHED ONE PASS OF WRITABLE CHARACTERS?
3661  020474  001353                          BNE     3$              ;BR IF YES
3662  020476  000754                          BR      4$              ;IF NOT WRITE NEXT LINE
3663
3664  020500  005073  000002          6$:     CLR     @2(R3)          ;CLEAR RECEIVER
3665  020504  000000                          HALT                    ;STOP TEST
3666  020506  000726                          BR      OUTTST          ;RESTART TEST IF CONTINUED
```

```
3667
3668
3669  020510  046123  030525  052040  EM5:    .ASCIZ  /SLU1 TCSR DONE NOT SET WITH RESET
3670  020516  051503  020122  047504
3671  020524  042516  047040  052117
3672  020532  051440  052105  053440
3673  020540  052111  020110  042522
3674  020546  042523  000124
3675  020552  046123  030525  051040  EM6:    .ASCIZ  /SLU1 RCSR DID NOT RETURN SSYNC/
3676  020560  051503  020122  044504
3677  020566  020104  047516  020124
3678  020574  042522  052524  047122
3679  020602  051440  054523  041516
3680  020610     000
3681  020611     123  052514  020061  EM7:    .ASCIZ  /SLU1 RBUF DID NOT RETURN SSYNC/
3682  020616  041122  043125  042040
3683  020624  042111  047040  052117
3684  020632  051040  052105  051125
3685  020640  020116  051523  047131
3686  020646  000103
3687  020650  040503  020116  047516  EM11:   .ASCIZ  /CAN NOT SET BIT2 OF SLU1 TCSR/
3688  020656  020124  042523  020124
3689  020664  044502  031124  047440
3690  020672  020106  046123  030525
3691  020700  052040  051503  000122
3692  020706  042522  042523  020124  EM13:   .ASCIZ  /RESET DID NOT CLEAR BIT2 OF SLU1 TCSR/
3693  020714  044504  020104  047516
3694  020722  020124  046103  040505
3695  020730  020122  044502  031124
3696  020736  047440  020106  046123
3697  020744  030525  052040  051503
3698  020752  000122
3699  020754  044502  033124  047440  EM14:   .ASCIZ  /BIT6 OF SLU1 TCSR NOT CLEAR AFTER RESET/
3700  020762  020106  046123  030525
3701  020770  052040  051503  020122
3702  020776  047516  020124  046103
3703  021004  040505  020122  043101
3704  021012  042524  020122  042522
3705  021020  042523  000124
3706  021024  046123  030525  054040  EM15:   .ASCIZ  /SLU1 XMIT INTERRUPTED WITH PRIORITY 7/
3707  021032  044515  020124  047111
3708  021040  042524  051122  050125
3709  021046  042524  020104  044527
3710  021054  044124  050040  044522
3711  021062  051117  052111  020131
3712  021070  000067
3713  021072  040503  020116  047516  EM16:   .ASCIZ  /CAN NOT SET BIT6 OF SLU1 TCSR/
3714  021100  020124  042523  020124
3715  021106  044502  033124  047440
3716  021114  020106  046123  030525
3717  021122  052040  051503  000122
3718  021130  040503  020116  047516  EM17:   .ASCIZ  /CAN NOT CLEAR BIT6 OF SLU1 TCSR/
3719  021136  020124  046103  040505
3720  021144  020122  044502  033124
3721  021152  047440  020106  046123
3722  021160  030525  052040  051503
```

```
3723  021166  000122
3724  021170  042522  042523  020124  EM20:   .ASCIZ  /RESET DID NOT CLEAR BIT6 OF SLU1 TCSR/
3725  021176  044504  020104  047516
3726  021204  020124  046103  040505
3727  021212  020122  044502  033124
3728  021220  047440  020106  046123
3729  021226  030525  052040  051503
3730  021234  000122
3731  021236  044502  033124  047440  EM21:   .ASCIZ  /BIT6 OF SLU1 RCSR NOT CLEAR AFTER RESET/
3732  021244  020106  046123  030525
3733  021252  051040  051503  020122
3734  021260  047516  020124  046103
3735  021266  040505  020122  043101
3736  021274  042524  020122  042522
3737  021302  042523  000124
3738  021306  046123  030525  051040  EM22:   .ASCIZ  /SLU1 RCVR INTERRUPT WITH PRIORITY 7/
3739  021314  053103  020122  047111
3740  021322  042524  051122  050125
3741  021330  020124  044527  044124
3742  021336  050040  044522  051117
3743  021344  052111  020131  000067
3744  021352  040503  020116  047516  EM23:   .ASCIZ  /CAN NOT SET BIT6 OF SLU1 RCSR/
3745  021360  020124  042523  020124
3746  021366  044502  033124  047440
3747  021374  020106  046123  030525
3748  021402  051040  051503  000122
3749  021410  040503  020116  047516  EM24:   .ASCIZ  /CAN NOT CLEAR BIT6 OF SLU1 RCSR/
3750  021416  020124  046103  040505
3751  021424  020122  044502  033124
3752  021432  047440  020106  046123
3753  021440  030525  051040  051503
3754  021446  000122
3755  021450  040503  020116  047516  EM25:   .ASCIZ  /CAN NOT CLEAR BIT6 OF SLU1 RCSR WITH RESET/
3756  021456  020124  046103  040505
3757  021464  020122  044502  033124
3758  021472  047440  020106  046123
3759  021500  030525  051040  051503
3760  021506  020122  044527  044124
3761  021514  051040  051505  052105
3762  021522     000
3763  021523     123  052514  020061  EM26:   .ASCIZ  /SLU1 RECEIVER DONE NEVER SET/
3764  021530  042522  042503  053111
3765  021536  051105  042040  047117
3766  021544  020105  042516  042526
3767  021552  020122  042523  000124
3768  021560  042522  042523  020124  EM27:   .ASCIZ  /RESET DID NOT CLEAR SLU1 RCVR DONE/
3769  021566  044504  020104  047516
3770  021574  020124  046103  040505
3771  021602  020122  046123  030525
3772  021610  051040  053103  020122
3773  021616  047504  042516     000
3774  021623     122  040505  044504  EM30:   .ASCIZ  /READING SLU1 RBUF DID NOT CLEAR RCVR DONE/
3775  021630  043516  051440  052514
3776  021636  020061  041122  043125
3777  021644  042040  042111  047040
3778  021652  052117  041440  042514
```

```
3779  021660  051101  05;040  053103
3780  021666  020122  047504  042516
3781  021674     000
3782  021675     123  052514  020062  EM31:   .ASCIZ  /SLU2 TCSR DID NOT RETURN SSYNC/
3783  021702  041524  051123  042040
3784  021710  042111  047040  052117
3785  021716  051040  052105  051125
3786  021724  020116  051523  047131
3787  021732  000103
3788  021734  046123  031125  052040  EM32:   .ASCIZ  /SLU2 TBUF DID NOT RETURN SSYNC/
3789  021742  052502  020106  044504
3790  021750  020104  047516  020124
3791  021756  042522  052524  047122
3792  021764  051440  054523  041516
3793  021772     000
3794  021773     123  052514  020062  EM33:   .ASCIZ  /SLU2 TCSR DONE NOT CLEARED WITH TBUF FULL
3795  022000  041524  051123  042040
3796  022006  047117  020105  047516
3797  022014  020124  046103  040505
3798  022022  042522  020104  044527
3799  022030  044124  052040  052502
3800  022036  020106  052506  046114
3801  022044     000
3802  022045     123  052514  020062  EM34:   .ASCIZ  /SLU2 TCSR DONE NOT SET AFTER TRANSMIT/
3803  022052  041524  051123  042040
3804  022060  047117  020105  047516
3805  022066  020124  042523  020124
3806  022074  043101  042524  020122
3807  022102  051124  047101  046523
3808  022110  052111     000
3809  022113     123  052514  020062  EM35:   .ASCIZ  /SLU2 TCSR DONE NOT SET WITH RESET/
3810  022120  041524  051123  042040
3811  022126  047117  020105  047516
3812  022134  020124  042523  020124
3813  022142  044527  044124  051040
3814  022150  051505  052105     000
3815  022155     123  052514  020062  EM36:   .ASCIZ  /SLU2 RCSR DID NOT RETURN SSYNC/
3816  022162  041522  051123  042040
3817  022170  042111  047040  052117
3818  022176  051040  052105  051125
3819  022204  020116  051523  047131
3820  022212  000103
3821  022214  046123  031125  051040  EM37:   .ASCIZ  /SLU2 RBUF DID NOT RETURN SSYNC/
3822  022222  052502  020106  044504
3823  022230  020104  047516  020124
3824  022236  042522  052524  047122
3825  022244  051440  054523  041516
3826  022252     000
3827  022253     102  052111  020060  EM40:   .ASCIZ  /BITO OF SLU2 TCSR NOT CLEAR AFTER RESET/
3828  022260  043117  051440  052514
3829  022266  020062  041524  051123
3830  022274  047040  052117  041440
3831  022302  042514  051101  040440
3832  022310  052106  051105  051040
3833  022316  051505  052105     000
3834  022323     103  047101  047040  EM41:   .ASCIZ  /CAN NOT SET BITO OF SLU2 TCSR/
```

```
3835  022330  052117  051440  052105
3836  022336  041040  052111  020060
3837  022344  043117  051440  052514
3838  022352  020062  041524  051123
3839  022360     000
3840  022361     103  047101  047040  EM42:   .ASCIZ  /CAN NOT CLEAR BIT0 OF SLU2 TCSR/
3841  022366  052117  041440  042514
3842  022374  051101  041040  052111
3843  022402  020060  043117  051440
3844  022410  052514  020062  041524
3845  022416  051123     000
3846  022421     122  051505  052105  EM43:   .ASCIZ  /RESET DID NOT CLEAR BIT0 OF SLU2 TCSR/
3847  022426  042040  042111  047040
3848  022434  052117  041440  042514
3849  022442  051101  041040  052111
3850  022450  020060  043117  051440
3851  022456  052514  020062  041524
3852  022464  051123     000
3853  022467     102  052111  020066  EM44:   .ASCIZ  /BIT6 OF SLU2 TCSR NOT CLEAR AFTER RESET/
3854  022474  043117  051440  052514
3855  022502  020062  041524  051123
3856  022510  047040  052117  041440
3857  022516  042514  051101  040440
3858  022524  052106  051105  051040
3859  022532  051505  052105     000
3860  022537     123  052514  020062  EM45:   .ASCIZ  /SLU2 XMIT INTERRUPTED WITH PRIORITY 7/
3861  022544  046530  052111  044440
3862  022552  052116  051105  052522
3863  022560  052120  042105  053440
3864  022566  052111  020110  051120
3865  022574  047511  044522  054524
3866  022602  033440     000
3867  022605     103  047101  047040  EM46:   .ASCIZ  /CAN NOT SET BIT6 OF SLU2 TCSR/
3868  022612  052117  051440  052105
3869  022620  041040  052111  020066
3870  022626  043117  051440  052514
3871  022634  020062  041524  051123
3872  022642     000
3873  022643     103  047101  047040  EM47:   .ASCIZ  /CAN NOT CLEAR BIT6 OF SLU2 TCSR/
3874  022650  052117  041440  042514
3875  022656  051101  041040  052111
3876  022664  020066  043117  051440
3877  022672  052514  020062  041524
3878  022700  051123     000
3879  022703     122  051505  052105  EM50:   .ASCIZ  /RESET DID NOT CLEAR BIT6 OF SLU2 TCSR/
3880  022710  042040  042111  047040
3881  022716  052117  041440  042514
3882  022724  051101  041040  052111
3883  022732  020066  043117  051440
3884  022740  052514  020062  041524
3885  022746  051123     000
3886  022751     102  052111  020066  EM51:   .ASCIZ  /BIT6 OF SLU2 RCSR NOT CLEAR AFTER RESET/
3887  022756  043117  051440  052514
3888  022764  020062  041522  051123
3889  022772  047040  052117  041440
3890  023000  042514  051101  040440
```

```
3891  023006  052106  051105  051040
3892  023014  051505  052105     000
3893  023021     12?  052514  020062  EM52:   .ASCIZ  /SLU2 RCVR INTERRUPT WITH PRIORITY ?
3894  023026  041522  051126  044440
3895  023034  052116  051105  052522
3896  023042  052120  053440  052111
3897  023050  020110  051120  047511
3898  023056  044522  054524  033440
3899  023064     000
3900  023065     103  047101  047040  EM53:   .ASCIZ  /CAN NOT SET BIT6 OF SLU2 RCSR/
3901  023072  052117  051440  052105
3902  023100  041040  052111  020066
3903  023106  043117  051440  052514
3904  023114  020062  041522  051123
3905  023122     000
3906  023123     103  047101  047040  EM54:   .ASCIZ  /CAN NOT CLEAR BIT6 OF SLU2 RCSR/
3907  023130  052117  041440  042514
3908  023136  051101  041040  052111
3909  023144  020066  043117  051440
3910  023152  052514  020062  041522
3911  023160  051123     000
3912  023163     103  047101  047040  EM55:   .ASCIZ  /CAN NOT CLEAR BIT6 OF SLU2 RCSR WITH RESET/
3913  023170  052117  041440  042514
3914  023176  051101  041040  052111
3915  023204  020066  043117  051440
3916  023212  052514  020062  041522
3917  023220  051123  053440  052111
3918  023226  020110  042522  042523
3919  023234  000124
3920  023236  046123  031125  051040  EM56:   .ASCIZ  /SLU2 RECEIVER DONE NEVER SET/
3921  023244  041505  044505  042526
3922  023252  020122  047504  042516
3923  023260  047040  053105  051105
3924  023266  051440  052105     000
3925  023273     122  051505  052105  EM57:   .ASCIZ  /RESET DID NOT CLEAR SLU2 RCVR DONE/
3926  023300  042040  042111  047040
3927  023306  052117  041440  042514
3928  023314  051101  051440  052514
3929  023322  020062  041522  051126
3930  023330  042040  047117  000105
3931  023336  042522  042101  047111  EM60:   .ASCIZ  /READING SLU2 RBUF DID NOT CLEAR RCVR DONE/
3932  023344  020107  046123  031125
3933  023352  051040  052502  020106
3934  023360  044504  020104  047516
3935  023366  020124  046103  040505
3936  023374  020122  041522  051126
3937  023402  042040  047117  000105
3938  023410  045514  020123  044504  EM61:   .ASCIZ  /LKS DID NOT RETURN SSYNC/
3939  023416  020104  047516  020124
3940  023424  042522  052524  047122
3941  023432  051440  054523  041516
3942  023440     000
3943  023441     102  052111  020066  EM62:   .ASCIZ  /BIT6 OF LKS NOT CLEAR AFTER RESET/
3944  023446  043117  046040  051513
3945  023454  047040  052117  041440
3946  023462  042514  051101  040440
```

```
3947  023470  052106  051105  051040
3948  023476  051505  052105     000
3949  023503     114  051513  044440  EM63:   .ASCIZ  /LKS INTERRUPT WITH PRIORITY 7/
3950  023510  052116  051105  052522
3951  023516  052120  053440  052111
3952  023524  020110  051120  047511
3953  023532  044522  054524  033440
3954  023540     000
3955  023541     103  047101  047040  EM64:   .ASCIZ  /CAN NOT SET BIT6 OF LKS/
3956  023546  052117  051440  052105
3957  023554  041040  052111  020066
3958  023562  043117  046040  051513
3959  023570     000
3960  023571     103  047101  047040  EM65:   .ASCIZ  /CAN NOT CLEAR BIT6 OF LKS/
3961  023576  052117  041440  042514
3962  023604  051101  041040  052111
3963  023612  020066  043117  046040
3964  023620  051513     000
3965  023623     122  051505  052105  EM66:   .ASCIZ  /RESET DID NOT CLEAR BIT6 OF LKS/
3966  023630  042040  042111  047040
3967  023636  052117  041440  042514
3968  023644  051101  041040  052111
3969  023652  020066  043117  046040
3970  023660  051513     000
3971  023663     102  052111  020067  EM67:   .ASCIZ  /BIT7 OF LKS NOT SET AFTER RESET/
3972  023670  043117  046040  051513
3973  023676  047040  052117  051440
3974  023704  052105  040440  052106
3975  023712  051105  051040  051505
3976  023720  052105     000
3977  023723     103  047101  047040  EM70:   .ASCIZ  /CAN NOT CLEAR BIT7 OF LKS/
3978  023730  052117  041440  042514
3979  023736  051101  041040  052111
3980  023744  020067  043117  046040
3981  023752  051513     000
3982  023755     102  052111  020067  EM71:   .ASCIZ  /BIT7 OF LKS DOES NOT SET/
3983  023762  043117  046040  051513
3984  023770  042040  042517  020123
3985  023776  047516  020124  042523
3986  024004  000124
3987  024006  051127  052111  047111  EM72:   .ASCIZ  /WRITING TO ONE INTERNAL ADDRESS MODIFIED ANOTHER/
3988  024014  020107  047524  047440
3989  024022  042516  044440  052116
3990  024030  051105  040516  020114
3991  024036  042101  051124  051505
3992  024044  020123  047515  044504
3993  024052  044506  042105  040440
3994  024060  047516  044124  051105
3995  024066     000
3996  024067     123  052514  020061  EM74:   .ASCIZ  /SLU1 XMIT INTERRUPTS WHEN DISABLED/
3997  024074  046530  052111  044440
3998  024102  052116  051105  052522
3999  024110  052120  020123  044127
4000  024116  047105  042040  051511
4001  024124  041101  042514  000104
4002  024132  046123  030525  054040  EM75:   .ASCIZ  /SLU1 XMIT DID NOT INTERRUPT/
```

```
4003  024140  044515  020124  044504
4004  024146  020104  047516  020124
4005  024154  047111  042524  051122
4006  024162  050125  000124
4007  024166  046123  030525  054040  EM76:   .ASCIZ  /SLU1 XMIT INTERRUPT AT PRIORITY 7/
4008  024174  044515  020124  047111
4009  024202  042524  051122  050125
4010  024210  020124  052101  050040
4011  024216  044522  051117  052111
4012  024224  020131  000067
4013  024230  046123  030525  054040  EM77:   .ASCIZ  /SLU1 XMIT INTERRUPTS WITH ENABLE CLEAR/
4014  024236  044515  020124  047111
4015  024244  042524  051122  050125
4016  024252  051524  053440  052111
4017  024260  020110  047105  041101
4018  024266  042514  041440  042514
4019  024274  051101     000
4020  024277     123  052514  020061  EM100:  .ASCIZ  /SLU1 XMIT DID NOT INTERRUPT/
4021  024304  046530  052111  042040
4022  024312  042111  047040  052117
4023  024320  044440  052116  051105
4024  024326  052522  052120     000
4025  024333     123  052514  020061  EM101:  .ASCIZ  /SLU1 XMIT RE-INTERRUPTED/
4026  024340  046530  052111  051040
4027  024346  026505  047111  042524
4028  024354  051122  050125  042524
4029  024362  000104
4030  024364  047514  042101  047111  EM102:  .ASCIZ  /LOADING SLU1 TBUF DID NOT CLEAR INTERRUPT/
4031  024372  020107  046123  030525
4032  024400  052040  052502  020106
4033  024406  044504  020104  047516
4034  024414  020124  046103  040505
4035  024422  020122  047111  042524
4036  024430  051122  050125  000124
4037  024436  046123  030525  051040  EM103:  .ASCIZ  /SLU1 RCVR INTERRUPTS WITH ENABLE CLEAR/
4038  024444  053103  020122  047111
4039  024452  042524  051122  050125
4040  024460  051524  053440  052111
4041  024466  020110  047105  041101
4042  024474  042514  041440  042514
4043  024502  051101     000
4044  024505     123  052514  020061  EM104:  .ASCIZ  /SLU1 RCVR DID NOT INTERRUPT/
4045  024512  041522  051126  042040
4046  024520  042111  047040  052117
4047  024526  044440  052116  051105
4048  024534  052522  052120     000
4049  024541     123  052514  020061  EM105:  .ASCIZ  /SLU1 RCVR INTERRUPTS AT PRIORITY 7/
4050  024546  041522  051126  044440
4051  024554  052116  051105  052522
4052  024562  052120  020123  052101
4053  024570  050040  044522  051117
4054  024576  052111  020131  000067
4055  024604  046123  030525  051040  EM106:  .ASCIZ  /SLU1 RCVR INTERRUPTS WITH INTERRUPT ENABLE CLEAR/
4056  024612  053103  020122  047111
4057  024620  042524  051122  050125
4058  024626  051524  053440  052111
```

```
4059  024634  020110  047111  042524
4060  024642  051122  050125  020124
4061  024650  047105  041101  042514
4062  024656  041440  042514  051101
4063  024664     000
4064  024665     123  052514  020061  EM107:  .ASCIZ  /SLU1 RCVR DID NOT INTERRUPT/
4065  024672  041522  051126  042040
4066  024700  042111  047040  052117
4067  024706  044440  052116  051105
4068  024714  052522  052120     000
4069  024721     123  052514  020061  EM110:  .ASCIZ  /SLU1 RECEIVER RE-INTERRUPTED/
4070  024726  042522  042503  053111
4071  024734  051105  051040  026505
4072  024742  047111  042524  051122
4073  024750  050125  042524  000104
4074  024756  046123  030525  051040  EM111:  .ASCIZ  /SLU1 READING RBUF DID NOT CLEAR INTERRUPT/
4075  024764  040505  044504  043516
4076  024772  051040  052502  020106
4077  025000  044504  020104  047516
4078  025006  020124  046103  040505
4079  025014  020122  047111  042524
4080  025022  051122  050125  000124
4081  025030  042522  042523  020124  EM112:  .ASCIZ  /RESET DID NOT CLEAR SLU1 RCVR INTERRUPT/
4082  025036  044504  020104  047516
4083  025044  020124  046103  040505
4084  025052  020122  046123  030525
4085  025060  051040  053103  020122
4086  025066  047111  042524  051122
4087  025074  050125  000124
4088  025100  046123  030525  023440  EM113:  .ASCIZ  /SLU1 'OR' FLAG DID NOT SET/
4089  025106  051117  020047  046106
4090  025114  043501  042040  042111
4091  025122  047040  052117  051440
4092  025130  052105     000
4093  025133     123  052514  020061  EM114:  .ASCIZ  /SLU1 'ERROR' NOT SET WITH 'OR' FLAG/
4094  025140  042447  051122  051117
4095  025146  020047  047516  020124
4096  025154  042523  020124  044527
4097  025162  044124  023440  051117
4098  025170  020047  046106  043501
4099  025176     000
4100  025177     104  052101  020101  EM115:  .ASCIZ  /DATA COMPARE ERROR/
4101  025204  047503  050115  051101
4102  025212  020105  051105  047522
4103  025220  000122
4104  025222  046123  031125  054040  EM116:  .ASCIZ  /SLU2 XMIT INTERRUPTS WHEN DISABLED/
4105  025230  044515  020124  047111
4106  025236  042524  051122  050125
4107  025244  051524  053440  042510
4108  025252  020116  044504  040523
4109  025260  046102  042105     000
4110  025265     123  052514  020062  EM117:  .ASCIZ  /SLU2 XMIT DID NOT INTERRUPT/
4111  025272  046530  052111  042040
4112  025300  042111  047040  052117
4113  025306  044440  052116  051105
4114  025314  052522  052120     000
```

```
4115  025321    123  052514  020062  EM120:  .ASCIZ  /SLU2 XMIT INTERRUPT AT PRIOR''
4116  025326 046530  052111  044440
4117  025334 052116  051105  052522
4118  025342 052120  040440  020124
4119  025350 051120  047511  044522
4120  025356 054524  033440     000
4121  025363    123  052514  020062  EM121:  .ASCIZ  /SLU2 XMIT INTERRUPTS WITH ENABLE CLEAR
4122  025370 046530  052111  044440
4123  025376 052116  051105  052522
4124  025404 052120  020123  044527
4125  025412 044124  042440  040516
4126  025420 046102  020105  046103
4127  025426 040505  000122
4128  025432 046123  031125  054040  EM122:  .ASCIZ  /SLU2 XMIT DID NOT INTERRUPT/
4129  025440 044515  020124  044504
4130  025446 020104  047516  020124
4131  025454 047111  042524  051122
4132  025462 050125  000124
4133  025466 046123  031125  054040  EM123:  .ASCIZ  /SLU2 XMIT RE-INTERRUPTED/
4134  025474 044515  020124  042522
4135  025502 044455  052116  051105
4136  025510 052522  052120  042105
4137  025516    000
4138  025517    114  040517  044504  EM124:  .ASCIZ  /LOADING SLU2 TBUF DID NOT CLEAR INTERRUPT/
4139  025524 043516  051440  052514
4140  025532 020062  041124  043125
4141  025540 042040  042111  047040
4142  025546 052117  041440  042514
4143  025554 051101  044440  052116
4144  025562 051105  052522  052120
4145  025570    000
4146  025571    123  052514  020062  EM125:  .ASCIZ  /SLU2 RCVR INTERRUPTS WITH ENABLE CLEAR/
4147  025576 041522  051126  044440
4148  025604 052116  051105  052522
4149  025612 052120  020123  044527
4150  025620 044124  042440  040516
4151  025626 046102  020105  046103
4152  025634 040505  000122
4153  025640 046123  031125  051040  EM126:  .ASCIZ  /SLU2 RCVR DID NOT INTERRUPT/
4154  025646 053103  020122  044504
4155  025654 020104  047516  020124
4156  025662 047111  042524  051122
4157  025670 050125  000124
4158  025674 046123  031125  051040  EM127:  .ASCIZ  /SLU2 RCVR INTERRUPTS AT PRIORITY 7/
4159  025702 053103  020122  047111
4160  025710 042524  051122  050125
4161  025716 051524  040440  020124
4162  025724 051120  047511  044522
4163  025732 054524  033440     000
4164  025737    123  052514  020062  EM130:  .ASCIZ  /SLU2 RCVR INTERRUPTS WITH INTERRUPT ENABLE CLEAR/
4165  025744 041522  051126  044440
4166  025752 052116  051105  052522
4167  025760 052120  020123  044527
4168  025766 044124  044440  052116
4169  025774 051105  052522  052120
4170  026002 042440  040516  046102
```

```
4171  026010  020105  046103  040505
4172  026016  000122
4173  026020  046123  031125  051040  EM131:  .ASCIZ  /SLU2 RCVR DID NOT INTERRUPT/
4174  026026  053103  020122  044504
4175  026034  020104  047516  020124
4176  026042  047111  042524  051122
4177  026050  050125  000124
4178  026054  046123  031125  051040  EM132:  .ASCIZ  /SLU2 RECEIVER RE-INTERRUPTED/
4179  026062  041505  044505  042526
4180  026070  020122  042522  044455
4181  026076  052116  051105  052522
4182  026104  052120  042105     000
4183  026111     123  052514  020062  EM133:  .ASCIZ  /SLU2 READING RBUF DID NOT CLEAR INTERRUPT/
4184  026116  042522  042101  047111
4185  026124  020107  041122  043125
4186  026132  042040  042111  047040
4187  026140  052117  041440  042514
4188  026146  051101  044440  052116
4189  026154  051105  052522  052120
4190  026162     000
4191  026163     122  051505  052105  EM134:  .ASCIZ  /RESET DID NOT CLEAR SLU2 RCVR INTERRUPT/
4192  026170  042040  042111  047040
4193  026176  052117  041440  042514
4194  026204  051101  051440  052514
4195  026212  020062  041522  051126
4196  026220  044440  052116  051105
4197  026226  052522  052120     000
4198  026233     123  052514  020062  EM135:  .ASCIZ  /SLU2 'OR' FLAG DID NOT SET/
4199  026240  047447  023522  043040
4200  026246  040514  020107  044504
4201  026254  020104  047516  020124
4202  026262  042523  000124
4203  026266  046123  031125  023440  EM136:  .ASCIZ  /SLU2 'ERROR' NOT SET WITH 'OR' FLAG/
4204  026274  051105  047522  023522
4205  026302  047040  052117  051440
4206  026310  052105  053440  052111
4207  026316  020110  047447  023522
4208  026324  043040  040514  000107
4209  026332  046123  031125  041040  EM137:  .ASCIZ  /SLU2 BREAK DID NOT TRANSMIT ALL ZEROES/
4210  026340  042522  045501  042040
4211  026346  042111  047040  052117
4212  026354  052040  040522  051516
4213  026362  044515  020124  046101
4214  026370  020114  042532  047522
4215  026376  051505     000
4216  026401     102  042522  045501  EM140:  .ASCIZ  /BREAK DID NOT SET FRAMING ERROR/
4217  026406  042040  042111  047040
4218  026414  052117  051440  052105
4219  026422  043040  040522  044515
4220  026430  043516  042440  051122
4221  026436  051117     000
4222  026441     123  052514  020062  EM141:  .ASCIZ  /SLU2 'ERROR' NOT SET WITH 'FR' FLAG/
4223  026446  042447  051122  051117
4224  026454  020047  047516  020124
4225  026462  042523  020124  044527
4226  026470  044124  023440  051106
```

```
 4227  026476  020047  046106  043501
 4228  026504     000
 4229  026505     104  052101  020101  EM142:  .ASCIZ  /DATA COMPARE ERROR WITH CABLE/
 4230  026512  047503  050115  051101
 4231  026520  020105  051105  047522
 4232  026526  020122  044527  044124
 4233  026534  041440  041101  042514
 4234  026542     000
 4235  026543     122  041524  044440  EM143:  .ASCIZ  /RTC INTERRUPT AT PRIORITY 7/
 4236  026550  052116  051105  052522
 4237  026556  052120  040440  020124
 4238  026564  051120  047511  044522
 4239  026572  054524  033440     000
 4240  026577     122  041524  044440  EM144:  .ASCIZ  /RTC INTERRUPTS WHEN DISABLED/
 4241  026604  052116  051105  052522
 4242  026612  052120  020123  044127
 4243  026620  047105  042040  051511
 4244  026626  041101  042514  000104
 4245  026634  052122  020103  047111  EM145:  .ASCIZ  /RTC INTERRUPT DID NOT OCCUR/
 4246  026642  042524  051122  050125
 4247  026650  020124  044504  020104
 4248  026656  047516  020124  041517
 4249  026664  052503  000122
 4250  026670  052122  020103  047111  EM146:  .ASCIZ  /RTC INTERRUPT DID NOT OCCUR/
 4251  026676  042524  051122  050125
 4252  026704  020124  044504  020104
 4253  026712  047516  020124  041517
 4254  026720  052503  000122
 4255  026724  052122  020103  047504  EM147:  .ASCIZ  /RTC DOUBLE INTERRUPT/
 4256  026732  041125  042514  044440
 4257  026740  052116  051105  052522
 4258  026746  052120     000
 4259  026751     122  051505  052105  EM150:  .ASCIZ  /RESET DID NOT CLEAR RTC INTERRUPT/
 4260  026756  042040  042111  047040
 4261  026764  052117  041440  042514
 4262  026772  051101  051040  041524
 4263  027000  044440  052116  051105
 4264  027006  052522  052120     000
 4265  027013     122  041524  044440  EM151:  .ASCIZ  /RTC INTERRUPT DID NOT CLEAR WITH BIT7 OF LKS/
 4266  027020  052116  051105  052522
 4267  027026  052120  042040  042111
 4268  027034  047040  052117  041440
 4269  027042  042514  051101  053440
 4270  027050  052111  020110  044502
 4271  027056  033524  047440  020106
 4272  027064  045514  000123
 4273  027070  046103  041517  020113  EM152:  .ASCIZ  /CLOCK REPEATABILITY ERROR/
 4274  027076  042522  042520  052101
 4275  027104  041101  046111  052111
 4276  027112  020131  051105  047522
 4277  027120  000122
 4278  027122  046123  030525  051040  EM153:  .ASCIZ  /SLU1 RECEIVER STATUS ERROR/
 4279  027130  041505  044505  042526
 4280  027136  020122  052123  052101
 4281  027144  051525  042440  051122
 4282  027152  051117     000
```

```
4283  027155     123  052514  020062  EM154:  .ASCIZ  /SLU2 RECEIVER STATUS ERROR/
4284  027162  042522  042503  053111
4285  027170  051105  051440  040524
4286  027176  052524  020123  051105
4287  027204  047522  000122
4288  027210  047111  047503  051122  EM155:  .ASCIZ  /INCORRECT RECEIVE COUNT SLU1/
4289  027216  041505  020124  042522
4290  027224  042503  053111  020105
4291  027232  047503  047125  020124
4292  027240  046123  030525     000
4293  027245     123  052514  020061  EM156:  .ASCIZ  /SLU1 DATA COMPARE ERROR IN EXERCISER/
4294  027252  040504  040524  041440
4295  027260  046517  040520  042522
4296  027266  042440  051122  051117
4297  027274  044440  020116  054105
4298  027302  051105  044503  042523
4299  027310  000122
4300  027312  047111  047503  051122  EM157:  .ASCIZ  /INCORRECT RECEIVE COUNT SLU2/
4301  027320  041505  020124  042522
4302  027326  042503  053111  020105
4303  027334  047503  047125  020124
4304  027342  046123  031125     000
4305  027347     123  052514  020062  EM160:  .ASCIZ  /SLU2 DATA COMPARE ERROR IN EXERCISER/
4306  027354  040504  040524  041440
4307  027362  046517  040520  042522
4308  027370  042440  051122  051117
4309  027376  044440  020116  054105
4310  027404  051105  044503  042523
4311  027412  000122
4312  027414  051124  050101  041440  EM161:  .ASCIZ  /TRAP CATCHER/
4313  027422  052101  044103  051105
4314  027430     000
4315
4316  027431     124  051505  021524  DH5:    .ASCIZ  /TEST#   ERR PC  TCSR/
4317  027436  020040  042440  051122
4318  027444  050040  020103  052040
4319  027452  051503  000122
4320  027456  042524  052123  020043  DH6:    .ASCIZ  /TEST#   ERR PC  RCSR/
4321  027464  020040  051105  020122
4322  027472  041520  020040  041522
4323  027500  051123     000
4324  027503     124  051505  021524  DH7:    .ASCIZ  /TEST#   ERR PC  RBUF/
4325  027510  020040  042440  051122
4326  027516  050040  020103  051040
4327  027524  052502  000106
4328  027530  042524  052123  020043  DH32:   .ASCIZ  /TEST#   ERR PC  TBUF/
4329  027536  020040  051105  020122
4330  027544  041520  020040  041124
4331  027552  043125     000
4332  027555     124  051505  021524  DH61:   .ASCIZ  /TEST#   ERR PC  LKS/
4333  027562  020040  042440  051122
4334  027570  050040  020103  046040
4335  027576  051513     000
4336  027601     124  051505  021524  DH72:   .ASCIZ  /TEST#   ERR PC  GDADR   BDADR   GDDAT   BDDAT/
4337  027606  020040  042440  051122
4338  027614  050040  020103  043440
```

```
 4339  027622  040504  051104  020040
 4340  027630  041040  040504  051104
 4341  027636  020040  043440  042104
 4342  027644  052101  020040  041040
 4343  027652  042104  052101     000
 4344  027657     124  051505  021524  DH115:  .ASCIZ  /TEST#  ERR PC  RCSR    GOOD    BAD/
 4345  027664  020040  042440  051122
 4346  027672  050040  020103  051040
 4347  027700  051503  020122  020040
 4348  027706  043440  047517  020104
 4349  027714  020040  041040  042101
 4350  027722     000
 4351  027723     124  051505  021524  DH137:  .ASCIZ  /TEST#  ERR PC  RCSR    DATA/
 4352  027730  020040  042440  051122
 4353  027736  050040  020103  051040
 4354  027744  051503  020122  020040
 4355  027752  042040  052101  000101
 4356  027760  042524  052123  020043  DH142:  .ASCIZ  /TEST#  ERR PC  GOOD    BAD/
 4357  027766  020040  051105  020122
 4358  027774  041520  020040  047507
 4359  030002  042117  020040  020040
 4360  030010  040502  000104
 4361  030014  042524  052123  020043  DH152:  .ASCIZ  /TEST#  ERR PC  LKS     CNT1    CNT2/
 4362  030022  020040  051105  020122
 4363  030030  041520  020040  045514
 4364  030036  020123  020040  020040
 4365  030044  047103  030524  020040
 4366  030052  020040  047103  031124
 4367  030060     000
 4368  030061     124  051505  021524  DH155:  .ASCIZ  /TEST#  ERR PC  RCSR    TRANS   RCV/
 4369  030066  020040  042440  051122
 4370  030074  050040  020103  051040
 4371  030102  051503  020122  020040
 4372  030110  052040  040522  051516
 4373  030116  020040  051040  053103
 4374  030124     000
 4375  030125     124  051505  021524  DH161:  .ASCIZ  /TEST#   ERR PC  RCSR    OLDPC   TRAP ADR/
 4376  030132  020040  042440  051122
 4377  030140  050040  020103  051040
 4378  030146  051503  020122  020040
 4379  030154  047440  042114  041520
 4380  030162  020040  052040  040522
 4381  030170  020120  042101  000122
 4382  030176  005015  045103  042113  M1:     .ASCIZ  <CR><LF>/CJKDF-B/
 4383  030204  026506  000102
 4384  030210     200                  M2:     .ASCII  <CRLF>
 4385
 4386          030212                          .EVEN
 4387  030212  001104  001016  003004  DT5:    .WORD   $TESTN,$ERRPC,CTCSR,0
 4388  030220  000000
 4389  030222  001104  001016  003000  DT6:    .WORD   $TESTN,$ERRPC,CRCSR,0
 4390  030230  000000
 4391  030232  001104  001016  003002  DT7:    .WORD   $TESTN,$ERRPC,CRBUF,0
 4392  030240  000000
 4393  030242  001104  001016  002774  DT31:   .WORD   $TESTN,$ERRPC,TCSR,0
 4394  030250  000000
```

```
4395  030252  001104  001016  002776  DT32:   .WORD   $TESTN,$ERRPC,TBUF,0
4396  030260  000000
4397  030262  001104  001016  002770  DT36:   .WORD   $TESTN,$ERRPC,RCSR,0
4398  030270  000000
4399  030272  001104  001016  002772  DT37:   .WORD   $TESTN,$ERRPC,RBUF,0
4400  030300  000000
4401  030302  001104  001016  003010  DT61:   .WORD   $TESTN,$ERRPC,LKS,0
4402  030310  000000
4403  030312  001104  001016  001020  DT72:   .WORD   $TESTN,$ERRPC,$GDADR,$BDADR,$GDDAT,$BDDAT,0
4404  030320  001022  001024  001026
4405  030326  000000
4406  030330  001104  001016  003000  DT115:  .WORD   $TESTN,$ERRPC,CRCSR,$GDDAT,$BDDAT,0
4407  030336  001024  001026  000000
4408  030344  001104  001016  002770  DT137:  .WORD   $TESTN,$ERRPC,RCSR,$BDDAT,0
4409  030352  001026  000000
4410  030356  001104  001016  001024  DT142:  .WORD   $TESTN,$ERRPC,$GDDAT,$BDDAT,0
4411  030364  001026  000000
4412  030370  001104  001016  003010  DT152:  .WORD   $TESTN,$ERRPC,LKS,FIRST,SECND,0
4413  030376  013574  013576  000000
4414  030404  001104  001016  003000  DT155:  .WORD   $TESTN,$ERRPC,CRCSR,XMTCT1,RECCT1,0
4415  030412  014726  014732  000000
4416  030420  001104  001016  002770  DT157:  .WORD   $TESTN,$ERRPC,RCSR,XMTCT2,RECCT2,0
4417  030426  014730  014734  000000
4418  030434  001104  001016  002770  DT161:  .WORD   $TESTN,$ERRPC,RCSR,OLDPC,BDVECT,0
4419  030442  015114  015116  000000
4420  030450  000200          BUF1:   .BLKW   200             ;SLU1 INPUT BUFFER FOR BLAST TEST
4421  031050  000200          BUF2:   .BLKW   200             ;SLU2 INPIT BUFFER FOR BLAST TEST
4422          000001                  .END
```

```
ABASE = 176500
ACDW1 = 000000
ACDW2 = 000000
ACPUOP= 000000
ADDW0 = 000000
ADDW1 = 000000
ADDW10= 000000
ADDW11= 000000
ADDW12= 000000
ADDW13= 000000
ADDW14= 000000
ADDW15= 000000
ADDW2 = 000000
ADDW3 = 000000
ADDW4 = 000000
ADDW5 = 000000
ADDW6 = 000000
ADDW7 = 000000
ADDW8 = 000000
ADDW9 = 000000
ADEVCT= 000000
ADEVM = 000000
AENV  = 000000
AENVM = 000000
AFATAL= 000000
AMADR1= 000000
AMADR2= 000000
AMADR3= 000000
AMADR4= 000000
AMAMS1= 000000
AMAMS2= 000000
AMAMS3= 000000
AMAMS4= 000000
AMSGAD= 000000
AMSGLG= 000000
AMSGTY= 000000
AMTYP1= 000000
AMTYP2= 000000
AMTYP3= 000000
AMTYP4= 000000
APASS = 000000
APRIOR= 000000
APTCSU= 000040
APTENV= 000001
APTSIZ= 000200
APTSPO= 000100
ASWREG= 000000
ATESTN= 000000
AUNIT = 000000
AUSWR = 000400
AVECT1= 000300
AVECT2= 000000
BDVECT  015116
BIT0  = 000001
BIT00 = 000001
BIT01 = 000002
BIT02 = 000004
BIT03 = 000010
BIT04 = 000020
BIT05 = 000040
BIT06 = 000100
BIT07 = 000200
BIT08 = 000400
BIT09 = 001000
BIT1  = 000002
BIT10 = 002000
BIT11 = 004000
BIT12 = 010000
BIT13 = 020000
BIT14 = 040000
BIT15 = 100000
BIT2  = 000004
BIT3  = 000010
BIT4  = 000020
BIT5  = 000040
BIT6  = 000100
BIT7  = 000200
BIT8  = 000400
BIT9  = 001000
BLAST   013600
BPT   = 000003
BPTVEC= 000014
BUF1    030450
BUF2    031050
CATCH   015070
CHECK1  014524
CHECK2  014604
CKSWR = 104407
CMPARE  013532
CONT    006510
CONT41  012330
COUNT   014736
CR    = 000015
CRBUF   003002
CRCSR   003000
CRLF  = 000200
CRPSW   003024
CRVECT  003022
CTBUF   003006
CTCSR   003004
CTPSW   003030
CTVECT  003026
CWDONE  004602
DDISP = 177570
DH115   027657
DH137   027723
DH142   027760
DH152   030014
DH155   030061
DH161   030125
DH32    027530
DH5     027431
DH6     027456
DH61    027555
DH7     027503
DH72    027601
DISPLA  001042
DISPRE  000174
DSWR  = 177570
DT115   030330
DT137   030344
DT142   030356
DT152   030370
DT155   030404
DT157   030420
DT161   030434
DT31    030242
DT32    030252
DT36    030262
DT37    030272
DT5     030212
DT6     030222
DT61    030302
DT7     030232
DT72    030312
ECHO    020106
EMTVEC= 000030
EM100   024277
EM101   024333
EM102   024364
EM103   024436
EM104   024505
EM105   024541
EM106   024604
EM107   024665
EM11    020650
EM110   024721
EM111   024756
EM112   025030
EM113   025100
EM114   025133
EM115   025177
EM116   025222
EM117   025265
EM120   025321
EM121   025363
EM122   025432
EM123   025466
EM124   025517
EM125   025571
EM126   025640
EM127   025674
EM13    020706
EM130   025737
EM131   026020
EM132   026054
EM133   026111
EM134   026163
EM135   026233
EM136   026266
EM137   026332
EM14    020754
EM140   026401
EM141   026441
EM142   026505
EM143   026543
EM144   026577
EM145   026634
EM146   026670
EM147   026724
EM15    021024
EM150   026751
EM151   027013
EM152   027070
EM153   027122
EM154   027155
EM155   027210
EM156   027245
EM157   027312
EM16    021072
EM160   027347
EM161   027414
EM17    021130
EM20    021170
EM21    021236
EM22    021306
EM23    021352
EM24    021410
EM25    021450
EM26    021523
EM27    021560
EM30    021623
EM31    021675
EM32    021734
EM33    021773
EM34    022045
EM35    022113
EM36    022155
EM37    022214
EM40    022253
EM41    022323
EM42    022361
EM43    022421
EM44    022467
EM45    022537
EM46    022605
EM47    022643
EM5     020510
EM50    022703
EM51    022751
EM52    023021
EM53    023065
EM54    023123
EM55    023163
EM56    023236
EM57    023273
EM6     020552
EM60    023336
EM61    023410
EM62    023441
EM63    023503
EM64    023541
EM65    023571
EM66    023623
EM67    023663
EM7     020611
EM70    023723
EM71    023755
EM72    024006
EM74    024067
EM75    024132
EM76    024166
EM77    024230
ERRVEC= 000004
FINIE   014664
FIRST   013574
GTSWR = 104406
HT    = 000011
ID      003700
IOHAND  014400
IOTVEC= 000020
LF    = 000012
LKS     003010
LTCIT   012544
LTCRT   006152
MFR     020327
MOR     020341
MPAR    020316
MSG     020270
MSTOP   020354
M1      030176
M2      030210
OLDPC   015114
OUTTST  020364
PIRQ  = 177772
```

```
PIROVE= 000240
PR0    = 000000
PR1    = 000040
PR2    = 000100
PR3    = 000140
PR4    = 000200
PR5    = 000240
PR6    = 000300
PR7    = 000340
PS     = 177776
PSW    = 177776
PWRVEC= 000024
RBUF    002772
RCSR    002770
RDCHR = 104410
RDLIN = 104411
RECCT1  014732
RECCT2  014734
REC1    014210
REC2    014324
RESVEC= 000010
RPSW    003014
RTCPSW  003034
RTCVT   003032
RVECT   003012
R6     =%000006
R7     =%000007
SECND   013576
SLU1IT  006700
SLU2IT  010600
SLU2RT  004726
STACK = 001100
START   003036
STKLMT= 177774
SWR     001040
SWREG   000176
SW0    = 000001
SW00   = 000001
SW01   = 000002
SW02   = 000004
SW03   = 000010
SW04   = 000020
SW05   = 000040
SW06   = 000100
SW07   = 000200
SW08   = 000400
SW09   = 001000
SW1    = 000002
SW10   = 002000
SW11   = 004000
SW12   = 010000
SW13   = 020000
SW14   = 040000
SW15   = 100000
SW2    = 000004
SW3    = 000010
SW4    = 000020
SW5    = 000040
SW6    = 000100
SW7    = 000200
SW8    = 000400
SW9    = 001000
TBITVE= 000014
TBUF    002776
TCSR    002774
TICKER  014144
TKVEC = 000060
TOLER   013544
TPSW    003020
TPVEC = 000064
TRAPVE= 000034
TRTVEC= 000014
TST1    003450
TST10   004246
TST11   004412
TST12   004556
TST13   004652
TST14   004726
TST15   005002
TST16   005042
TST17   005134
TST2    003516
TST20   005214
TST21   005254
TST22   005314
TST23   005452
TST24   005634
TST25   006016
TST26   006110
TST27   006152
TST3    003564
TST30   006226
TST31   006410
TST32   006524
TST33   006700
TST34   007046
TST35   007166
TST36   007322
TST37   007434
TST4    003734
TST40   007614
TST41   007764
TST42   010134
TST43   010256
TST44   010372
TST45   010476
TST46   010600
TST47   010722
TST5    004012
TST50   011042
TST51   011176
TST52   011340
TST53   011460
TST54   011576
TST55   011730
TST56   012034
TST57   012160
TST6    004052
TST60   012246
TST61   012354
TST62   012446
TST63   012544
TST64   012766
TST65   013140
TST66   013262
TST67   013416
TST7    004112
TST70   013600
TVECT   003016
TYPDS = 104405
TYPE  = 104401
TYPOC = 104402
TYPON = 104404
TYPOS = 104403
UNIQUE  006524
WAIT    020276
WAITER  014500
WAITIO  014140
WDONE   006040
WRPSW   015056
XMIT1   014154
XMIT2   014270
XMTCT1  014726
XMTCT2  014730
$APTHD  000500
$ATYC   016012
$ATY1   015766
$ATY3   015774
$ATY4   016004
$AUTOB  001034
$BASE   001154
$BDADR  001022
$BDDAT  001026
$CHARC  016564
$CKSWR  017242
$CMTAG  001000
$CM3  = 000000
$CM4  = 000005
$CNTLG  017777
$CNTLU  017772
$CPUOP  001126
$CRLF   001075
$DBLK   017232
$DEVCT  001110
$DEVM   001156
$DOAGN  015032
$DTBL   017222
$ENDAD  015022
$ENDCT  014770
$ENDMG  015041
$ENULL  015036
$ENV    001120
$ENVM   001121
$EOP    014740
$EOPCT  014762
$ERFLG  001003
$ERMAX  001015
$ERROR  015120
$ERRPC  001016
$ERRTB  001160
$ERRTY  015302
$ERTTL  001012
$ESCAP  001072
$ETABL  001120
$ETEND  001160
$FATAL  001102
$FFLG   016232
$FILLC  001056
$FILLS  001055
$GDADR  001020
$GDDAT  001024
$GET42  015012
$GTSWR  017312
$HD   = 000003
$HIBTS  000500
$ICNT   001004
$ILLUP  015576
$INTAG  001035
$ITEMB  001014
$LF     001076
$LFLG   016231
$LPADR  001006
$LPERR  001010
$MADR1  001132
$MADR2  001136
$MADR3  001142
$MADR4  001146
$MAIL   001100
$MAMS1  001130
$MAMS2  001134
$MAMS3  001140
$MAMS4  001144
$MBADR  000502
$MFLG   016230
$MNEM   020015
$MSGAD  001114
$MSGLG  001116
$MSGTY  001100
$MSWR   020004
$MTYP1  001131
$MTYP2  001135
$MTYP3  001141
$MTYP4  001145
$NULL   001054
$NMTST= 000001
$OCNT   017012
$OMODE  017014
$OVER   015752
$PASS   001106
$PASTM  000506
$POWER  015604
$PWRDN  015436
$PWRMG  015572
$PWRUP  015510
$QUES   001074
$RDCHR  017524
$RDLIN  017654
$RDSZ = 000010
$RTNAD  015034
$SAVR6  015602
$SCOPE  015614
$SETUP= 000137
$STUP = 177777
$SVLAD  015716
$SVPC = 000500
$SWR  = 161000
$SWREG  001122
$SWMSK= 000000
$TESTN  001104
$TKB    001046
$TKS    001044
$TMP0   001060
$TMP1   001062
$TMP2   001064
$TMP3   001066
$TMP4   001070
$TN   = 000071
$TPB    001052
$TPFLG  001057
$TPS    001050
$TRAP   020026
$TRAP2  020050
$TRP  = 000012
$TRPAD  020062
$TSTM   000504
```

```
CJKDFB0 11 24 OPTIONS DIAGNOSTIC        MACY11 30(1046)  04 JAN 85  11:58  PAGE 98
CJKDFB P11     04 JAN 85 11:44          SYMBOL TABLE

$TSTNM  001002          $TYPEX  016566          $UNITM  000510          $XON  = 000021          .$ERR=  001160
$TTYIN  017762          $TYPOC  016614          $USWR   001124          $XTSTR  015626          .$$   = 000500
$TYPDS  017016          $TYPON  016630          $VECT1  001150          $$GET4= 000000
$TYPE   016234          $TYPOS  016570          $VECT2  001152          $OFILL  017013
$TYPEC  016446          $UNIT   001112          $XOFF = 000023          .       = 031450

  ABS.  031450      000


 ERRORS DETECTED:  0

 CJKDFB,CJKDFB/SOL/NL:TOC=SYSMAC SML,CJKDFB.P11
 RUN TIME:  18 20 .6 SECONDS
 RUN-TIME RATIO: 92/40=2.2
 CORE USED:  43K  (86 PAGES)
```