CC Technical Documentation
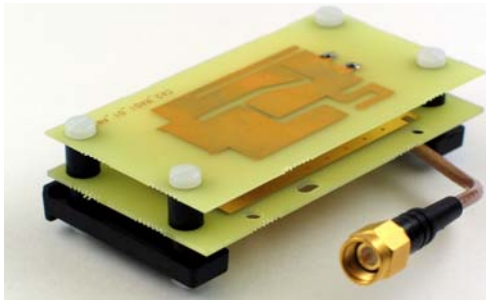## RM–11 Series Transceivers

Service Tools

Contents   Page

Model 3205 Service Tools

JBV-1 Docking Station	DA-12 Docking Station Adapter
0770298	0770603
The Docking Station and the Docking Station Adapter are needed for Mbus, Fbus, RF, and audio connections. This setup allows connection between flash prommers. The Docking Station can be powered by FPS-8 or external power supply.	The flash adapter allows FBUS/MBUS connections for flashing.

CPL-8 GPS/RF Coupler	JSX-1A Shield Box
0770475	0770346
CPL-8 allows testing of the GPS antenna at AMS locations. *Shield Box JSX-1A is required.*	The Shield Box allows RF radiated tests and antenna testing. Contact the Americas AMS in Melbourne, FL for more information on how to obtain one.
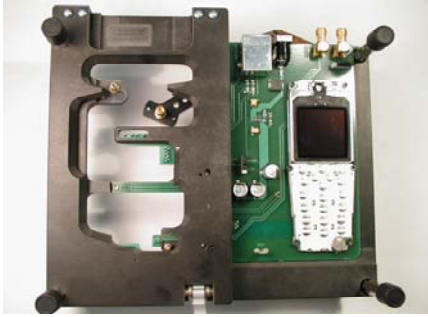
DKU-5F Flash Cable	FPS-8 Flash Prommer
0780738	0080321
For use with the Spirent UPST and UMPP service software. *Note: The cable cannot be used as a straight through USB connection cable.*	The Flash Prommer FPS-8 is used for heavy flash at authorized service centers.

XCS-4 Mbus/Fbus Cable	CA-5S DC Service Cable
0730178	0730283
XCS-4 Service Cable is a modular cable for flashing DCT4 products.	The DC Service Cable (CA-5S) connects the docking station (JBV-1) to the charger connection (Vin) of the phone to conduct EM calibration. *Note: CA-5S replaces the SCB-3 cable (0730114).*

PCS-1 Power Cable	XRS-6 RF Cable
0730012	0730231
The PCS-1 Power Cable is used to connect the service tools (JBV-1, DA-12) to an external power supply.	The XRS-6 Cable is used to connect service tools to RF measuring equipment.

FLS-4S POS Flash Dongle	DAU-9T FBUS Data Cable
0080543	0730267
The Point of Sale (POS) flash is a low-cost software upgrade tool. This requires XCS-1 cable and ACF-8 for operation.	FBUS cable DAU-9T provides a connection from the serial port of the computer to the system connector of the phone.

DAU-9S Cable	CA-25RS RF Test Probe
0730108	0730316
This is a general-purpose cable to support F / MBUS communication between a Mod-10 device and a PC.	The CA-25RS allows testing of the CDMA RF.

CA-22DS Service Connector	MJ-18 Module Jig
0730311	0770599
This cable is used with FLS-4S or FLC-20 0081544 for bottom-connector flashing.	This jig allows phone PWB-level service and trouble-shooting for authorized service centers.

PKD-1 SW Security Device	SRT-10 Camera Removal Tool
0750018	0770556
SW security device (PKD-1) is a hardware device that, when connected to the parallel (LPT) port of the PC, enables the use of service software. Without the dongle present, it is not possible to use the service software. Printers or other peripheral devices can be connected to the PC through the dongle, if needed. *Caution: Make sure that you have switched off the PC and the printer before making connections!*	SRT-10 is used to remove the camera. For detailed camera module disassembly/assembly instructions, see the *Disassembly/Assembly* chapter.

Flashing and Testing Setups

POS Flash Setup 1	POS Flash Setup 2
FLC-20 and CA-22DS	DKU-5F

POS Flash Setup 3	Service Center Flash Setup 4
FLS-4S and CA-22DS	FPS-8 prommer, JBV-1, and DA-12

Flashing, Testing, and Tuning with Covers On

Tightened performance specifications require more precise equipment and methods for testing and alignment. Manual tuning ca not provide accurate results for the RM-11, which means that this test has to be automated.

These setups are intended to be with the Phoenix Service Software. Both manual testing and automated tuning are permitted with Phoenix Service Software.

Service Setup 1
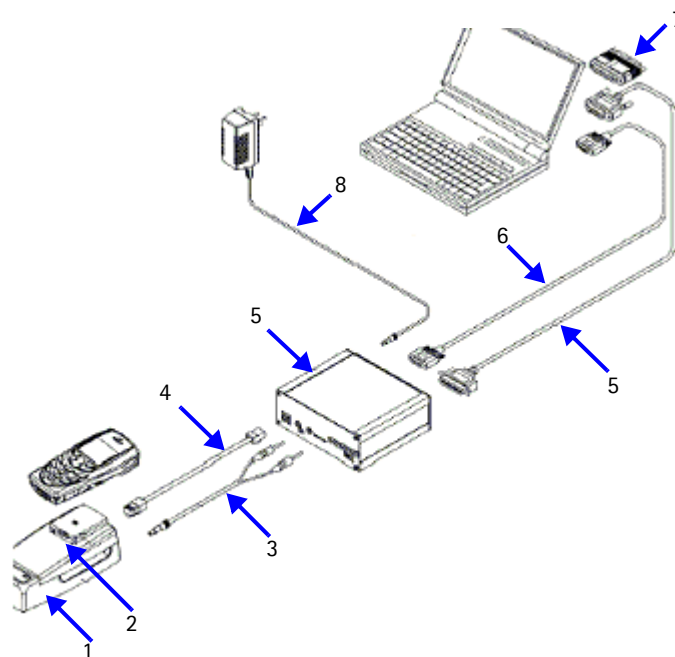
Item	Name	Type	Code
1	Docking Station	JBV-1	0770298
2	Docking Station Adapter	DA-12	0770603
3	DC Power Cable	PCS-1	0770012
4	Modular Cable	XCS-4	0730178
5	Flash Prommer Box	FPS-8	0080321
6	Printer Cable (included with FPS-8)	CA-10DS	0730298
7	D9-D9 Cable (included with FPS-8)	AXS-4	0730090
8	SW Protection Key	PKD-1	0750018
9	AC Charger	ACP-8F	0680032

Service Setup 2
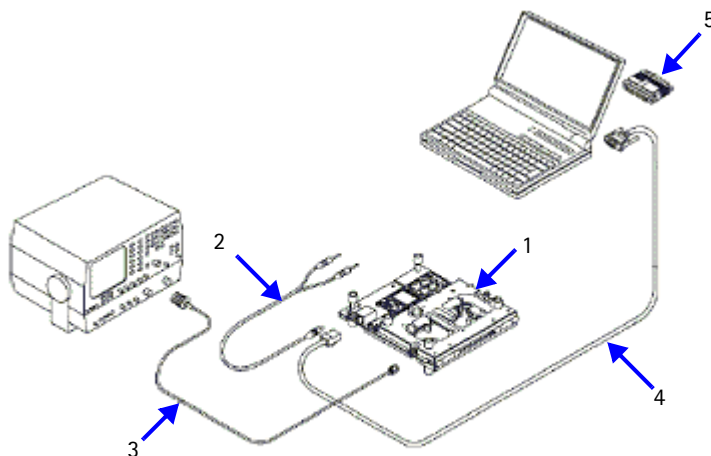
Item	Name	Type	Code
1	Module Jig	MJ–18	0770599
2	DC Power Cable	PCS–1	0730012
3	RF Antenna Cable	XRS–6	0730231
4	Service MBUS Cable	DAU–9S	0730108
5	SW Protection Key	PKD–1	0750018
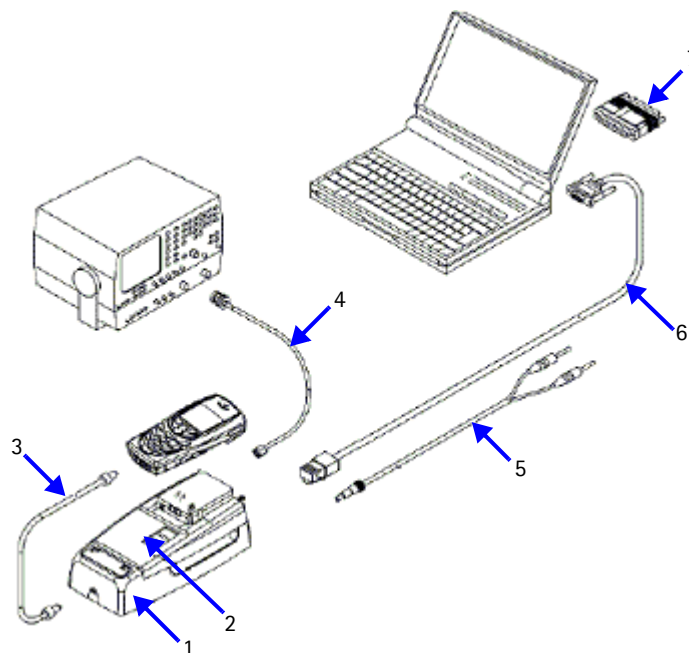
NOKIA

Service Setup 3

Item	Name	Type	Code
1	Docking Station	JBV–1	0770298
2	Docking Station Adapter	DA–12	0770603
3	DC Service Cable	CA–5S	0730283
4	RF Antenna Cable	XRS–6	0730231
5	DC Power Cable	PCS–1	0730012
6	Service MBUS Cable	DAU–9S	0730108
7	SW Protection Key	PKD–1	0750018

Automated Tuning and Alignment

This setup is used for tuning of the handset at Nokia Authorized Service Centers.
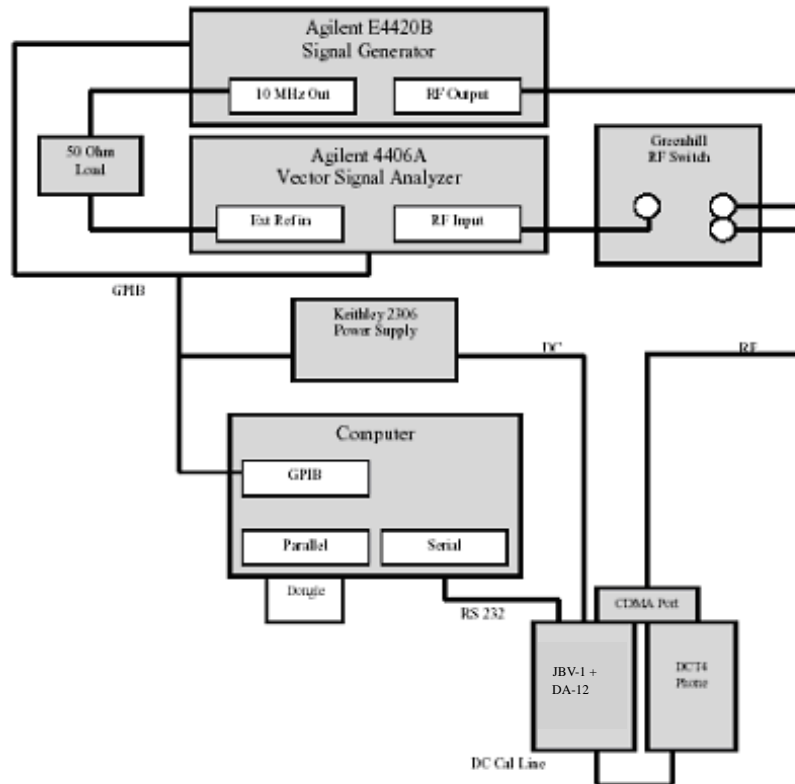

Figure 1: Tuning and alignment diagram

Use the following equipment for automated tuning and alignment.

Note: A Test Sequence File is required to perform "Auto tune" on this phone. In addition, Phoenix needs to have the Auto Tune function installed. Consult your local Nokia After Market Services office more information.

Table 1: Automated tuning and alignment equipment list

Item	Name	MFR	Model #	QTY	Comment
1	Vector Signal Analyzer	Agilent	E4406A	1	Options B78, BAC and BAE
2	Signal Generator	Agilent	E4421B	1	Digital signal generator with high stability oscillator and high spectral purity
3	Momentum Series	Agilent	8960C	1	CDMA tester for IS-95, IS-2000, and AMPS protocols
4	Power Supply	Keithly	K2306	2	Programmable with sense wire
5	Win2000 PC				Dell with Pentium III or above, network card, 256M RAM, 20GB HD, CD-ROM, etc.
6	NI-GPIB Interface	NI	GPIB-USB-A	2	USB to GPIB adapter (184983G-01)

Issue 2 09/2005

Table 1: Automated tuning and alignment equipment list (Continued)

Item	Name	MFR	Model #	QTY	Comment
7	Docking Station	Nokia	JBV-1	1	Consult your local Nokia After Market Services office for more information
8	RF Switches	Green Hill	TVi9901	1	Consult your local Nokia After Market Services office for more information

GPS Testing Engine

Use this setup for testing the GPS engine at Nokia Authorized Service Centers. Both Galvanic and Radiated tests are supported. The GPS Test component in Phoenix provides functionality to perform these tests. Refer to the *Troubleshooting – GPS* section for more details regarding GPS engine troubleshooting.
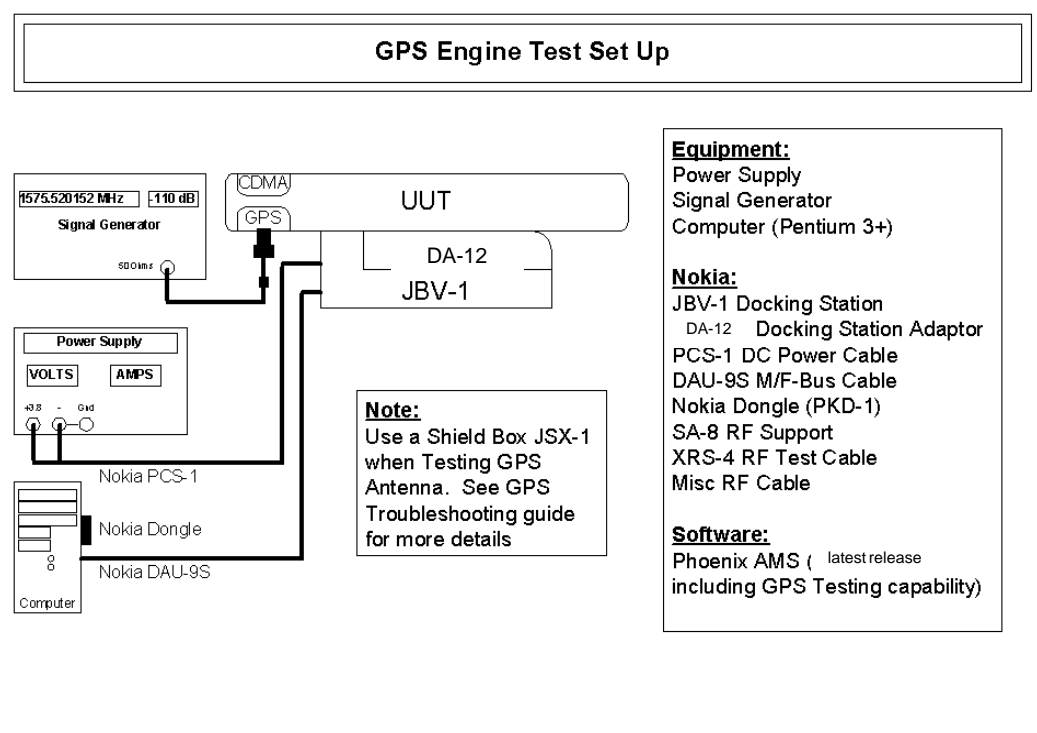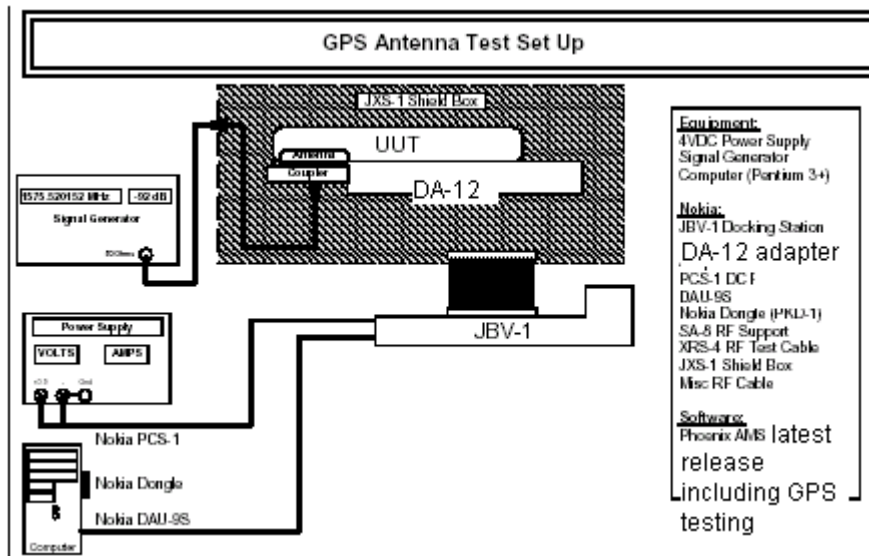

Figure 2: GPS Galvanic Testing

Figure 3: GPS radiated testing

GPS Testing Equipment

- Power Supply

- Signal Generator up to 2 GHz

- Computer (Pentium 3, W2000)

- JBV-1 Docking Station

- DA-12 Docking Station Adaptor

- PCS-1 DC Power Cable

- DAU-9S M/F-Bus Cable

- RF Test Cables (for GPS RF Port)

- Latest Release Phoenix AMS version w/ GPS Test Component