



Service Information

COPIER

HARDWARE

SOFTWARE

Model : PCL5e Printer Driver v4.41 for Windows 9x/NT4.0/2000

Number: FF-T01-V1-000098-01
(00-OIPD0-B0073)

Date : July 31, 2000

© Canon (UK) Limited

Location : PCL5e Printer

Subject : PCL5e Printer Driver Version 4.41 for Windows 9x/NT4.0/2000 Release

Reason : PCL5e Printer Driver v4.41 for Windows 9x/NT4.0/2000 was released.

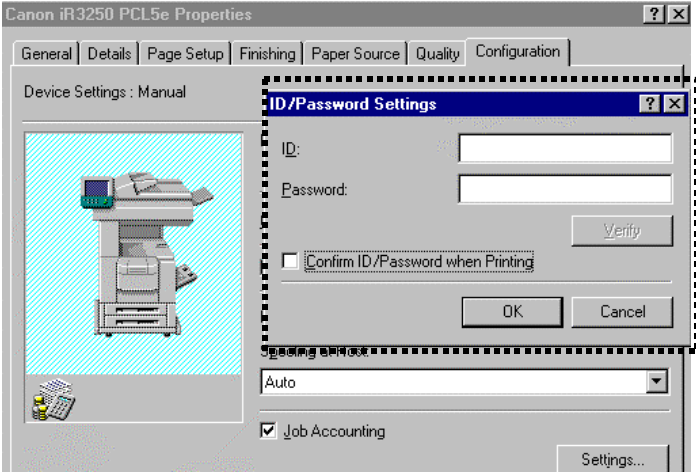
[History of Release]

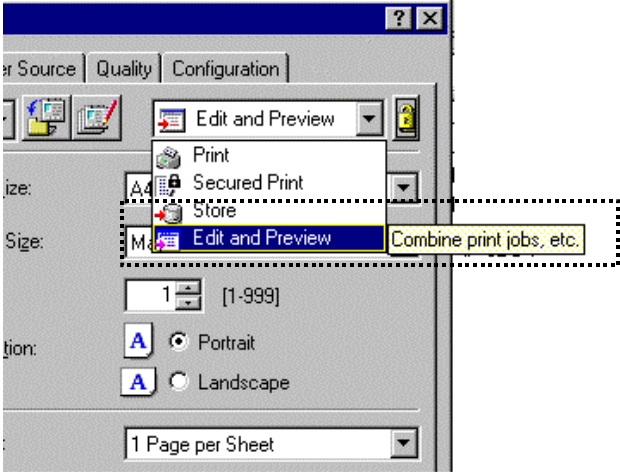
Service Info. No.	Ver. No.	Description	Date
FF-T01-V1-000093-01	PCL5e Drv V4.41	- iR3250 Support (UK English) - WHQL Certification Acquisition (except GP30-55 MDC) - Job Accounting Support (iR3250) - Dynamic Configuration with VDC - Job Combine/Editing Function Support (Windows9x only) - CPCA Support - Oficio Paper Support at Network Multi PDL Printer Board-D1/E1	July 31, 2000
FF-T01-V1-000083-01	PCL5e Drv v4.40	Windows2000 Support	May 17, 2000
RR-T02-RAX-000001-01	PCL5e Drv v4.30/ PCL6 Drv v2.00	LBP-1000/LBP-1760/LBP-1760e Support	February 17, 2000
FF-T01-V1-000055-01	PRN Drv V4.20 FAX Drv V1.20/21	Localized version Release	January 17,2000

99-OIPD0-B0077	PRN Drv V4.20 FAX Drv V1.20/21	- Network Multi PDL Printer Board-H1/K1 v2.0 Support - Multi PDL Board-B1/Printer Board-P3 Support (Windows9x) - Multi PDL Board-A1/Printer Board-P2 Support (Windows NT4.0 Only)	November 17, 1999
99-OIPD0-B0060	PRN Drv V4.10 FAX Drv V1.10	- Network Multi PDL Printer Board-D1/E1 v2.0 Support - Network Printer Board-F1 v2.0 Support - Multi PDL Board-B1/Printer Board-P3 Support (Windows NT4.0 Only)	September 8, 1999
99-OIPD0-B0026	PRN Drv V4.00/4.01 FAX Drv V1.00/1.01	New Release	March 30, 1999

Details :

Here are the modifications in PCL5e Printer Driver v4.41 for Windows9x/NT4.0/2000.

No.	Item	Descriptions
1	iR3250 Support (UK English)	iR3250 is added as a new support device (for UK English only).
2	WHQL (Windows Hardware Quality Lab) Certification Acquisition (except GP30-55 MDC)	In this version, the WHQL certification has been acquired from Microsoft. Therefore, in installing the driver of this version with “Add Printer”, no warning message is displayed.
3	Job Accounting (iR3250 only)	<p>The Department Management is a function to count and manage Print Sheet Number, etc. for each Department ID. In printing with the Department Management valid, the Printer Driver requests [Department ID] and [Password]. When the ID and Password are met there, the printing can be done.</p> 
4	Dynamic Configuration	<p>The Device Information acquisition and Device search with the Virtual Device Component is supported. The protocols are TCP/IP and IPX/SPX. However, it is not supported for GP200-215/GP30-55 Multi PDL Printer Board A1/B1/P3. For the Device Information acquisition, DLL of Novell is required. (See Readme.)</p>

5	Job Combine/Editing Support with PageComposer v3.00 (Windows9x only)	<p>(1) Job Operations Combining, Changing, Deleting, Duplicating, etc. can be performed among Print jobs by selecting [Editing + Preview] in printing from an application.</p> <p>(2) Print Setup Modifications After Print is performed from an application, the Print job setup (such as Number of Copies, 2-Sided/1-Sided Specification) can be modified.</p> <p>(3) Link to Preview Display With the Preview Function Support, Jobs can be confirmed before printing.</p> 
6	CPCA Support (iR3250)	CPCA Revision 2.4 is supported at iR3250.
7	Support for Printing with Oficio Paper at the printer board for GP200-225/iR210, "Network Multi PDL Printer Board-D1/E1 v2.0"	Printing with Oficio Paper (Paper Size used in South America) is supported at the printer board for GP200-225/iR210, "Network Multi PDL Printer Board-D1/E1 v2.0" However, patch files are required for the Printer Board.
8	Corrections for the following Field Claim: In opening Document Default at PC with Video Card of ATI 3D RAGE PRO attached, Blue Screen occurs. (Windows NT4.0)	The following nonconformance reported from CSPL/Canon Europe is corrected. At PCL Driver v4.10 for Windows NT4.0, in opening Document Default at PC with Video Card of ATI 3D Rage Pro (v5.2.040, 4.0.0) attached, Blue Screen occurs in Windows NT.

Restrictions :

Here are the restrictions in the PCL5e Printer Driver v4.41 for Windows9x/NT4.0/2000.

No.	Item	Descriptions
1	Restrictions on Combining Jobs with Page Composer	(1) Data with different Resolution or Graphics Mode cannot be combined. (2) For [Spooling at Host = Disabled] in Configuration Tab, Jobs cannot be combined. (3) After Combining Jobs, Overlay printing cannot be set. (4) Since Driver Set values are saved at every sheet in MS Excel, the followings need to be performed. <ul style="list-style-type: none"> - Right-click at Sheet Tab with Mouse, - Set "Select all Sheet", then - Set "Editing + Preview".

Supported Devices :

This version supports the following devices.

iR3250 (UK)	
GP300-405 PCL (UK)	/ iR330-400 PCL (US)
GP555-605-605P PCL (UK)	/ iR600-550-60 PCL (US)
GP200-225 PCL (UK/US)	/ iR210 PCL (US)
GP200-215 PCL-P3/B1 (US/UK)	
GP30-55 PCL (UK/US)	
LBP-1000 PCL5e (UK)	
LBP-1760/1760e PCL5e (UK)	/ LBP-1760 PCL (US)

Combination of ROMs :

iR3250	Ver.4.02 or later
Network Multi PDL Printer Board-D1/E1 (GP200-225/iR210)	Ver.2.0
NetWork Printer Board-F1 (GP605-555-605P/iR60-600)	Ver.2.0
Network Multi PDL Printer Board-H1/K1 (GP300-405/iR330-400)	Ver.2.0
Multi PDL Board-B1 (GP200-215)	Ver.4.01 or later (v6.03 is recommended)
Printer Board-P3 (GP200-215)	Ver.4.01 or later (v6.03 is recommended)
Multi PDL Board-A1 (GP55-30)	Ver.15.11
Printer Board-P2 (GP55-30)	Ver.15.12