
KPA500 KIT ASSEMBLY MANUAL ERRATA

Rev. F6-4, January 9, 2017 E740149E

MAKE THESE CHANGES TO YOUR REV F6 MANUAL OR ANNOTATE THE TEXT TO REFER TO THIS ERRATA AT THE PLACES INDICATED

1. Page 25, replace the last check box step and Figure 34 with the following:

Connect the 270V wire from the power supply module to the PA/LPF module as shown in Figure 34. **Support** the pc board so it does not flex while mating the connector. This is the connector you routed through the hole in the Z-bracket earlier.

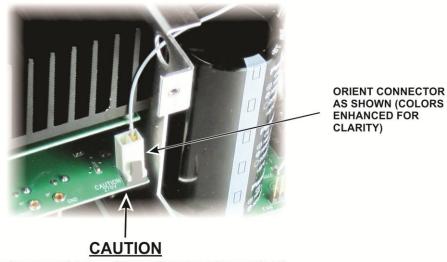

SUPPORT THE BOARD FROM BELOW WITH YOUR FINGERS WHILE ATTACHING THE CONNECTOR SO THE BOARD CANNOT FLEX. ALLOWING THE BOARD TO FLEX MAY BREAK COMPONENTS ON THE BOARD.

Figure 34. Connecting the 270V Wire to the PA/LPF Module.

Errata Continued on Next Page

2. Page 32, replace the last checkbox step and Figure 47 with the following:

Place three rubber disks on the bolt and move them down against the bottom cover. The nut and washers will be under the disk as shown in Figure 47.

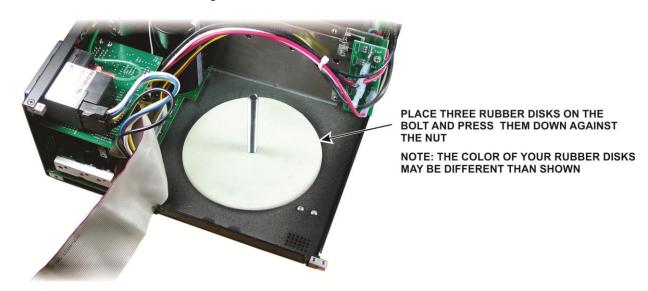


Figure 47. Installing the Bottom Rubber Disks.

- 3. Page 42, Figure 62: Change the length of the screw shown from 3/8" (9.5 mm) to 7/16" (11 mm).
- **4.** Page A-3 (Parts List), *KPA500 Carry Handle Bag E850453:* Change the length of the 8-32 screw to 7/16" (11 mm) and change the part number for the screw to E700356.
- **5. Page A-4 (Parts List):** Change the serial number label part number from E850187 to E850450.
- **6.** Page A-10 (Parts List), *KPA500 Transformer Assembly E850466*: In the description change the number of rubber disks supplied from 2 to 4.