

SSU05352-1

93-01-06
4822 872 09429

Related to: ScopeMeter™
Fluke 93, 95,97
Philips PM93-PM95-PM97
Service Manual 4822 872 05352


Already published: none

CLASS 3

Subject: Corrections/additions Service Manual

The following corrections must be made in Section 7 of ScopeMeter™ Service Manual 4822 872 05352:

page 7-13 21 /ACH7 The SCOPE signal must be:

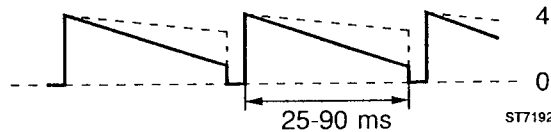


page 7-32 3 INPB The signal amplitude indicated in the SCOPE signal must be approximately **80 mV** peak to peak.

page 7-33 9 STOP Remove the text " at $\leq 20 \mu\text{s}/\text{div}$. At $\geq 20 \mu\text{s}/\text{div}$: +5V "

15 TOUT Remove the text " at $\leq 20 \mu\text{s}/\text{div}$. At $\geq 20 \mu\text{s}/\text{div}$: +5V "

The SCOPE signal must be:

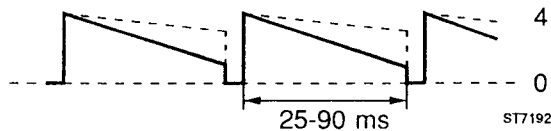

page 7-33 26 INPa The signal amplitude indicated in the SCOPE signal must be approximately **80 mV** peak to peak.

Printed in The Netherlands

