

METRAHa® 28S and 29S CAT IV Precision Digital Multimeter, Power Meter

3-348-866-03 6/3.01

METRAHit®28S and 29S

- 300,000 digits and triple display
- Precision multimeter (V, dB, A, Ω, F, Hz, F, °C/°F)
- Current measurement with (clip-on) current transformer: DIN EN ISO 9001 Reg. No.1262 a transformation ratio of 1000:1 or 10000:1 is utilized for display purposes
- Integrated quartz movement for recording of MIN/MAX values relative to real-time
- AUTO SELECT automatic measured quantity recognition (V, Ω and F)

METRA*Hit*®29S

- Power and energy measurements (W, VAr, VA, Wh, PF) with analog signals or energy measurement with pulses, current measurement value, mean values and peak power values are displayed
- · Power disturbances recording
- Large, 128 kB measurement value memory









Applications

METRA*Hit*[®]28S and 29S multimeters are high performance precision instruments for the lab, service and training. With a display range of 300,000 digits as well high level accuracy and long-term stability, they fulfill all calibration and R&D laboratory demands. Battery operation allows for on-site precision servicing and calibration.

Features

Convenient Triple Display

The current measurement value, as well as two other values, are updated and displayed, e.g. minimum and maximum value. The usual switching back and forth between display values is no longer necessary. Display resolution for the main display value can be varied from 4% places for AC to 5% places for DC (METRA $Hit^{®}$ 29S: from 2% to 5% places). The measurement rate, adjustable from 1 ms to 0.5 s, allows for high-speed recorder, precision data logger and mean value recorder functions with the help of METRA $Win^{®}$ 10/METRA $Win^{®}$ 10 (optional PC software).

High Resolution and Precision

5% places, or 309,999 digits, allow for cost effective calibration of tested devices and components, as well as precise reference measurements.

Effective Value for Distorted Waveforms

The implemented measurement process provides for effective value measurement (TRMS) independent of the waveform up to 100 kHz.

Additional Functions

Continuity testing with acoustic signal, event counting (number of events and event durations), counts zero crossings, stopwatch, data comparison and wide-range capacitance measurement. The integrated temperature measurement function allows for the connection of thermocouples and platinum resistance thermometers.

Overload Protection

The instrument is protected from overload in the voltage range. Acoustic signalling occurs if measuring range limits are exceeded. The FUSE display indicates a defective fuse in the current range.

Calibration

METRA*Hit*[®]28S and 29S multimeters are shipped with a DKD calibration certificate. They can be automatically calibrated with the CS92E calibration system via the RS232 data interface.

Infrared Measurement Data Transmission

These devices include a serial, duplex data interface for remote control and measurement value transmission via infrared light.

METRAHは®28S and 29S CAT IV Precision Digital Multimeter, Power Meter

Automatic Blocking System (ABS) *

Automatic blocking of connector sockets prevents incorrect connection of measurement cables, and selection of incorrect measuring quantities. Thus hazards for the operator, the instrument and the system are substantially reduced, and in many cases entirely eliminated.

Automatic Measurement Value Storage *

The DATA HOLD function allows for storage of the digitally displayed measurement value. A patented process assures that the actual measurement value, and not random values, are stored when rapid measurement magnitude changes occur. The stored measurement value appears at the digital display.

* Protected by patent

Sampling Rate

The sampling rate determines the time interval after which the respective measurement value is transmitted to the interface, or saved to measurement value memory.

Depending upon the measured quantity, sampling rates can be set in steps of 1, 2 or 5 from 0.05 s to 10 min.

Additional Functions, METRAHit®29S

Power Measurement

The METRA*Hit*®29S is a compact high performance measurement instrument for direct and alternating current for single and three-phase current measurements. The current path can be connected directly, or with a clip-on current transformer. If a current transformer is connected to the multimeter (mA or A input), all current and power displays appear with the correct value in accordance with the selected transformation ratio. The utilized current transformer must have a transformation ratio of 1000:1 or 10.000:1.

Universal power measuring functions include the measurement of active, reactive, and apparent power, as well as power factor and energy .

Furthermore, mean and peak values (e.g. a 15 minute max. value) can be measured during a predefined period of time. Type WZ12D, Z3511, Z3512 and Z3514 current clips are suitable for use with the instrument.

Power Disturbance Recording

The instrument is capable of continuously recording line voltage and power disturbances. The following power disturbances can be acquired: violation of predetermined limit values, power failure and positive or negative pulses. Each of these events is stored to memory and can be queried at a later point in time. The type of event, the time of its occurrence and its duration (except for pulses) are displayed.

If memory mode is deactivated, approximately 250 events can be stored to volatile memory and read out at the display.

These data remain in storage until the instrument is switched to a different operating mode.

If memory mode is activated, the events are recorded at the instrument as a non-compressed data file which is uploaded to a PC at a later point in time.

Memory Mode

The instrument is equipped with a 128 kB measurement value memory which is synchronized with a quartz movement, and which has room for 13,000 to 60,000 measurement values depending upon configuration. Data can be stored to intermediate memory or uploaded directly to a PC. The system records data relative to real-time which allows for use as a real time data logger.

Depending upon the measured quantity, sampling rates can be adjusted in steps of 1, 2 or 5 within a range of 0.5 ms to 10 min. Selected measurement values can also be stored to memory by pressing a key.

The contents of the memory can be read out with the help of a PC which has been connected to the multimeter via the METRA \it{Hit}^{\otimes} BD232 IR adapter, and with METRA \it{win}^{\otimes} 10/METRA \it{Hit}^{\otimes} analysis software.

Applicable Regulations and Standards

IEC 61010-1 DIN EN 61010 Part 1 VDE 0411-1	Safety regulations for electrical measurement, control, regulating and laboratory devices
DIN 43751	Digital measuring instruments
IEC/EN 61326-1 + /A1	EMC Requirements Electrical instruments for control technology and laboratory use
VDI/VDE 3540	Reliability of measurement, control and regulating devices
DIN EN 60529 DIN VDE 0470 Part 1	Test instruments and procedures – level of protection provided by enclosures (IP code)

Standard Equipment

- 1 Multimeter
- 1 Protective case for operation under adverse conditions. A cover made of pliable rubber including support bar protects the device from damage due to impacts and falls. The rubber material assures a secure stance for the instrument even on vibrating surfaces.
- 1 KS17 cable set
- 2 Batteries
- 1 Operating Instructions
- 1 DKD calibration certificate

Guarantee

3 years material and workmanship

1 ... 3 years (depending on application) for calibration

METRAHa 28S and 29S CAT IV **Precision Digital Multimeter, Power Meter**

METRAHit®28S and 29S Characteristic Values

Meas.	Measuring Range	Mea		ution at nge Upper Limit	Input In	Input Impedance		at highest resolution nce conditions ±(% of rdg + D)	Overload Capacity		Meas.
Function	weasuring Kange		30000 1)	•		_	of range + D)	≂ ⁵⁾	Value	Duration	Function
	300 mV	1 μV	10 μV	3000 /	> 20 MΩ		0.02 + 0.005 + 5 10)	0.5 + 30	value	Duration	
	3 V	10 μV	100 μV		11 MΩ	5 MΩ // < 50 pF	0.02 + 0.005 + 5	0.2 + 30	1050 V		
l v	30 V	100 μV	1 mV		10 MΩ	5 MΩ // < 50 pF	0.02 + 0.005 + 5	0.2 + 30	DC		v
'	300 V	1 mV	10 mV		10 MΩ	5 MΩ // < 50 pF	0.02 + 0.005 + 5	0.2 + 30	AC	cont.	
	1000 V	10 mV	100 mV		10 MΩ	5 MΩ // < 50 pF	0.02 + 0.005 + 5	0.2 + 30	eff sine		
dB		see table fo		e		same as V ₹	_	± 0.1 dB ¹¹⁾			dB
			lowing pag		Volt. Drop. approx. f	or upper range limit B		2 0.11 0.5			
					—	≂ ≂	_	≂5)			
	300 μΑ	1 nA	10 nA		160 mV	160 mV	0.05 + 0.02 + 5	0.5 + 30			
	3 mA	10 nA	100 nA		160 mV	160 mV	0.05 + 0.01 + 5	0.5 + 30	-		
	20 mA	400					0.02 + 0.01 + 5	0.5.00	0.36 A	cont.	
A	30 mA	100 nA	1 μΑ		170 mV	170 mV	0.05 + 0.01 + 5	0.5 + 30			Α
	300 mA	1 μΑ	10 μΑ		300 mV	300 mV	0.1 + 0.01 + 5	0.5 + 30	-		
	3 A		100 μA		110 mV	110 mV	0.2 + 0.05 + 5	0.5 + 30	10.16)		
	10 A		1 mA		350 mV	350 mV	0.2 + 0.05 + 5	0.5 + 30	10 A ⁶⁾	cont.	
					Open-circuit voltage	Measuring current at upper ranger limit		% of range + D)			
	300 Ω	1 mΩ			0.6 V	max. 250 μA		0.01 + 5 /)			
	3 kΩ	10 mΩ		Ī	0.6 V	max. 45 μA	0.05 +	0.01 + 5 ⁷⁾	-		
Ω	30 kΩ	$100\mathrm{m}\Omega$			0.6 V	max. 4.5 μA		0.01 + 5 0.02 + 5			Ω
32	300 kΩ	1 Ω			0.6 V	max. 1.5 μA	0.05 +	0.02 + 5	DC DC	22	
	3 MΩ	10 Ω			0.6 V	max. 150 nA	0.1 + 0		AC	10 min	
	30 MΩ	100 Ω			0.6 V	max. 15 nA	1 + 0.2	+ 5	eff		
Ω \square	300 Ω			0.1 Ω	max. 3 V	max. 1 mA	1 + 0 +	3	sine		Ω 🖈
→ □)	300 mV			100 μV	max. 3 V	max. 1 mA	0.2 + 0	+ 3			→ □)
→	3 V		100 μV		max. 3 V	max. 1 mA	0.2 + 0	+ 3	-		→
					Discharge resistor	U _{0 max}	±(% of rdg	+ % of range)			
	3 nF			1 pF	10 MΩ	3 V	1.0 + 0				
	30 nF			10 pF	10 MΩ	3 V	1.0 + 0	.2 7)			
	300 nF			100 pF	1 ΜΩ	3 V	1.0 + 0	.2	500 V		
F	3 μF			1 nF	100 kΩ	3 V	1.0 + 0	.2	DC AC	10 min	F
'	30 μF			10 nF	11 kΩ	3 V	1.0 +0.	2	eff	10 111111	r
	300 μF			100 nF	2 kΩ	3 V	5.0 + 1		sine		
	3000 μF			1 μF	2 kΩ	3 V	5.0 + 1				
	30000 μF			1 μF	2 kΩ	3 V	5.0 + 1				
					f _m	3) in		dg. + D)			
	300.000 Hz	0.001 Hz			1 Hz		0.05 +		1000 V		
Hz	3.00000 kHz	0.01 Hz			1 Hz		0.05 +	1 ^{o)}	1000 V	cont.	Hz
	300.000 kHz	1 Hz			1 Hz		0.05 +	1 ⁸⁾	300 V 30 V		
<u> </u>	100 min ²⁾		10 ms				±15 D		DC1000V		(7)
\vdash	100 /////		10 1113						AC 750V		\cup
								dg. + D)			
	- 200.0 Pt 100/ + 100.0 °C						0.5 K +	3 9)	500 V DC		
	Pt 1000 + 100.0 c		0.1 °C					. 0)	eff		
	+ 850.0 °C						0.2% +	3 4)	sine	10!	00/05
°C/°F	K – 270.0 NiCr-Ni + 1372.0 °C		0.1 °C				0.7 + 3	9. 10)	1050 V DC	- 10 min	°C/°F
	J – 210.0 Fe-CuNi + 1200.0 °C		0.1 °C				0.8 + 3	9. 10)	eff sine		

¹⁾ Display: 5¾ places for DC, 4¾ places for AC, other resolution and sampling rates can be selected for storage and transmission in the rAtE menu.

3) Lowest measurable frequency

6) 12 A – 5 min, 16 A – 30 s

Key: D = Digit

²⁾ Stopwatch; format: mm:ss:hh,

where m=minute, s=second and h=hundredth second, max.: 99:59:59

with sinusoidal measurement signal symmetric to zero point

⁴⁾ at 0 ° ... + 40 ° C 5) Values < 100 digits are suppressed, 16 ... <u>45 ... 65 Hz</u> ... 100 kHz sine. See page 4 for influences.

 $[\]stackrel{7)}{\ldots}$ ZERO is displayed when the "Zero Balancing" function is active.

⁷⁾ ZERO is displayed when the "Zero Balancing" function is at 8) Range 300mV ₹ : U_E = 50mV_{eff/rms} . . . 300mV_{eff/rms} 30 V ₹ : U_E = 0.3 V_{eff/rms} . . . 30 V_{eff/rms} 30 V ₹ : U_E = 3 V_{eff/rms} . . . 30 V_{eff/rms} 1000 V ₹ : U_E = 30 V_{eff/rms} . . . 1000 V_{eff/rms} for voltages > 100 V : power limiting at 3 · 10⁶ V · Hz

⁹⁾ Plus sensor deviation

Without integrated reference junction: inherent deviation ±2 K

 $^{^{11)}}$ For U > 10% of the measuring range

METRAHar 28S and 29S CAT IV **Precision Digital Multimeter, Power Meter**

dB Ranges

Measuring Ranges	Display Range at Reference Voltage U _{REF} = 0,775 V	Resolution
300mV ~ 3 V ~ 30 V ~ 300 V ~ 1000 V ~	- 48 dB 8 dB - 38 dB + 12dB - 18 dB + 32 dB + 2 dB + 52 dB + 22 dB + 63 dB	0.01 dB 0.01 dB 0.01 dB 0.01 dB 0.01 dB 0.01 dB
	Display (dB) = 20 lg U _x (V) /U _{REF}	

System Monitoring with METRA*Hit*®29S

Interference Type	Meas. Range	Resolution	Inherent Deviation at Highest Resolution under Reference Conditions	Pulse Duration
Dropout*	300 V	4 V	5% of rdg + 5% v. B	Sampling rate:
Dropout	1000 V	40 V	10% of rdg + 10% v. B	2 ms
Pulse	200 1000 V	10 V	50 V	0.5 5 μ s

^{*} Settings adjusted with trigger parameters

Real-Time Clock

±1 min/month Accuracy Temperature Effect 50 ppm/K

AUTO SELECT

Automatic Measurement Magnitude Recognition

Meas. Quantity	Measuring Range for Recognition	Condition	Recogni- tion Time
Voltage V	V _{eff} > 0.81 V 500 V	_	1 s
Voltage V \sim	V _{eff} > 1 V 500 V	frequency > 20 Hz	1 s
Resistance	0 Ω 15 ΜΩ	_	1 s
Capacitance	> 1.5 nF 300 μF	Electrolytic capacitor must be correctly connected	1 s
Diode	voltage in forward direction max. 1 V	Diode must be correctly connected: anode to →	1 s

Influence Variables and Errors

Influence Variable	Sphere of Influence	Meas. Quantity / Meas. Range 1)	Influence Error ppm/K
	V 	30	
		V ~	50
		300 μA 30 mA +	180
		300 mA + ==	290
	0 °C +21 °C	3 A / 10 A = + ≂	200
Temperature	and	300 Ω 300 kΩ	100
	+25 °C +40 °C	3 MΩ	200
		30 MΩ	1000
		3 nF 30 μF	500
		Hz	50
		°C	100

Influence Variable	Frequency	Meas. Quantity / Meas. Range 1)	Influence Error $^{2)}$ \pm % of rdg.
	> 15 Hz 45 Hz		2 + 10 D
	> 65 Hz 1 kHz		0.5
	> 1 kHz 10 kHz	300.000 mV	1
	> 10 kHz 50 kHz		2
	> 50 kHz 100 kHz		10
Frequency	> 15 Hz 45 Hz		2 + 10 D
V _{AC}	> 65 Hz 1 kHz	3.00000 V 30.0000 V	0.5
	> 1 kHz 20 kHz	300.000 V	1.5
	> 20 kHz 100 kHz		2
	> 15 Hz 45 Hz		2 + 10 D
	> 65 Hz 1 kHz	1000.00 V	1
	> 1 kHz 10 kHz		10

Influence Variable	Frequency	Meas. Quantity / Meas. Range 1)	Influence Error ±(% of rdg. + D)
F	> 15 Hz 45 Hz	300.00 μA	2 + 10
Frequency I _{AC}	> 65 Hz 5 kHz	65 Hz 5 kHz 10,000 A	0.75 + 5
'AC	> 5 kHz 10 kHz		5 + 5

Power Measurements with METRAHit®29S

Meas. Function		suring ange	Selector Switch Posi- tion		Resolution at Meas. Range Upper Limit		Overload Capacity at 0 + 40 °C	
			mA	Α	10	000	Value	Duration
	1	mW	•		0.1	μW		
	10	mW	•		1	μW	V: 1050 V mA: 0.36 A A: 10 A DC AC eff	
	100	mW	•		10	μW		V / mA:
W, VAr, VA	1	W	•		0.1	mW		continuously
W, VAI, VA	10	W	•	•	1	mW		10 A: cont. 12 A: 5 min
	100	W	•	•	10	mW		16 A: 30 s
	1	kW	•	•	0.1	W	sine	
	10	kW		•	1	W		

Inherent Deviation and Frequency Influence for Power and Energy Measurements with METRAHit®29S

Meas. Quantity	Meas. Range	Inherent Deviation (% of rdg + D)			
ivieas. Qualitity	ivieas. Karige	15 Hz 45 Hz	45 Hz 65 Hz	65 Hz 1 kHz	
Active power	300 mA 10 A	1.3+20	1+20	3+20	
Reactive power		2.5+20	1.5+20	3+20	
Apparent power		1.2+20	1+20	1.2+20	
Power factor	±(0.02 1)	2+2	1+2	2+2	
1/4 hr. power		1.2+20	1+20	1.3+20	
Energy		1.2+2	1+2	1.3+2	
Voltage		0.4+30	0.3+30	0.4+30	
Current		0.7+30	0.6+30	0.9+30	

 $[\]stackrel{1)}{\text{2}}$ With zero balancing $\stackrel{2)}{\text{2}}$ Indicated error applies as of display of 10% of measurement value

METRAHa *28S and 29S CAT IV Precision Digital Multimeter, Power Meter

Influence Variable	Sphere of Influence	Meas. Quantity / Meas. Range 1)	Influence Error ²⁾
	Crest 1 3	V ∼. A ∼	± 1 % of rdg.
	factor CF > 3 5	V ∼, A ∼	± 3 % of rdg.
Measuring Quantity Waveform		e crest factor, CF, for the alt red is dependent upon the of Voltage and C	

Influence Variable	Sphere of Influence	Meas. Quantity / Meas. Range ¹⁾	Influence Error
Relative Humidity	75 % 3 days instrument OFF	V, A, Ω F, Hz °C	1 x inherent deviation

Influence Variable	Sphere of Influence	Meas. Range	Damping ±dB
	Interference magnitude max. 1000 V ~	V 	> 90 dB
Common Mode Interference Voltage	Interference magnitude max. 1000 V ~ 50 Hz, 60 Hz sine	300 mV 30 V \sim	> 80 dB
		300 V ∼	> 70 dB
		1000 V ∼	> 60 dB
Series Mode Interference	Interference magnitude V \sim , per nominal measuring range value, max. 1000 V \sim , 50 Hz, 60 Hz sine	V 	> 60 dB
Voltage	Interference magnitude max. 1000 V —	V ~	> 60 dB

¹⁾ With zero balancing

Reference Conditions

Ambient Temperature $+23 \text{ °C} \pm 2 \text{ K}$ Relative Humidity $+23 \text{ °C} \pm 2 \text{ K}$

Meas. Quantity

Frequency 45 ... 65 Hz

Meas. Quantity

Waveform sine Battery Voltage $3 \text{ V} \pm 0.1 \text{ V}$ Adapter Voltage $4.5 \text{ V} \pm 0.2 \text{ V}$

Response Time

Response Time (after manual range selection)

Meas. Quantity/ Measuring Range	Digital Display Response Time	Meas. Quantity Step Function	
V , V ∼, A , A ∼	1.5 s	from 0 to 80 % of measuring range upper limit	
300 Ω 3 MΩ	2 s	from ∞ to 50 % of measuring range upper limit	
30 MΩ	5 s		
Continuity	< 50 ms		
→	1.5 s		
3 nF 300 μF	max. 2 s	from 0 to 50 % of measuring range upper limit	
3 000 μF	max. 7 s		
30 000 μF	max. 14 s		
>10 Hz	max. 1.5 s		
°C	max. 3 s		

Power Supply

Battery 2 ea. 1.5 V mignon cell (2 x AA size)

alkali manganese cell per IEC LR6 zinc carbon battery per IEC R6

Service Life with alkali manganese cell:

approx. 100 hr.

with zinc carbon battery:

approx. 50 hr.

Battery Test automatic display of " + " symbol

when battery voltage drops below

approx. 2.3 V

Economy Circuit

The instrument is switched off automatically, if the measurement value remains unchanged for about 10 minutes, and if no activation of the operating elements occurs during this time. This function can be deactivated. This does not apply to the following functions: events counting, counting of zero crossings, stopwatch, power measurement, power disturbance recording, transmission and menu modes, and "continuous on".

Ambient Conditions

Operating Temperature -20 °C ... +50 °C

Storage Temperature $-25~^{\circ}\text{C}$... $+70~^{\circ}\text{C}$ (without batteries) Relative Humidity max. 75%, without condensation

Elevation to 2000 m

Mechanical Design

Dimensions

Weight

Protection Casing: IP 50,

Connector jacks: IP 20 84 mm x 195 mm x 35 mm METRA*Hit*®28S: approx. 350 gr.

with batteries

METRAHit®29S: approx. 405 gr.

with batteries

²⁾ Except for sinusoidal waveshape

METRAHar 28S and 29S CAT IV **Precision Digital Multimeter, Power Meter**

Display

LCD display field (65 mm x 30 mm) with display of max. 3 measurement values, unit of measure, current type and various special functions.

7 segment characters Display/Character Height


main display: 12 mm auxiliary displays: 7 mm

Number of Places Overflow Display Polarity Display

"OL" appears in display "-" sign is displayed when plus pole is connected to "⊥" jack

Defective Fuse

"FUSE" appears in display

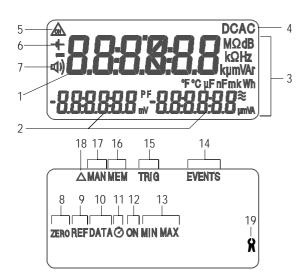

Digital Display Symbols

- 1 Main display with decimal point and polarity display
- Auxiliary displays with decimal point and polarity display
- 3 Unit of measure
- 4 Selected current type
- 5 Continuous operation, symbol blinks for data transmission
- 6 Low battery
- 7 Acoustic signal on, buzzer sounds for corresponding function
- 8 Zero balancing
- 9 Reference value
- 10 Display memory, "save measurement value"
- 11 Stopwatch on, or elapsed time since start of measurement
- Together with symbol 11: Elapsed time since activation of corresponding function, counter, number of events if trigger threshold is exceeded
- 13 MIN/MAX storage
- 14 Event duration
- 15 Synchronized storage, METRAHit®29S only
- 16 Memory mode, METRAHit®29S only
- 17 Manual measuring range selection
- 18 Relative value
- Measurement with (clip-on) current transformer is active: Transformation ratio of 1000:1 or 10000:1 is taken into consideration.

Display Refresh

V (DC, AC+DC), A, Ω , →, EVENTS AC+DC,

Count 2 per second V AC, EVENTS AC 1 per second W, VA, VAr, Wh 1 v second Hz, °C (Pt100/1000) 1 to 2 per second °C (J ,K) 0,5 per second

Fusing

Fuse for ranges up to 300 mA

FF (UR) 1.6 A / 1000 V AC/DC;

6.3 mm x 32 mm; 10 kA switching capacity

at 1000 V AC/DC with resistive load; protects all current measuring ranges up to 300 mA in combination

with power diodes

up to 10 A FF (UR) 16 A / 1000 V AC/DC: 10 mm

x 38 mm; 30 kA switching capacity at 1000 V AC/DC with resistive load: protects 3 A and 10 A ranges

Electrical Safety

Protection Class II per IEC 61010-1/EN 61010-1/

VDE 0411-1

Overvoltage

Ш IV Category Operating Voltage 600 V 1000 V Contamination Level 2 2

7.4 kV~ per IEC 61010-1/EN 61010-Test Voltage

1/VDE 0411-1

Electromagnetic Compatibility, EMC

Interference Emission EN 61326-1: 1997 class B EN 61326: 1997 / A1: 1998 Interference Immunity

IEC 61000-4-2: 1995

IEC 61000-4-2: 1995 / A1: 1998

8 kV atmospheric discharge 4 kV contact discharge

IEC 61000-4-3: 1995 + A1: 1998

3 V/m

IEC 61000-4-4: 1995

0.5 kV

Data Interface

Data Transmission Optical transmission through housing

with infrared light

With accessory interface adapter

RS232C, serial, per DIN 19241 Type METRA*Hit*[®]SI232-II: all baud rates **Baud Rate** METRA*Hit*®BD232: 9600 bauds

METRA Har 28S and 29S CAT IV Precision Digital Multimeter, Power Meter

Accessories

Ever-Ready Case F836

for multimeters (without protective rubber cover) and accessories



METRAHit®BD232 Interface Adapter

Parameters can be configured for METRAHit®28S and 29S multimeters, and measurement data can be uploaded to a PC with the METRAHit®BD232 bidirectional adapter. The adapter is not itself equipped with a memory, but it can be used to read out data from the memory at the METRAHit®29S. It supports all measuring functions and data formats available with the METRAHit®20 series, and is included in the user-friendly BD Pack 1.

METRAHit®SI232-II Memory Adapter (for METRAHit®28S)

The METRAHit®SI232-II memory adapter can be attached to the METRAHit®28S hand-held multimeter and allows for on-site storage of measurement data without the use of a PC, and uploading to a PC at a later point in time. Data are synchronized with an integrated clock. The data format is limited to a maximum of 30,000 digits for storage to memory.

Memory: 128 kB (Equivalent to approx. 100,000 measurement values. Can be increased by a factor of 10 to 20 if data compression is used.)

Adjustable Sampling Rate: 50 ms ... 1 min

METRAwin®10/METRAHit® Software


METRAwin®10/METRAHit® software (runs under WINDOWS 3.11 or higher) provides for the processing and representation of measurement data at the PC. Sampling in the on-line mode can be accomplished manually with the adjustable sampling interval, or signal dependent (with adjustable signal hysteresis). Storage in ASCII format is controlled with two trigger thresholds per channel, as well as via system time.

Data Logger (1)

Acquired measurement data from up to 10 channels are displayed at the monitor in an easy to read table in numeric format.

Multimeter (2)

Transmitted measurement data from up to 4 freely selectable channels appear at the monitor in digital format with an additional

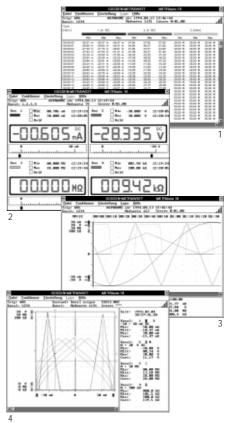

analog scale display in online operation, or as an analog pointer instrument with optional digital display.

Y(t) Recorder (3)

Recorded measurement values from up to 4 freely selectable channels are displayed as a line diagram at the monitor with a horizontal time axis, and are measured off with two cursors. Stored signals can be zoomed in or out along the amplitude and time axes. The time scale can be displayed in absolute clock time or relative measuring time.

XY Recorder (4)

Recorded data from 2 to 4 freely selectable channels are displayed at the monitor as an XY graph and are measured off with the cursor. As is also the case with all other display formats, all of the scales are freely adjustable.

High performance arithmetic functions allow for both off-line and online analysis, linking and graphic representation of measurement data.

Sampling (on-line)

On-line sampling is accomplished manually (mouse click), automatically with an adjustable interval (50 ms ... 60 min) or signal-dependent with adjustable signal hysteresis (0 ... 500 digits). Data can be controlled with timing or trigger windows, and automatically stored as multiple data files.

Measurement Data Processing

Measurement data can be processed by means of computing and linearization functions. For example, mA signals from sensors or transducers can be directly represented as pressure values, as active power, or in many other units of measure.

METRAHa 28S and 29S CAT IV **Precision Digital Multimeter, Power Meter**

Order Information

Designation	Туре	ID Number		
Precision digital multimeter including KS17 cable set, battery, GH18 and DKD calibration certificate	METRA <i>Hit</i> ®28S ^{D)}	M228A		
Precision digital multimeter and power meter incl. KS17 cable set, battery, GH18 and DKD calibration certificate	METRA <i>Hit</i> ®29S ^{D)}	M229A		
Accessories				
Power pack 230 V~/4,5 V, 600 mA	NA4/500	Z218A		
Cable set for multimeter	KS17	GTY 3620 034 P0002		
Safety cable set for power meters	KS29	Z229A		
Single channel memory pack including: METRA <i>Hit</i> ®BD232 bidirectional interface adapter, cable, METRAwin®10/METRA <i>Hit</i> ® software and installation instructions	BD-Pack 1 ²⁾	Z215A		
Single channel memory pack including: METRA <i>Hit</i> ®Sl232-II memory adapter, cable, <i>METRAwin</i> ®10/METRA <i>Hit</i> ® software and installation instructions	1-CH. Pack ¹⁾	GTZ 3231 020 R0001		
Four channel memory pack including: 4 METRA <i>Hit</i> [®] S1232-II memory adapters, cable, <i>METRAwin</i> [®] 10/METRA <i>Hit</i> [®] software and installation instructions	4-CH. Pack ¹⁾	GTZ 3234 020 R0001		
Memory adapter for METRA <i>Hit</i> ®28S	SI232-II ^{D)}	GTZ 3242 020 R0001		
Bidirectional interface adapter for METRA <i>Hit</i> ®29S	BD232 ²⁾	GTZ 3242 100 R0001		
Single channel pack including cable, METRAwin®10/METRA <i>Hit</i> ® software and installation instructions	Z3231	GTZ 3231 000 R0001		
RS232 interface cable, 2 m, (included with Z3231)	Z3241	GTZ 3241 000 R0001		
METRAwin [®] 10/METRA <i>Hit</i> [®] software update and installation instructions	Z3240	GTZ 3240 000 R0001		
Electric set including: F829 carrying case, WZ11 clip-on current transformer (15 180 A~, 1 mA/1 A~) and measuring cables	Electric-Set	GTZ 3236 000 R0001		
Clip-on current transformer 30 mA 150 A, 1000:1 Frequency range 50 500 Hz Clip jaw opening: cable diameter max. 15 mm	WZ12D ^{D)}	Z219D		
Clip-on current transformer, 4 500 A~, 1 mA~/A~ with cable and protective circuit Clip jaw opening: cable diam. max. 30 mm		GTZ 3511 000 R0001		
Clip-on current transformer, 0,5 1000 A~, 1 mA~/A~ with cable and protective circuit Clip jaw opening: cable diam. max. 54 mm	Z3512	GTZ 3512 000 R0001		
Clip-on current transformer, 1 2000 A~, 1 mA~/A~ with cable and protective circuit Clip jaw opening: cable diam. max. 64 mm	Z3514	GTZ 3514 000 R0001		

Designation	Туре	ID Number
Clip-on current/voltage transformer, active, with battery (service life 30 hr.) Measuring ranges AC 20 A Measuring ranges DC 30 A Frequency range DC 20 kHz Output 10 mV/A Clip jaw opening: cable diameter max. 19 mm	Z201A ¹⁾	Z201A
Clip-on current/voltage transformer, active, with battery (service life 50 hr.) Measuring ranges AC 20 A/200 A Measuring ranges DC 30 A/300 A Frequency range DC 10 kHz Output 10 mV/A or 1 mV/A Clip jaw opening: cable diameter max. 19 mm	Z202A ¹⁾	Z202A
Clip-on current/voltage transformer, active, with battery (service life 50 hr.) Measuring ranges AC 200 A/1000 A Measuring ranges DC 300 A/1000 A Frequency range DC 10 kHz Output 1 mV/A Clip jaw opening: cable diameter max. 32 mm	Z203A ¹⁾	Z203A
Amp <i>FLEX</i> current transformer ^{D)} 30/300 A; 3 V 300/3000 A; 3 V 1000 A; 1 V 1/10 kA; 1 V	AF033A ¹⁾ AF33A ¹⁾ AF11A ¹⁾ AF101A ¹⁾	Z207A Z207B Z207D Z207C
Energy measurement adapter for Ferraris meters ^{D)}	EMA1	Z112A
Pt100 temperature sensor for surface and immersion measurements, –40 +600 °C	Z3409A	GTZ 3409 000 R0002
Pt1000 temperature sensor for measurements in gases and liquids, –50 +220 °C	TF220	Z102A
Pt100 oven sensor, -50 +550 °C	TF550	GTZ 3408 000 R0001
10 adhesive Pt100 temperature sensors, from −50 +550 °C	TS-Chipset	GTZ 3406 000 R0001
Carrying case	F829	GTZ 3301 000 R0003
Ever-ready case	F836	GTZ 3302 000 R0001
Ever-ready case for 2 METRA <i>Hit</i> [®] S with METRA <i>Hit</i> [®] SI232-II and accessories	F840	GTZ 3302 001 R0001
Fuse link (10 ea.)	FF (UR) 1,6 A / 1000 V AC/DC	GTY 3578 136 P0001
Fuse link (10 ea.)	FF (UR) 16 A / 1000 V AC/DC	GTY 3578 176 P0001

For METRA*Hit*[®]28S (with limited functionality)
 Highly recommended for METRA*Hit*[®]29S

Please refer to our Measuring Instruments and Testers Catalog for additional information concerning accessories.

Printed in Germany • Subject to change without notice

GOSSEN-METRAWATT GMBH Thomas-Mann-Str. 16-20 90471 Nürnberg, Germany Phone +49 911 8602-0 +49 911 8602-669 e-mail: info@gmc-instruments.com http://www.gmc-instruments.com

