

4276A-07

S E R V I C E N O T E

SUPERSEDES: None

HP 4276A LCZ Meter

Serial Numbers: 0000A00000 / 2830J03858

Duplicate Service Notes: 4277A-11

Instructions on replacing A4Q10

To Be Performed By: HP-Qualified Personnel

Parts Required:

HP Part No.	Qty.	Description
1854-1297	1	XTR NPN 2SD2298
0360-0001	1	LUG, 3/4 IN. LG

Situation:

The power transistor A4Q10 on A4 power supply board has been changed. The new transistor has P/N 1854-1297 while the old transistor is no longer supplied has P/N 1854-0935. The shapes of the old and new transistors are different, so additional part and special instructions are required to install the new transistor on the old A4 board.

Solution/Action:

Install new transistor with lug as shown below.

DATE: May 1994

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR:

ENTITY:

ADDITIONAL INFORMATION:

YO

3355

PCO 33-34583

© 1994 HEWLETT-PACKARD COMPANY
PRINTED IN U.S.A.



4276A-07
4277A-11

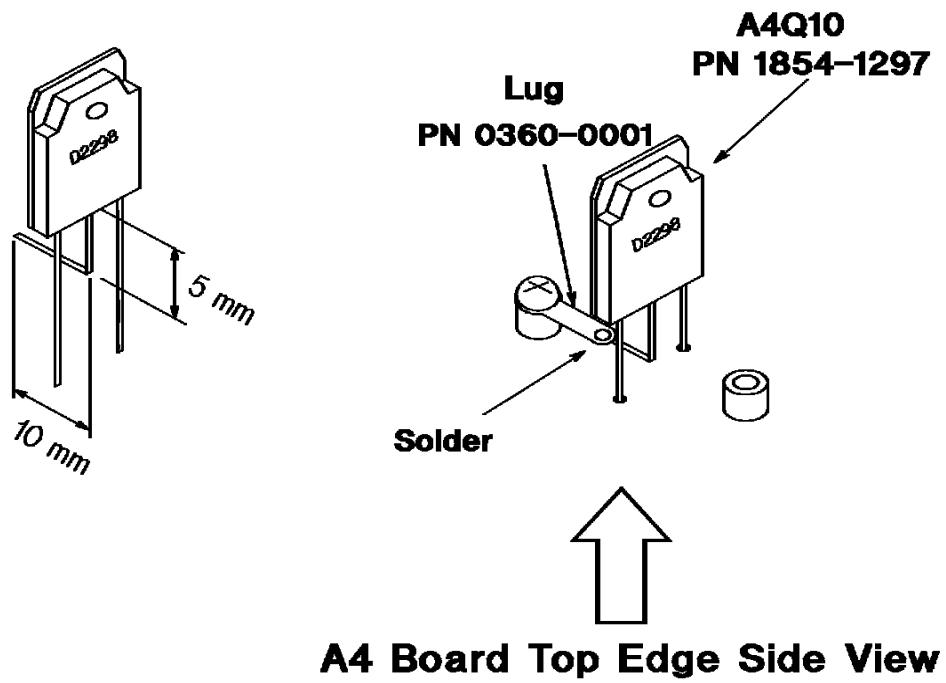


Fig.1 New Transistor Mounting