



SERVICE BULLETIN

Product : LCD Monitor	Bulletin No. : 01-C/M-E0018
Model : SyncMaster 150MP,170MP	Bulletin Date : 21.March.2001
Buyer :	ECN Date : 03. July. 2001
SUBJECT : Remote controller change for 150MP,170MP(ML15*,ML17*) LCD Monitor	

Background : When using remote controller(Remocon) of 150MP & 170MP model, can affect Samsung air conditioner to abnormal operation.

Samsung changed remote controller to prevent interference from 03.July.2000

Refer to the pictures of changed remocon in additional information.

Remocon change history

Old type -> Design change -> Code change to prevent interference

(Add green sticker on inside battery cover)

Cause : Used same custom code with Samsung airconditioner remote controller.

Solution : In case of replacing main board for the units which produced before July.2000, replace remocon with new type.

Application Date : July.2000~

(Interchangeability Code : * I.C)

Location No.	OLD (before) Parts		NEW (changed) Parts		* I.C
	SEC Code	Description	SEC Code	Description	
Remocon	BN09-00057A	KSS51840-78,SAMSUNG	BN09-00057A	KSS51840-78,SAMSUNG	C

Type	A type	B type	C type	D type	E type	F type
Interchange Type Code (* I.C)	OLD → Early (Parts) (Prod.) NEW → Late	OLD → Early (Parts) (Prod.) NEW → Late	OLD → Early (Parts) (Prod.) NEW → Late	OLD → Early (Parts) (Prod.) NEW → Late	Parts Addition (None New)	Parts deletion (Old Del.)

Application Reference () Only Defected sets () Whole sets ()

Attachment Schematic Diagram () Component Lay-out () Exploded View ()
 Mechanical Diagram () None () Others ()

Product Month : - all Serial No. (~ from)

Published by : C.J.Oh Checked by : C. K.Park Approved by : Y.K.Yoo

Revision (V8.1 : July 30, 1997) ... Customer Satisfaction Group (Pages : 1 of 2)

History fo remote controller change

Remote controller

Old type remocon



New type remocon



Inner side of battery cover

Before code change




After code change



Green Sticker

Remocon Package

Transparent tape

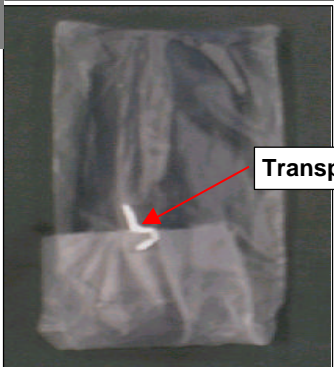

White tape

