

# SONY

## car stereo Service Bulletin No.82

Technical Department  
Sony Service Company  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

Model: CDX-R66/R88

Date: September 4, 1987

Subject: Signal Processor Oscillator



**Symptom:**

(11)

Unit is dead. No key in, no loading, no display. The oscillator for the signal processor may not work under very humid or very dry conditions.

**Solution:**

Please add a  $1M\Omega$  1/6W resistor (P/N 1-247-903-00) in parallel with crystal X501.

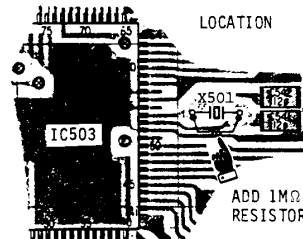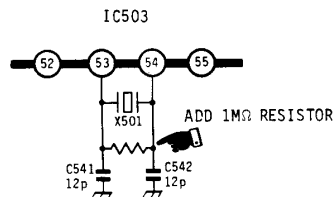

**Applicable Serial Numbers:**

	CDX-R88	CDX-R66
U.S.	10,001-19,500	10,001-11,500