

SONY

Car Stereo Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey, 07656

Model: XR-7280

No. 207

Subject: A.M.S. Does Not Work and/or Cross-Talk

Date: July 29, 1991


Symptom:
(22)

A.M.S. does not work and/or cross-talk is heard between left and right channels of tape deck.

Solution:

Add a ground wire to "EQ A.M.S. Block" of main board. Mounting of the ground wire is dependent upon the part number printed on the main board.

APPLICABLE SERIAL NUMBERS
112601 - 117700

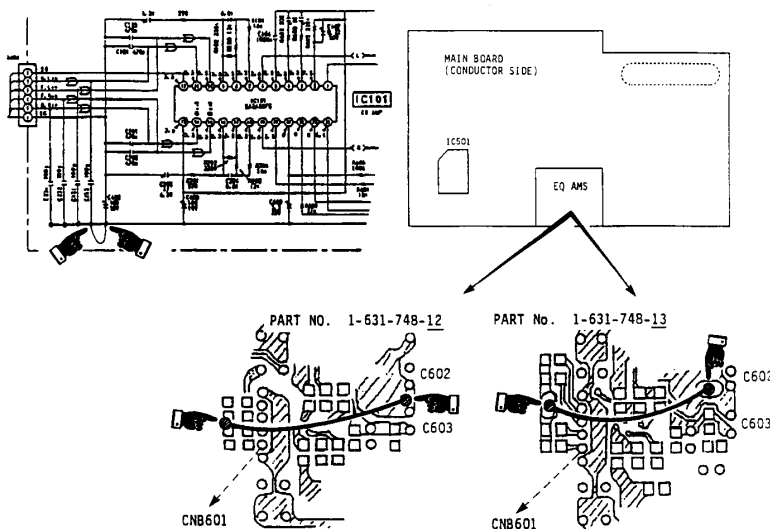

Reference: Tech News ME-91008

PRINTED IN U.S.A.
CSA-14791-2

CSA-14 Tuner / Tape Deck