

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-707ESD

No. 23

Subject: Possible Skipping With 3 Inch
CDs



Date: July 29, 1988

Symptom:
(62)

If customer complains of skipping while playing 3 inch CDs,
replace R212 with a new value as shown.

Solution:

Ref. No.	Description	Part Number	
		Former	New
R212	1/6W Resistor	1-249-436-11 (39k Ohms)	1-249-433-11 (22k Ohms)

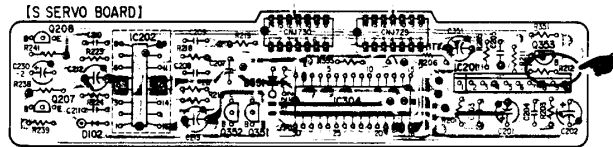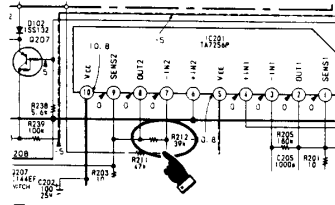

Compact Disc
CSA-13