

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: TC-RX400/RX50

No. 49R

Subject: No Operation By Remote Commander

Date: January 31, 1989


Symptom:
(25)

Remote commands are sometimes not accepted.

Solution: Replace R520 with 47k.

Applicable Serial Numbers: TC-RX400 up to 815501
TC-RX50 up to 803501

Ref. No.	Former		New	
	Description	Part Number	Description	Part Number
R520	10k	1-249-429-11	47k	1-249-437-11

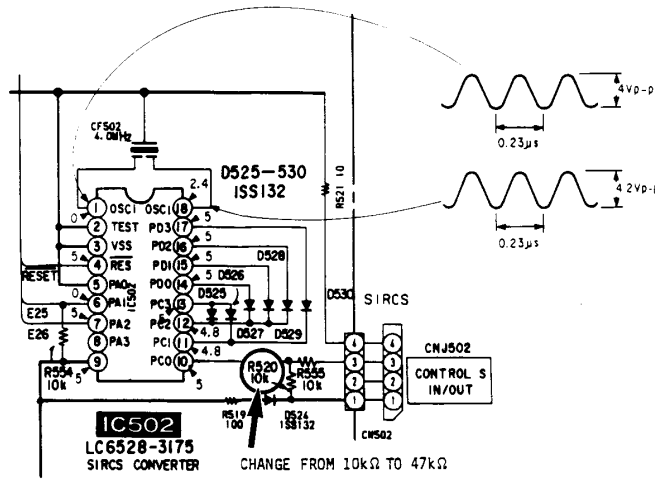

Reference: FAX A881355

PRINTED IN U.S.A.
CSA-13189-1

CSA-13 Tape Deck