

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: SRS-D3K

No. 163

Subject: Hum During Silence

Date: January 30, 1991

Symptom:
(54)

Hum may be heard during passages of silence when listener is positioned close to speaker, and ambient room noise level is very low.



Solution: If this symptom occurs, make the following changes to the "AMP" Board:

CHANGE

Ref. No.	Description		Part Number	
	Former	New	Former	New
C302	Capacitor, 0.12uF, Mylar	Capacitor, 0.1uF, Tantalum	1-130-496-00	1-131-402-00
C303	Capacitor, 0.1uF, Mylar	Capacitor, 0.1uF, Tantalum	1-130-495-00	1-131-402-00

ADD

Description	Part Number
Resistor, 470 Ohm, 1/6W, Carbon	1-249-413-11
Capacitor, 1000uF/25V, Electrolytic	1-124-557-11

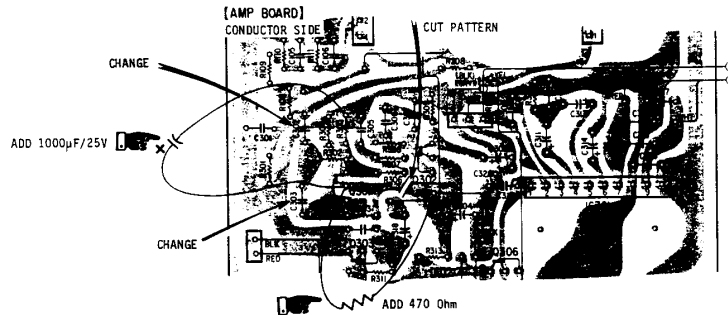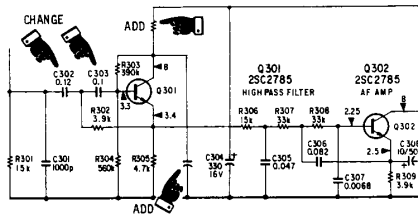

Reference: Tech News GA90019

PRINTED IN U.S.A.
CSA-13191-3

CSA-13 Speakers