

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-AV720

No. 292

Subject: Replacement Part For Main Board Is Different
From Original


Date: September 17, 1992

Symptom:
(**)

The replacement part for the main board has one single 4-pin connector for CNP601, while the original main board has one (3) Pin and one (2) Pin Connector for CNP602.

Solution:

Cut the female mate plugs which formerly connected separately to the (2) and (3) Pin Connectors for CNP601. Strip the ends of each of the five wires back approximately 1/16 inch and solder directly to the (4) Pin Connector for CNP601. See the diagram below for details on making proper connections.

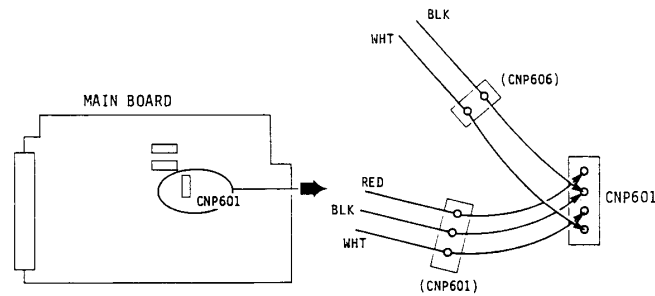

CSA-13 Receiver