

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics
Sony Drive, Park Ridge, New Jersey 07656

Model: TA-S7

No. 350


Subject: Video processed through the *Video In* input is washed out.

Date: August 12, 1993

Symptom:
(32)

A video signal processed through the *Video In* input is washed out when observed through the *Video Out* output. When the same video signal is connected to the *TV Video In* input, the signal observed through the *Video Out* output looks normal.

Solution: One side of R804 is missing a connection to ground on the Video Board. The trace on one side of R804 does not connect anywhere. Connect the open side of R804 to the ground plane on the Video Board as shown in the diagram below.

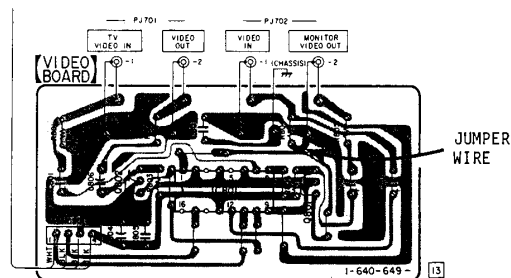

Reference: FPR-Q2292
Autoflagged - YES



PRINTED IN USA
CSA-13793-7