

CONFIDENTIAL

CSA-13

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

Service Bulletin Hi Fi Products

odel: D-151, D-151C, D-242CK, D-242SK, D-242CKT,

No. 525

D-245, D-247, ICF-CD1000

Subject: No Sound Date: May 6, 1997


Symptom:

(162) No Sound. Unit does not read TOC and gives a "NO Disc" Indication.

Solution: Verify Rack is damaged. If so, replace with improved version.

Note: The new version has the same part number as the old. Make sure to Look at the new piece and compare it to the diagram below.

DESCRIPTION	PART NUMBER
RACK	2-625-414-02

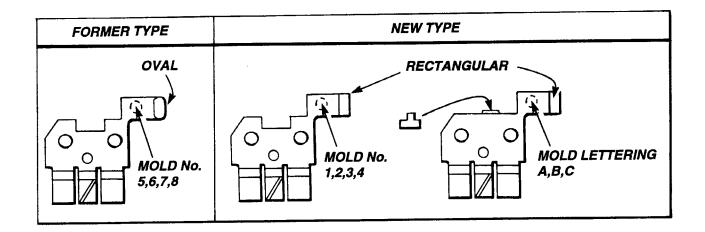

Reference: TN # GA-96034 PRINTED IN USA