

Model: CPD-15SF2, CPD-17SF2

No. 145

Subject: No picture with Wide Vert. Sync. Pulse

Date: January 13, 1997

Symptom:

(131)

If set has no picture when Vert. Sync Input has Wide ($\geq 400 \mu\text{s}$) Vert. Sync. Pulse. Unit may not accept Vert. Sync. and go in Power Save mode.

Solution:


Then please perform the following procedure on the D Board.

Note: The parts listed below are needed to complete this procedure.

MODEL	REF	DESCRIPTION	PART NUMBER
CPD-15SF2	IC901	IC ST7271N5B1/CCM	8-759-354-66
CPD-17SF2	IC901	IC ST7271N5B1/CER	8-759-370-67
ALL	C948	0.22 UF 5% 50V	1-136-169-00

1. Replace IC901. Refer to illustration shown below.
2. Replace C948 with 0.22 μF part. Refer to illustration shown below.

C948 & IC901 LOCATION

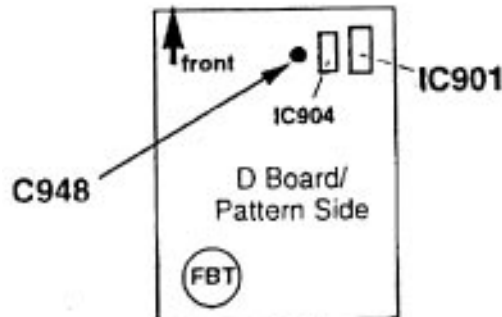

The procedure is completed.

