

XXIV. *Account of a new Electrometer.* By Mr. Abraham Brook; communicated by Sir Joseph Banks, Bart. P. R. S.

Read May 30, 1782.

AAAAN, fig. 1. represents the electrometer in full size and proportion, standing on a table, or the like. The foot B is a square piece of board, $9\frac{1}{2}$ inches each way, resting on three pins C, C, c, seen at the under side of the foot. C, C, with the broad heads, are screws to set the instrument upright withal. D is a solid piece of glass, which supports and insulates the instrument from the place on which it stands. The arms G₁ and g, with the ball F, turn round on the wire H (which is solid brass, as may be also the arm g), and, when in use, are put near at a right angle with G₂ and H, being turned to the off side so as to be as much as possible out of each other's spheres or the atmosphere of a jar, battery, prime conductor, &c. The arms G₁ and G₂ are hollow tubes of copper, not so heavy as wires. The balls I₁, I₂, are made of copper, and hollow, so as to be as light as possible. K represents a kind of face or dial plate to the instrument with its index, which is carried once round by the motion of the arm G₂ with its ball I₂ moving through a quarter, or 90 degrees, of a circle; this motion is given to it by the repulsive power of the charge, &c. of electricity between the two balls I₂ and L. The ends of the index from its center are of different lengths. The longest end reaches to a graduated circle, divided into 90 equal parts, answering

answering to the 90° , which the arm G2 moves through. The shortest end reaches to a smaller circle, divided into 60 equal parts, answering to 60 grs. weight, or 60 divisions, on the arm G1, with its sliding weight *m*, each of which is equal to one grain, and the whole face is covered with a watch glass, to prevent the electricity from flying off at the points.

The top of the glass-supporter, or insulator D, is cemented into a brass cap M. This cap enters the ball L at bottom, and screws into the upper part of the ball L at *a*. The top part of this cap M is tapered off to a cone about an inch and a half long or high. The lower end of the wire H has a hole made conically into it, so as to receive the upper part, or conical end, of the cap M, which permits all the upper part of the electrometer to turn round any way that may be necessary. The kind of ferrel O, with its base, is perforated for the lower end of the wire H to go through. The bent arm *b*, which supports the cup N, is screwed into the base of the ferrel O, and turns freely round upon the wire H. The cup N is to receive the ball P of the arm, fig. 9. This arm shortens or lengthens, as may be wanted, by a wire sliding into a tube. The end of the wire is slit, forming a spring in the tube to be steady. In this arm, fig. 9. is a kind of rule joint at *d*, that the arm may give way easily if wanted. The semi-circular end of the arm is a spring, and slips on to a ball from the prime-conductor, or the conductor itself (if they fit), jar, or battery. The ends of it are flat and broad, as represented in the drawing in miniature, of the electrometer at fig. 2. in the other drawing.

Fig. 2. to 11. shews the internal structure of the electrometer.

Fig. 12. shews the part at *z* that screws into the ball F, to support the arm *g* with its ball *r*. This piece, which is made

hollow on the side next the wire H, so as to fit, and is screwed in, so as to press against H, serves as a spring to keep the ball F steady, which slides up and down, as well as turns round, on H.

In order to make the divisions of G₁, fig. 1. exactly a grain each, first slide the weight *m* towards the ball F, fig. 1. till it is an exact counter-balance to the weight in F. At one end of the weight *m* let the divisions begin; then suspend any tolerable pair of scales, so that the bottom of one of them may rest on the top of the ball *r*; then lay the ball I₁ into the scale, and slide the weight *m* near to I₁, and put as many grains into the other scale as will just raise the ball I₁ in the scale; then mark the arm G₁ at the same end of the weight *m*, and divide the space between the two marks into as many parts as there are grains in the scale, which may be divided and sub-divided into halves and quarters.

The arm G₂ being repelled shews when the charge is increasing, &c.; and I₁ tells what such a repulsive power is between two balls of the size of these in grains, according to the number the weight *m* rests at when lifted up by the repulsive power of a charge. The longest end of the index K shews how many degrees of a circle G₂ is repelled; and, by many trials, according to the number of grains, the arm G₁ shews, when it is lifted up, and the weight *m* put at different places, such respective numbers of grains may be marked on the least graduated circle on the dial plate where the shortest end of the index points; so that when all the grains are thus marked on the dial plate, thus ascertained by the arm G₁, all these parts of the instrument, that is, the ball F with the arms G₁ and *g* may be taken off, and the instrument is then graduated to be used without them; but I do not know how the grains can be so exactly

exactly marked and ascertained as by these parts being on the instrument: nor do I mean to confine the number of grains or divisions on G_1 ; but, I think, my experience seems to tell me, that no glass to be *charged*, as we call it, with electricity, will bear a greater charge than that whose repulsive force, between two balls of this size, equals 60 grains weight, before it will be perforated or struck through. Nay, I have not found many instances where it would stand 50 grains; and, I think, it is very hazardous to go more than 45 grains.

Thus, by knowing the quantity of coated surface, and the diameter of the balls, as I_1 and r , I would say, so much or so much coated surface charged to so many or so many grains repulsion between two balls of such or such a size would melt a wire of this or that size, or do such a thing, kill such an animal, &c.; and if balls, wires, or arms of this size, are found too small, larger may be made on the same plan.

In respect to the advantages of this electrometer above *those now in use*, I do not, perhaps, know them all; and lest my partiality may prejudice me in behalf of my own contrivance, would rather leave them to the judgement of others; my opinion however is, that all that I have seen or heard of are such as speak no intelligible language, and that this speaks so as to be understood universally; for, unless the repulsive power of the charge of different glasses be very different, this electrometer, or any other electrometer, made after this manner, must, I should think, speak very nearly the same language, it being known how much coated surface there is, and the size of the balls; but if the size of the balls be not the same, the language the instrument speaks will be very different. Although other Electrometers shewed a

greater or leffer charge or power, by an arm being repelled to a greater or leffer diftance, or by ftriking differently at different diftances, yet the power of the charge was not in any manner afcertained; we could fay, that the arm or index was repelled to fuch or fuch a number of degrees of a circle, or that it ftruck to fuch or fuch a diftance; but the repulfive power of a charge to repel the index fo much, or fo many degrees of a circle, or the ftrength of the charge to ftrike to fuch a diftance was not (that I know of) in any manner intelligibly afcertained. This fhews it by the weight that the repulfive power has to lift up in grains, &c.; which weight is to be proved by any tolerable pair of fcales and weights; and I do not know any other method that has been yet tried to fhew the different ftrength of charges fo good as that of repulfion.

All the neceffary parts of the inftrument being made of metal and glafs that is pretty ftout, I think, the electricity is lefs liable to efcape than by wood, &c. I have tried reeds on account of their being light, and covered them with tin-foil, or gilded them to make them good conductors; but fo frequently found inconveniencies from them by points rifing up, the celerity of moving, and the different weight of them at different times owing to moiifture, change of the weather, and the like, that I have laid them all afide, and find my prefent inftrument as free from thefe inconveniencies as I could expect; nor is it liable to be out of order, if proper care is taken of it.



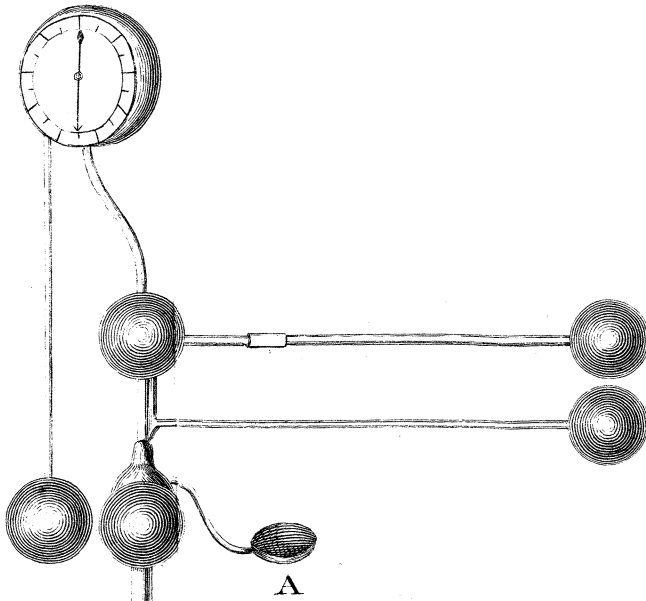


Fig. 1.

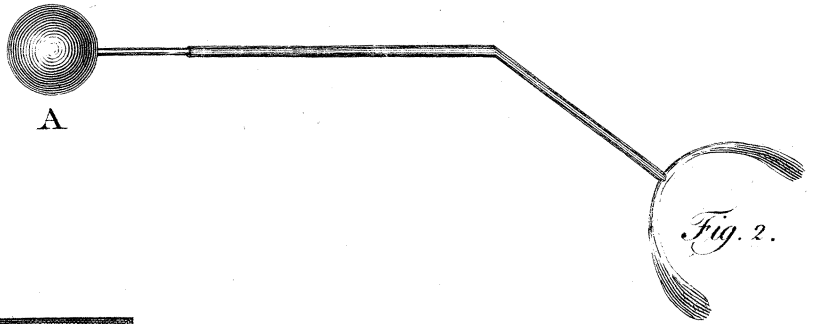


Fig. 2.

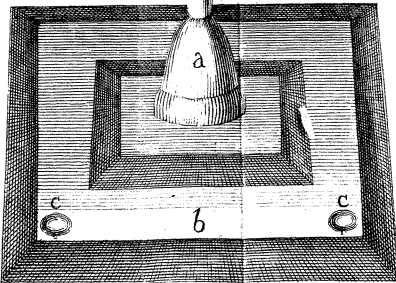


Fig. 1. represents the Electrometer in miniature. Fig. 2. is an Arm to make a communication from a Battery, &c. by the Semicircular End being slid on to a Ball of the Battery &c. and the Ball Δ being laid into the Cup Δ Fig. 1.

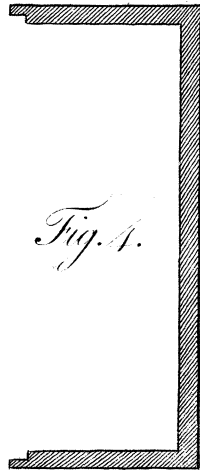
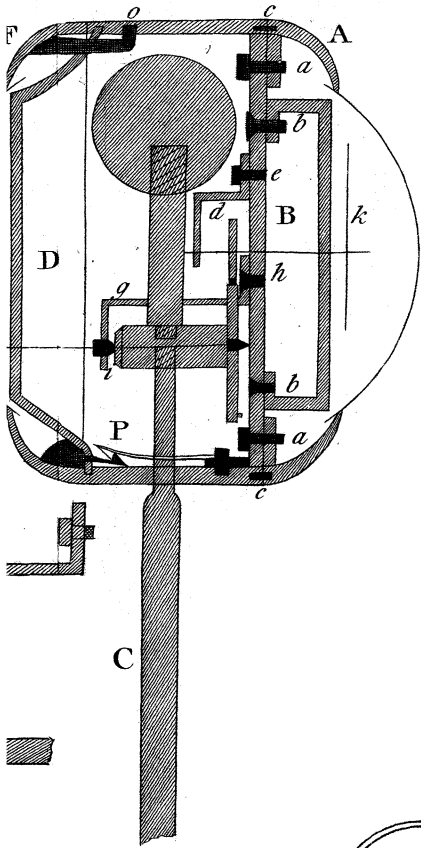


Fig. 5.

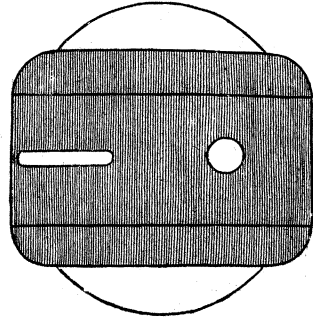


Fig. 7.

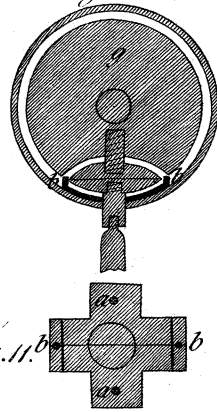


Fig. 11.







Fig. 8.

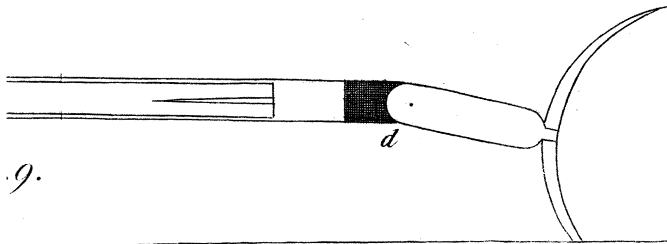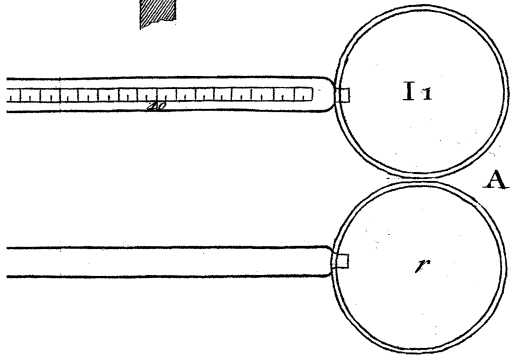

9.

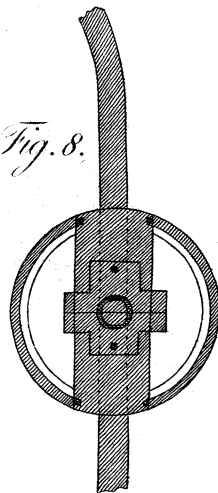