


## REMOVABLE WING TIP

HXL  
DEC 22/06

57-31-00  
SECTION TITLE  
PAGE 1

**BOEING**  
767  
PARTS CATALOG (MAINTENANCE)

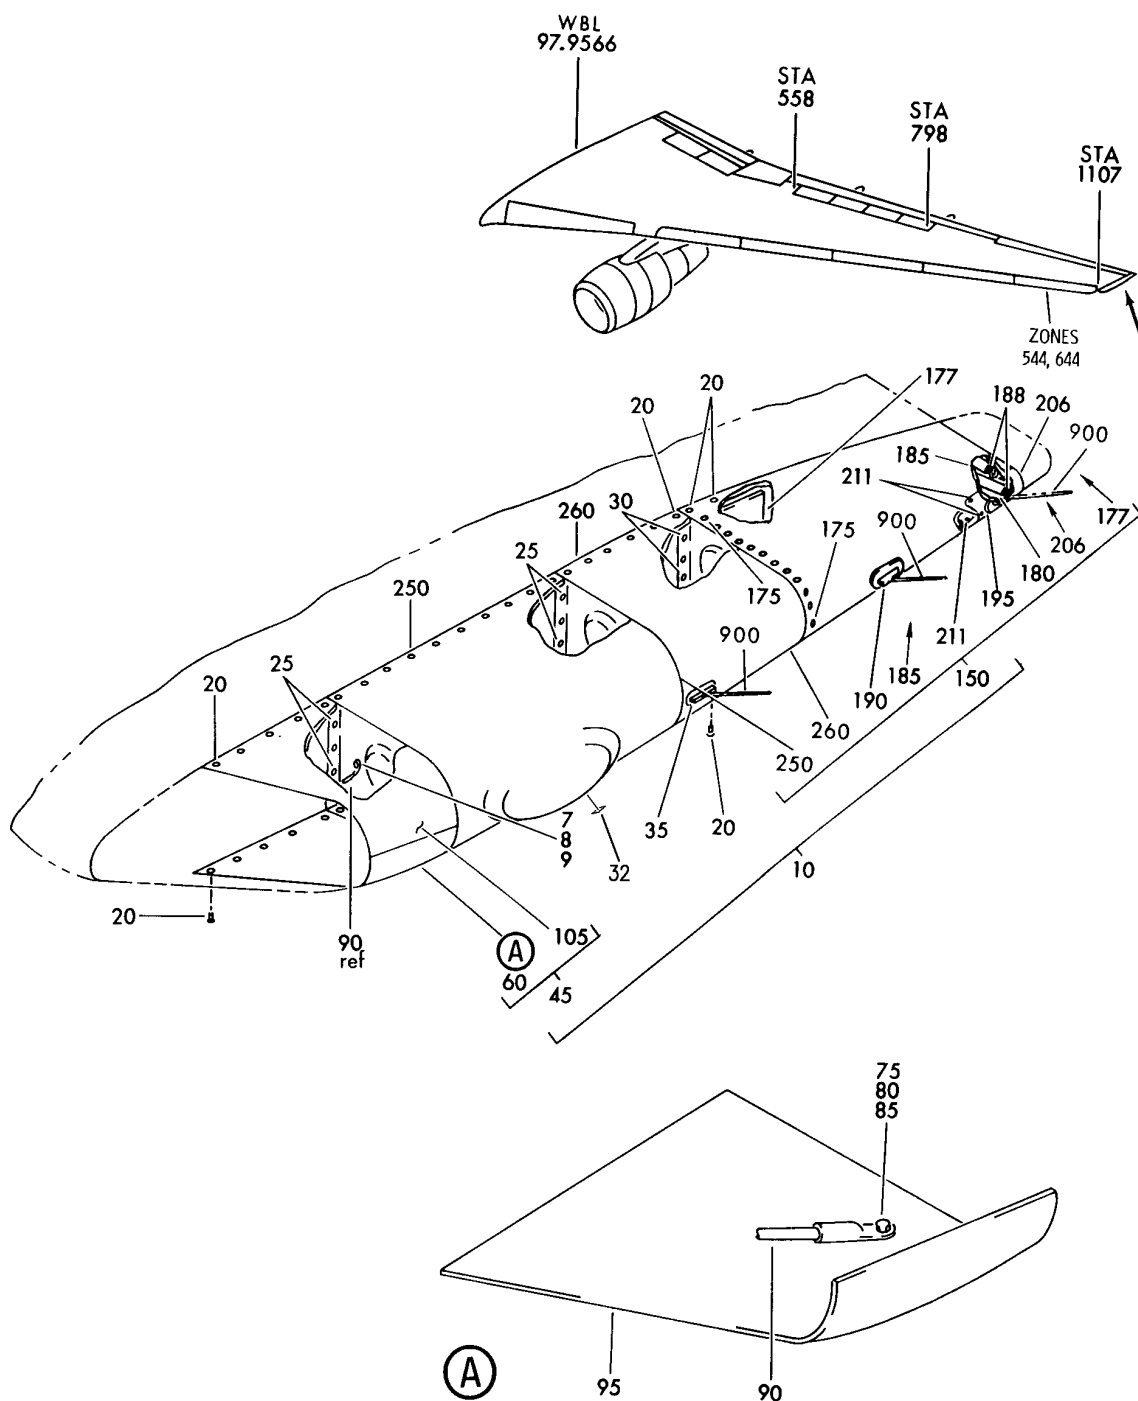

V 57310101 REV 257

TIP INSTL-WING  
FIGURE 1

**57-31-01-01**

HXL  
DEC 22/06

57-31-01-01  
PAGE 0

**BOEING**  
767  
**PARTS CATALOG (MAINTENANCE)**

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 1	119T0001-1		TIP INSTL-WING TIP INSTL-WING POSITION DATA: LH FOR NHA SEE: 57-00-00-01A		RF
- 5	119T0001-2		TIP INSTL-WING POSITION DATA: RH FOR NHA SEE: 57-00-00-01A		RF
7	BACB30NM4K3		.BOLT		1
8	AN960PD416		.WASHER		1
9	BRH10A4		.NUT		1
			SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653		
10	119T0001-3SP		.TIP ASSY- POSITION DATA: LH SIDE QUALIFIED I/W DATA: 119T0001-29 MAY REPLACE 119T0001-3SP FOR VB251B280 ONLY -51SP CAN REPLACE OR BE REPLACED BY -3SP SUBJECT TO CUSTOMER COLOR PREFERENCE		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

# 57-31-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-31-01  
FIG. 01  
PAGE 1  
APR 22/09

 **BOEING**  
767  
**PARTS CATALOG (MAINTENANCE)**

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
10	119T0001-51SP		.TIP ASSY- POSITION DATA: LH SIDE QUALIFIED I/W DATA: -51SP CAN REPLACE OR BE REPLACED BY -3SP SUBJECT TO CUSTOMER COLOR PREFERENCE		1
10	119T0001-62SP		.TIP ASSY- POSITION DATA: LH SIDE		1
- 15	119T0001-4SP		.TIP ASSY- POSITION DATA: RH SIDE QUALIFIED I/W DATA: 119T0001-30 MAY REPLACE 119T0001-4SP FOR TBL VB251B280 ONLY -52SP CAN REPLACE OR BE REPLACED BY -4SP SUBJECT TO CUSTOMER COLOR PREFERENCE		1
- 15	119T0001-52SP		.TIP ASSY- POSITION DATA: RH SIDE QUALIFIED I/W DATA: -52SP CAN REPLACE OR BE REPLACED BY -4SP SUBJECT TO CUSTOMER COLOR PREFERENCE.		1
- 15	119T0001-63SP		.TIP ASSY- POSITION DATA: RH SIDE ATTACHING PARTS		1
20	BACB30NN3K4		.BOLT		46
25	BACB30NM4K3		.BOLT		6
30	BACB30NM3K3		.BOLT		3
			-----*-----		
35	611R8A		..RETAINER-DISCH SUPPLIER CODE: V55635 MISCELLANEOUS DATA: 611R8A IS THE VENDOR'S MODEL NUMBER, NOT THE PART NUMBER. THE CORRECT PART NUMBER IS 16290 PER DAYTON-GRANGER, INC.		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

# 57-31-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-31-01  
FIG. 01  
PAGE 2  
APR 22/09

 **BOEING**  
767  
**PARTS CATALOG (MAINTENANCE)**

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			ATTACHING PARTS		
- 40	BACR15BA4AD		..RIVET- SIZE DETERMINED ON INSTL. -----*-----		4
45	119T0004-1		..FAIRING ASSY- POSITION DATA: LH SIDE		1
- 50	119T0004-2		..FAIRING ASSY- POSITION DATA: RH SIDE		1
- 55	BACR15BA5AD		ATTACHING PARTS ..RIVET- SIZE DETERMINED ON INSTL. -----*-----		25
60	119T0004-11		...PANEL ASSY-ACCESS POSITION DATA: LH SIDE ACCESS PANEL NUMBER: 544AB		1
- 65	119T0004-12		...PANEL ASSY-ACCESS POSITION DATA: RH SIDE ACCESS PANEL NUMBER: 644AB		1
- 70	BACB30NN3K4		ATTACHING PARTS ...BOLT -----*-----		8
75	BACB30NU3K3		....BOLT		1
80	AN960PD10		....WASHER		1
85	BRH10A3		....NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC3 OPTIONAL PART: H10-3BAC V15653 NS202101-02 V80539 RMLH9075-3W V72962 VN303A02 V92215 96-02 V80539 T6S1032J V11815		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

# 57-31-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-31-01  
FIG. 01  
PAGE 3  
APR 22/09

 **BOEING**  
767  
**PARTS CATALOG (MAINTENANCE)**

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1	90 940CW21-10		.....JUMPER ASSY SUPPLIER CODE: V91812 SPECIFICATION NUMBER: BACJ40AB21-10 OPTIONAL PART: 100221-10 V1FF12 RBEJ40AB21-10 V1GK47		1
	95 119T0013-1		.....SKIN- POSITION DATA: LH SIDE		1
-	100 119T0013-2		.....SKIN- POSITION DATA: RH SIDE		1
	105 119T0004-3		...PANEL ASSY-FXD POSITION DATA: LH SIDE		1
-	110 119T0004-4		...PANEL ASSY-FXD POSITION DATA: RH SIDE		1
	150 119T0007-17		..FAIRING ASSY- POSITION DATA: AFT LH SIDE		1
-	155 119T0007-18		..FAIRING ASSY- POSITION DATA: AFT RH SIDE ATTACHING PARTS		1
	175 BACR15BA5AD		..RIVET- SIZE DETERMINED ON INSTL. -----*-----		24
	177 MS27253-1		...PLATE ATTACHING PARTS		1
-	178 BACR15BB3		...RIVET- SIZE DETERMINED ON INSTL. -----*-----		4
	180 119T0007-10		...SEAL- MANUFACTURED FROM: EXTR RUBBER F25.01 10-60754-177 X 12.40 IN. SPARES ORDER MATERIAL CODE: 5287001770		1

R  
R  
R  
R  
R  
R  
R

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED

HXL

# 57-31-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-31-01  
FIG. 01  
PAGE 4  
AUG 22/09

 **BOEING**  
767  
**PARTS CATALOG (MAINTENANCE)**

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
R R R R R R R R R R	185	119T0007-12	...SEAL- MANUFACTURED FROM: EXTR RUBBER F25.01 10-60754-177 X 8.40 IN. SPARES ORDER MATERIAL CODE: 5287001770		1
	188	119T0007-19	...PLUG-END MANUFACTURED FROM: SH RUBBER SILICONE SPONGE BMS1-23 .80 DIA X 1.50 IN SPARES ORDER MATERIAL CODE: 5238500230		2
	190	611R8A	...RETAINER-DISCH SUPPLIER CODE: V55635 MISCELLANEOUS DATA: 611R8A IS THE VENDOR'S MODEL NUMBER, NOT THE PART NUMBER. THE CORRECT PART NUMBER IS 16290 PER DAYTON-GRANGER, INC.		1
	195	610R1A	...RETAINER-DISCH SUPPLIER CODE: V55635 MISCELLANEOUS DATA: 610R1A IS THE VENDOR'S MODEL NUMBER, NOT THE PART NUMBER. THE CORRECT PART NUMBER IS 16760 PER DAYTON-GRANGER, INC. AN ELR WILL BE WRITTEN TO CORRECT ANY DRAWINGS THAT CALL OUT 610R1A.		1
	- 200	BACR15BA4AD	ATTACHING PARTS ...RIVET- SIZE DETERMINED ON INSTL. -----*-----		8
	206 211	BACB30NN3K3 119T0007-5	...BOLT ...COVER- POSITION DATA: LH SIDE ACCESS PANEL NUMBER: 544BB		3 1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

# 57-31-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-31-01  
FIG. 01  
PAGE 5  
AUG 22/09



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 216	119T0007-6		...COVER- POSITION DATA: RH SIDE ACCESS PANEL NUMBER: 644BB		1
250	119T0005-1		..PANEL ASSY- POSITION DATA: FWD LH SIDE		1
- 255	119T0005-2		..PANEL ASSY- POSITION DATA: FWD RH SIDE		1
260	119T0006-1		..PANEL ASSY- POSITION DATA: AFT LH SIDE		1
- 265	119T0006-2		..PANEL ASSY- POSITION DATA: AFT RH SIDE		1
- 270	BACR15BA5AD		ATTACHING PARTS ..RIVET- SIZE DETERMINED ON INSTL. -----*-----		76
900			ILLUSTRATION REFERENCE: DISCHARGER INSTL-STATIC 23-61-01-01		RF

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED

HXL

57-31-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-31-01  
FIG. 01  
PAGE 6  
AUG 22/09