


HIGH TENSION DISTRIBUTION

HXL
DEC 22/06

74-21-00
SECTION TITLE
PAGE 1

BOEING
767
PARTS CATALOG (MAINTENANCE)

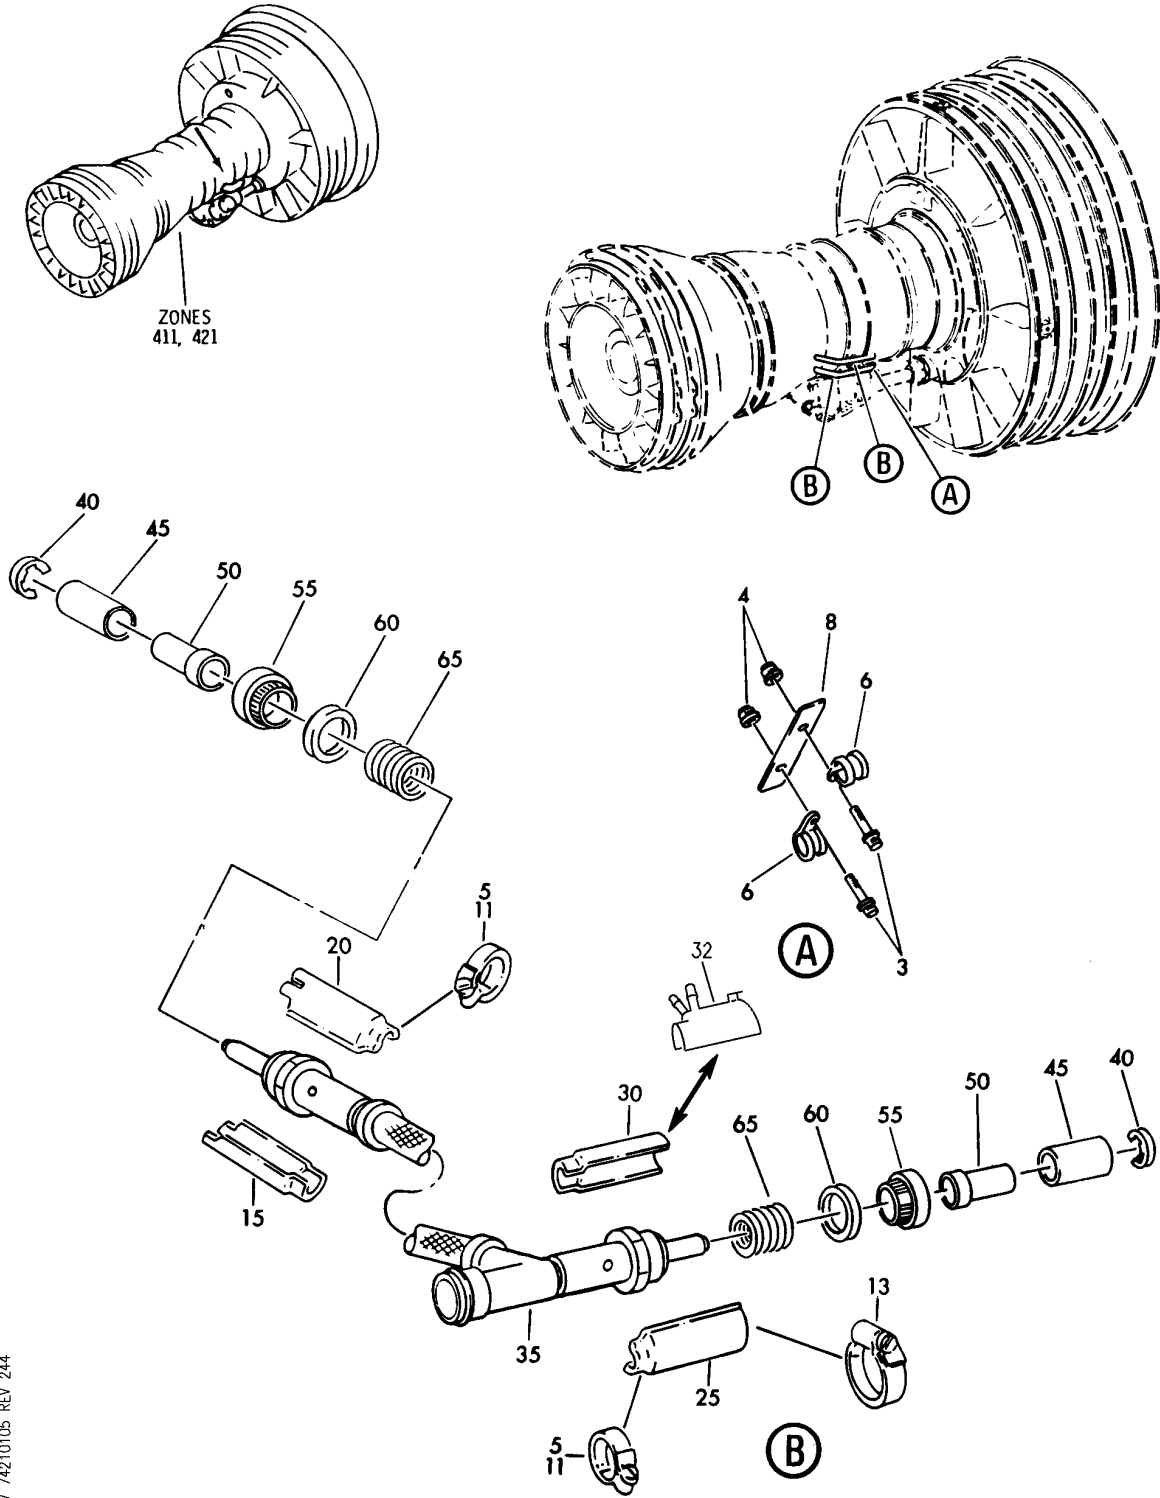

V 74210105 REV 244

CABLES-EXCITER TO SPARK IGNITER (PW4000)
FIGURE 5

74-21-01-05

HXL
DEC 22/06

74-21-01-05
PAGE 0



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5			CABLES-EXCITER TO SPARK IGNITER (PW4000)		
- 1	PW4060		ENGINE- SUPPLIER CODE: V77445 CONFIG CHG DATA FROM A CMM: SEE 71-00-51 FIG. 2 FOR APPLICABLE ENGINE SERIES		RF
3	MS9556-08		.BOLT- POST SERVICE BULLETIN: 74-3 V77445		2
4	776440		.NUT- SUPPLIER CODE: V77445 OPTIONAL PART: SL7061C1032 V11815 LH11973-3 V56878 H49674-3 V15653 73356-1032 V56878 AS3070-09 POST SERVICE BULLETIN: 74-3 V77445		2
4	SL7061C1032		.NUT- SUPPLIER CODE: V11815 CONFIG CHG DATA FROM A CMM: PRATT AND WHITNEY PART NO. AS3066-09 OPTIONAL PART: 776440 V77445 LH11973-3 V56878 H49674-3 V15653 73356-1032 V56878 AS3070-09 POST SERVICE BULLETIN: 74-3 V77445		2

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED

HXL

74-21-01-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

74-21-01
FIG. 05
PAGE 1
DEC 22/06

BOEING
767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5	4 LH11973-3		.NUT- SUPPLIER CODE: V56878 CONFIG CHG DATA FROM A CMM: PRATT AND WHITNEY PART NO. AS3067-09 OPTIONAL PART: 776440 V77445 SL7061C1032 V11815 H49674-3 V15653 73356-1032 V56878 AS3070-09 POST SERVICE BULLETIN: 74-3 V77445		2
	4 H49674-3		.NUT- SUPPLIER CODE: V15653 CONFIG CHG DATA FROM A CMM: PRATT AND WHITNEY PART NO. AS3068-09 OPTIONAL PART: 776440 V77445 SL7061C1032 V11815 LH11973-3 V56878 73356-1032 V56878 AS3070-09 POST SERVICE BULLETIN: 74-3 V77445		2

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

— ITEM NOT ILLUSTRATED

HXL

74-21-01-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

74-21-01
FIG. 05
PAGE 2
DEC 22/06



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5	4 AS3070-09		.NUT- OPTIONAL PART: 776440 V77445 SL7061C1032 V11815 LH11973-3 V56878 H49674-3 V15653 73356-1032 V56878 POST SERVICE BULLETIN: 74-3 V77445		2
	4 73356-1032		.NUT- SUPPLIER CODE: V56878 CONFIG CHG DATA FROM A CMM: PRATT AND WHITNEY PART NO. AS3069-09 OPTIONAL PART: 776440 V77445 SL7061C1032 V11815 LH11973-3 V56878 H49674-3 V15653 AS3070-09 POST SERVICE BULLETIN: 74-3 V77445		2
	5 741198		.CLAMP-HOSE SUPPLIER CODE: V77445 OPTIONAL PART: ST1063-08 V77445 650276 V77445		4

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED

HXL

74-21-01-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

74-21-01
FIG. 05
PAGE 3
DEC 22/06



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5	5 650276		.CLAMP-HOSE SUPPLIER CODE: V77445 OPTIONAL PART: ST1063-08 V77445 741198 V77445		4
	5 ST1063-08		.CLAMP-HOSE SUPPLIER CODE: V77445 OPTIONAL PART: 650276 V77445 741198 V77445		4
	6 ST1455-14		.CLAMP-LOOP CUSHION SUPPLIER CODE: V77445		2
	8 53T115		.BRACKET-LOOP CLAMP SUPPLIER CODE: V77445 POST SERVICE BULLETIN: 74-3 V77445		1
	11 741198		.CLAMP-HOSE SUPPLIER CODE: V77445 OPTIONAL PART: 6808 V81646 650276 V77445		4
	11 650276		.CLAMP-HOSE SUPPLIER CODE: V77445 OPTIONAL PART: 6808 V81646 741198 V77445		4

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED

HXL

74-21-01-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

74-21-01
FIG. 05
PAGE 4
DEC 22/06



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
11	6808		.CLAMP-HOSE SUPPLIER CODE: V81646 CONFIG CHG DATA FROM A CMM: PRATT AND WHITNEY PART NO. ST1063-08 OPTIONAL PART: 650276 V77445 741198 V77445		4
13	741199		.CLAMP-HOSE SUPPLIER CODE: V77445 OPTIONAL PART: ST1062-20 V77445 650727 V77445		2
13	ST1062-20		.CLAMP-HOSE SUPPLIER CODE: V77445 OPTIONAL PART: 650727 V77445 741199 V77445		2
13	650727		.CLAMP-HOSE SUPPLIER CODE: V77445 OPTIONAL PART: 741199 V77445 ST1062-20 V77445		2
15	50T848		.SHIELD-HEAT SUPPLIER CODE: V77445		2
20	50T847		.SHIELD-HEAT SUPPLIER CODE: V77445		2
25	50T850		.SHIELD-HEAT SUPPLIER CODE: V77445		2

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED

HXL

74-21-01-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

74-21-01
FIG. 05
PAGE 5
DEC 22/06



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5	30 50T849		.SHIELD-HEAT SUPPLIER CODE: V77445 CONFIG CHG DATA FROM A CMM: FOR INTRCHG SEE PW IPC PRE SERVICE BULLETIN: 73-192 V77445		2
-	31 50T849		.SHIELD-HEAT SUPPLIER CODE: V77445 CONFIG CHG DATA FROM A CMM: FOR INTRCHG SEE PW IPC		1
	32 52U462-01		.SHIELD-HEAT SUPPLIER CODE: V77445 CONFIG CHG DATA FROM A CMM: FOR INTRCHG SEE PW IPC POST SERVICE BULLETIN: 73-192 V77445		1
	35 10-609660-7		.CABLE-EXCITER TO SPARK IGNITER SUPPLIER CODE: V59501 CONFIG CHG DATA FROM A CMM: PRATT AND WHITNEY PART NO. 57T745 OPTIONAL PART: 10-609660-3 V59501 10-609660-9 V59501 POST SERVICE BULLETIN: 74-7 V77445 PRE SERVICE BULLETIN: 74-8 V77445		2

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED

HXL

74-21-01-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

74-21-01
FIG. 05
PAGE 6
DEC 22/06



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
35	10-609660-3		.CABLE-EXCITER TO SPARK IGNITER SUPPLIER CODE: V59501 CONFIG CHG DATA FROM A CMM: PRATT AND WHITNEY PART NO. 52T998 OPTIONAL PART: 10-609660-7 V59501 10-609660-9 V59501 POST SERVICE BULLETIN: 74-2 V77445 PRE SERVICE BULLETIN: 74-7 V77445		2
35	10-609660-9		.CABLE-EXCITER TO SPARK SUPPLIER CODE: V59501 CONFIG CHG DATA FROM A CMM: PRATT AND WHITNEY PART NO. 50U683 OPTIONAL PART: 10-609660-7 V59501 10-609660-3 V59501 POST SERVICE BULLETIN: 74-8 V77445		2
40	10-102476		..RING-RETAINING SUPPLIER CODE: V59501		4
45	10-700306-1		..SLEEVE-INSULATOR SUPPLIER CODE: V59501		4
50	10-700118		..BUSHING- SUPPLIER CODE: V59501		4
50	9048006		..BUSHING- SUPPLIER CODE: V59501		4
55	10-700305		..GROMMET-RUBBER SUPPLIER CODE: V59501		4
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

74-21-01-05

74-21-01
FIG. 05
PAGE 7
DEC 22/06

HXL



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
60	10-700314		.. WASHER- SUPPLIER CODE: V59501 USED WITH: 10-609660-3		4
60	9059257		.. WASHER- SUPPLIER CODE: V59501 USED WITH: 10-609660-9		4
65	10-700313		.. SPRING-HELICAL COMP SUPPLIER CODE: V59501 USED WITH: 10-609660-3		4
65	9048137		.. SPRING ASSY-CAGED SUPPLIER CODE: V59501 USED WITH: 10-609660-7		4
65	9048489-1		.. SPRING- SUPPLIER CODE: V59501 USED WITH: 10-609660-9		4

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED



HXL

74-21-01-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

74-21-01
FIG. 05
PAGE 8
DEC 22/06

BOEING
767
PARTS CATALOG (MAINTENANCE)

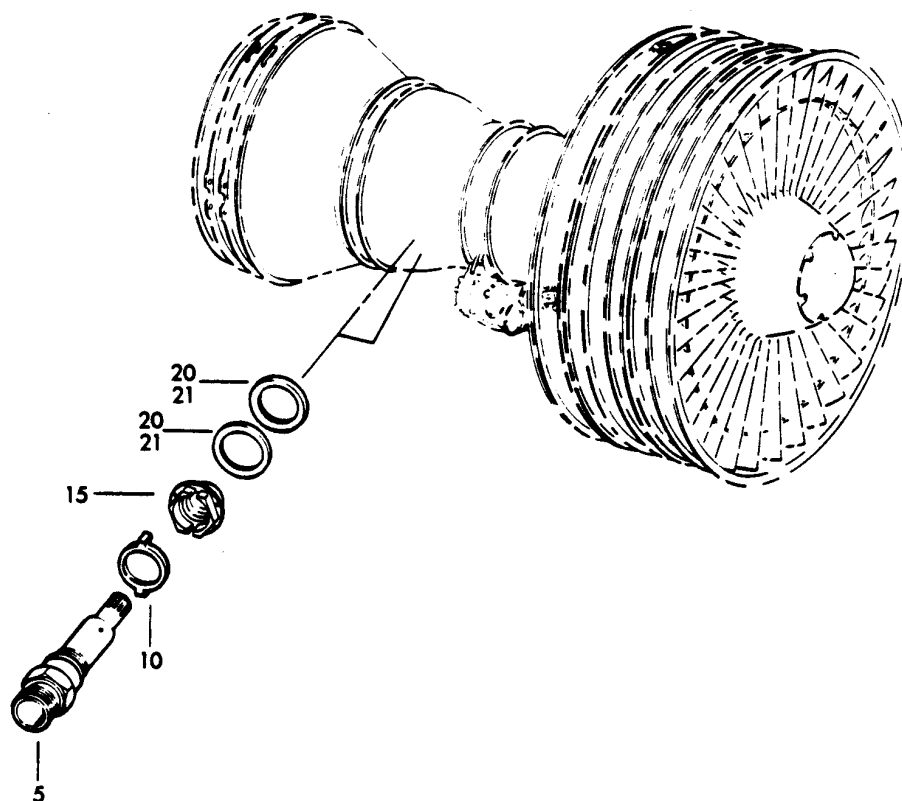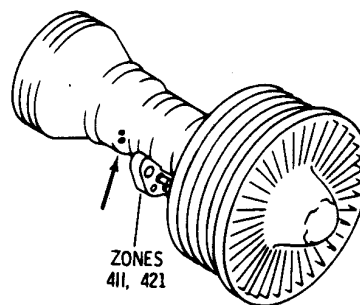

V 74210205 SHIT 1 REV 062

PLUGS-IGNITER (PW4000)
FIGURE 5

74-21-02-05

HXL
DEC 22/06

74-21-02-05
PAGE 0



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5			PLUGS-IGNITER (PW4000)		
- 1	PW4060		ENGINE- SUPPLIER CODE: V77445 CONFIG CHG DATA FROM A CMM: SEE 71-00-51 FIG. 2 FOR APPLICABLE ENGINE SERIES		RF
5	709520		.PLUG-IGNITER SUPPLIER CODE: V77445 OPTIONAL PART: AA134S1 VOAFL4 JD9 V70673		2
5	JD9		.PLUG-IGNITER SUPPLIER CODE: V70673 CONFIG CHG DATA FROM A CMM: PRATT AND WHITNEY PART NO. 709521 OPTIONAL PART: 709520 V77445 AA134S1 VOAFL4		2
5	AA134S1		.PLUG-IGNITER SUPPLIER CODE: VOAFL4 CONFIG CHG DATA FROM A CMM: PRATT AND WHITNEY PART NO. 709525 OPTIONAL PART: 709520 V77445 JD9 V70673		2
10	741074		.WASHER-KEY SUPPLIER CODE: V77445 REFERENCE SERVICE BULLETIN: 74-9 V77445		2

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED

HXL

74-21-02-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

74-21-02
FIG. 05
PAGE 1
DEC 22/07



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
15	741075		.BOSS-SPARK IGNITER SUPPLIER CODE: V77445 OPTIONAL PART: 50J855-01 V77445 PRE SERVICE BULLETIN: 74-9 V77445		2
15	50J855-01		.BOSS ASSY-SPARK IGNITER SUPPLIER CODE: V77445 OPTIONAL PART: 741075 V77445 POST SERVICE BULLETIN: 74-9 V77445		2
20	741073CL1		.SPACER-RING 1.180X 1.500X.008-.018 SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL2		.SPACER-RING .018-.028 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL3		.SPACER-RING .028-.038 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL4		.SPACER-RING .038-.048 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL5		.SPACER-RING .048-.058 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL6		.SPACER-RING .058-.068 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL7		.SPACER-RING .068-.078 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

- ITEM NOT ILLUSTRATED

HXL

74-21-02-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

74-21-02
FIG. 05
PAGE 2
DEC 22/07

 **BOEING**
767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
20	741073CL8		.SPACER-RING .078-.088 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL9		.SPACER-RING .088-.098 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL10		.SPACER-RING .098-.108 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL11		.SPACER-RING .108-.118 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL12		.SPACER-RING .118-.128 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL13		.SPACER-RING .128-.138 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL14		.SPACER-RING .138-.148 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL15		.SPACER-RING .148-.158 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL16		.SPACER-RING .158-.168 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
20	741073CL17		.SPACER-RING .168-.178 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
21	741073CL18		.SPACER-RING .178-.188 THK SUPPLIER CODE: V77445 SELECT FROM ITEM.		AR
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

74-21-02-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

74-21-02
FIG. 05
PAGE 3
DEC 22/07