


STRAIGHT HD CONNECTOR C-C MALE CRIMP  
CABLE 3.6/75 DOUBLE SCREEN PACK 20

PLUG HDC43/5GTIS

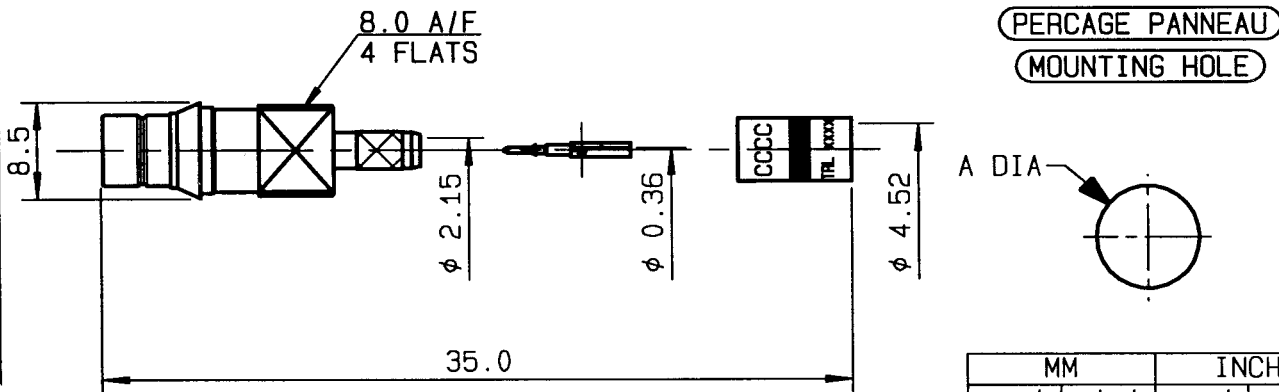

	MM		INCH	
	maxi	mini	maxi	mini
A	7.55	7.50	0.297	0.295

CABLES : BT3002

CHARACTERISTICS

NOMINAL IMPEDANCE	75	$\Omega$
FREQUENCY RANGE	0-3	GHz
TEMPERATURE RATING	-40/+100	$^{\circ}\text{C}$
VSWR	NA +	0 x F(GHz)Maxi
RF INSERTION LOSS	NA	$\sqrt{F(\text{GHz})}$ dB Maxi
VOLTAGE RATING	NA	Vrms Max
DIELECTRIC WITHSTANDING VOLTAGE	1500	Vrms min
INSULATION RESISTANCE	5000	M $\Omega$ min
HERMETIC SEAL	NA	Atm.cm3/s
LEAKAGE (pressurized only)	NA	Mpa
WEIGHT	10	gr

STANDARDISATION

CABLE RETENTION	150	N min
CENTER CONTACT RETENTION		
Axial force - mating end	22	N min
Axial force - opposite end	NA	N min
Torque (Min)	NA	cm.N min
RECOMMENDED TORQUES		
Mating	NA	cm.N
Panel nut	NA	cm.N
Clamp nut	NA	cm.N

CONSTRUCTION

CONNECTOR PARTS	MATERIALS	FINISH
BODY	BRASS	GOLD
OUTER CONTACT	-	-
CENTER CONTACT	BRASS	GOLD
INSULATOR	PTFE	-
FERRULE	BRASS	NICKEL
GROMMET	POLYACETAL	-
-	-	-
-	-	-
-	-	-


ISSUE	REVISION No	DESCRIPTION	BY	DATE
-	-	-	-	-
-	-	-	-	-
-	-	-	-	-

Initiated on 29/09/94

The information given here is subject to change without notice. Design changes may be in order to improve the product




Approval by MARTIN

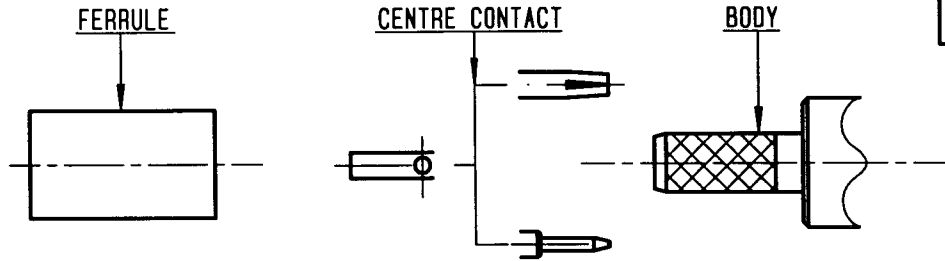

①


Slide ferrule onto cable.  
Strip cable.

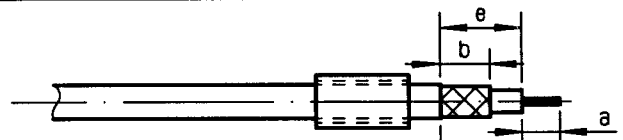

Stripping	a	b	c	d	e
inch	0.177	0.315	0.827	0	0.65
mm	4.5	8	21	-	16.5


②

Place centre contact on conductor.  
(ensure conductor is visible through inspection hole).  
Place adaptor in crimp tool.  
Insert cable into adaptor. Push home.  
Crimp centre contact.  
Crimp tool R282 281 010 (Q92434)

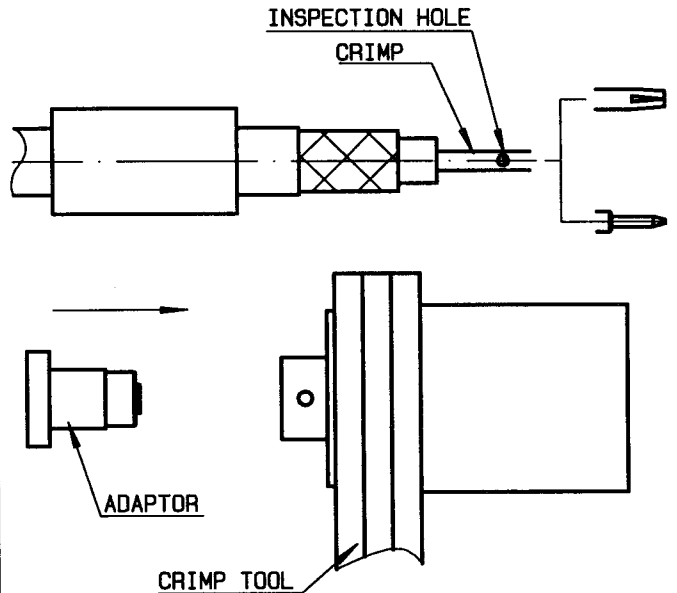

③

Guide dielectric into connector while fanning braid. Push home until centre contact 'clicks' into place.

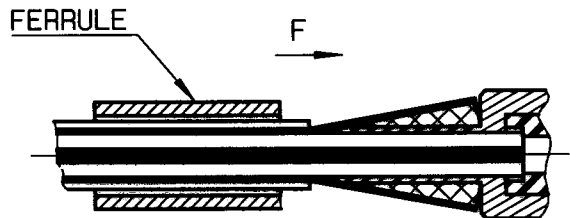

④

Slide crimp sleeve forward until sleeve butts up against body.  
Crimp ferrule.  
Crimp tool R282 287 000 (Q92316) +  
die set R282 265 002 (Q92435) (Hex. 4.52).

