
# **R3C MALE COAX CAB 5/50**

### **CONDITIONNEMENT BOBINE 2300**

R299.197.030

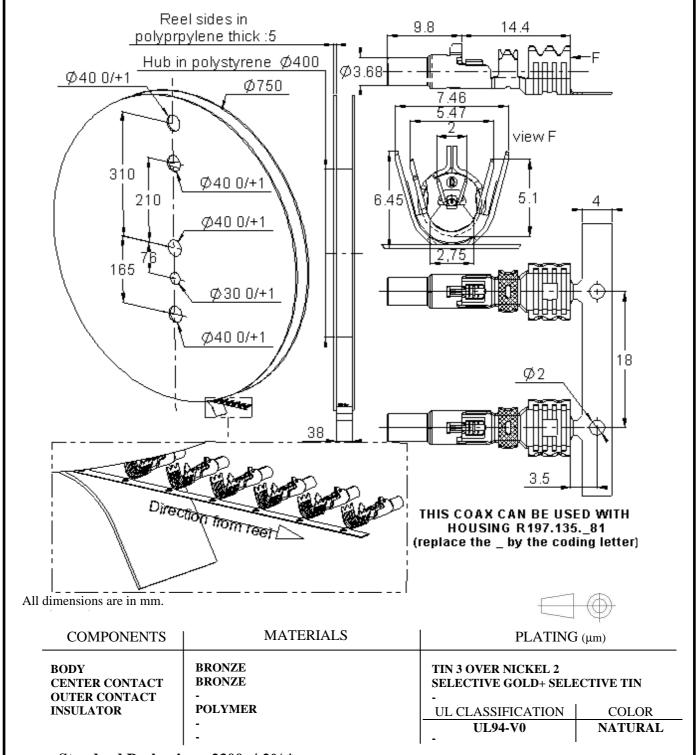

Standard Packaging: 2300+/-2%\*

**Issue:** 0748 B

In the effort to improve our products, we reserve the right to make changes judged to be necessary.




<sup>\*</sup> Nota: possibility of having a maximum of five missing parts consecutively on the tape

## **R3C MALE COAX CAB 5/50**

### **CONDITIONNEMENT BOBINE 2300**

R299.197.030

### Recommanded Stripping dimensions of the RG58 cable for R3C male R299.197.030

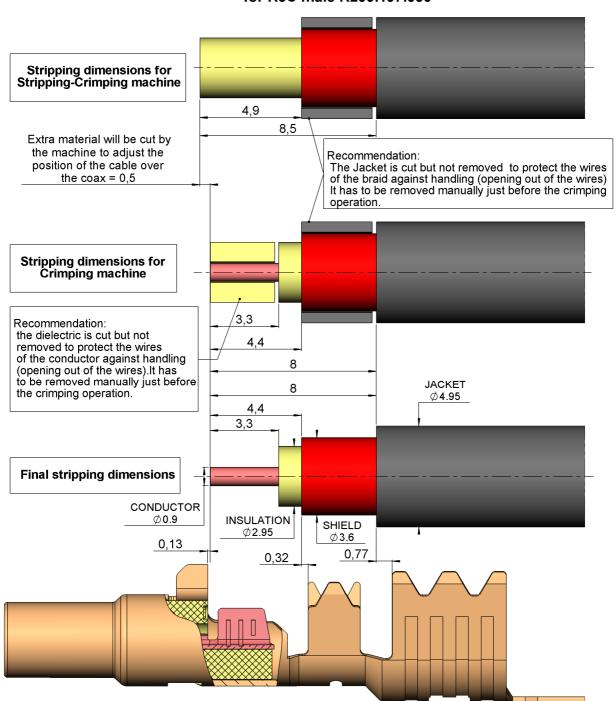



**Issue:** 0748 B

In the effort to improve our products, we reserve the right to make changes judged to be

necessary.




## **R3C MALE COAX CAB 5/50**

## **CONDITIONNEMENT BOBINE 2300**

R299.197.030

crimping height **			
conductor X	braid Y	jacket Z	conductor/body W
$1,18\pm0,05$	3,7+0,05/-0,1	4,8+0,05/-0,1	2,65±0,05

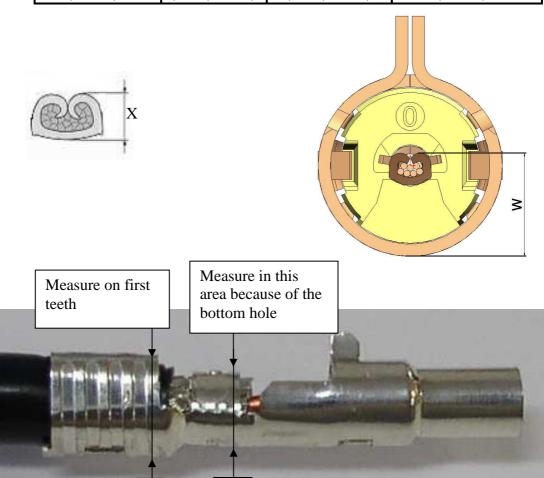

## \*\* CAUTION

- -Before using applicator, make sure the press is calibrated :135,8 mm from the lower dead point up to the base
- -Crimping height may change depending on the manufacturer of the cable, for more informations please contact us
- -We recommend to make electrical test after each set up of the applicator:

Outer and center contact continuity+Dielectric withstanding voltage 800Vrms, 50Hz Insulation resistance 1000 Mohms

Cable retention = 110Newton mini during 5 seconds with electrical continuity

**Issue:** 0748 B

In the effort to improve our products, we reserve the right to make changes judged to be necessary.

