

# TB 9-6625-2264-24

CHANGE 1

DEPARTMENT OF THE ARMY TECHNICAL BULLETIN

---

## CALIBRATION PROCEDURE FOR TEST SET, AVIATOR'S NIGHT VISION IMAGING SYSTEM, TS-3895A/UV

---

Headquarters, Department of the Army, Washington, DC  
15 October 2008

---

*Distribution Statement A: Approved for public release; distribution is unlimited.*

---

TB 9-6625-2264-24, 15 January 2008, is changed as follows:

1. Remove old pages and insert new pages as indicated below. New or changed material is indicated by a vertical bar in the margin of the page.

**Remove Pages**  
3 and 4

**Insert Pages**  
3 and 4

2. File this change sheet in front of the publication for reference purposes.

By Order of the Secretary of the Army:

Official



JOYCE E. MORROW

*Administrative Assistant to the  
Secretary of the Army*

0822603

GEORGE W. CASEY, JR.  
*General, United States Army  
Chief of Staff*

Distribution:

To be distributed in accordance with IDN 344400, requirements for calibration procedure  
TB 9-6625-2264-24.



# \*TB 9-6625-2264-24

DEPARTMENT OF THE ARMY TECHNICAL BULLETIN

## CALIBRATION PROCEDURE FOR TEST SET, AVIATOR'S NIGHT VISION IMAGING SYSTEM, TS-3895A/UV

Headquarters, Department of the Army, Washington, DC  
15 January 2008

*Distribution Statement A: Approved for public release; distribution is unlimited.*

### REPORTING OF ERRORS AND RECOMMENDING IMPROVEMENTS

You can improve this manual. If you find any mistakes or if you know of a way to improve these procedures, please let us know. Mail your letter or DA Form 2028 (Recommended Changes to Publications and Blank Forms) directly to: Commander, U.S. Army Aviation and Missile Command, ATTN: AMSAM-MMC-MA-NP, Redstone Arsenal, AL 35898-5000. A reply will be furnished to you. You may also send in your comments electronically to our E-mail address: [2028@redstone.army.mil](mailto:2028@redstone.army.mil) or by fax 256-842-6546/DSN 788-6546. For the World Wide Web use: <https://amcom2028.redstone.army.mil>. Instructions for sending an electronic 2028 can be found at the back of this manual.

SECTION			Paragraph	Page
I	IDENTIFICATION AND DESCRIPTION			
	Test instrument identification.....		1	2
	Forms, records, and reports .....		2	2
	Calibration description.....		3	2
II.	EQUIPMENT REQUIREMENTS			
	Equipment required .....		4	2
	Accessories required .....		5	3
III.	CALIBRATION PROCESS			
	Preliminary instructions.....		6	3
	Equipment setup .....		7	3
	Light level accuracy.....		8	4
	Final procedure.....		9	7

\*This bulletin supersedes TB 9-6625-2264-35, dated 9 July 2003.

## SECTION I IDENTIFICATION AND DESCRIPTION

**1. Test Instrument Identification.** This bulletin provides instructions for the calibration of Test Set, Aviator's Night Vision Imaging System, TS-3895A/UV. TM 11-5855-264-14 was used as the prime data source in compiling these instructions. The equipment being calibrated will be referred to as the TI (test instrument) throughout this bulletin.

**a. Model Variations.** None.

**b. Time and Technique.** The time required for this calibration is approximately 1 hour, using the dc and low frequency technique.

### 2. Forms, Records, and Reports

**a.** Forms, records, and reports required for calibration personnel at all levels are prescribed by TB 750-25.

**b.** Adjustments to be reported are designated (R) at the end of the sentence in which they appear. When adjustments are in tables, the (R) follows the designated adjustment. Report only those adjustments made and designated with (R).

**3. Calibration Description.** TI parameters and performance specifications which pertain to this calibration are listed in table 1.

Table 1. Calibration Description

Test instrument parameters	Performance specifications
High light ANVIS <sup>1</sup> NVG <sup>2</sup>	6.54 x 10 <sup>-9</sup> w/cm <sup>2</sup> .Sr +50% 2.41 x 10 <sup>-8</sup> w/cm <sup>2</sup> .Sr ±50%
Low light ANVIS <sup>1</sup> NVG <sup>2</sup>	2.56 x 10 <sup>-11</sup> w/cm <sup>2</sup> .Sr +32% 9.44 x 10 <sup>-11</sup> w/cm <sup>2</sup> .Sr +32%

<sup>1</sup>AN/AVS-6.

<sup>2</sup>AN/PVS-5 and -7.

## SECTION II EQUIPMENT REQUIREMENTS

**4. Equipment Required.** Table 2 identifies the specific equipment to be used in this calibration procedure. This equipment is issued with Secondary Transfer Calibration Standards Set AN/GSM-286, AN/GSM-287 and AN/GSM-705. Alternate items may be used by the calibrating activity. The items selected must be verified to perform satisfactorily prior to use and must bear evidence of current calibration. The equipment must meet or exceed the minimum use specifications listed in table 2. The accuracies listed in table 2 provide a four-to-one ratio between standard and TI. Where the four-to-one ratio cannot be met, the actual accuracy of the equipment selected is shown in parenthesis.

**5. Accessories Required.** The accessories required for this calibration are common usage accessories issued as indicated in paragraph 4 above, and are not listed in this calibration procedure. The following peculiar accessories, supplied with the standard, are also required for this calibration: Bit, tamper proof, 1/8 inch, PN MISC 003-F27503, manufacturer: Corland; and lens cap/target, APN 13440044.

Table 2. Minimum Specifications of Equipment Required

Common name	Minimum use specifications	Manufacturer and model (part number)
NIGHT VISION DEVICE DETECTOR STANDARD	Wavelength range: 305 to 1000 nm wavelength peak response: 720 nm $\pm$ 50 Responsivity: $4.73 \times 10^7$ V/W.cm <sup>2</sup> .Sr <sup>1</sup> at 820 nm $\pm$ 10% Dynamic range: $1.0 \times 10^{-12}$ to $5.0 \times 10^{-8}$ w/cm <sup>2</sup> .Sr at 820 nm Gain (elect): $10^9$ V/A	13335470 (13335470)
MULTIMETER	Range: 0.82 mV to 1.71 V dc Resolution: 0.1 mV	Agilent, Model 3458A (3458A)

### SECTION III CALIBRATION PROCESS

#### 6. Preliminary Instructions

a. The instructions outlined in paragraphs 6 and 7 are preparatory to the calibration process. Personnel should become familiar with the entire bulletin before beginning calibration.

b. Items of equipment used in this procedure are referenced within the text by common name as listed in table 2.

c. Unless otherwise specified, verify the result of each test and, whenever the test requirement is not met, take corrective action before continuing with the calibration. Adjustments required to calibrate the TI are included in this procedure. Additional maintenance information is contained in TM 11-5855-264-14 for this TI.

d. Unless otherwise specified, all controls and control settings refer to the TI.

#### 7. Equipment Setup

##### WARNING

HIGH VOLTAGE is used or exposed during the performance of this calibration. DEATH ON CONTACT may result if personnel fail to observe safety precautions. REDUCE OUTPUT(S) to minimum after each step within the performance check where applicable.

- a. Remove protective cover from TI as necessary to gain access to adjustments.
- b. Ensure the **ON-OFF-POWER CHECK** switch is in the **OFF** position.
- c. Connect TI to appropriate power source.

## 8. Light Level Accuracy

### NOTE

If the night vision device detector standard is exposed to overload light conditions, several minutes are needed in low light level conditions for the night vision device detector standard to recover.

#### a. Performance Check

(1) Connect multimeter **Input HI and LO** to night vision device detector standard BNC CONNECTOR (fig. 1).

(2) Install night vision device detector standard into TI RIGHT TEST PORT (fig. 1). Install lens cap/target over TI LEFT TEST PORT (fig. 1).

(3) Turn night vision device detector standard power ON/OFF SWITCH (fig. 1) to **ON** and allow night vision detector standard to warm-up 5 minutes and record multimeter indication.

### NOTE

Multimeter must not be in autoranging.

(4) Set TI **ON-OFF-POWER CHECK** switch to **ON** and rotate selector switch to **LOW LIGHT LEVEL RESOLUTION**.

(5) Pull TI ANVIS/NVG GOGGLE SWITCH (fig. 2) to **NVG** (up) position. If multimeter does not indicate between 3.04 and 5.90 mV dc after algebraically subtracting indication recorded in (3) above, perform **b** (1), (2), and (4) below.

(6) Push TI ANVIS/NVG GOGGLE SWITCH (fig. 2) to **ANVIS** (down) position. If multimeter does not indicate between 0.82 and 1.60 mV dc after algebraically subtracting indication recorded in (3) above, perform **b** (1), (3), and (4) below.

(7) Remove lens cap/target from TI Left Test Port (fig. 1) and remove night vision device detector standard from RIGHT TEST PORT (fig. 1) and install in TI LEFT TEST PORT (fig. 1). Install lens cap/target over TI RIGHT TEST PORT (fig. 1).

(8) Repeat (5) and (6) above.

(9) Rotate TI selector switch to **SELF TEST. GO** (green) light will illuminate.

(10) Rotate TI selector switch to **HIGHLIGHT LEVEL RESOLUTION**.

(11) Pull TI ANVIS/NVG GOGGLE SWITCH (fig. 2) to **NVG** (up) position. Multimeter will indicate between 0.570 and 1.710 V dc.

(12) Push TI ANVIS/NVG GOGGLE SWITCH (fig. 2) to **ANVIS** (down) position. Multimeter will indicate between 0.155 and 0.464 V dc.

(13) Remove lens cap/target from TI RIGHT TEST PORT (fig. 1) and remove night vision device detector standard from LEFT TEST PORT (fig. 1) and install in TI RIGHT TEST PORT (fig. 1). Install lens cap/target over LEFT TEST PORT (fig. 1).

(14) Repeat (11) and (12) above.

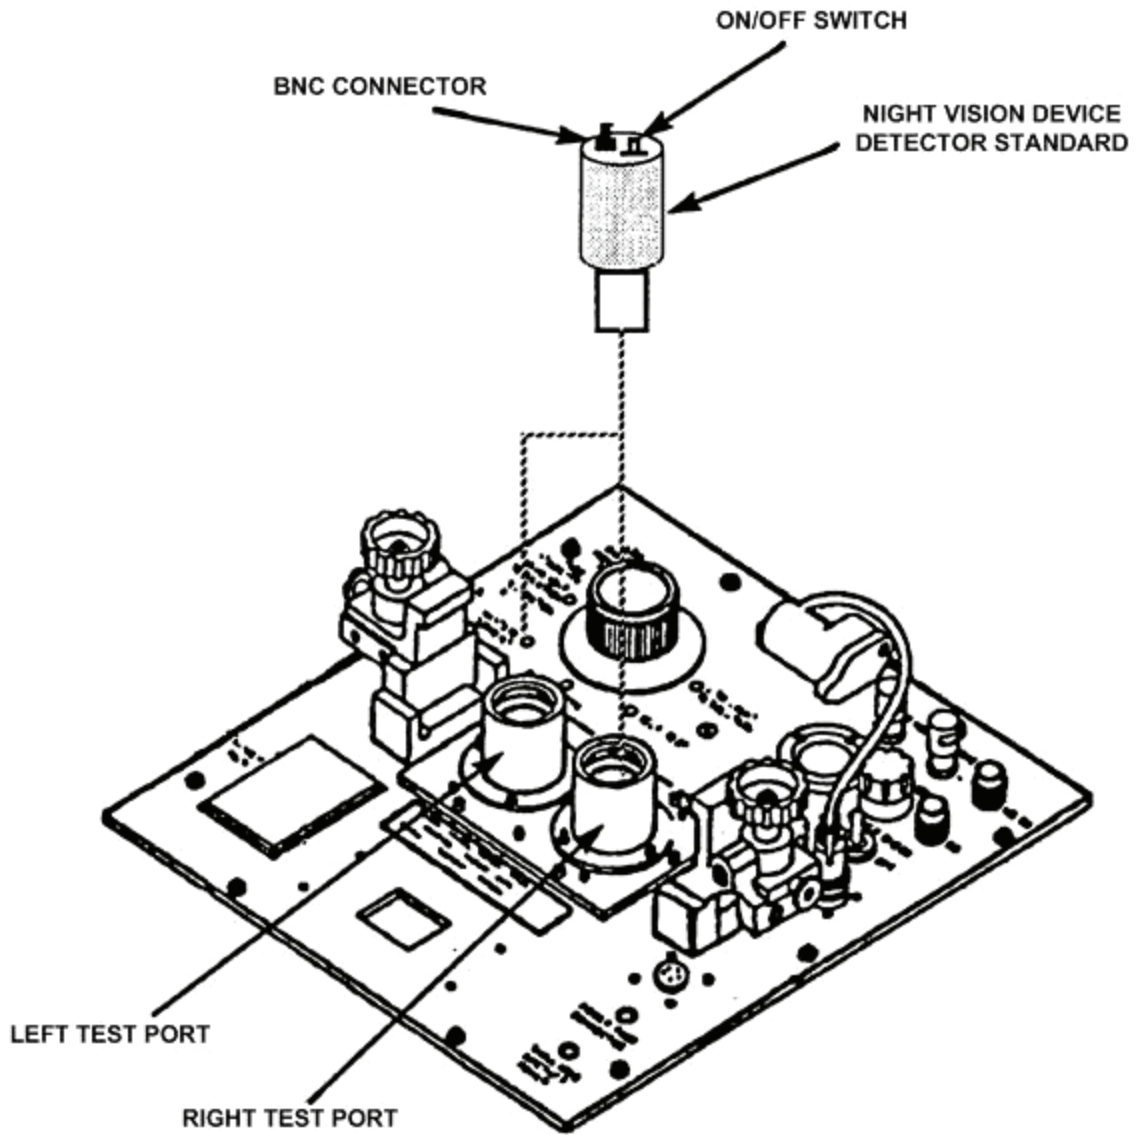


Figure 1. TS-3895A/UV control panel.

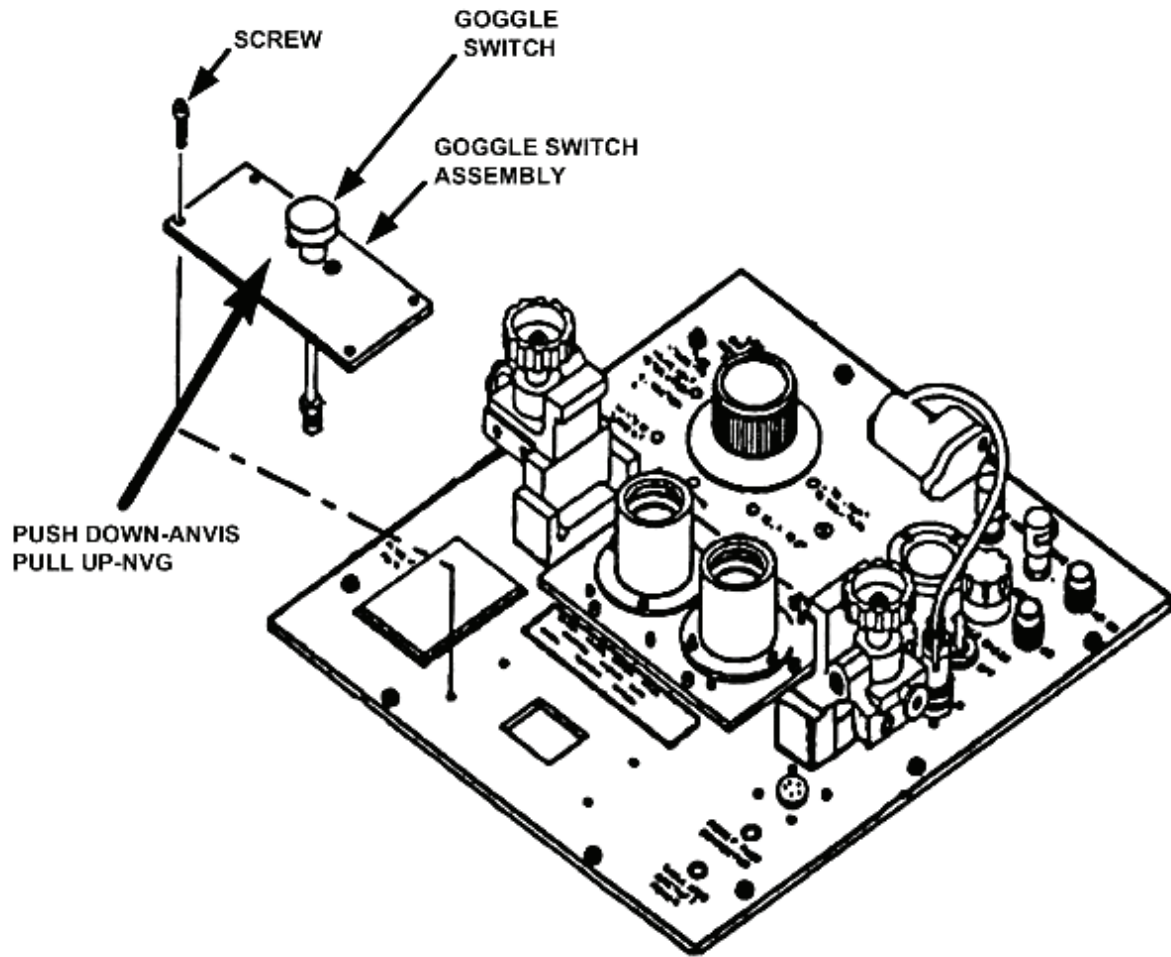


Figure 2. TS-3895A/UV control panel.



**b. Adjustments**

**NOTE**

TI low light level adjustments may affect TI high light level indications. It may be necessary to make adjustments for best compromise.

- (1) Remove GOGGLE SWITCH ASSEMBLY (fig. 2) using tamper-proof bit.

**NOTE**

Temporarily install GOGGLE SWITCH ASSEMBLY (fig. 2) after making adjustment.

- (2) Adjust R43 (fig. 3) for a 4.47 mV dc multimeter indication (R).
- (3) Press S1 micro switch (fig. 3) and adjust R44 (fig. 3) for a 1.21 mV dc multimeter indication (R). Temporarily install goggle switch assembly (fig. 2) with ANVIS/NVG goggle switch (fig. 2) in the down position.
- (4) Install goggle switch assembly (fig. 2) using tamper proof bit.

**9. Final Procedure**

- a. Deenergize and disconnect all equipment.
- b. Annotate and affix DA label/form in accordance with TB 750-25.

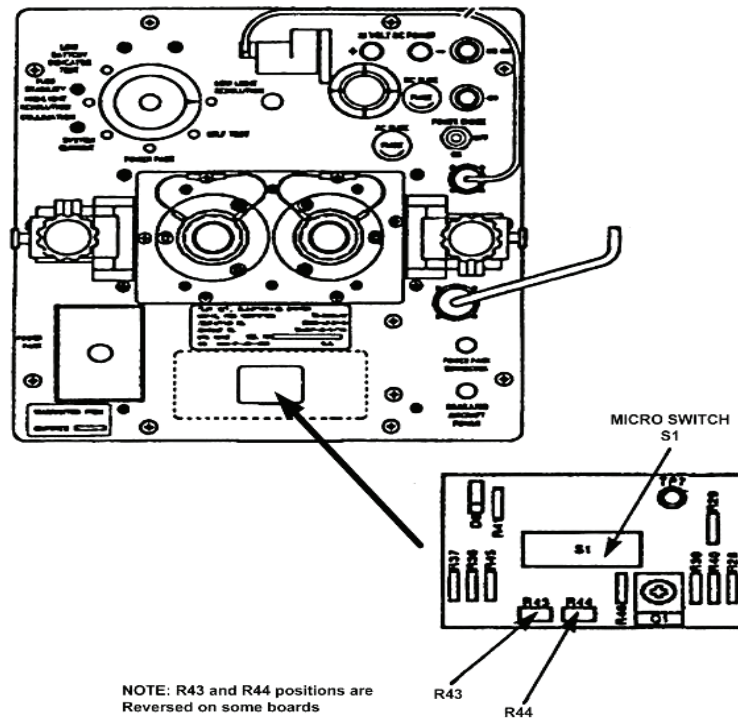


Figure 3. TS-3895A/UV - adjustment locations.



By Order of the Secretary of the Army:

Official:

GEORGE W. CASEY, JR.  
*General, United States Army*  
*Chief of Staff*



JOYCE E. MORROW  
*Administrative Assistant to the*  
*Secretary of the Army*

0733208

Distribution:

To be distributed in accordance with initial distribution number (IDN) 344400, requirements for calibration procedure TB 9-6625-2264-24.



### **Instructions for Submitting an Electronic 2028**

The following format must be used if submitting an electronic 2028. The subject line must be exactly the same and all fields must be included; however, only the following fields are mandatory: 1, 3, 4, 5, 6, 7, 8, 9, 10, 13, 15, 16, 17, and 27.

From: "Whomever" [whomever@redstone.army.mil](mailto:whomever@redstone.army.mil)

To: <2028@redstone.army.mil

Subject: DA Form 2028

1. **From:** Joe Smith
2. **Unit:** home
3. **Address:** 4300 Park
4. **City:** Hometown
5. **St:** MO
6. **Zip:** 77777
7. **Date Sent:** 19-OCT -93
8. **Pub no:** 55-2840-229-23
9. **Pub Title:** TM
10. **Publication Date:** 04-JUL-85
11. **Change Number:** 7
12. **Submitter Rank:** MSG
13. **Submitter FName:** Joe
14. **Submitter MName:** T
15. **Submitter LName:** Smith
16. **Submitter Phone:** 123-123-1234
17. **Problem:** 1
18. **Page:** 2
19. **Paragraph:** 3
20. **Line:** 4
21. **NSN:** 5
22. **Reference:** 6
23. **Figure:** 7
24. **Table:** 8
25. **Item:** 9
26. **Total:** 123
27. **Text**

This is the text for the problem below line 27.





