# TECHNICAL MANUAL

OPERATOR'S, UNIT AND
DIRECT SUPPORT MAINTENANCE MANUAL
(INCLUDING REPAIR PARTS AND SPECIAL TOOLS LIST)
FOR

# KOEHLER CLOSED CUP FLASH TESTER

This technical manual is an authentication of the manufacturer's commercial literature and does not conform with the format and the content requirements normally associated with Army technical manuals. This technical manual does, however, contain all essential information required to operate and maintain the equipment.

Approved for public release; distribution is unlimited.

HEADQUARTERS, DEPARTMENT OF THE ARMY
28 SEPTEMBER 1990

This technical manual is an authentication of the manufacturer's commercial literature and does not conform with the format and the content requirements normally associated with Army technical manuals. This technical manual does, however, contain all essential information required to operate and maintain the equipment.

# Approved for public release; distribution is unlimited.

### SUPPLEMENTARY INTRODUCTORY MATERIAL

1–1. Maintenance Forms and Records.

Department of the Army forms and procedures used for equipment maintenance will be those described by DA Pam 738–750, The Army Maintenance Management System.

1–2. Reporting Errors and Recommending Improvements.

You can help improve this manual. If you find any mistakes or if you know of a way to improve the procedures, please let us know. Mail your letters, DA Form 2028 (Recommended Changes to Publications and Blank Forms), or DA Form 2028–2 located in the back of this manual, directly to: Commander, U.S. Army Troop Support Command, ATTN: AMSTR-MCTS, 4300 Goodfellow Blvd., St. Louis, MO 63120–1798. A reply will be furnished to you.

1–3. Destruction of Army Material to Prevent Enemy Use.

Refer to TM 750-244-3 for instructions covering the destruction of Army Material to prevent enemy use.

- 1-4. Administrative Storage of Equipment.
- a. Placement of equipment in administrative storage should be for short periods of time when a shortage of maintenance effort exists. Items should be in mission readiness within 24 hours or within the time factors as determined by the directing authority. During the storage period appropriate maintenance records will be kept.
- b. Before placing equipment in administrative storage, current preventive maintenance checks and services should be completed. Shortcomings and deficiencies should be corrected, and all modification work orders (MWO'S) should be applied.
- c. Storage site selection. Inside storage is preferred for items selected for administrative storage. If inside storage is not available, trucks, vans, conex containers and other containers may be used.



PRODUCT: Flash Point by Tag Closed Tester

Tag Closed Cup Flash Tester

- Conforms to ASTM D56, FTM 791-1101 and related specifications
- Gas, electrical or alcohol heating
- Flash points below 200°F (93°C)

Determines flash points of liquid products, except cutback asphalts, having flash points below 200°F (93°C). (For viscous products, products tending to form a surface film during testing and materials which contain suspended solids, use the Pensky Martens flash tester. For cutback asphalts use the Tag Open Cup tester).

Features stepless variable heat control with reference dial for convenient, accurate repeat setting of temperature rate of rise per specifications. Also available with gas or alcohol burner instead of electric heater. Precision machined cover mechanism simultaneously opens slide shutter and applies test flame to sample at the turn of a knob. Includes liquid bath with constant level overflow, brass test cup, plated brass thermometer ferrules and test flame reference bead. Bath and cover mechanism are constructed of plated brass. Heater is enclosed in a cast aluminum base assembly.

### SPECIFICATIONS

Conforms to the specifications of:

ASTM D56, FTM 791-1101, IP 304

DIMENSIONS 1 x w x  $h^*$ , in. (cm)

5 X 5 X 16 (13 X 13 X 41)
\*with thermometers inserted

# SHIPPING INFORMATION

Net Weight: 7 lbs (3.2 kg)

Shipping Weight: 8 lbs (3.6 kg)

Dimensions:  $12 \times 10 \times 11''$  (31 x 25 x 28 cm)

### ORDERING INFORMATION

Includes heater unit with electric heater or gas or alcohol burner. Order thermometers separately.

### Catalog


K14600	Tag	Closed	Cup	Flash	Tester,	
	Electrically Heated					

No. Description

115V 50/60 Hz
K14670 Tag Closed Cup Flash Tester,
Electrically Heated
220-240V 50/60 Hz

K14690 Tag Closed Cup Flash Tester, Gas Heated

K14680 Tag Closed Cup Flash Tester, Alcohol Heated K14510 COVER ASSEMBLY (WITH SLIDE SHUTTER, BURNER AND THERMOMETER

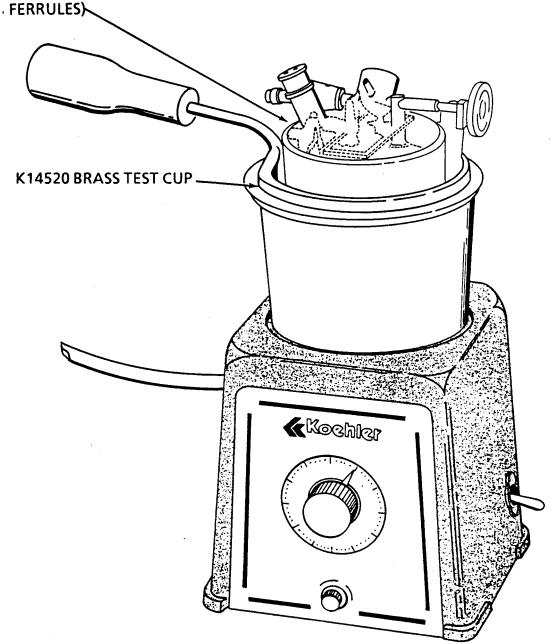

250-000-095 ASTM 9F THERMOMETER (20 TO 230° F) 250-000-9C ASTM 9C THERMOMETER ( – 5 TO 110° C) 250-000-57F ASTM 57F THERMOMETER ( – 4 TO 122° F) 250-000-57C ASTM 57C THERMOMETER ( – 20 to 50° C)

KOEHLER K14600 TAG CLOSED CUP FLASH TESTER, ELECTRICALLY HEATED, 115 V 50/60 HZ

# Accessories and Replacement Parts

- K14520 Brass Test Cup
  With heat resistant handle
- K14550 Carrying Case Wood construction
- 250-000-09F ASTM 9F Thermometer Range: 20 to 230°F
- 250-000-09C ASTM 9C Thermometer Range: -5 to +110°C
- 250-000-57F ASTM 57F Thermometer Range: -4 to +122°F
- 250-000-57C ASTM 57C Thermometer Range: -20 to +50°C

# APPENDIX A

# **REFERENCES**

A-1. **Scope.** This appendix contains all forms, pamphlets and technical manuals referenced in both the Air mobile and Semitrailer mounted Laboratories.

# A-2. Forms.

Recommended Changes to Publications	DA Form 2028 DA Form 2028–2
Quality Deficiency Report	SF 368
Equipment Inspection and Maintenance Work Sheet	
Hand Receipts	
A-3. Field Manuals.	
Petroleum Testing Facilities:	EN40. 70
Laboratories and Kits	
Inspecting and Testing Petroleum Products	
ASTM Test Method Supplement to	FIWI 10-9201/02
Atlas-Copco Compressor	TM 10-4310-392-13&P
Alcor Jet Fuel Thermal Oxidation Tester Operating	TM 40 0005 040 400 B
and Maintenance Manual	
Bacharach Gas Alarm and Calibration Data	
Brother Portable Typewriter	
Elkay Manufacturing 30 GPH Cooler	
Emcee Micro-Separometer	
Foxboro Pressure Recording Gauge	
Gammon Aqua Glo Water Detector	
Gammon Mini Monitor Fuel Sampling Kit	
Jelrus Burn–Out Furnace	
Koehler Cleveland Open Tester	
Koehler Cloud and Pour Point Chamber	TM 10-6630-238-13&P
Koehler Copper Strip Corrosion Bomb Bath	TM 10-6640-220-13&P
Koehler Distillation Apparatus	TM 10-6630-233-13&P
Koehler Dropping Point Apparatus	
Koehler Electric Pensky–Martins Tester	
Koehler Foaming Characteristics Determination Apparatus	
Koehler Kinematic Viscosity Bath	
Koehler Tag Closed Cup Flash Tester	
Lab-Line Explosion Proof Refrigerator	
Lily Freezer	
Millipore OM 39 Filter Holder	
Millipore Vacuum Pump	
Ohaus Harvard Trip Balance	
Precision Gas-Oil Distillation Test Equipment	
i ieolololi Gelielai Fulpose Walei Dalli	1W 10-0040-229-13QP

# TM 10-6630-235-13&P

Precision High Temperature Bronze Block Gum Bath	. TM	10-6630-234-13&P
Precision General Purpose Ovens	TM	10-6640-218-13&P
Precision Heater Instruction Manual and Parts List	. TM	10-6640-223-13&P
Precision Oxidation Stability Bath	TM	10-6640-232-13&P
Precision Pensky–Martens Flash Testers	TM	10-6630-231-13&P
Precision Reid Vapor Pressure Bath	TM	10-6640-226-13&P
Precision Slo-Speed Stirrer	TM	10-6640-224-13&P
Precision Universal Centrifuge	TM	10-6640-230-13&P
Precision Universal Penetrometer	TM	10-6640-228-13&P
Sargent–Welch Vacuum Pump	TM	10-4310-391-13&P
Sartorious Analytical Balance	TM	10-6670-277-13&P
Scotsman Cuber	TM	10-6640-227-13&P
Soltec VOM–Multimeter	TM	10-6625-3127-13&P
Teel Self-Priming Centrifugal Pump	TM	10-6640-217-13&P
Teel Submersible Pump	TM	10-4320-320-13&P
Texas Instrument TI–5030II Calculator	TM 1	0-7420-210-13&P
A-5. Pamphlets.		
The Army Maintenance Management System (TAMMS)		DA Pam 738-750
A-6. Miscellaneous Publications.		
The Army Integrated Publishing and Printing Program		
Apparatus, Instruments, Chemicals, Furniture, and Supplies for Industrial,		L 02/00/ ((WL)
Clinical, College and Government Laboratories Fisher Scie	entific	Laboratories Catalog
Petroleum—Petrochemical Testing Equipment		
		<b>o</b>

### APPENDIX B

### MAINTENANCE ALLOCATION CHART

### Section I. INTRODUCTION

### B-1. General.

- a. This section provides a general explanation of all maintenance and repair functions authorized at various maintenance categories.
- b. The Maintenance Allocation Chart (MAC) in Section II designates overall authority and responsibility for the performance of maintenance functions on the identified end item or component. The application of the maintenance functions to the end item or component will be consistent with the capacities and capabilities of the designated maintenance categories.
- c. Section III lists the tools and test equipment (both special tools and common tool sets) required for each maintenance function as referenced from Section II.
- d. Section IV contains supplemental instructions and explanatory notes for a particular maintenance function.
- B-2. **Maintenance Functions.** Maintenance functions will be limited to and defined as follows:
- a. <u>Inspect.</u> To determine the serviceability of an item by comparing its physical, mechanical, and/or electrical characteristics with established standards through examination (e.g., by sight, sound, or feel).
- b. <u>Test.</u> To verify serviceability by measuring the mechanical, pneumatic, hydraulic, or electrical characteristics of an item and comparing those characteristics with prescribed standards.
- c. <u>Service.</u> Operations required periodically to keep an item in proper operating condition, i.e., to clean (includes decontaminate, when required), to preserve, to drain, to paint, or to replenish fuel, lubricants, chemical fluids, or gases.
- d. <u>Adjust.</u> To maintain or regulate, within prescribed limits, by bringing into proper or exact position, or by setting the operating characteristics to specified parameters.
- e. <u>Align.</u> To adjust specified variable elements of an item to bring about optimum or desired performance.
- f. <u>Calibrate</u>. To determine and cause corrections to be made or to be adjusted on instruments or test, measuring, and diagnostic equipments used in precision measurement. Consists of comparisons of two instruments, one of which is a certified standard of knob accuracy, to detect and adjust any discrepancy in the accuracy of the instrument being compared.
- g. <u>Remove/Install.</u> To remove and install the same item when required to perform service or other maintenance functions. Install may be the act of emplacing, seating, or fixing into position a spare, repair part, or module (component or assembly) in a manner to allow the proper functioning of an equipment or system.
- *h.* <u>Replace.</u> To remove an unserviceable item and install a serviceable counterpart in its place. "Replace" is authorized by the MAC and is shown as the third position code of the SMR code.

- i. <u>Repair.</u> The application of maintenance services, <sup>1</sup> including fault location/troubleshooting, <sup>2</sup> removal/installation, and disassembly/assembly procedures, <sup>3</sup> and maintenance actions, <sup>4</sup> to identify troubles and restore serviceability to an item by correcting specific damage, fault, malfunction, or failure in a part, subassembly, module (component or assembly), end item, or system.
- *j. Overhaul.* That maintenance effort (service/action) prescribed to restore an item to a completely serviceable/operational condition as required by maintenance standards in appropriate technical publications (i.e, DMWR). Overhaul is normally the highest degree of maintenance performed by the Army. Overhaul does not normally return an item to like—new condition.
- *k.* Rebuild. Consists of those services/actions necessary for the restoration of unserviceable equipment to a like–new condition in accordance with original manufacturing standards. Rebuild is the highest degree of materiel maintenance applied to Army equipment. The rebuild operation includes the act of returning to zero those age measurements (hours/miles, etc.) considered in classifying Army equipment/components.

# B-3. Explanation Of Columns In The MAC, Section II.

- a. <u>Column 1. Group Number</u>. Column 1 lists functional group code numbers, the purpose of which is to identify maintenance significant components, assemblies, subassemblies, and modules with the next higher assembly. End item group number shall be "00."
- b. <u>Column 2. Component/Assembly.</u> Column 2 contains the names of components, assemblies, subassemblies, and modules for which maintenance is authorized.
- c. <u>Column 3. Maintenance Function</u>. Column 3 lists the functions to be performed on the item listed in column 2. (For a detailed explanation of these functions, see paragraph B 2.)
- d. <u>Column 4. Maintenance Category.</u> Column 4 specifies, by the listing of a work time figure in the appropriate subcolumn(s), the category of maintenance authorized to perform the function listed in column 3. This figure represents the active time required to perform that maintenance function at the indicated category of maintenance. If the number or complexity of the tasks within the listed maintenance function vary at different maintenance categories, appropriate work time figures will be shown for each category. The work time figure represents the average time required to restore an item (assembly, subassembly, component, module, end item, or system) to a serviceable condition under typical field operating conditions. This time includes preparation time (including any necessary disassembly/ assembly time), troubleshooting/fault location time, and quality assurance/quality control time in addition to the time required to perform the specific tasks identified for the maintenance functions authorized in the maintenance allocation chart. The symbol designations for the various maintenance categories are as follows:

<sup>&</sup>lt;sup>1</sup>Services - inspect, test, service, adjust, align, calibrate, and/or replace.

<sup>&</sup>lt;sup>2</sup> Fault locate/troubleshoot - the process of investigating and detecting the cause of equipment malfunctioning; the act of isolating a fault within a system or unit under test (UUT).

<sup>&</sup>lt;sup>3</sup> Disassemble/assemble - encompasses the step-by-step taking apart (or breakdown) of a spare/functional group coded item to the level of its least componency identified as maintenance significant (i. e., assigned an SMR code) for the category of maintenance under consideration,

<sup>\*</sup>Actions - welding, grinding, riveting, straightening, facing, remachining, and/or resurfacing.

C	Operator/Crew
0	Unit Maintenance
F	Direct Support Maintenance
H	General Support Maintenance
D	Depot Maintenance

- e. <u>Column 5. Tools and Equipment.</u> Column 5 specifies, by code, those common tool sets (not individual tools) and special tools, TMDE, and support equipment required to perform the designated function.
- f. <u>Column 6. Remarks</u>. This column shall, when applicable, contain a letter code, in alphabetic order, which shall be keyed to the remarks contained in section IV.

### B-4. Explanation Of Columns In Tool And Test Equipment Requirements, Section III.

- a. <u>Column 1. Reference Code</u>. The tool and test equipment reference code correlates with a code used in the MAC, section II, column 5.
- b. <u>Column 2. Maintenance Category.</u> The lowest category of maintenance authorized to use the tool or test equipment.
  - c. <u>Column 3. Nomenclature</u>. Name or identification of the tool or test equipment.
  - d. <u>Column 4. National Stock Number</u>. The National stock number of the tool or test equipment.
  - e. Column 5. Tool Number. The manufacturer's part number.

# B-5. Explanation Of Columns In Remarks, Section IV.

- a. Column I. Reference Code. The code recorded in column 6, Section II.
- b. <u>Column 2. Remarks</u>. This column lists information pertinent to the maintenance function being performed as indicated in the MAC, section II.

### Section II. MAINTENANCE ALLOCATION CHART

(1) GROUP NUMBER	(2) COMPONENT/ ASSEMBLY	(3) MAINTENANCE FUNCTION		MAINT NIT	(4) ENAN DS F	CE L	EVEL DEPOT D	(5) TOOLS AND EQUIPMENT	(6) REMARKS
01	TESTER FLASH POINT CLOSED, TAG	INSPECT REPLACE REPAIR	0.3	<b>0.3</b> 1.5				1, 2	А

 $\mbox{TM10-6630-235-13\&P}$  SECTION III. TOOL AND TEST EQUIPMENT REQUIREMENTS FOR

MAINTENANCE ALLOCATION CHART

O,F

(1) (2) (3) (4) (5) TOOL/TEST EQUIP. MAINTENANCE NOMENCLATURE REF CODE CATEGORY NSN TOOL NUMBER O,F TOOL KIT, GENERAL AUTOMOTIVE 5180-00-177-7033 (50980) SC 5180-90-CL-N26

MULTIMETER, 0-500V

6625-00-691-2453

SECTION IV. REMARKS

REFERENCE

2

CODE REMARKS

A REPAIR LIMITED TO REPLACEMENT OF PARTS.

### APPENDIX C

# COMPONENTS OF END ITEM AND BASIC ISSUE ITEMS LISTS Section I. INTRODUCTION

### C-1. Scope.

This appendix lists components of end item and basic issue items for the Flash Point Closed Tester to help you inventory items required for safe and efficient operation.

### C-2. General.

The Components of End Item and Basic Issue Items Lists are divided into the following sections:

- a. <u>Section II. Components of End Item.</u> This listing is for informational purposes only, and is not authority to requisition replacements. These items are part of the end item, but are removed and separately packaged for transportation or shipment. As part of the end item, these items must be with the end item whenever it is issued or transferred between property accounts. Illustrations are furnished to assist you in identifying the items.
- b. <u>Section III. Basic Issue Items</u>. These are the minimum essential items required to place the Flash Point Closed Tester in operation, to operate it, and to perform emergency repairs. Although shipped separately packaged, Bll must be with the shelter during operation and whenever it is transferred between property accounts. The illustrations will assist you with hard-to-identify items. This manual is your authority to request/requisition replacement Bll, based on TOE/MTOE authorization of the end item.

### C-3. Explanation of Columns.

The following provides an explanation of columns found in the tabular listings:

- a. <u>Column (1) Illustration Number (Illus Number)</u>. This column indicates the number of the illustration in which the item is shown.
- b. <u>Column (2) National Stock Number</u>. Indicates the National stock number assigned to the item and will be used for requisitioning purposes.
- c. <u>Column (3) Description</u>. Indicates the Federal item name and, if required, a minimum description to identify and locate the item. The last line for each item indicates the CAGEC (in parentheses) followed by the part number.
- d. <u>Column (4) Unit of Measure (U/M)</u>. Indicates the measure used in performing the actual operational/maintenance function. This measure is expressed by a two-character alphabetical abbreviation (e.g., ea, in, pr).
- e. <u>Column (5) Quantity required (QTY RQR</u>). Indicates the quantity of the item authorized to be used with/on the equipment.

### SECTION II. COMPONENTS OF END ITEM

(1)	(2)	(3)		(4)	(5)
	NATIONAL STOCK	DESCRIPTION	USABLE		
ILLUS	NUMBER	CAGEC AND PART NUMBER	ON CODE	U/M	QTY
		THERMOMETER RANG: 20 TO 230 °F (23035) 250-000-09F		EA	1
		THERMOMETER RANGE: -5 TO 110 °C (23035) 250-000-09C		EA	1
		THERMOMETER RANGE: -4 TO 122 °F (23035) 250-000-57F		EA	1
		THERMOMETER RANGE: $-20$ TO $+50$ $^{\circ}$ C (23035) 250-000-57C		EA	1
		SECTION III. BASIC ISSUE ITEMS			
		NOT APPLICABLE			

# APPENDIX D ADDITIONAL AUTHORIZATION LIST

# **NOT APPLICABLE**

# APPENDIX E EXPENDABLE/DURABLE SUPPLIES AND MATERIALS LIST

# **NOT APPLICABLE**

# By Order of the Secretary of the Army:

# CARL E. VUONO

General, United States Army Chief of Staff

### Official:

# THOMAS F. SIKORA

Brigadier General, United States Army The Adjutant General

### **DISTRIBUTION:**

To be distributed in accordance with DA Form 12–21A, Operator, Unit and Direct Support Maintenance requirements for Laboratory, Petroleum, MTD

**☆**U.S. GOVERNMENT PRINTING OFFICE: 1990 554-123/20057



# SOMETHING WRONG WITH THIS PUBLICATION?

THEN. . JOT DOWN THE DOPE ABOUT IT ON THIS FORM, CAREFULLY TEAR IT OUT, FOLD IT AND DROP IT IN THE MAIL!

FROM: (PRINT YOUR UNIT'S COMPLETE ADDRESS) PFC JOHN DOE COA, 34 ENGINEER BN

**PUBLICATION NUMBER** 

ALONG PERFORATED LINE

TM 10-6630-235-13&P

**PUBLICATION DATE** 

**PUBLICATION TITLE** 

28 SEPT 1990

KOEHLER CLOSED CUP FLASH TESTER

1 1/1	10-0030	J-255-1.	σαΓ	28 Si	EPI 1990	KOEHLER CLOSED CUP FLASH TESTER
	T. PIN-P		RE IT IS	IN THIS SPACE		
PAGE NO.	PARA- GRAPH	FIGURE NO	TABLE NO	b Cyle set on Clarge Cylend	e 6 g adustic ly h	paragraph 2-10 the total the engine on my as 4 Cylinders. manual to show L
81		4-3		pointe to fig a s	whe 4 him.	n figure 4-3 ia ta bolt. In key 1-3, item 16 is Cellel Please Correct other.
125	le	ne «	20	19 on 2910- gask	figure 100 - 70 sty & st	pasket, item pre B-16 by NSN 62-3001. I got a it it dresn't fit. Payo I got What so the NSN is lease give me a
PRINTED I	NAME, GRAD	E OR TITLE	AND TELEP	ONE NUMBER	SIGN	ENE STYLL BOE
JOHA	DOE	, PFC	(268)	317.7111	Jo	MNDOE

DA 1 JUL 79 2028-2

JOHN DOE, PFC (268) 317.7111 PREVIOUS EDITIONS ARE OBSOLETE.

DRSTS-M Overprint 1, 1 Nov 80

P.S.--IF YOUR OUTFIT WANTS TO KNOW ABOUT YOUR RECOMMENDATION MAKE A CARBON COPY OF THIS AND GIVE IT TO YOUR HEADQUARTERS.

REVERSE OF DA FORM 2028-2 REVERSE OF DRSTS-M OVERPRINT 2, 1 NOV 80

TEAR ALONG PERFORATED LINE

FILL IN YOUR UNIT'S ADDRESS

FOLD BACK

DEPARTMENT OF THE ARMY

**OFFICIAL BUSINESS** 

COMMANDER
U.S. ARMY TROOP SUPPORT COMMAND
ATTN: AMSTR-MCTS
4300 GOODFELLOW BOULEVARD
ST. LOUIS, MO 63120-1798

# RECOMMENDED CHANGES TO EQUIPMENT TECHNICAL PUBLICATIONS



# SOMETHING WRONG

WITH THIS PUBLICATION?

THEN. JOT DOWN THE DOPE ABOUT IT ON THIS FORM. CAREFULLY TEAR IT OUT. FOLD IT AND DROP IT IN THE MAIL!

FROM: (PRINT YOUR UNIT'S COMPLETE ADDRESS)

DATE SENT

**PUBLICATION NUMBER** 

TEAR ALONG PPRFORATED LINE

PUBLICATION DATE

PUBLICATION TITLE

TM 10-6630-235-13&P

28 SEPT 1990

KOEHLER CLOSED CUP FLASH TESTER

BE EXAC		OINT WHE	RE IT IS	IN THIS SPACE TELL AND WHAT SHOULD	WHAT IS WRONG	
NO PAGE	PARA- GRAPH	NO	NO NO	AND WHAT SHOULD	BE JUNE ABOUT II:	
1						
l						
Ĭ						
l						
						•
ł						
					•	A
1						
PRINTED	NAME, GRAD	E OR TITLE	AND TELEP	HONE NUMBER	SIGN HERE:	
1						

DA 1 JUL 79 2028-2

PREVIOUS EDITIONS ARE OBSOLETE.

DRSTS-M Overprint 2, 1 Nev 80.

P S.--IF YOUR OUTFIT WANTS TO KNOW ABOUT YOUR RECOMMENDATION MAKE A CARBON COPY OF THIS AND GIVE IT TO YOUR HEADQUARTERS.

REVERSE OF DA FORM 2028-2 REVERSE OF DRSTS-M OVERPRINT 2, 1 NOV 80

TEAR ALONG PERFORATED LINE

PILL IN YOUR UNIT'S ADDRESS	FOLD BACK	
DEPARTMENT OF THE ARMY		
OFFICIAL BUSINESS		

COMMANDER U.S. ARMY TROOP SUPPORT COMMAND ATTN: AMSTR-MCTS 4300 GOODFELLOW BOULEVARD ST. LOUIS, MO 63120-1798

### RECOMMENDED CHANGES TO EQUIPMENT TECHNICAL PUBLICATIONS



# SOMETHING WRONG WITH THIS PUBLICATION?

THEN. JOT DOWN THE DOPE ABOUT IT ON THIS FORM, CAREFULLY TEAR IT OUT. FOLD IT AND DROP IT IN THE MAIL' FROM: (PRINT YOUR UNIT'S COMPLETE ADDRESS)

DATE SENT

**PUBLICATION NUMBER** 

TM 10-6630-235-13&P

PUBLICATION DATE

PUBLICATION TITLE

28 SEPT 1990

KOEHLER CLOSED CUP FLASH TESTER

PAGE PARA- FIGURE TABLE NO
PAGE   PARA-   FIGURE   TABLE   AND WHAT SHOULD BE DONE ABOUT IT:
NO GRAPH NO NO
l 1 1 1 1
l
PRINTED NAME, GRADE OR TITLE, AND TELEPHONE NUMBER SIGN HERE:

DA 1 JUL 79 2028-2

PREVIOUS EDITIONS
ARE OBSOLETE.

DRSTS-M Overprint 2, 1 Nov 80.

P.S.--IF YOUR OUTFIT WANTS TO KNOW ABOUT YOUR RECOMMENDATION MAKE A CARBON COPY OF THIS AND GIVE IT TO YOUR HEADQUARTERS.

REVERSE OF DA FORM 2028-2 REVERSE OF DRSTS-M OVERPRINT 2, 1 NOV 80

TEAR ALONG PERFORATED LINE



FOLD BACK

DEPARTMENT OF THE ARMY

**OFFICIAL BUSINESS** 

COMMANDER
U.S. ARMY TROOP SUPPORT COMMAND
ATTN: AMSTR-MCTS
4300 GOODFELLOW BOULEVARD
ST. LOUIS, MO 63120–1798

### RECOMMENDED CHANGES TO EQUIPMENT TECHNICAL PUBLICATIONS



SOMETHING WRONG

WITH THIS PUBLICATION?

THEN. JOT DOWN THE DOPE ABOUT IT ON THIS FORM, CAREFULLY TEAR IT OUT. FOLD IT AND DROP IT IN THE MAIL' FROM: (PRINT YOUR UNIT'S COMPLETE ADDRESS)

DATE SENT

**PUBLICATION NUMBER** 

PUBLICATION DATE

PUBLICATION TITLE

TM 10-6630-235-13&P

28 SEPT 1990

KOEHLER CLOSED CUP FLASH TESTER

	BE EXACT PIN-POINT WHERE IT IS			IN THIS SPACE TELL WHAT IS WRONG AND WHAT SHOULD BE DONE ABOUT IT:				
	PAGE NO	PARA- GRAPH	FIGURE NO	TABLE NO	AND WHAT SHOULD BE DONE ABO	UT IT:		
I								
1								
•								
ı								
ı						· ·		
ı								
ı								
ı								
ı								
ı					,			
I	i							
ı								
ı								
ı								
I		i						
		!						
1								
Ì								
						, , , , , , , , , , , , , , , , , , ,		
				]				
	PRINTED	NAME. GRAD	DE OR TITLE	AND TELEP	HONE NUMBER SIGN HERE:			
						·		

DA 1 JUL 79 2028-2

PREVIOUS EDITIONS
ARE OBSOLETE.

DRSTS-M Overprint 2, 1 Nev 80.

P.S.--IF YOUR OUTFIT WANTS TO KNOW ABOUT YOUR RECOMMENDATION MAKE A CARBON COPY OF THIS AND GIVE IT TO YOUR HEADQUARTERS.

REVERSE OF DA FORM 2028-2 REVERSE OF DRSTS-M OVERPRINT 2, 1 NOV 80

TEAR ALONG PERFORATED LINE

FILL IN YOUR UNIT'S ADDRESS	FOLD BACK
DEPARTMENT OF THE ARMY	
OFFICIAL BUSINESS	

COMMANDER
U.S. ARMY TROOP SUPPORT COMMAND
ATTN: AMSTR-MCTS
4300 GOODFELLOW BOULEVARD
ST. LOUIS, MO 63120-1798

### RECOMMENDED CHANGES TO EQUIPMENT TECHNICAL PUBLICATIONS



SOMETHING WRONG WITH THIS PUBLICATION?

THEN. JOT DOWN THE DOPE ABOUT IT ON THIS FORM, CAREFULLY TEAR IT OUT. FOLD IT AND DROP IT IN THE MAIL'

FROM: (PRINT YOUR UNIT'S COMPLETE ADDRESS)

DATE SENT

**PUBLICATION NUMBER** 

TM 10-6630-235-13&P

PUBLICATION DATE
28 SEPT 1990

PUBLICATION TITLE

KOEHLER CLOSED CUP FLASH TESTER

BE EXAC	T. PIN-P	OINT WHE	RE IT IS	IN THIS SPACE TELL WHAT IS WRONG				
PAGE NO	PARA- GRAPH	FIGURE	TABLE	AND WHAT SHOULD	BE DONE ABOUT IT:			
	GRAFA		,40					
							•	
1								
i								
1								
							•	
			1			<i>,</i>	A	
		1						
				}				
	<b>\$</b>							
	1	1	1					
PRINTED	NAME, GRAI	E OR TITLE	AND TELEF	PHONE NUMBER	SIGN HERE:			

DA 1 JUL 79 2028-2

PREVIOUS EDITIONS
ARE OBSOLETE.

DR\$T\$-M Overprint 2, 1 Nev 80.

PS.--IF YOUR OUTFIT WANTS TO KNOW ABOUT YOUR RECOMMENDATION MAKE A CARBON COPY OF THIS AND GIVE IT TO YOUR HEADQUARTERS.

FILL IN YOUR UNIT'S ADDRESS
DEPARTMENT OF THE A

FOLD BACK

ARMY

OFFICIAL BUSINESS

**COMMANDER** U.S. ARMY TROOP SUPPORT COMMAND ATTN: AMSTR-MCTS 4300 GOODFELLOW BOULEVARD ST. LOUIS, MO 63120-1798

### RECOMMENDED CHANGES TO EQUIPMENT TECHNICAL PUBLICATIONS



# SOMETHING WRONG WITH THIS PUBLICATION?

THEN. JOT DOWN THE DOPE ABOUT IT ON THIS FORM, CAREFULLY TEAR IT OUT. FOLD IT AND DROP IT IN THE MAIL' FROM: (PRINT YOUR UNIT'S COMPLETE ADDRESS)

DATE SENT

**PUBLICATION NUMBER** 

TEAR ALONG PERFORATED LINE

**PUBLICATION TITLE** 

TM 10-6630-235-13&P

PUBLICATION DATE
28 SEPT 1990

KOEHLER CLOSED CUP FLASH TESTER

BE EXACT. PIN-POINT WHERE IT IS				IN THIS SPACE TELL	WHAT IS WRONG		
PAGE NO	PARA- GRAPH	FIGURE NO	TABLE NO	AND WHAT SHOULD	BE DONE ABOUT IT:		
				:			
						•	
	ļ						
						•	<i>2</i> *
ļ							
	L						
PRINTED	NAME. GRAD	E OR TITLE.	AND TELEP	HONE NUMBER	SIGN HERE:		

DA 1 JUL 79 2028-2

PREVIOUS EDITIONS
ARE OBSOLETE.

DRSTS-M Overprint 2, 1 Nov 80.

P.S.--IF YOUR OUTFIT WANTS TO KNOW ABOUT YOUR RECOMMENDATION MAKE A CARBON COPY OF THIS AND GIVE IT TO YOUR HEADQUARTERS.

REVERSE OF DA FORM 2028-2 REVERSE OF DRSTS-M OVERPRINT 2, 1 NOV 80

FILL IN YOUR UNIT'S ADDRESS	)
又	

FOLD BACK

DEPARTMENT OF THE ARMY

**OFFICIAL BUSINESS** 

COMMANDER
U.S. ARMY TROOP SUPPORT COMMAND
ATTN: AMSTR-MCTS
4300 GOODFELLOW BOULEVARD
ST. LOUIS, MO 63120-1798

-- TEAR ALONG PERFORATED LINE

# The Metric System and Equivalents

#### Linear Measure

1 centimeter = 10 millimeters = .39 inch 1 decimeter = 10 centimeters = 3.94 inches 1 meter = 10 decimeters = 39.37 inches 1 dekameter = 10 meters = 32.8 feet

1 hectometer = 10 dekameters = 328.08 feet 1 kilometer = 10 hectometers = 3,280.8 feet

#### Weighte

1 centigram = 10 milligrams = .15 grain 1 decigram = 10 centigrams = 1.54 grains 1 gram = 10 decigram = .035 ounce 1 dekagram = 10 grams = .35 ounce 1 hectogram = 10 dekagrams = 3.52 ounces 1 kilogram = 10 hectograms = 2.2 pounds 1 quintal = 100 kilograms = 220.46 pounds 1 metric ton = 10 quintals = 1.1 short tons

### Liquid Measure

1 centiliter = 10 milliters = .34 fl. ounce 1 deciliter = 10 centiliters = 3.38 fl. ounces 1 liter = 10 deciliters = 33.81 fl. ounces 1 dekaliter = 10 liters = 2.64 gallons 1 hectoliter = 10 dekaliters = 26.42 gallons 1 kiloliter = 10 hectoliters = 264.18 gallons

### Square Measure

1 sq. centimeter = 100 sq. millimeters = .155 sq. inch 1 sq. decimeter = 100 sq. centimeters = 15.5 sq. inches 1 sq. meter (centare) = 100 sq. decimeters = 10.76 sq. feet 1 sq. dekameter (are) = 100 sq. meters = 1,076.4 sq. feet 1 sq. hectometer (hectare) = 100 sq. dekameters = 2.47 acres 1 sq. kilometer = 100 sq. hectometers = .386 sq. mile -

#### Cubic Measure

1 cu. centimeter = 1000 cu. millimeters = .06 cu. inch 1 cu. decimeter = 1000 cu. centimeters = 61.02 cu. inches 1 cu. meter = 1000 cu. decimeters = 35.31 cu. feet

# **Approximate Conversion Factors**

To change	To	Multiply by	To change	To	Multiply by
inches	centimeters	2.540	ounce-inches	newton-meters	.007062
feet	meters	.305	centimeters	inches	.394
yards	meters	.914	meters	feet	3.280
miles	kilometers	1.609	meters	yards	1.094
square inches	square centimeters	6.451	kilometers	miles	.621
square feet	square meters	.093	square centimeters	square inches	.155
square yards	square meters	.836	square meters	square feet	10.764
square miles	square kilometers	2.590	square meters	square yards	1.196
acres	square hectometers	.405	square kilometers	square miles	.386
cubic feet	cubic meters	.028	square hectometers	acres	2.471
cubic yards	cubic meters	.765	cubic meters	cubic feet	35.315
fluid ounces	milliliters	<b>29</b> ,573	cubic meters	cubic yards	1.308
pints	liters	.473	milliliters	fluid ounces	.034
quarts	liters	.946	liters	pints	2.113
gallons	liters	3.785	liters	quarts	1.057
ounces	grams	28.349	liters	gallons	.264
pounds	kilograms	.454	grams	ounces	.035
short tons	metric tons	.907	kilograms	pounds	2.205
pound-feet	newton-meters	1.356	metric tons	short tons	1.102
pound-inches	newton-meters	.11296			

# Temperature (Exact)

°F.	Fahrenheit	5/9 (after	Celsius	$^{\circ}\mathrm{C}$
	temperature	subtracting 32)	temperature	

PIN: 046067-000